


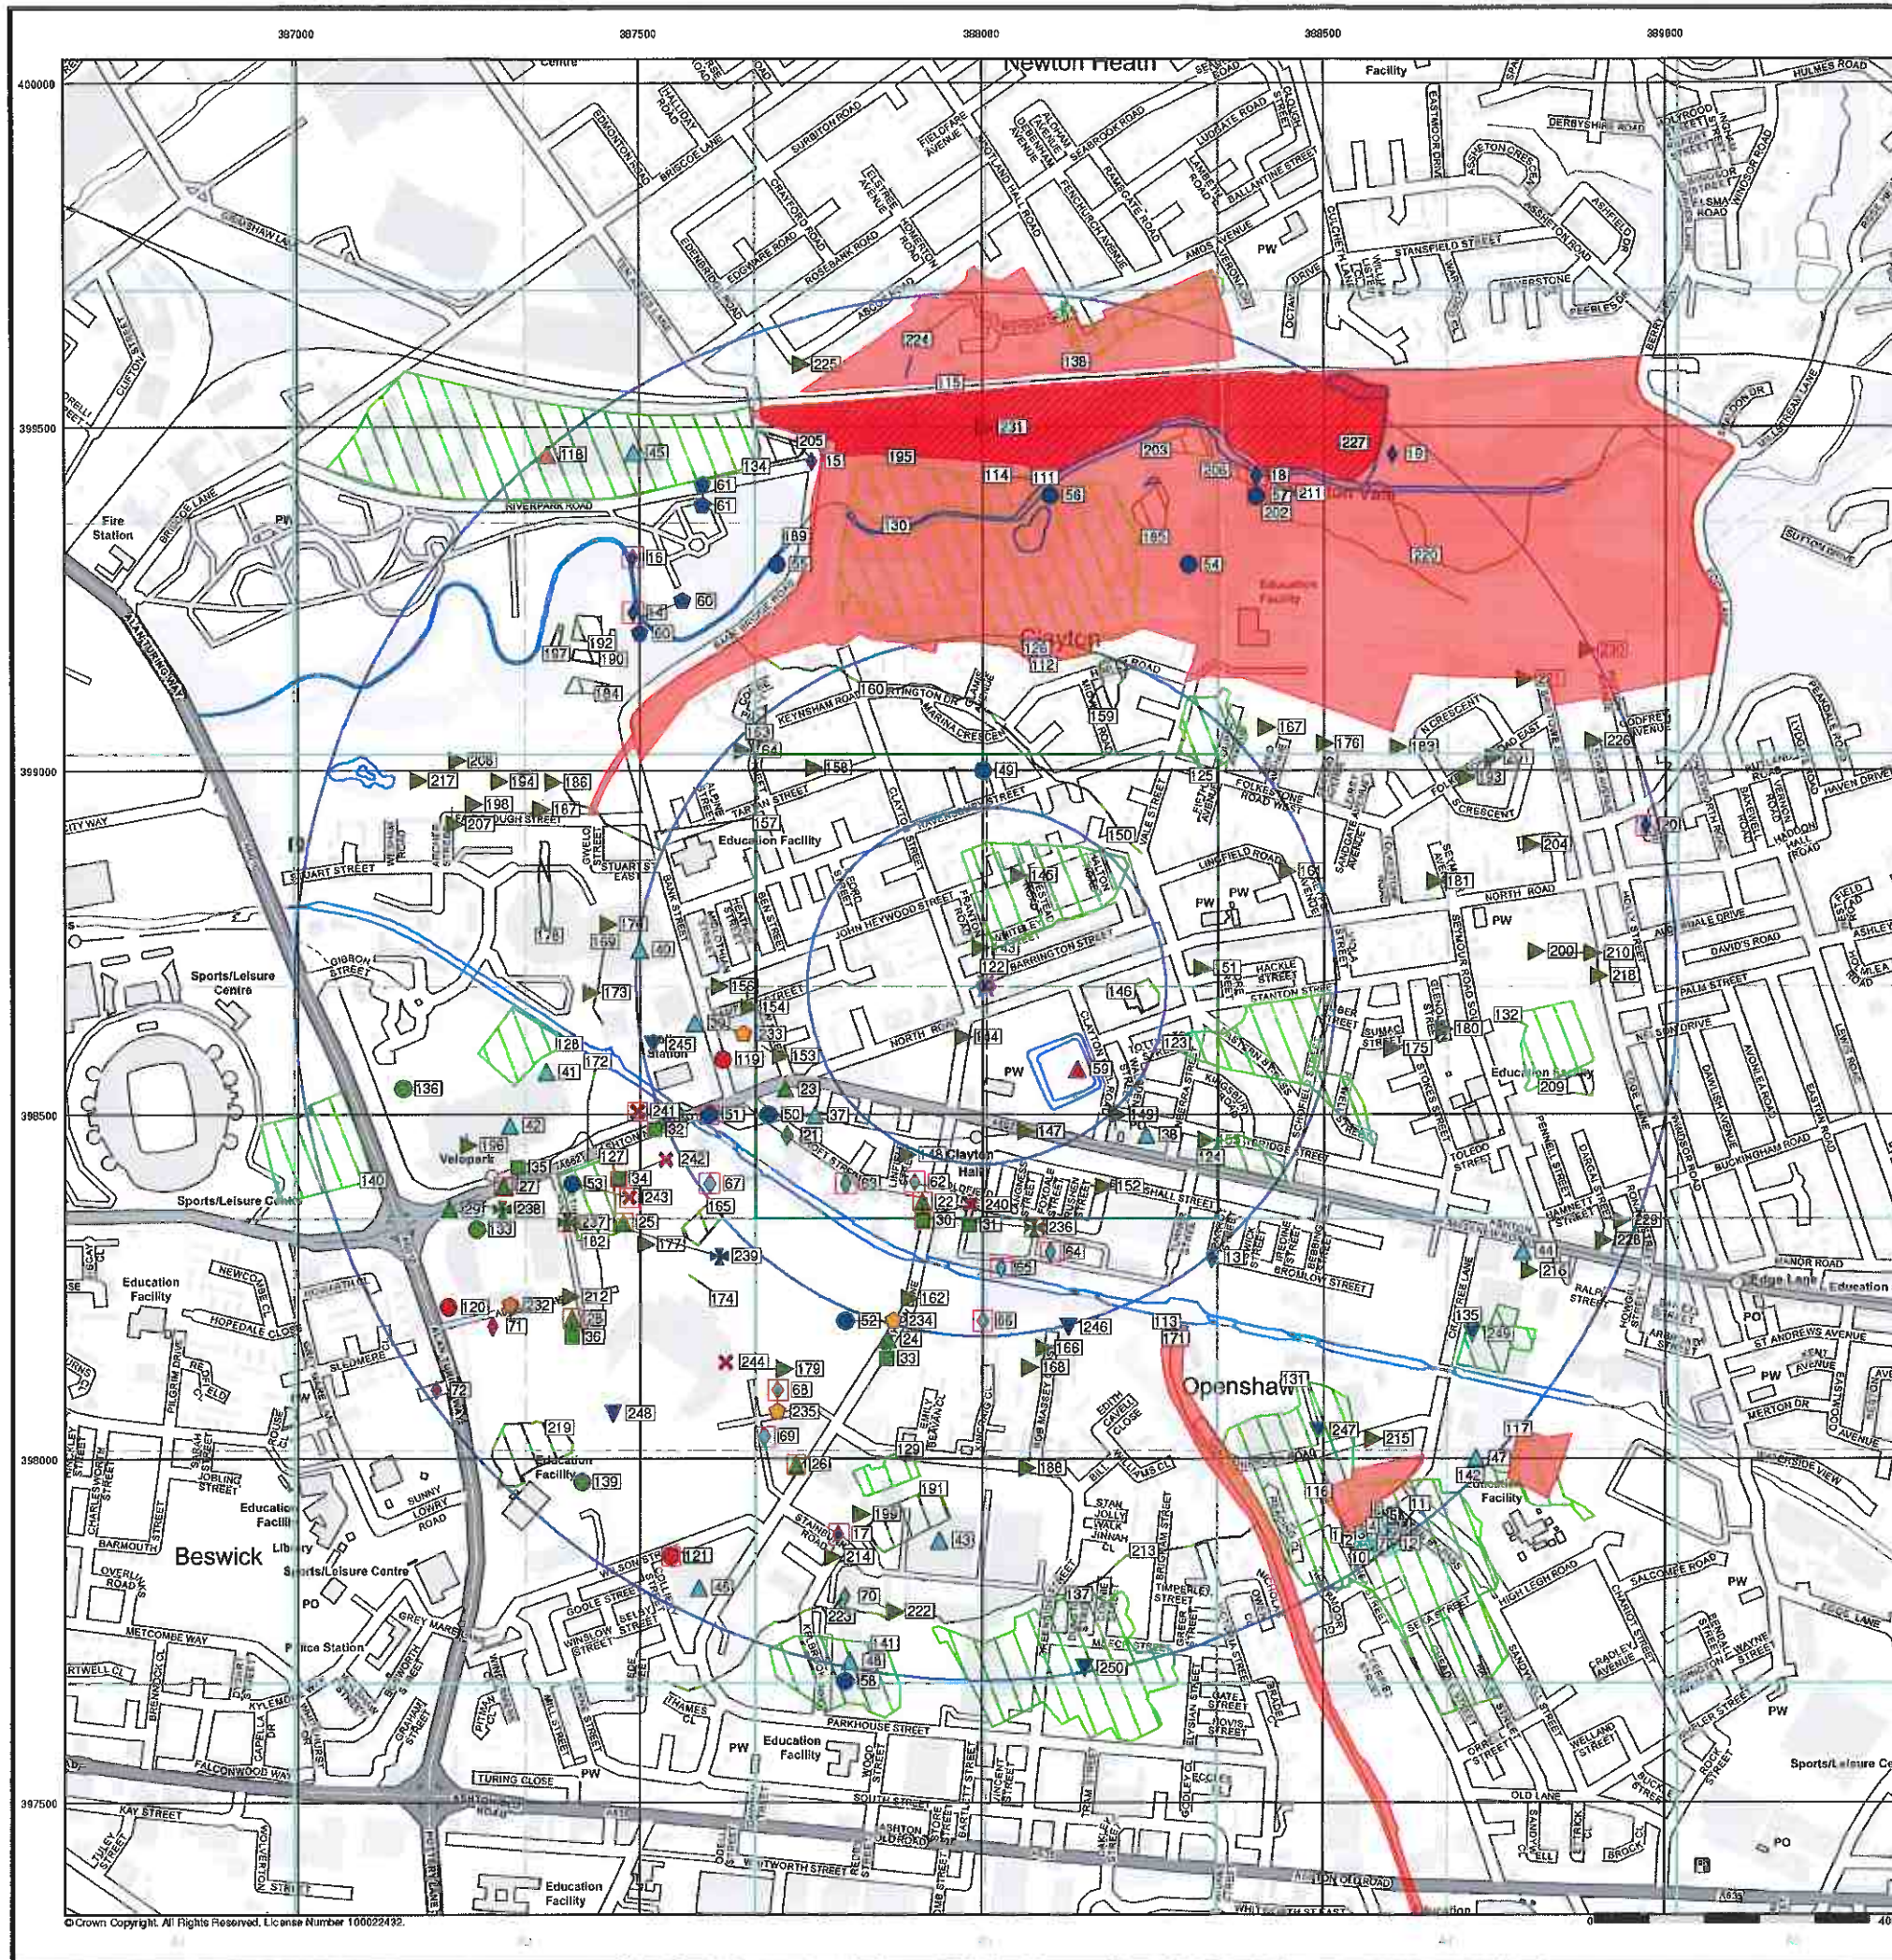

Envirocheck®

LANDMARK INFORMATION GROUP®


General

- Specified Site
- Specified Buffer(s)
- Bearing Reference Point
- Map ID

Agency and Hydrological

- Contaminated Land Register Entry or Notice (Location)
- Contaminated Land Register Entry or Notice
- Discharge Consent
- Enforcement or Prohibition Notice
- Integrated Pollution Control
- Integrated Pollution Prevention and Control
- Local Authority Integrated Pollution Prevention and Control
- Local Authority Pollution Prevention and Control Enforcement
- Pollution Incident to Controlled Waters
- Prosecution Relating to Authorised Processes
- Prosecution Relating to Controlled Waters
- Registered Radioactive Substance
- River Network or Water Feature
- River Quality Sampling Point
- Substantiated Pollution Incident Register
- Water Abstraction
- Water Industry Act Referral
- Hazardous Substances
 - COMAH Site
 - Explosive Site
 - NIHS Site
 - Planning Hazardous Substance Consent
 - Planning Hazardous Substance Enforcement
- Geological
 - BGS Recorded Mineral Site
- Waste
 - BGS Recorded Landfill Site (Location)
 - BGS Recorded Landfill Site
 - EA Historic Landfill (Buffered Point)
 - EA Historic Landfill (Polygon)
 - Integrated Pollution Control Registered Waste Site
 - Licensed Waste Management Facility (Landfill Boundary)
 - Licensed Waste Management Facility (Location)
 - Local Authority Recorded Landfill Site (Location)
 - Local Authority Recorded Landfill Site
 - Potentially Infilled Land (Non-water)
 - Potentially Infilled Land (Non-water)
 - Potentially Infilled Land (Water)
 - Potentially Infilled Land (Water)
 - Potentially Infilled Land (Water)
 - Registered Landfill Site
 - Registered Landfill Site (Location)
 - Registered Landfill Site (Point Buffered to 100m)
 - Registered Landfill Site (Point Buffered to 250m)
 - Registered Waste Transfer Site (Location)
 - Registered Waste Transfer Site
 - Registered Waste Treatment or Disposal Site (Location)
 - Registered Waste Treatment or Disposal Site

Site Sensitivity Map - Slice A

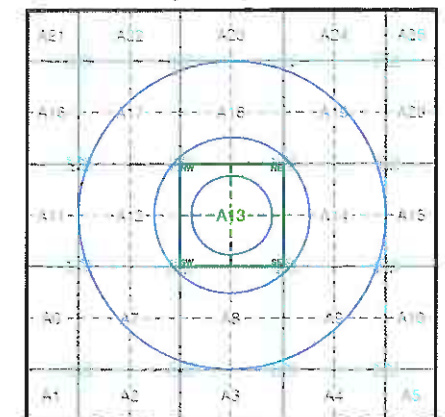

Order Details


Order Number: 284497305_1_1
Customer Ref: 21966
National Grid Reference: 388010, 398690
Slice: A
Site Area (Ha): 0.03
Search Buffer (m): 1000

Site Details

Land at Barrington Street, MANCHESTER, M11 4FB

Landmark®
INFORMATION GROUP

Tel: 0844 844 9952
Fax: 0844 844 9951
Web: www.envirocheck.co.uk

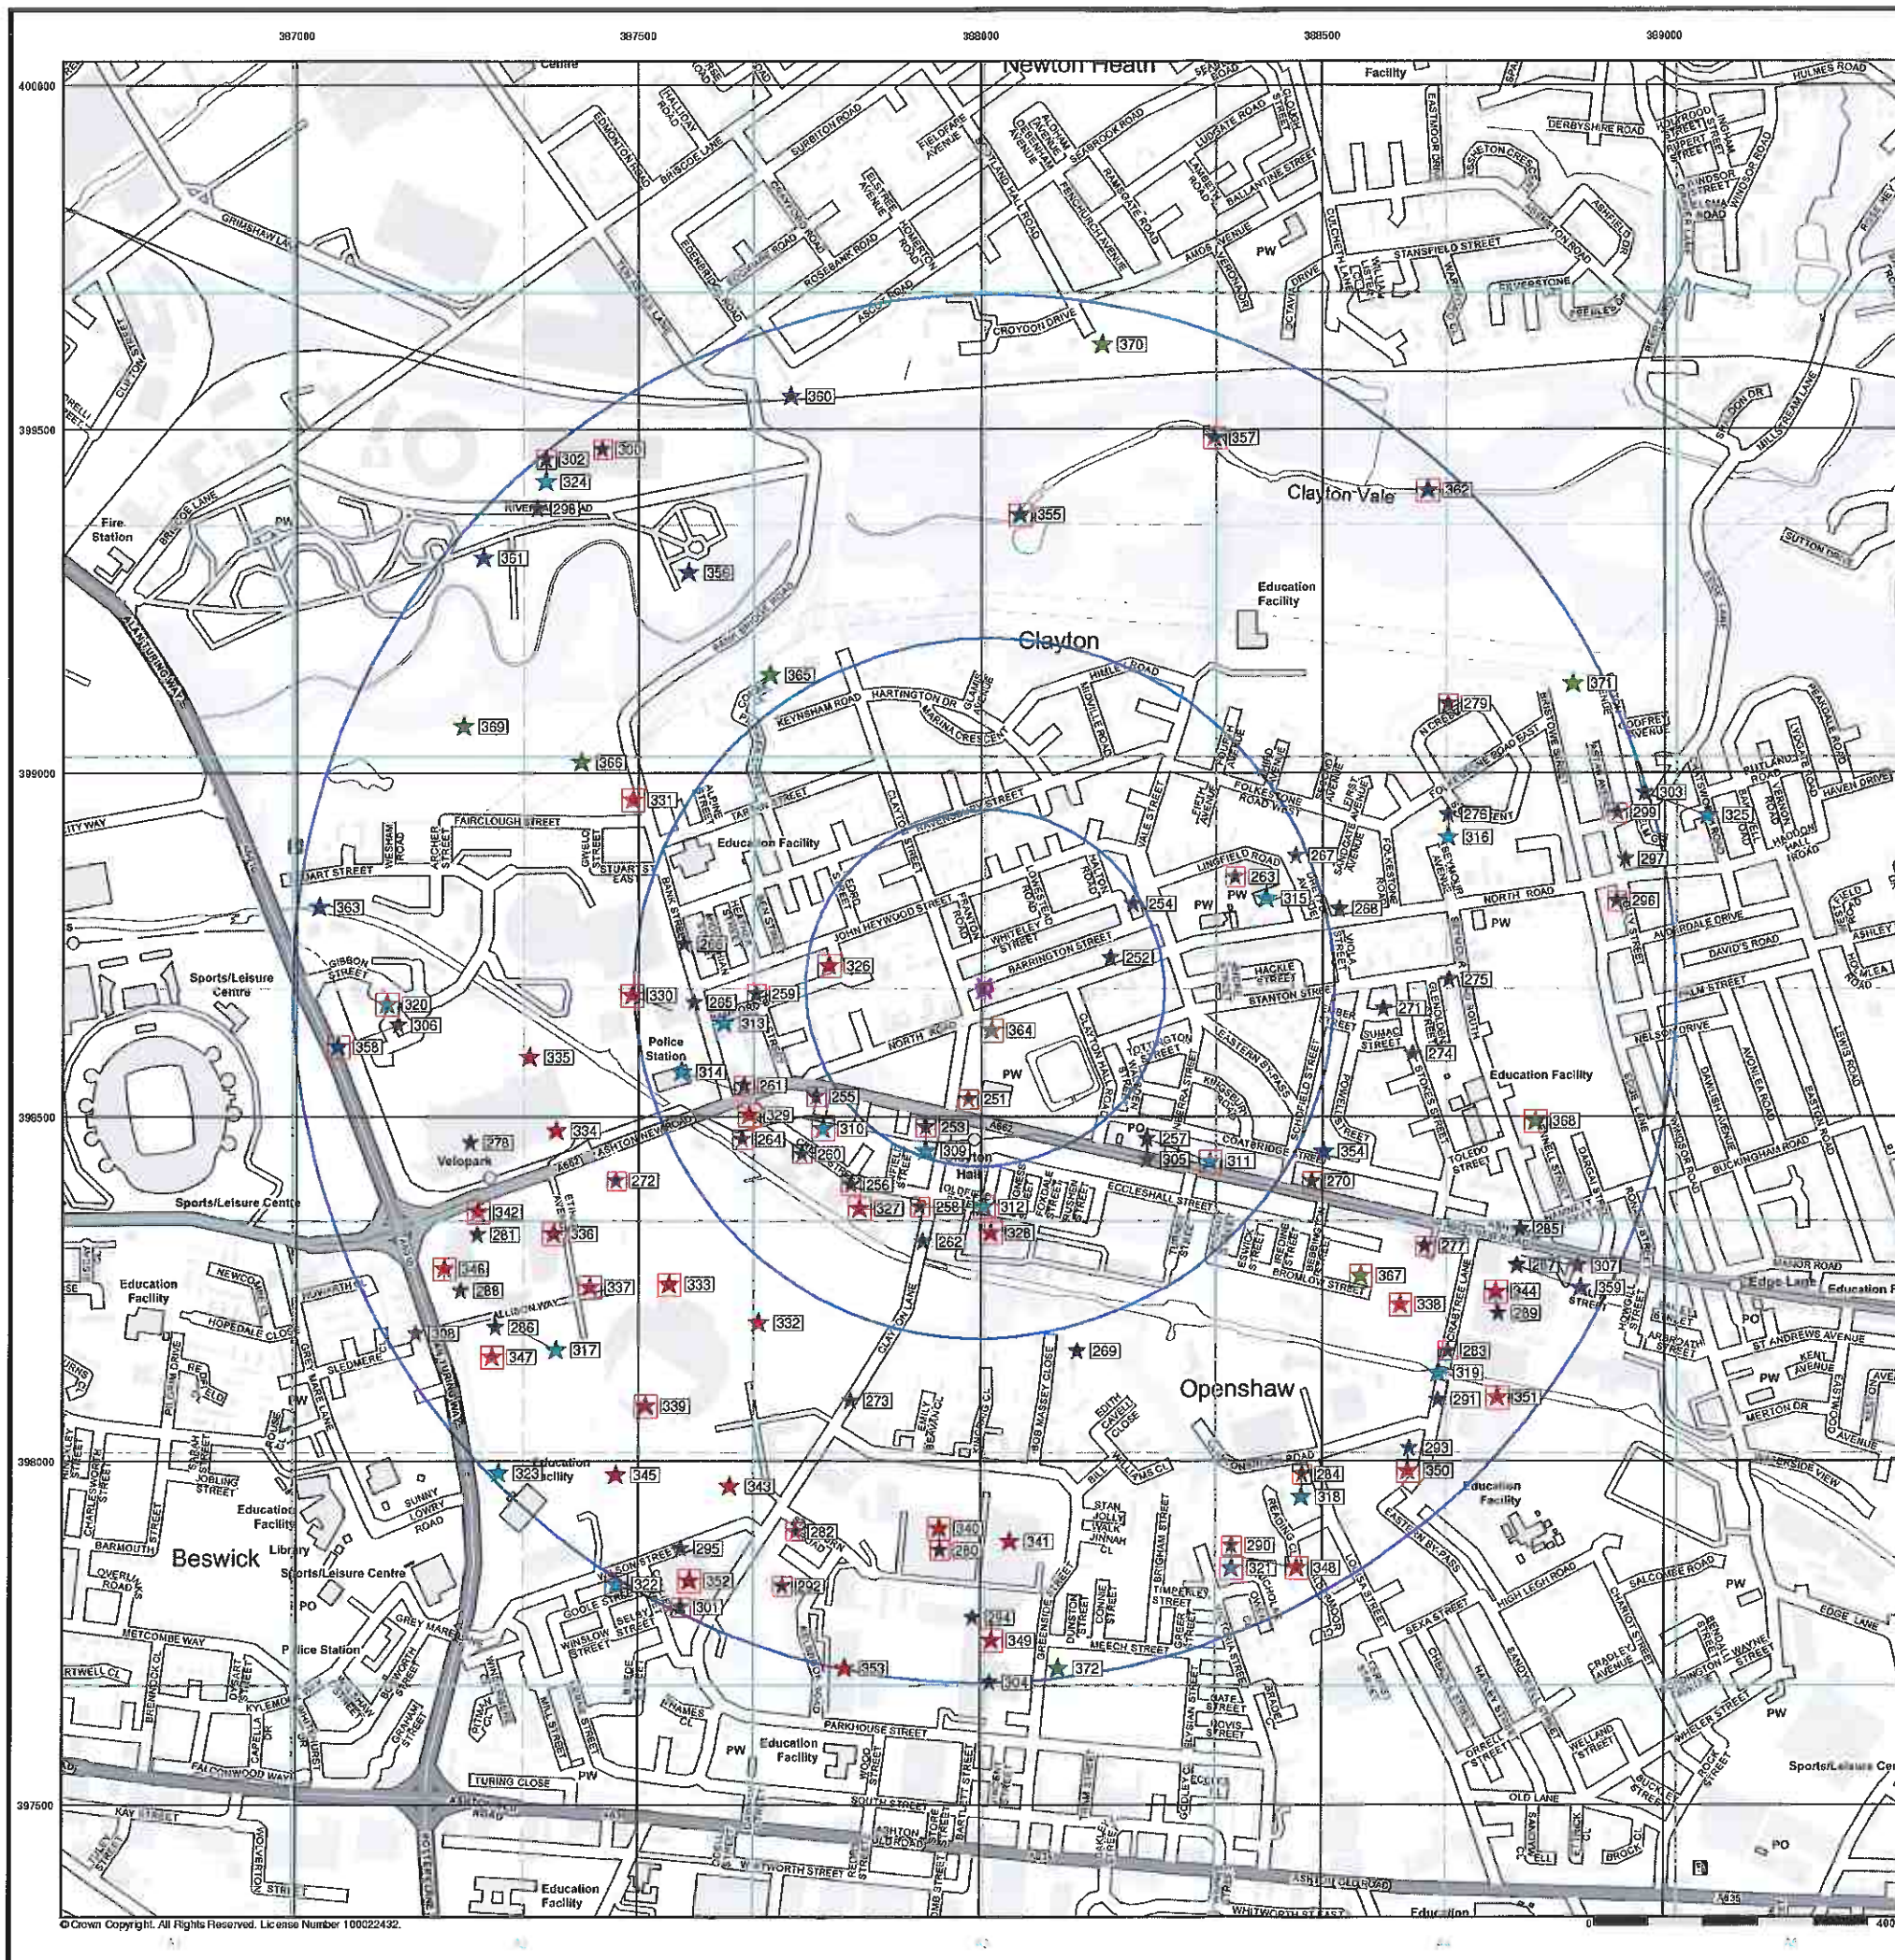

Envirocheck®

LANDMARK INFORMATION GROUP®

Industrial Land Use Map


General

- Specified Site
- Specified Buffer(s)
- X Bearing Reference Point
- Slice
- B Map ID

Industrial Land Use

- ★ Contemporary Trade Directory Entry
- ★ Fuel Station Entry
- Gas Pipeline
- ★ Points of Interest - Commercial Services
- ★ Points of Interest - Education and Health
- ★ Points of Interest - Manufacturing and Production
- ★ Points of Interest - Public Infrastructure
- ★ Points of Interest - Recreational and Environmental
- Underground Electrical Cables

Industrial Land Use Map - Slice A

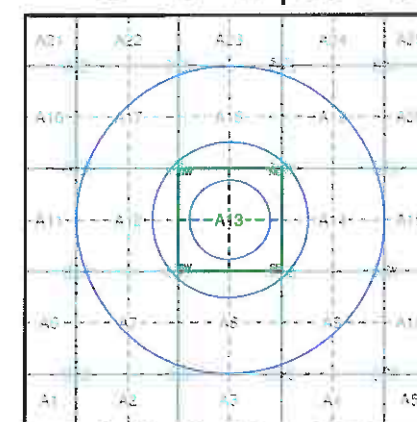

Order Details


Order Number: 284497305_1_1
 Customer Ref: 21966
 National Grid Reference: 388010, 398690
 Slice: A
 Site Area (Ha): 0.03
 Search Buffer (m): 1000

Site Details

Land at Barrington Street, MANCHESTER, M11 4FB

Landmark
 INFORMATION GROUP

Tel: 0844 844 9952
 Fax: 0844 844 9951
 Web: www.envirocheck.co.uk

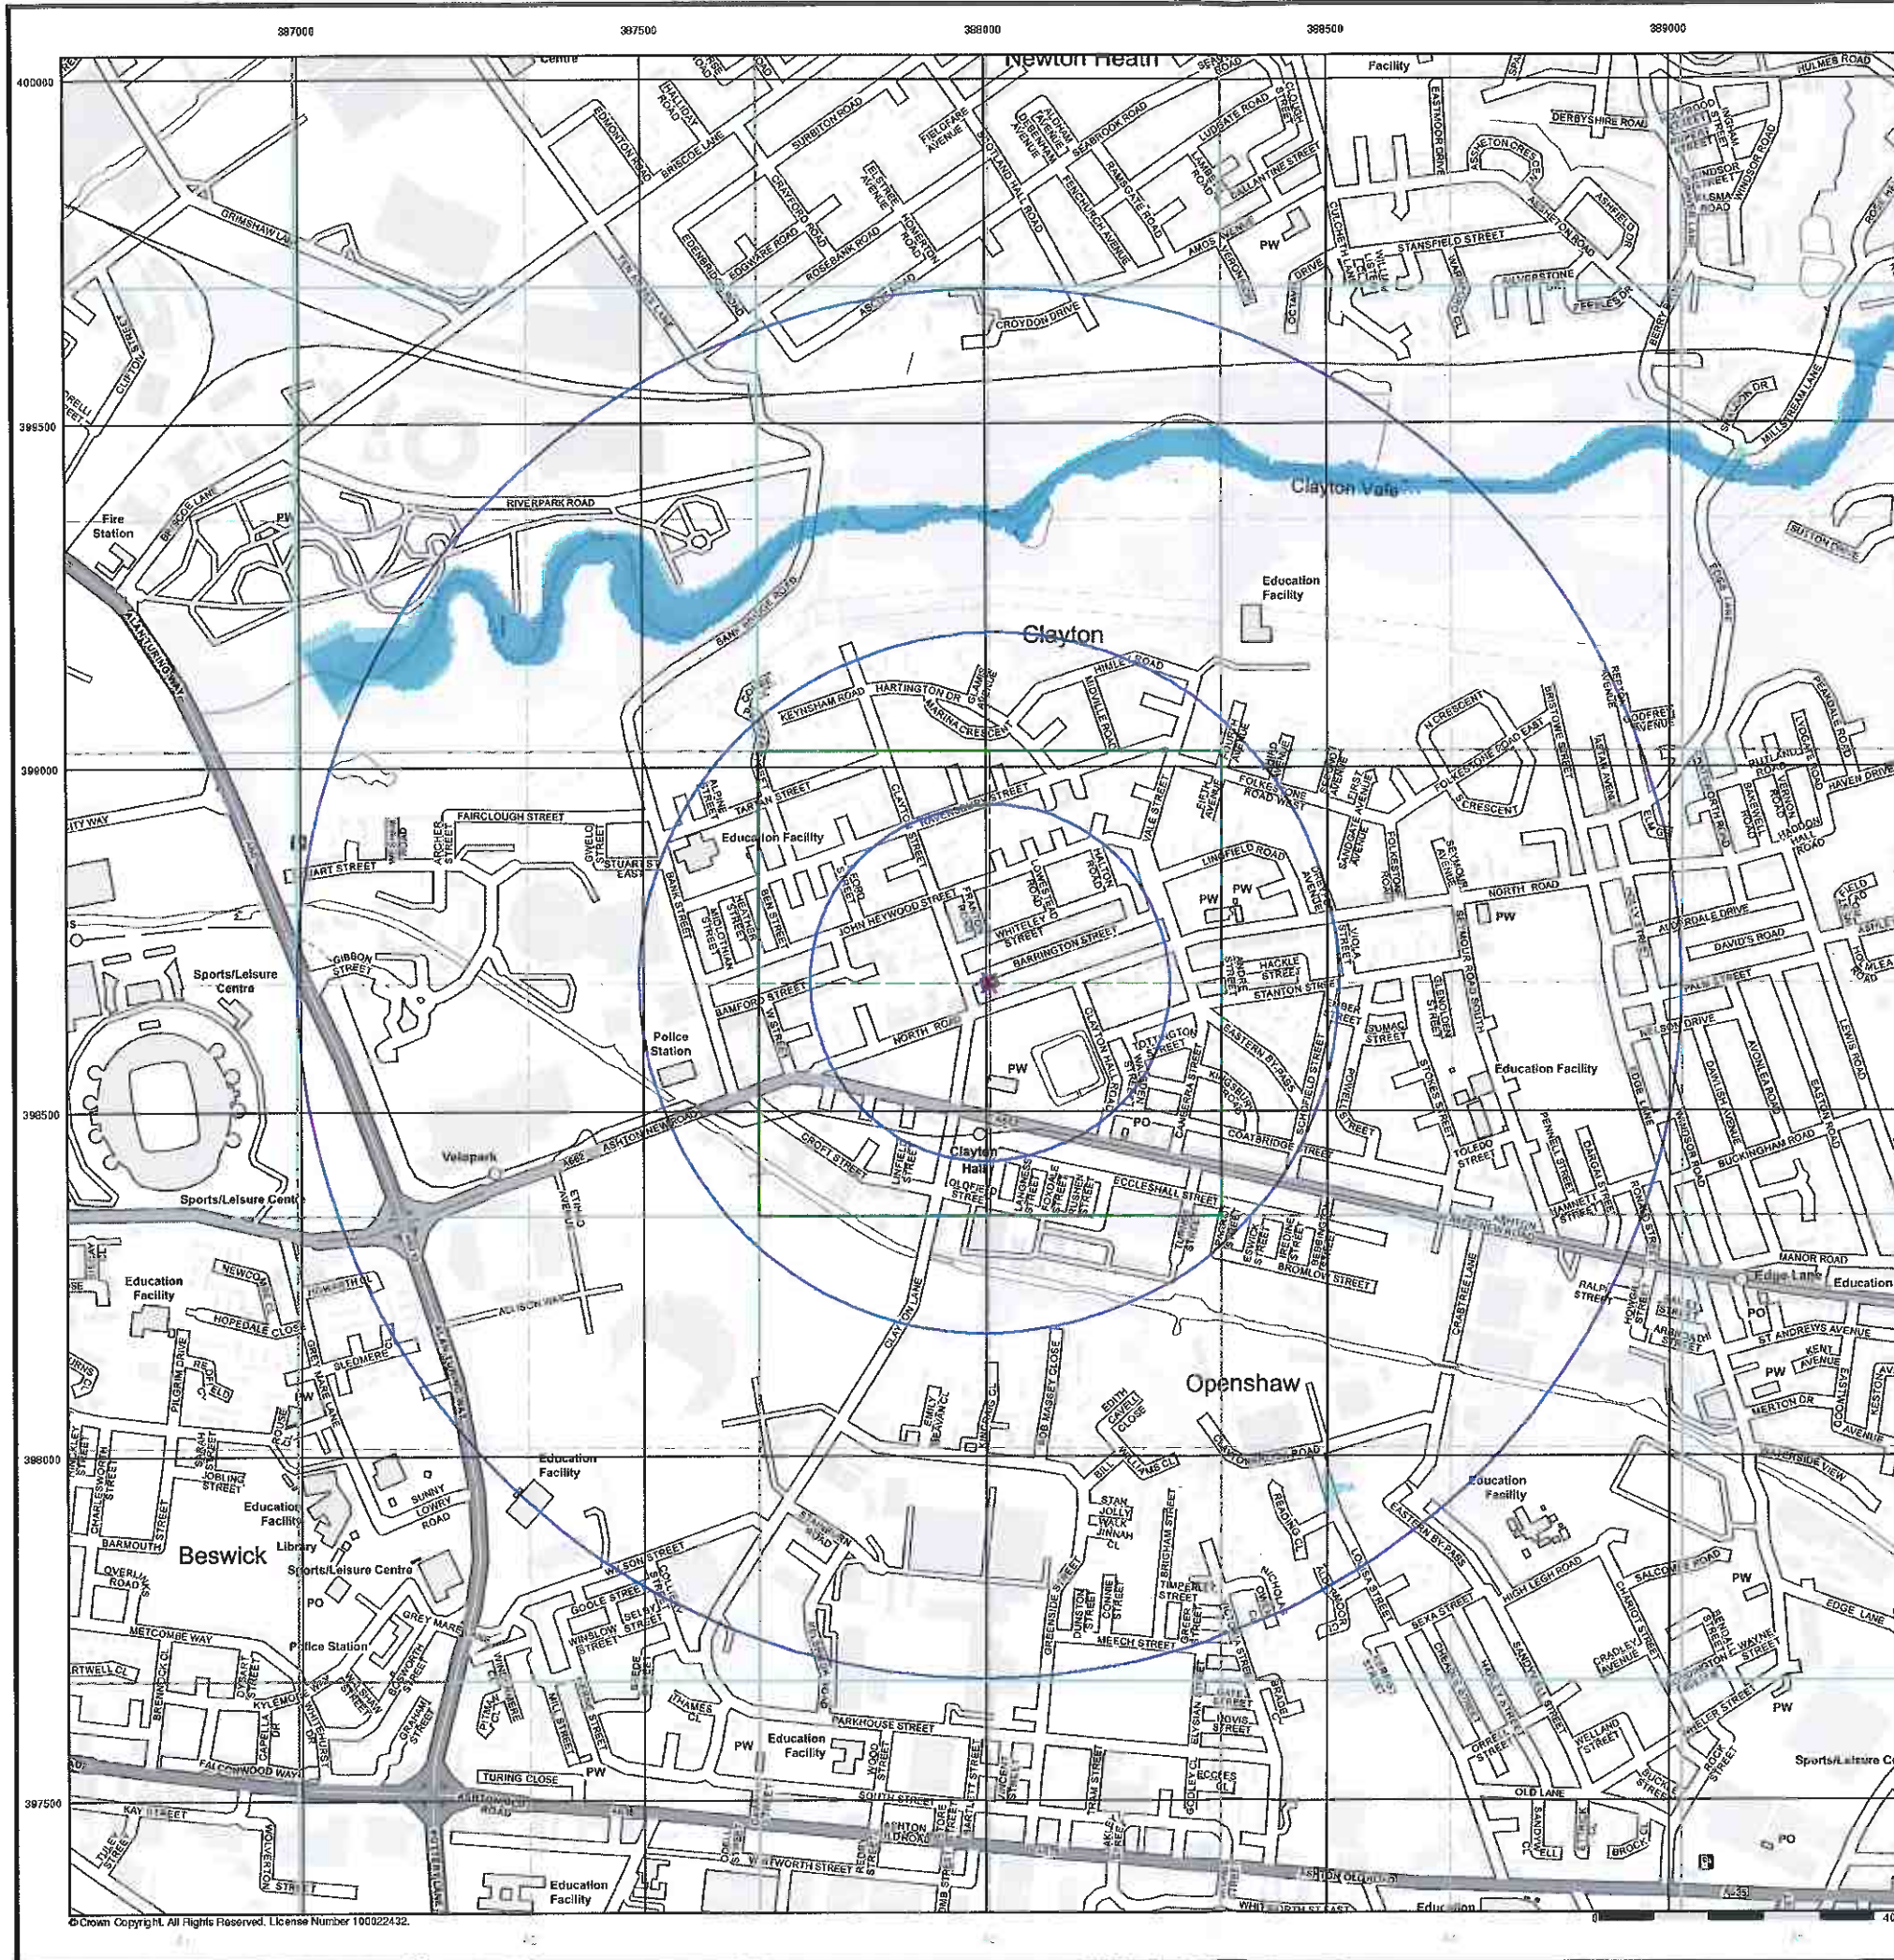

Envirocheck®

LANDMARK INFORMATION GROUP®


General

- Specified Site
- Specified Buffer(s)
- Bearing Reference Point

Agency and Hydrological (Flood)

- Extreme Flooding from Rivers or Sea without Defences (Zone 2)
- Flooding from Rivers or Sea without Defences (Zone 3)
- Area Benefiting from Flood Defence
- Flood Water Storage Areas
- Flood Defence

Flood Map - Slice A

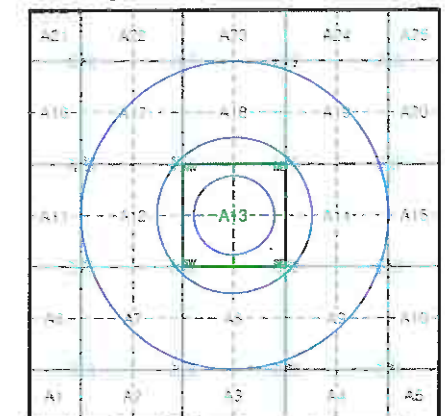

Order Details


Order Number: 284497305_1_1
 Customer Ref: 21966
 National Grid Reference: 388010, 398690
 Slice: A
 Site Area (Ha): 0.03
 Search Buffer (m): 1000

Site Details

Land at Barrington Street, MANCHESTER, M11 4FB

Landmark®
 INFORMATION GROUP

Tel: 0844 844 9952
 Fax: 0844 844 9951
 Web: www.envirocheck.co.uk

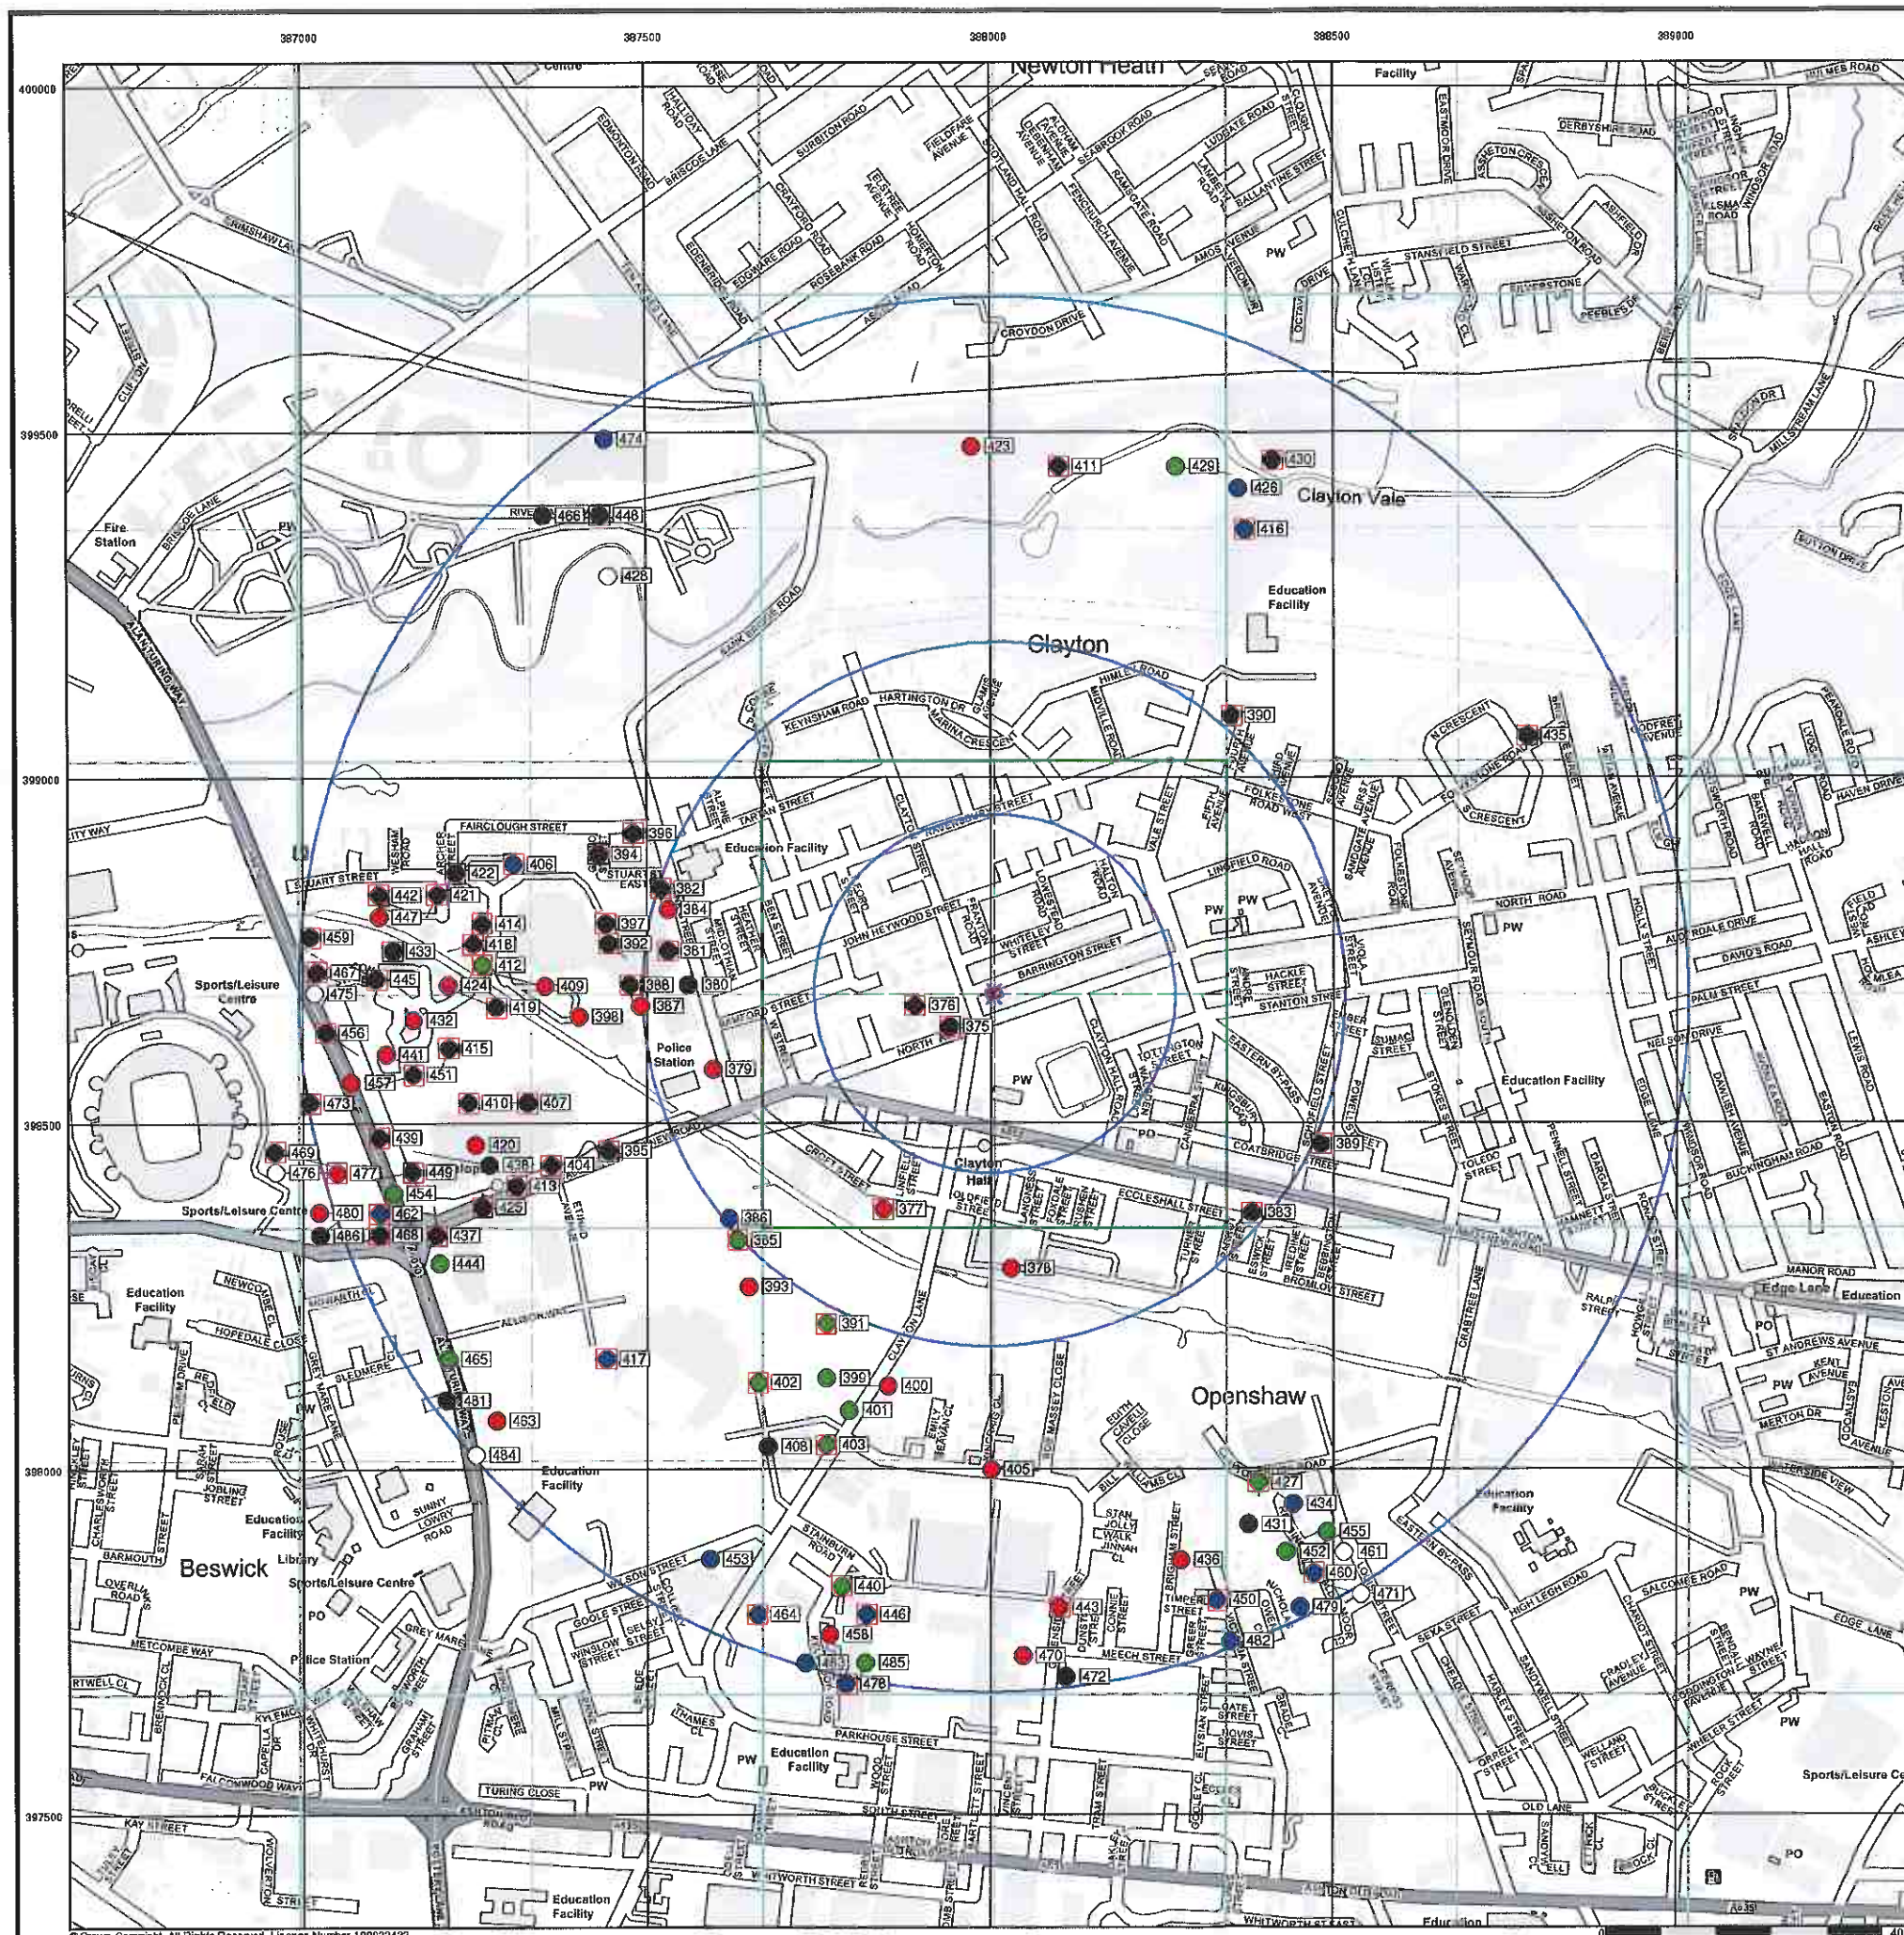

© Crown Copyright. All Rights Reserved. Licence Number 100022432.

Envirocheck®

LANDMARK INFORMATION GROUP®

General

- Specified Site
- Specified Buffer(s)
- Bearing Reference Point
- Map ID
- Several of Type of Location


Agency and Hydrological (Boreholes)

- BGS Borehole Depth 0 - 10m
- BGS Borehole Depth 10 - 30m
- BGS Borehole Depth 30m +
- Confidential
- Other

For Borehole information please refer to the Borehole .csv file which accompanied this slice.

A copy of the BGS Borehole Ordering Form is available to download from the Support section of www.envirocheck.co.uk.

Borehole Map - Slice A

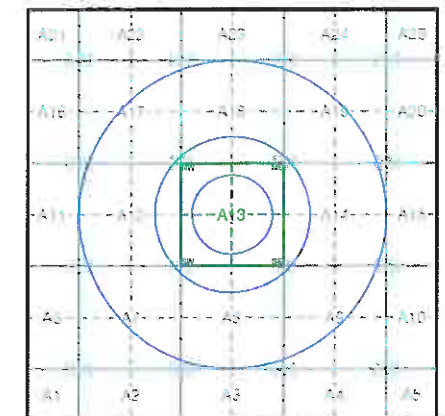

Order Details


Order Number: 284497305_1_1
 Customer Ref: 21966
 National Grid Reference: 388010, 398690
 Slice: A
 Site Area (Ha): 0.03
 Search Buffer (m): 1000

Site Details

Land at Barrington Street, MANCHESTER, M11 4FB

Landmark®
 INFORMATION GROUP

Tel: 0844 844 9952
 Fax: 0844 844 9951
 Web: www.envirocheck.co.uk

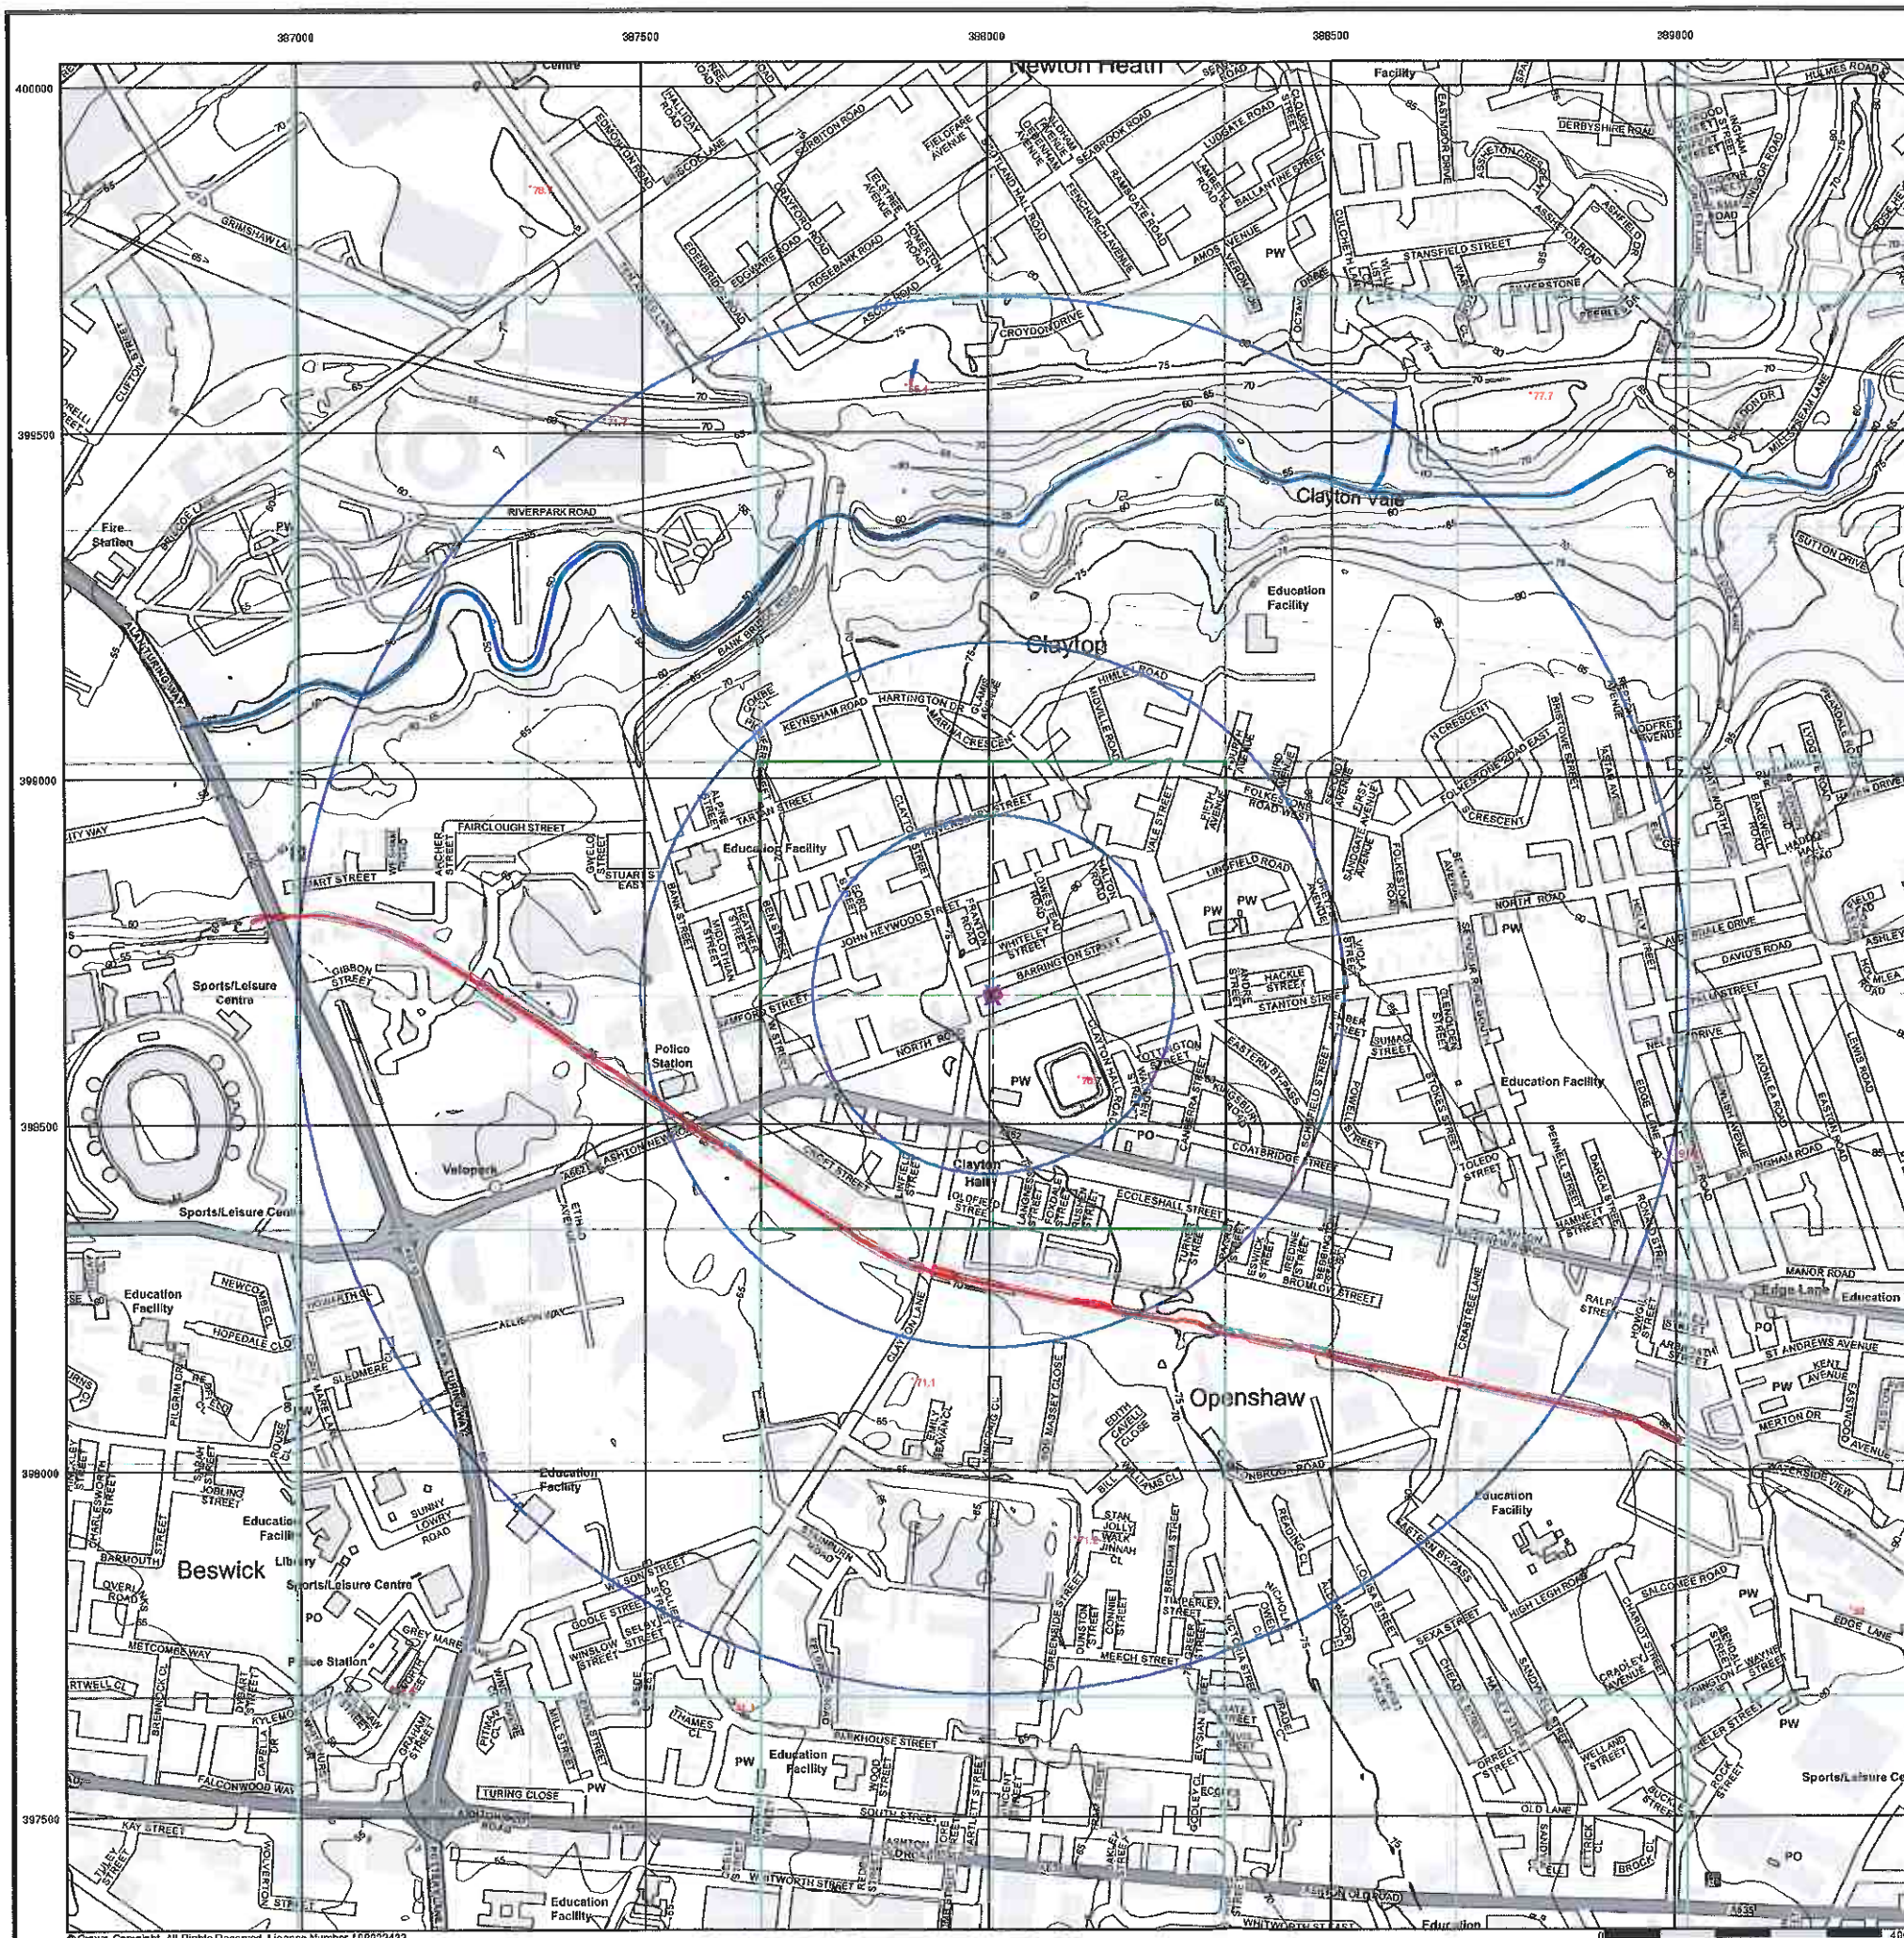

Envirocheck[®]

LANDMARK INFORMATION GROUP[®]

General

- Specified Site
- Specified Buffer(s)
- X Bearing Reference Point


OS Water Network Data

- | | |
|--------------|-------------------------|
| Canal | Drain |
| Reservoir | Other |
| Foreshore | Lake |
| Marsh | Transfer |
| Tidal River | Lock Or Flight Of Locks |
| Inland River | Sea |

Contours (height in meters)

- | | |
|------------------|-----------------|
| Standard Contour | Mean Low Water |
| Master Contour | Mean High Water |
| Spot Height | 167.3 |

OS Water Network Map - Slice A

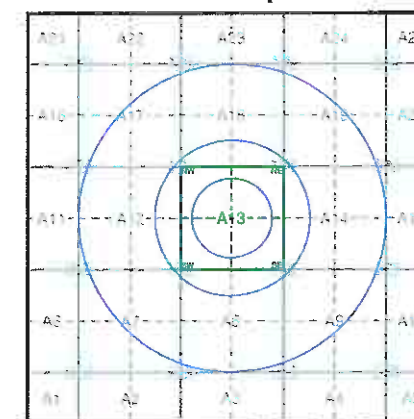

Order Details


Order Number: 284497305_1_1
 Customer Ref: 21966
 National Grid Reference: 388010, 398690
 Slice: A
 Site Area (Ha): 0.03
 Search Buffer (m): 1000

Site Details

Land at Barrington Street, MANCHESTER, M11 4FB

Landmark[®]
 INFORMATION GROUP

Tel: 0844 844 9952
 Fax: 0844 844 9951
 Web: www.envirocheck.co.uk

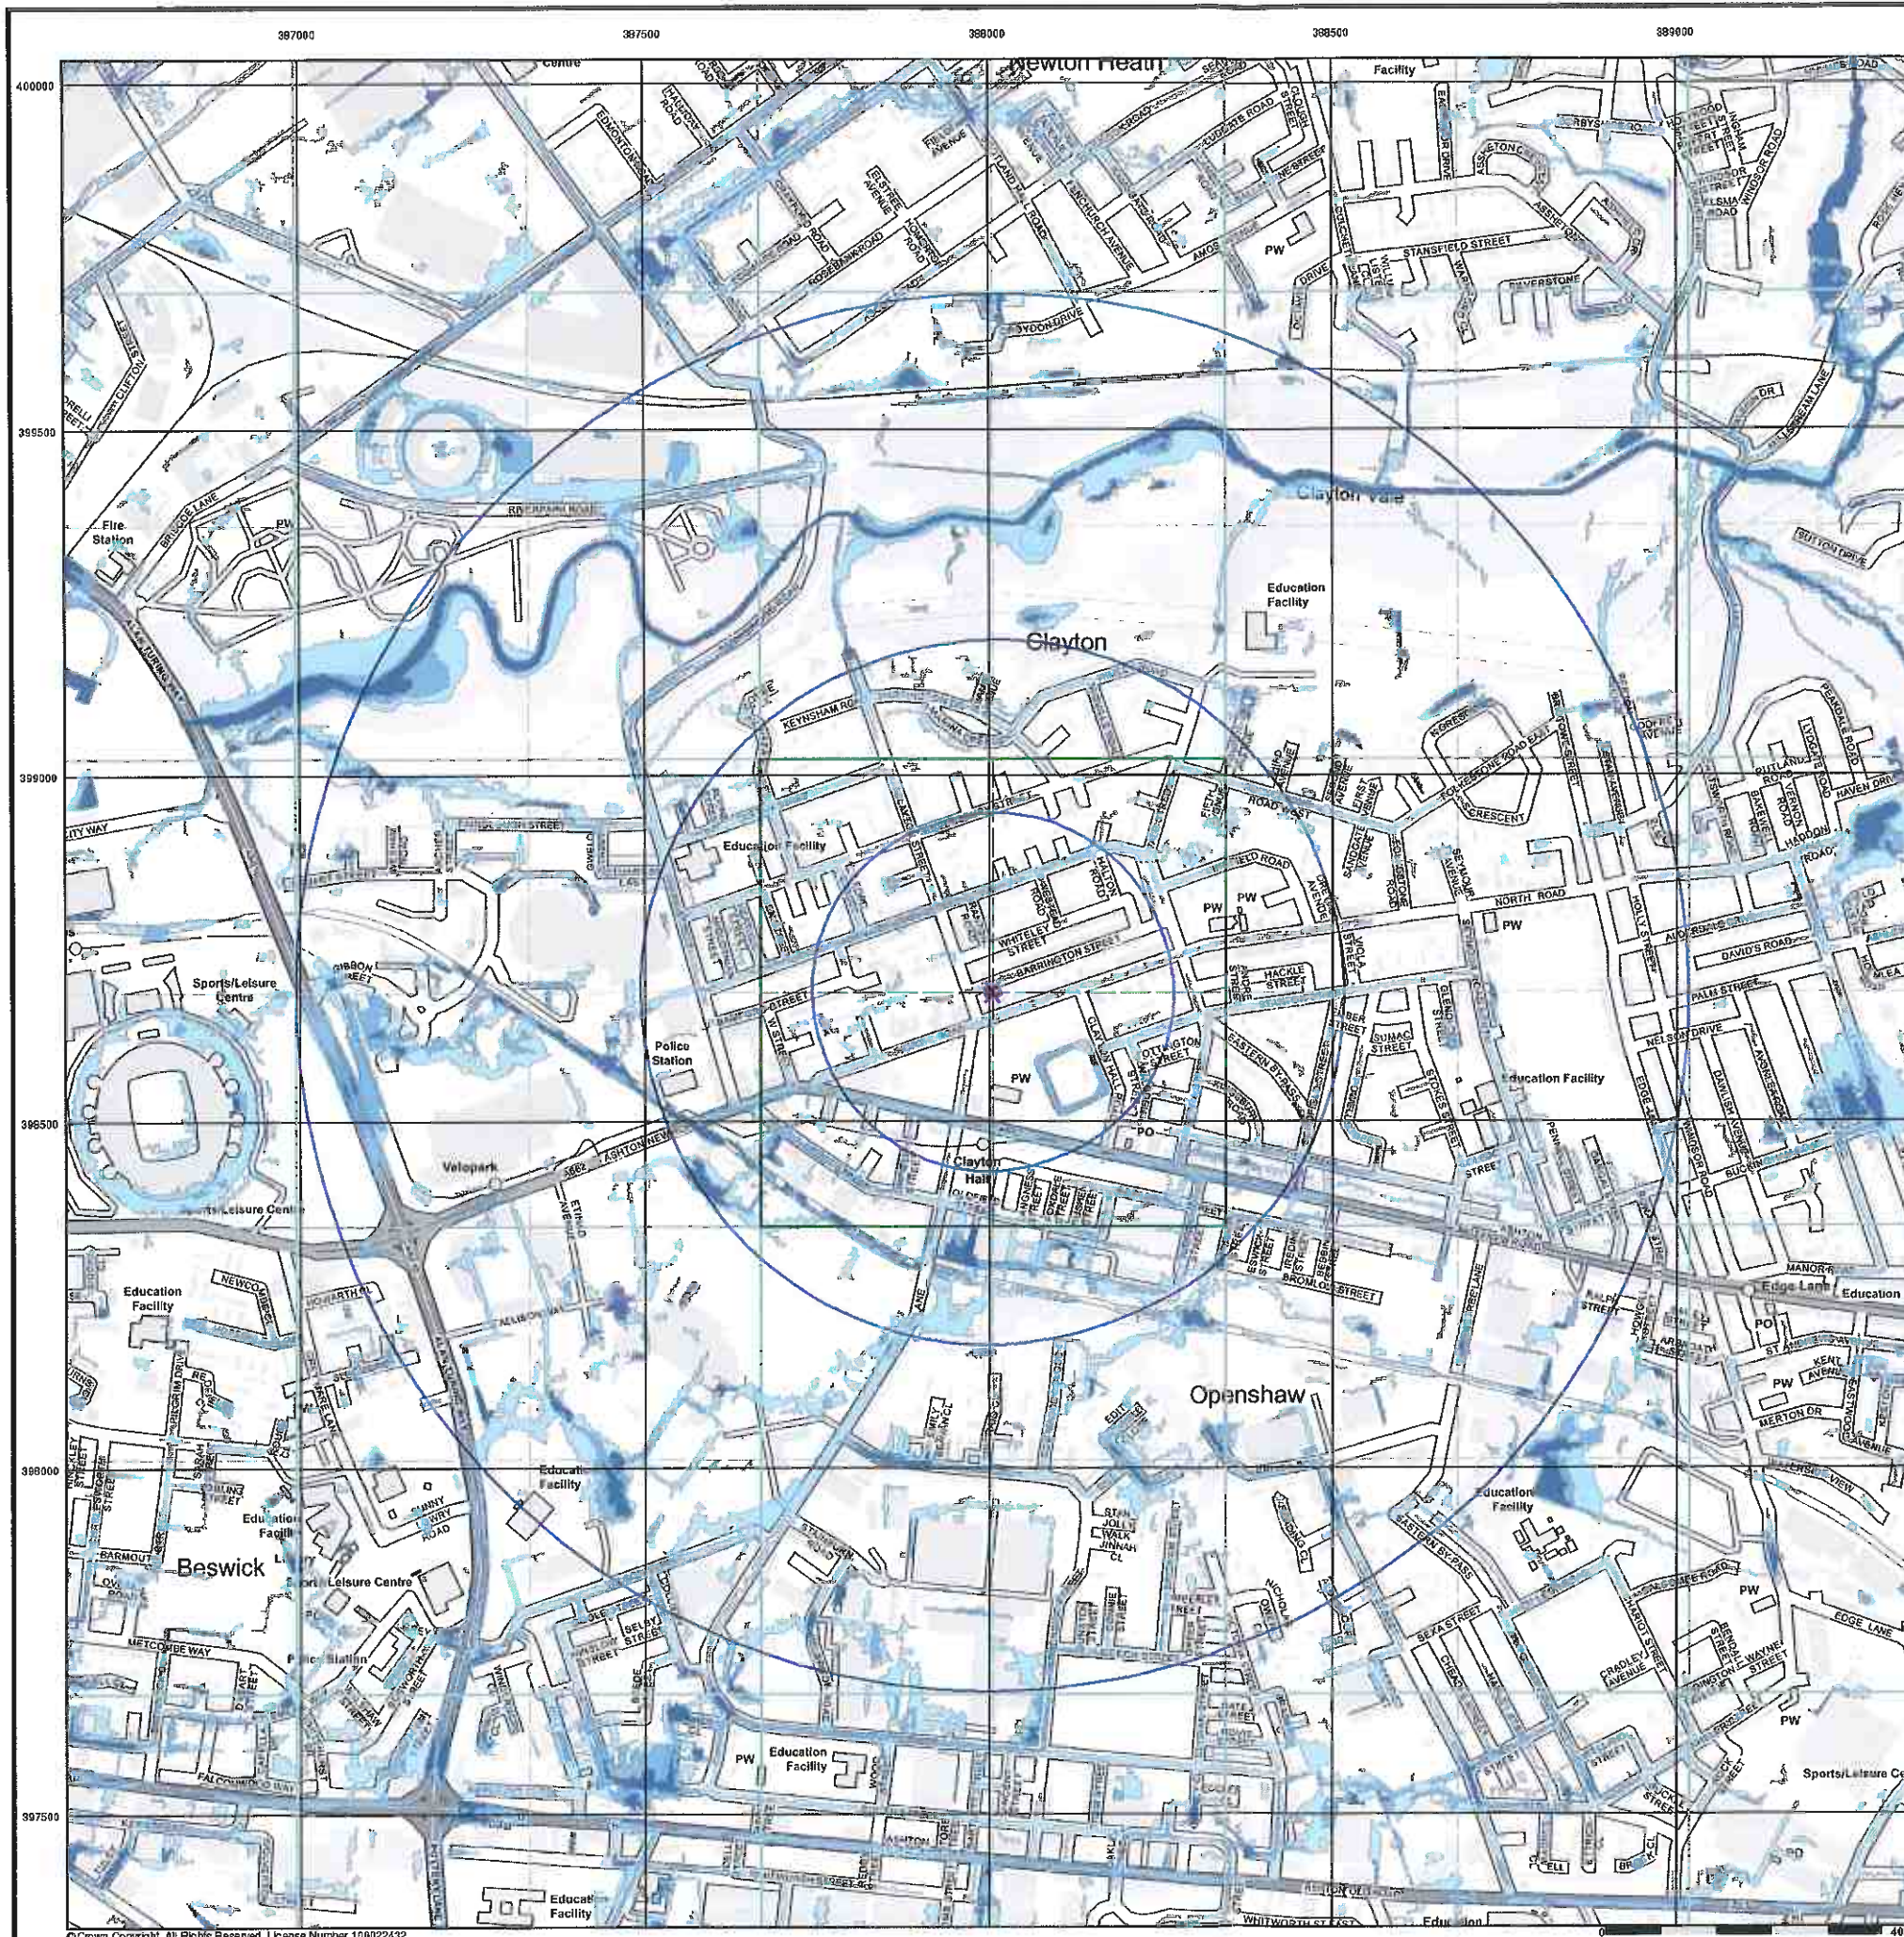

Envirocheck®

LANDMARK INFORMATION GROUP®

General

- Specified Site
- Specified Buffer(s)
- Bearing Reference Point

Risk of Flooding from Surface Water

- High - 30 Year Return
- Medium - 100 Year Return
- Low - 1000 Year Return

Suitability

See the suitability map below

- National to county
- County to town
- Town to street
- Street to parcels of land
- Property

EA/NRW Suitability Map - Slice A



Order Details


Order Number: 284497305_1_1
 Customer Ref: 21966
 National Grid Reference: 388010, 398690
 Slice: A
 Site Area (Ha): 0.03
 Search Buffer (m): 1000

Site Details

Land at Barrington Street, MANCHESTER, M11 4FB

Landmark
 INFORMATION GROUP

Tel: 0844 844 9952
 Fax: 0844 844 9951
 Web: www.envirocheck.co.uk

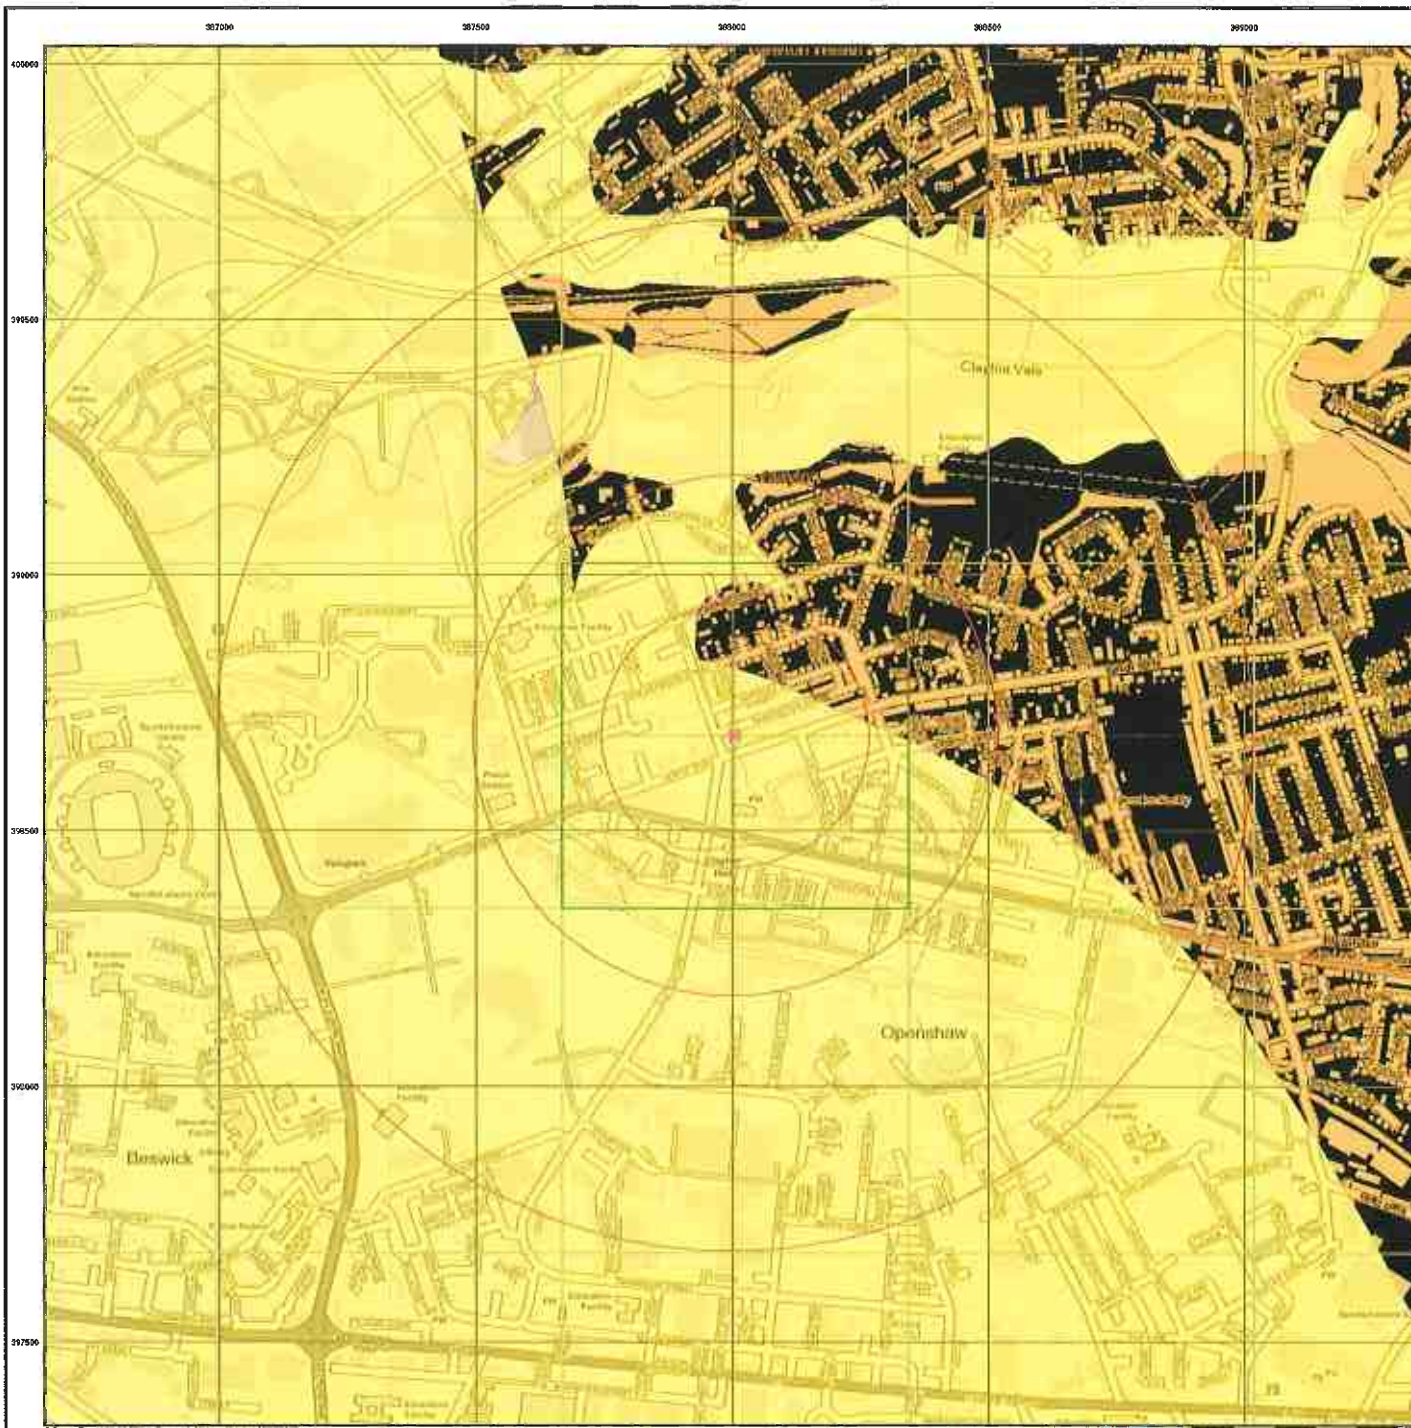

Envirocheck®


LANDMARK INFORMATION GROUP®

General


Specified Site Specified Buffer(s) Bearing Reference Point

Estimated Soil Chemistry Arsenic

Arsenic Concentrations mg/kg

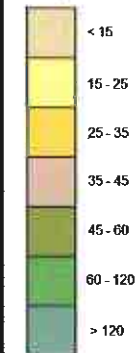

Estimated Soil Chemistry Arsenic - Slice A

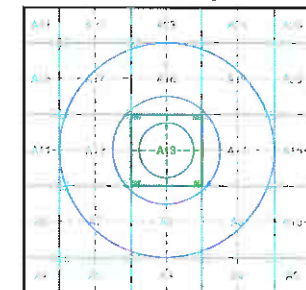

Order Details


Order Details: 284497305_1_1
 Customer Ref: 21966
 National Grid Reference: 388010, 398690
 Slice: A
 Site Area (Ha): 0.03
 Search buffer (m): 1000

Site Details

Land at Barrington Street, MANCHESTER, M11 4FB

Landmark®
 LANDMARK INFORMATION GROUP

Tel: 0844 844 9952
 Fax: 0844 844 9951
 Web: www.envirocheck.co.uk

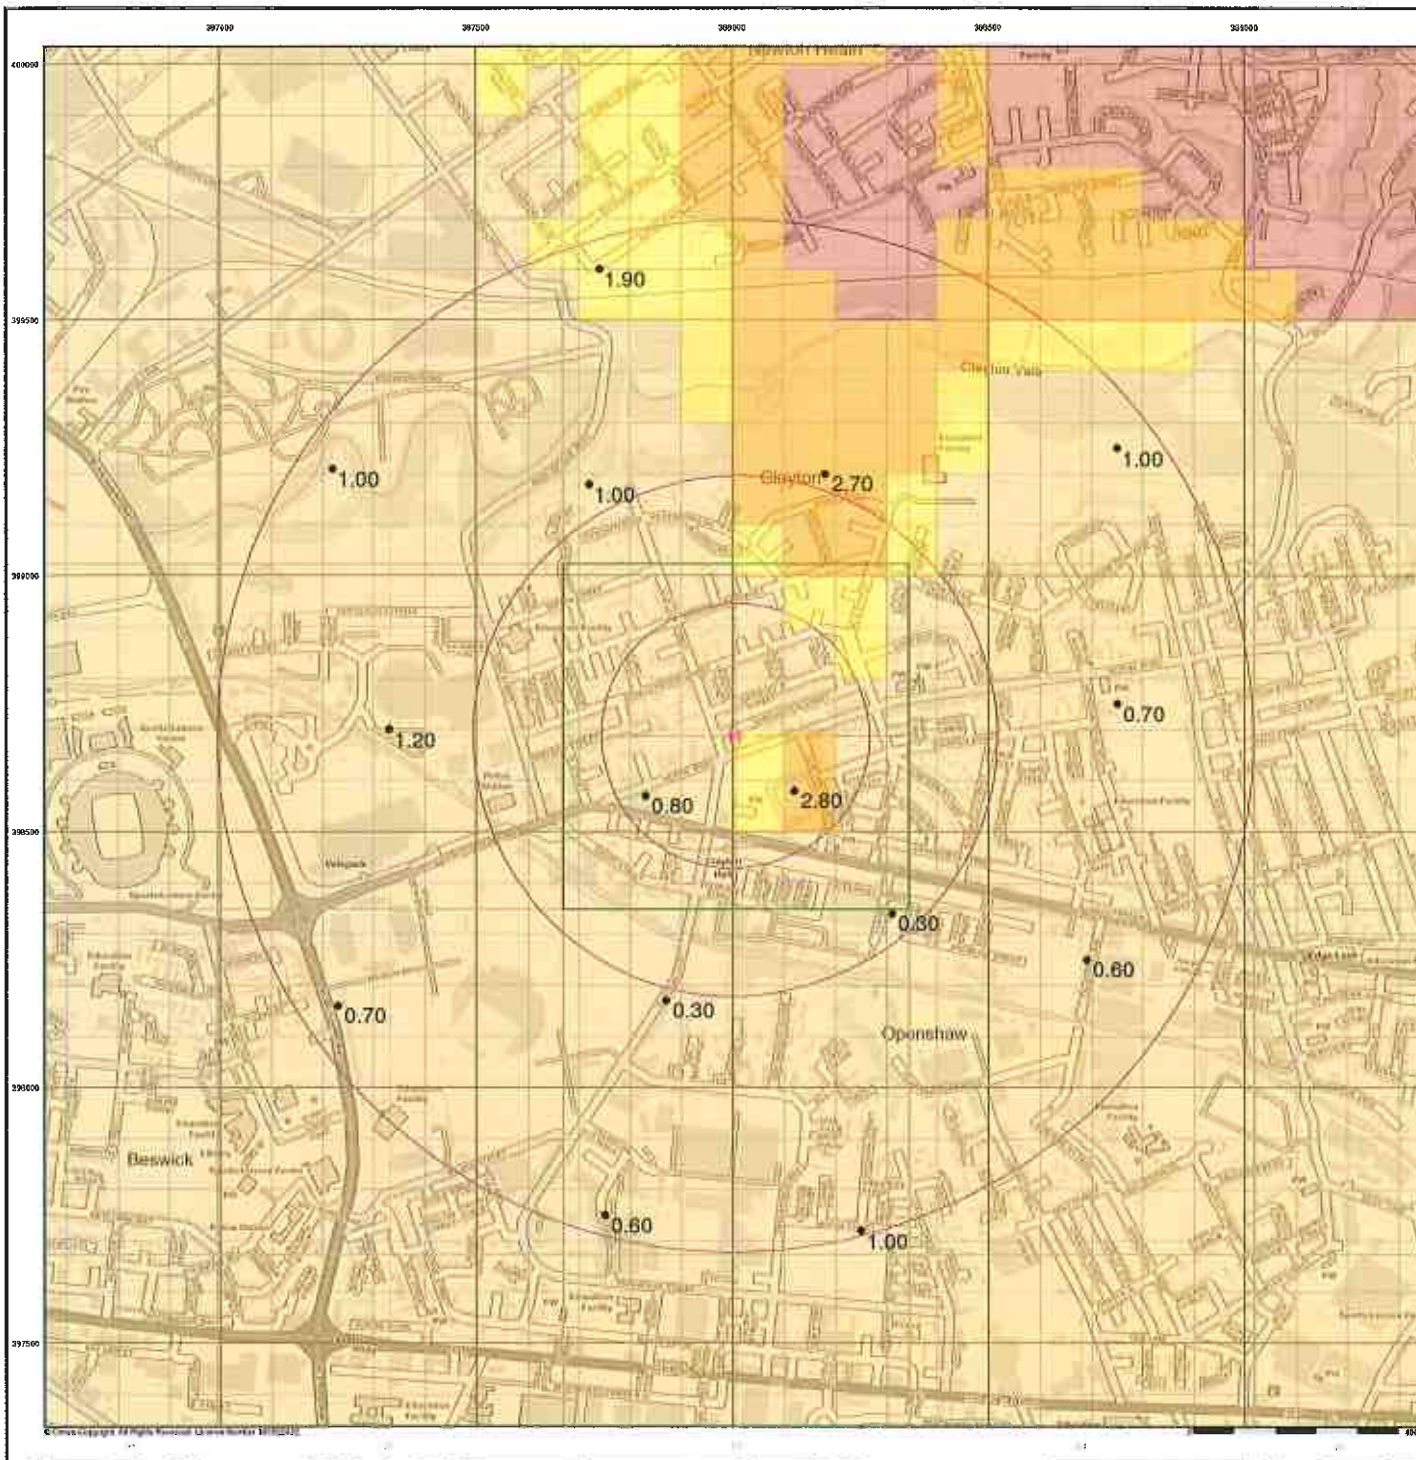

Envirocheck®

LANDMARK INFORMATION GROUP*


General

Specified Site Specified Buffer(s) Drawing Reference Point


Urban Soil Chemistry Cadmium

BGS Urban Soil Chemistry Measured Concentration Values (mg/kg)

Cadmium Concentrations mg/kg

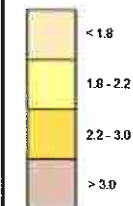

Urban Soil Chemistry Cadmium - Slice A

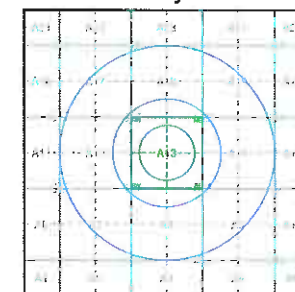

Order Details


Order Details: 284497305_1_1
 Customer Ref: 21966
 National Grid Reference: 398010, 398690
 Slice: A
 Site Area (Ha): 0.03
 Search buffer (m): 1000

Site Details

Land at Barrington Street, MANCHESTER, M11 4FB

Landmark®
 LANDMARK INFORMATION GROUP

Tel: 0844 644 9952
 Fax: 0844 644 9951
 Web: www.envirocheck.co.uk

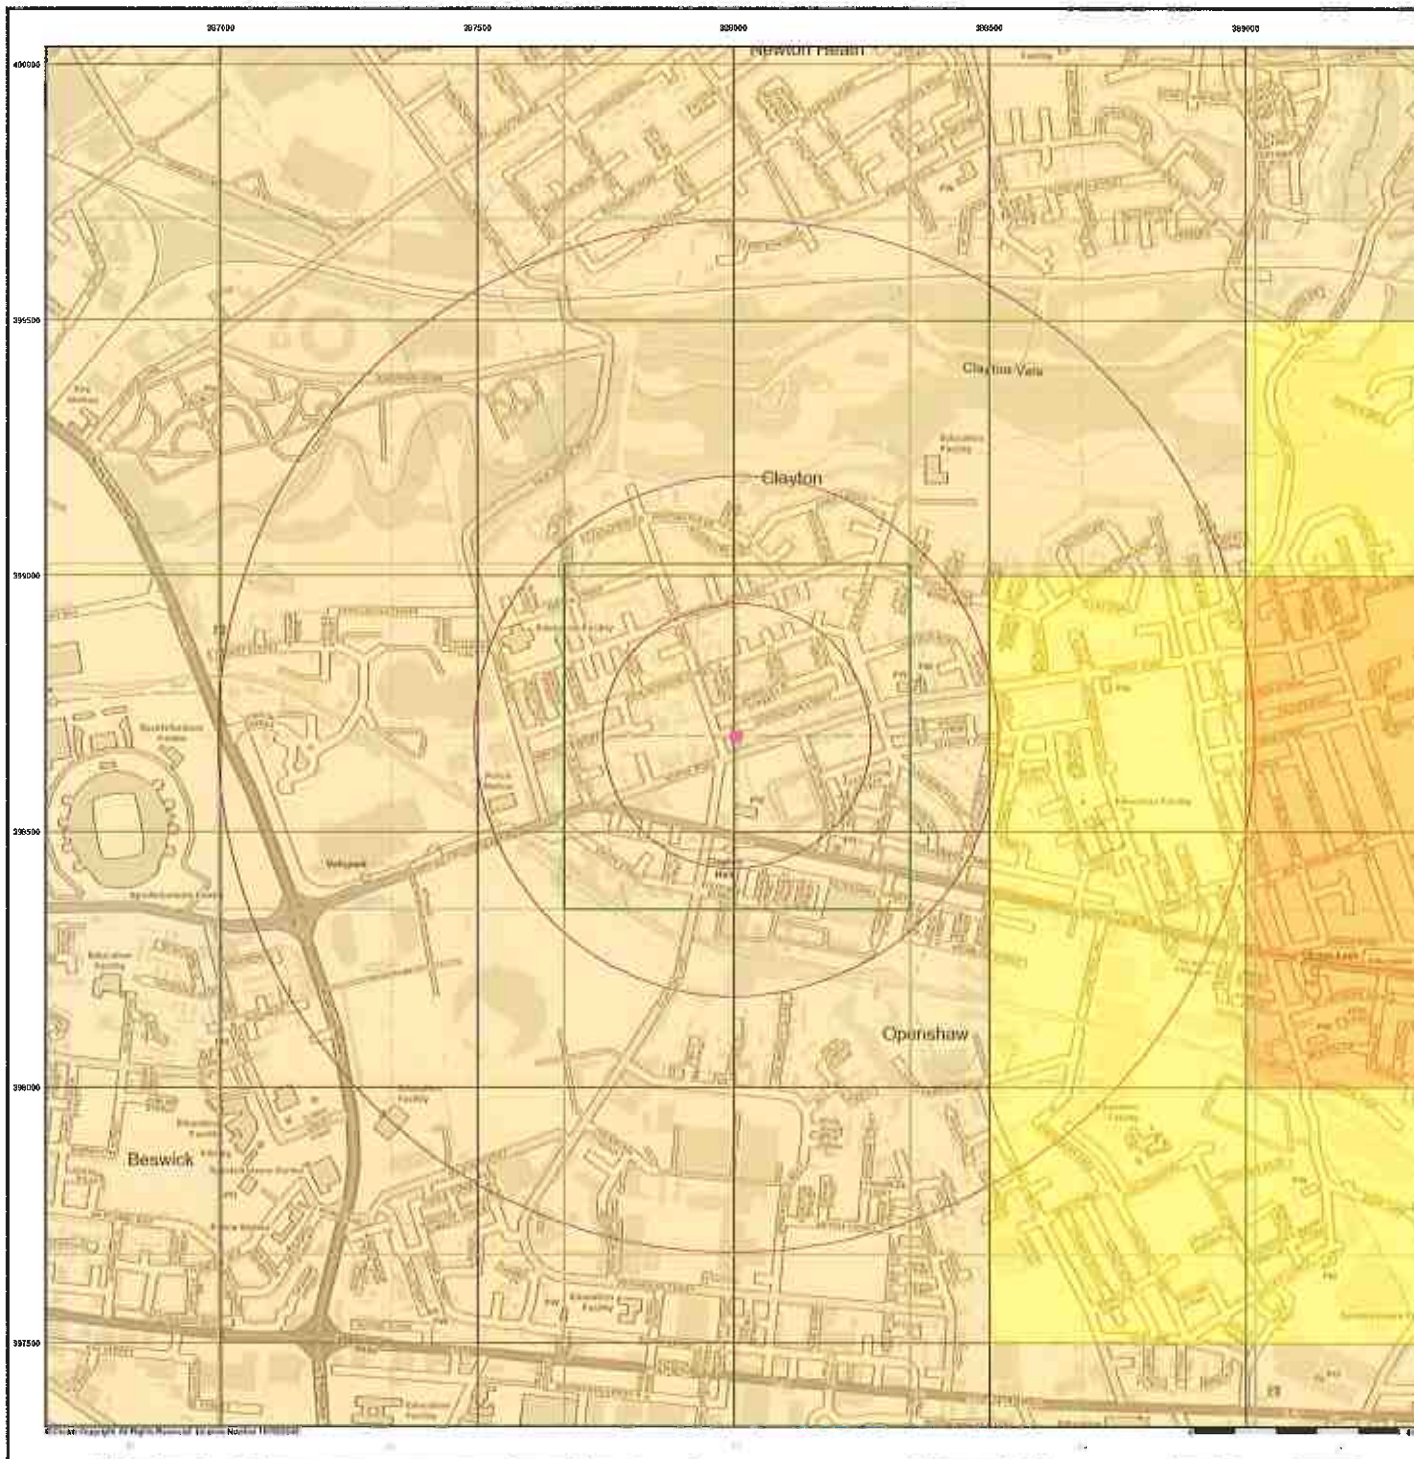

Envirocheck®


LANDMARK INFORMATION GROUP*

General


Specified Site Specified Buffer(s) Existing Reference Point

Estimated Soil Chemistry Cadmium

Cadmium Concentrations mg/kg

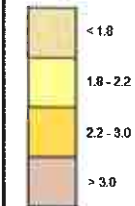

Estimated Soil Chemistry Cadmium - Slice A

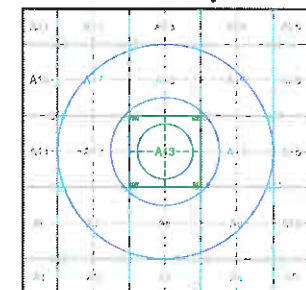

Order Details


Order Details: 284497305_1_1
 Customer Ref: 21966
 National Grid Reference: 388010, 398690
 Slice: A
 Site Area (Ha): 0.03
 Search buffer (m): 1000

Site Details

Land at Barrington Street, MANCHESTER, M11 4FB

Landmark
 INFORMATION GROUP

Tel: 0844 944 9952
 Fax: 0844 944 9951
 Web: www.envirocheck.co.uk

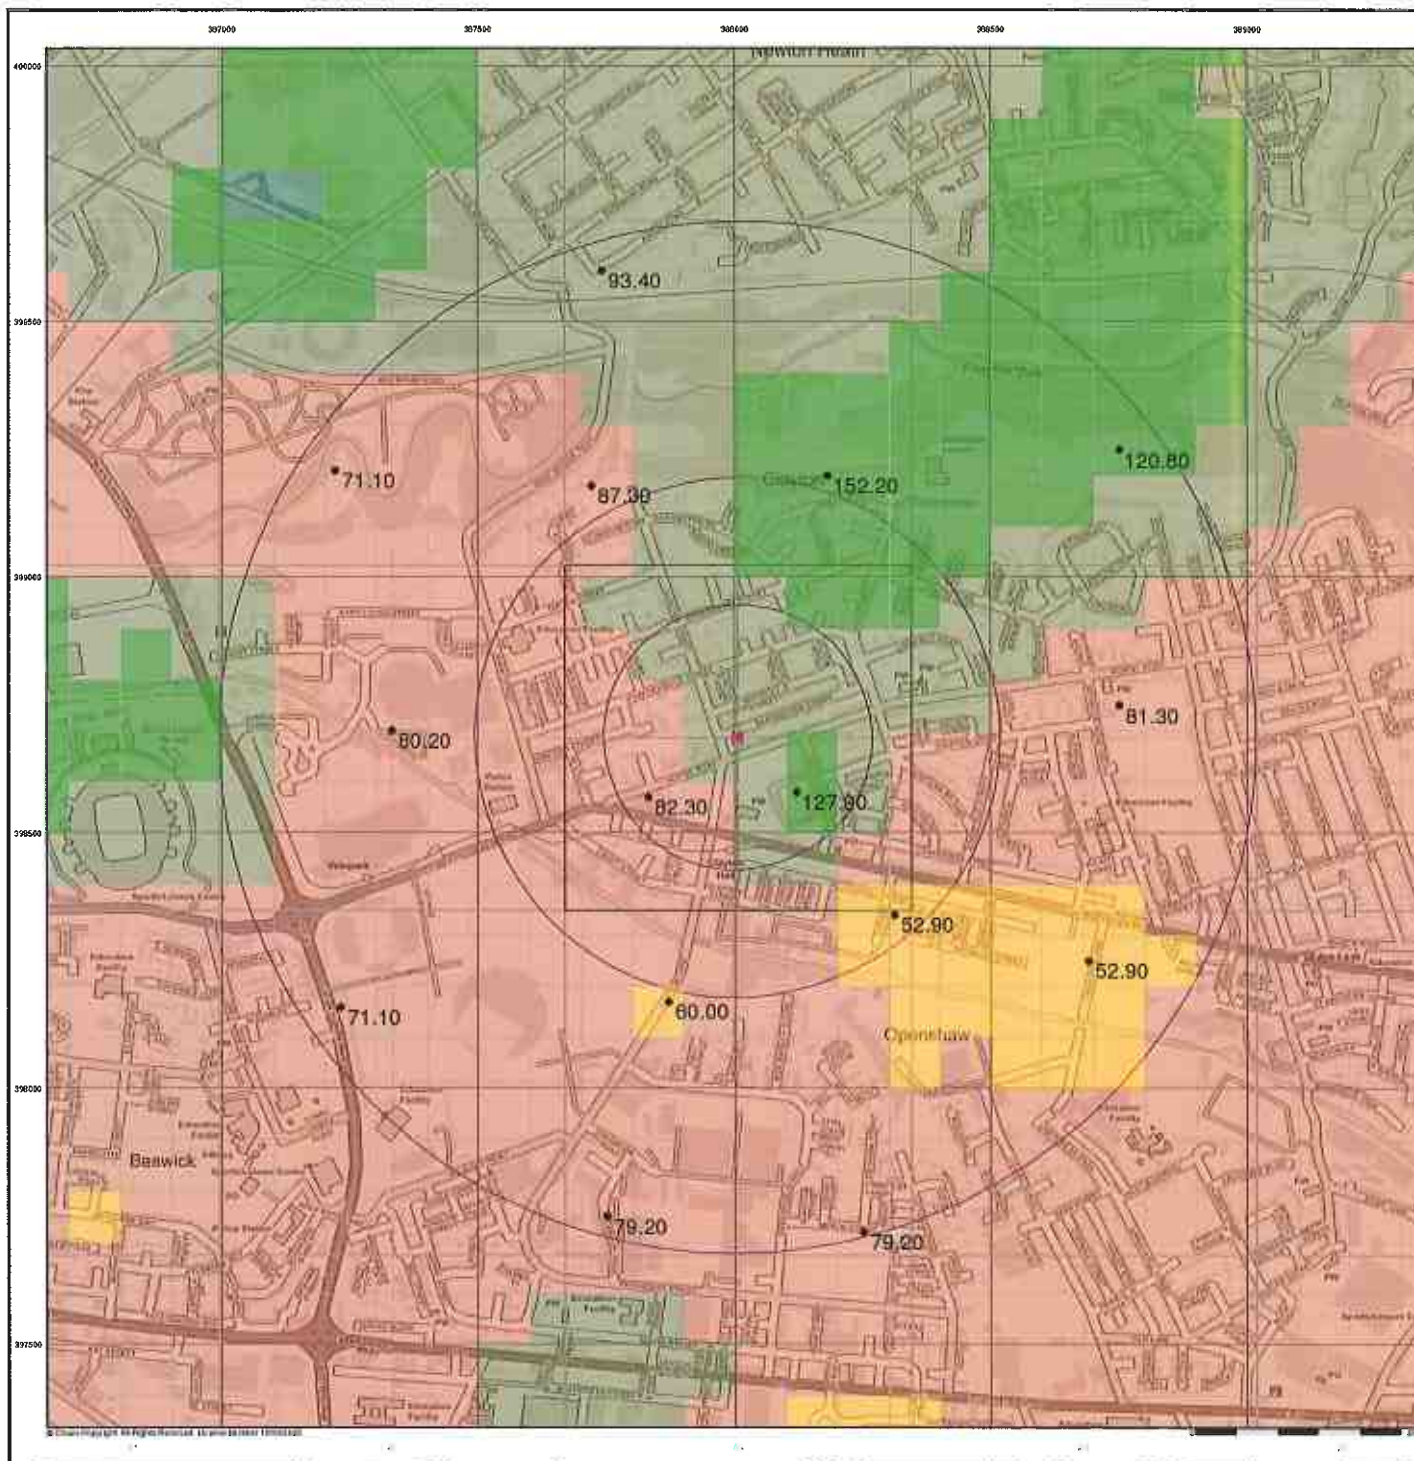

Envirocheck®

LANDMARK INFORMATION GROUP®


General

Specified Site Specified Buffer(s) Bearing Reference Point


Urban Soil Chemistry Chromium

BGS Urban Soil Chemistry Measured Concentration Values (mg/kg)

Chromium Concentrations mg/kg

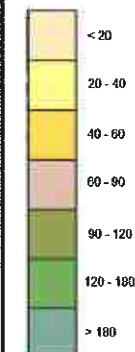

Urban Soil Chemistry Chromium - Slice A

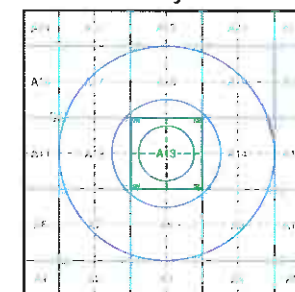

Order Details


Order Details: 284497305_1_1
 Customer Ref: 21966
 National Grid Reference: 388010, 398690
 Slice: A
 Site Area (Ha): 0.03
 Search buffer (m): 1000

Site Details

Land at Barrington Street, MANCHESTER, M11 4FB

Landmark®
 INFORMATION GROUP

Tel: 0844 844 9952
 Fax: 0844 844 9951
 Web: www.envirocheck.co.uk

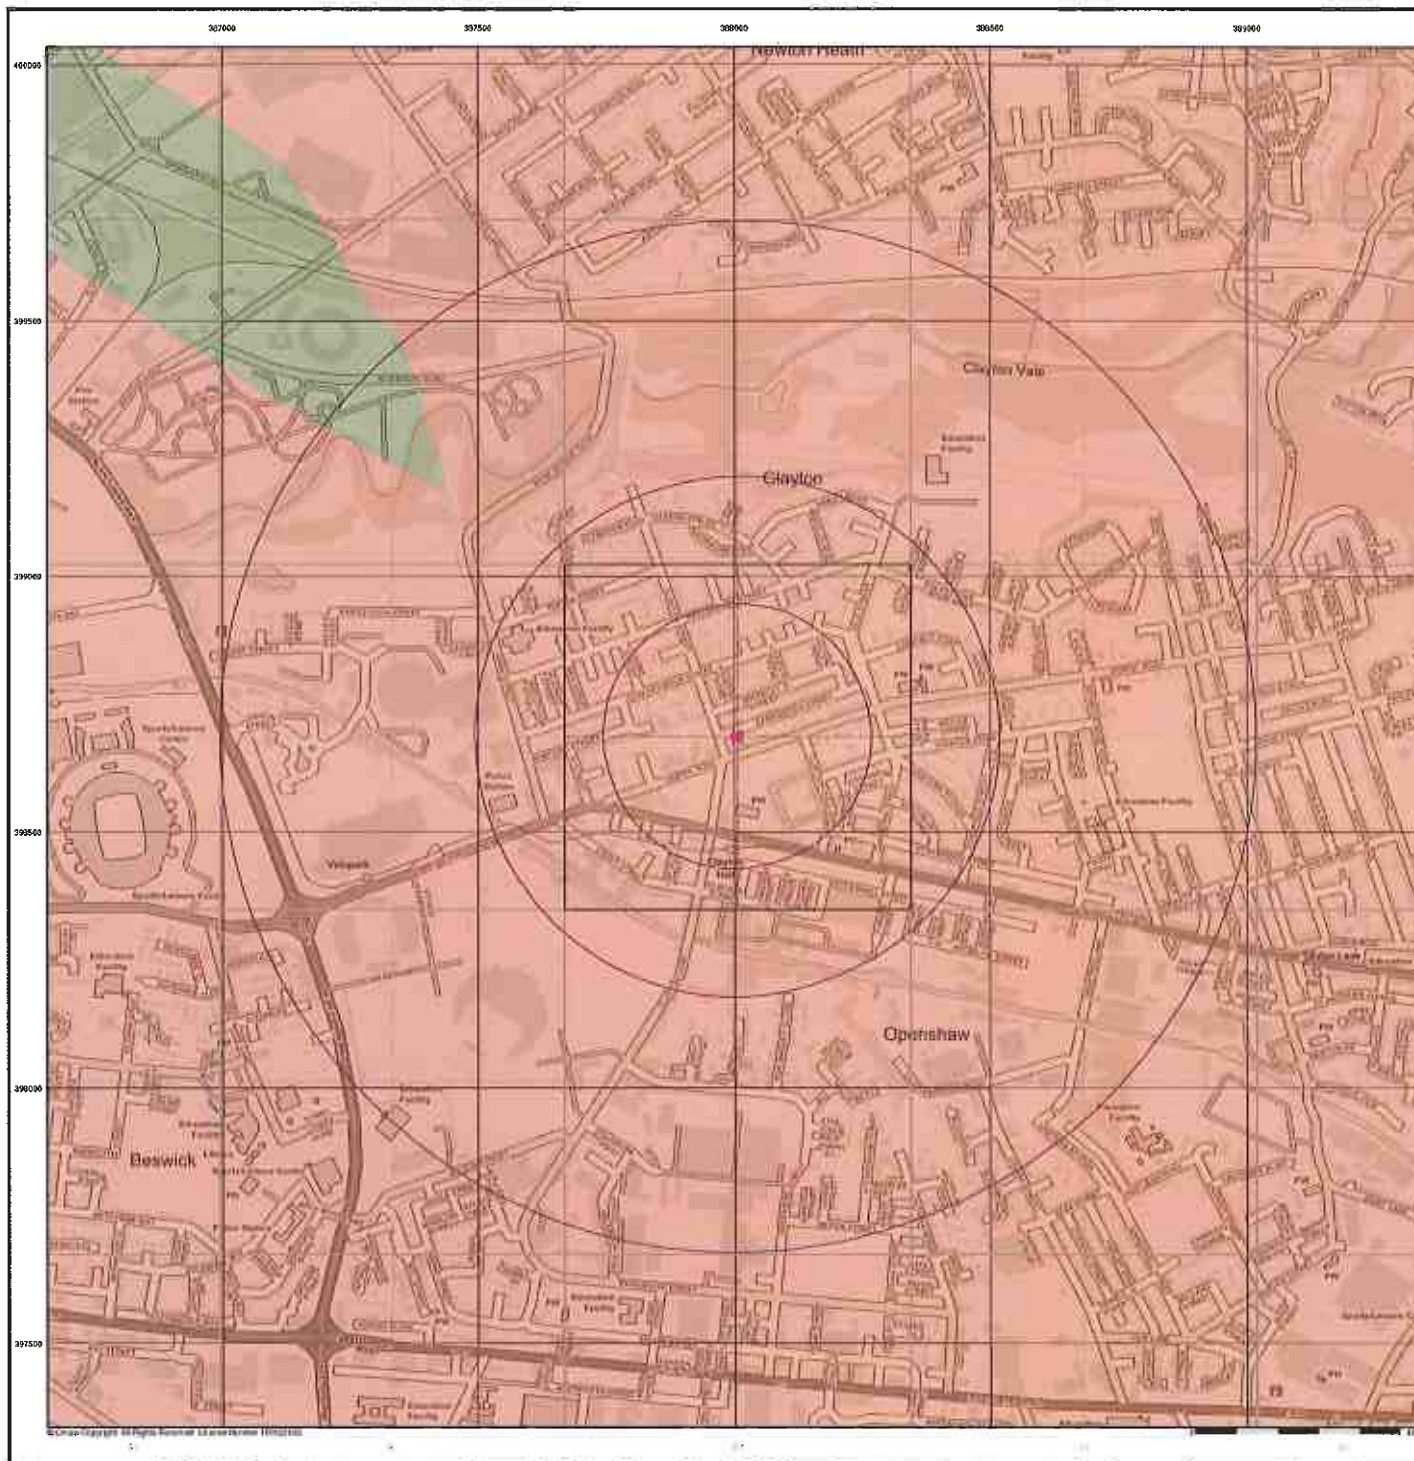

Envirocheck®


LANDMARK INFORMATION GROUP*

General


Specified Site Specified Buffer(s) Bearing Reference Point

Estimated Soil Chemistry Chromium

Chromium Concentrations mg/kg

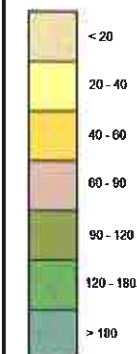

Estimated Soil Chemistry Chromium - Slice A

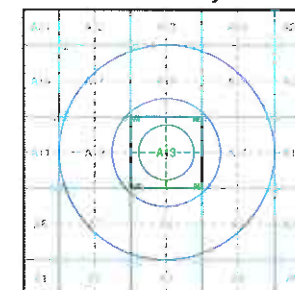

Order Details


Order Details: 284497305_1_1
 Customer Ref: 21966
 National Grid Reference: 388010, 398690
 Slice: A
 Site Area (Ha): 0.03
 Search buffer (m): 1000

Site Details

Land at Barrington Street, MANCHESTER, M11 4FB

Landmark
 INFORMATION GROUP

Tel: 0844 844 9952
 Fax: 0844 844 9951
 Web: www.envirocheck.co.uk

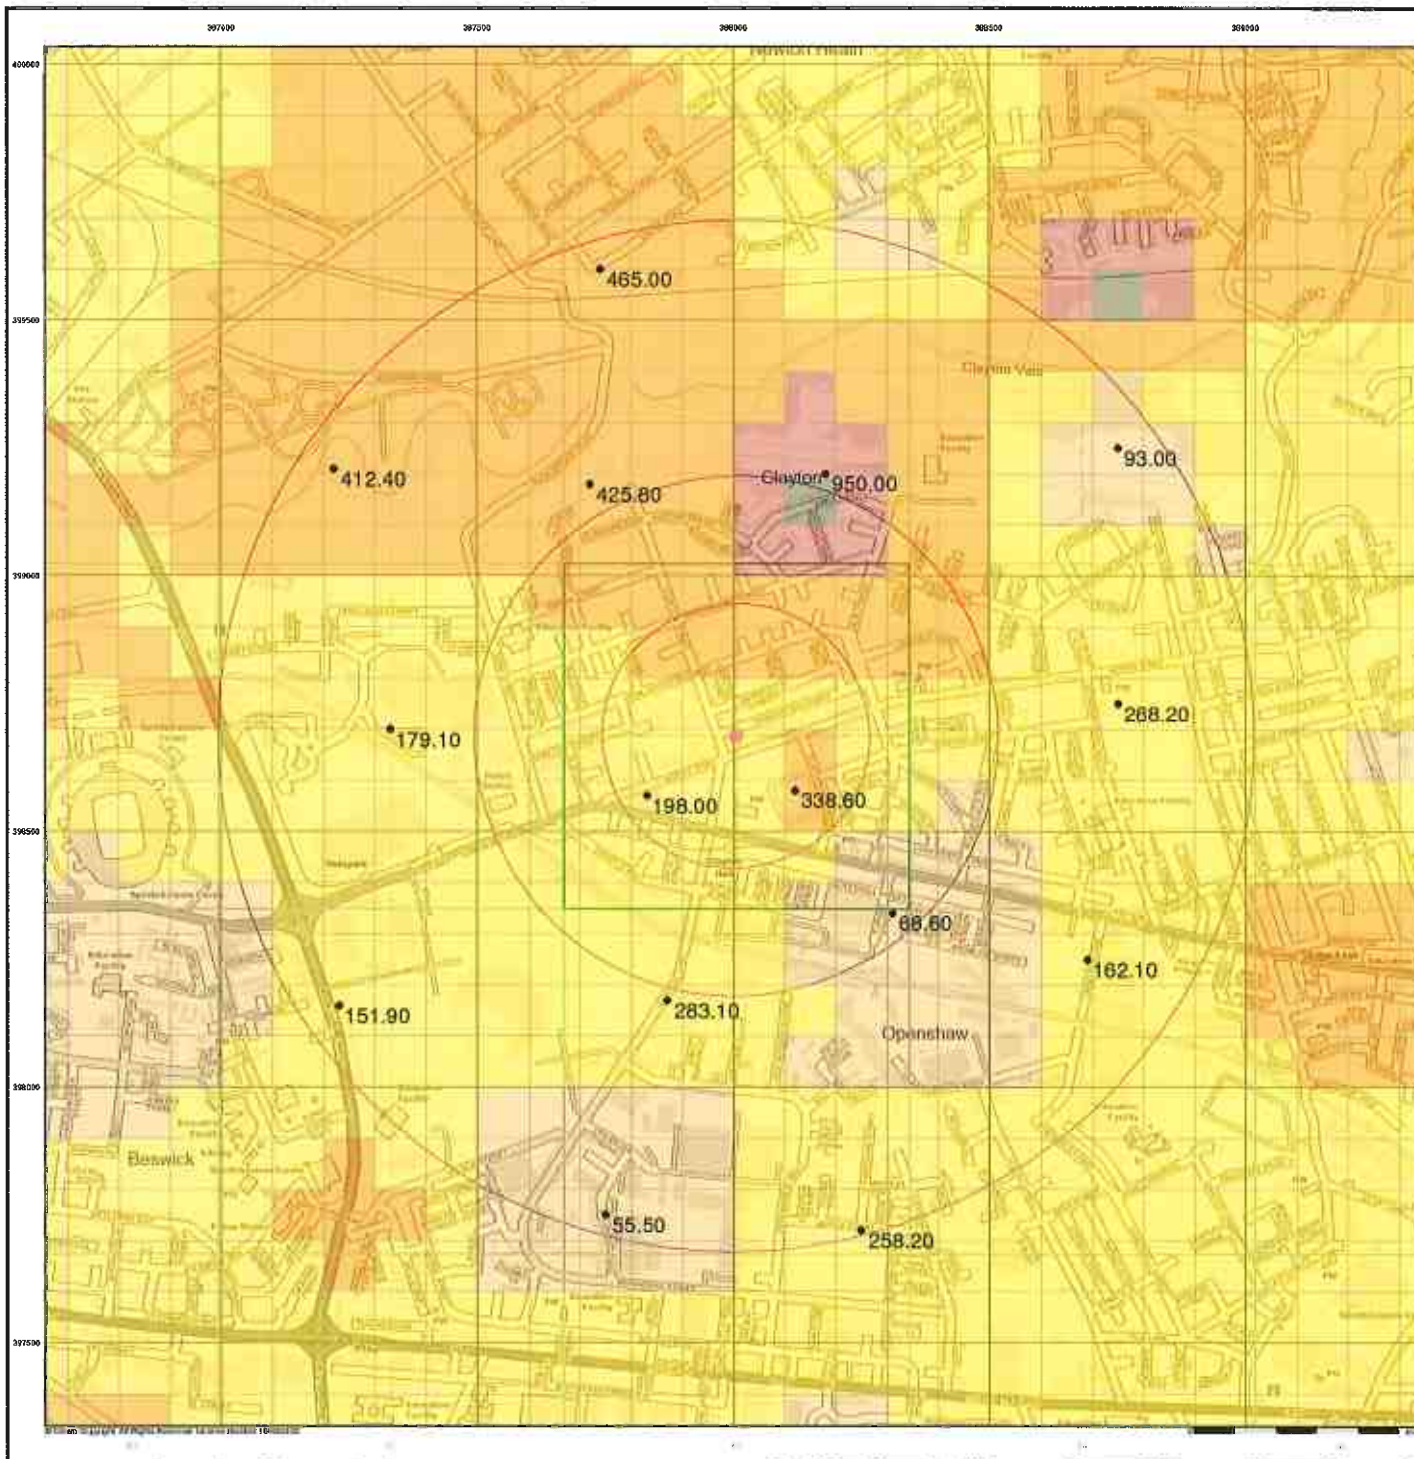

Envirocheck®

LANDMARK INFORMATION GROUP*


General

Specified Site Specified Buffer(s) Bearing Reference Point


Urban Soil Chemistry Lead

BGS Urban Soil Chemistry Measured Concentration Values (mg/kg)

Lead Concentrations mg/kg

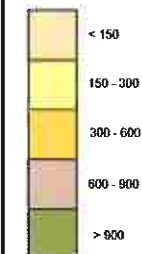

Urban Soil Chemistry Lead - Slice A

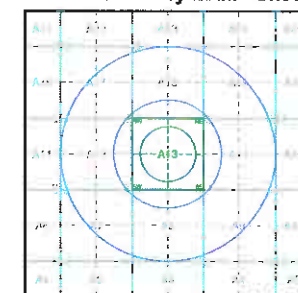

Order Details


Order Details: 284497305_1_1
 Customer Ref: 21966
 National Grid Reference: 388010, 398690
 Slice: A
 Site Area (Ha): 0.03
 Search buffer (m): 1000

Site Details

Land at Barrington Street, MANCHESTER, M11 4FB

Landmark
 INFORMATION GROUP

Tel: 0844 944 9552
 Fax: 0844 944 9551
 Web: www.envirocheck.co.uk

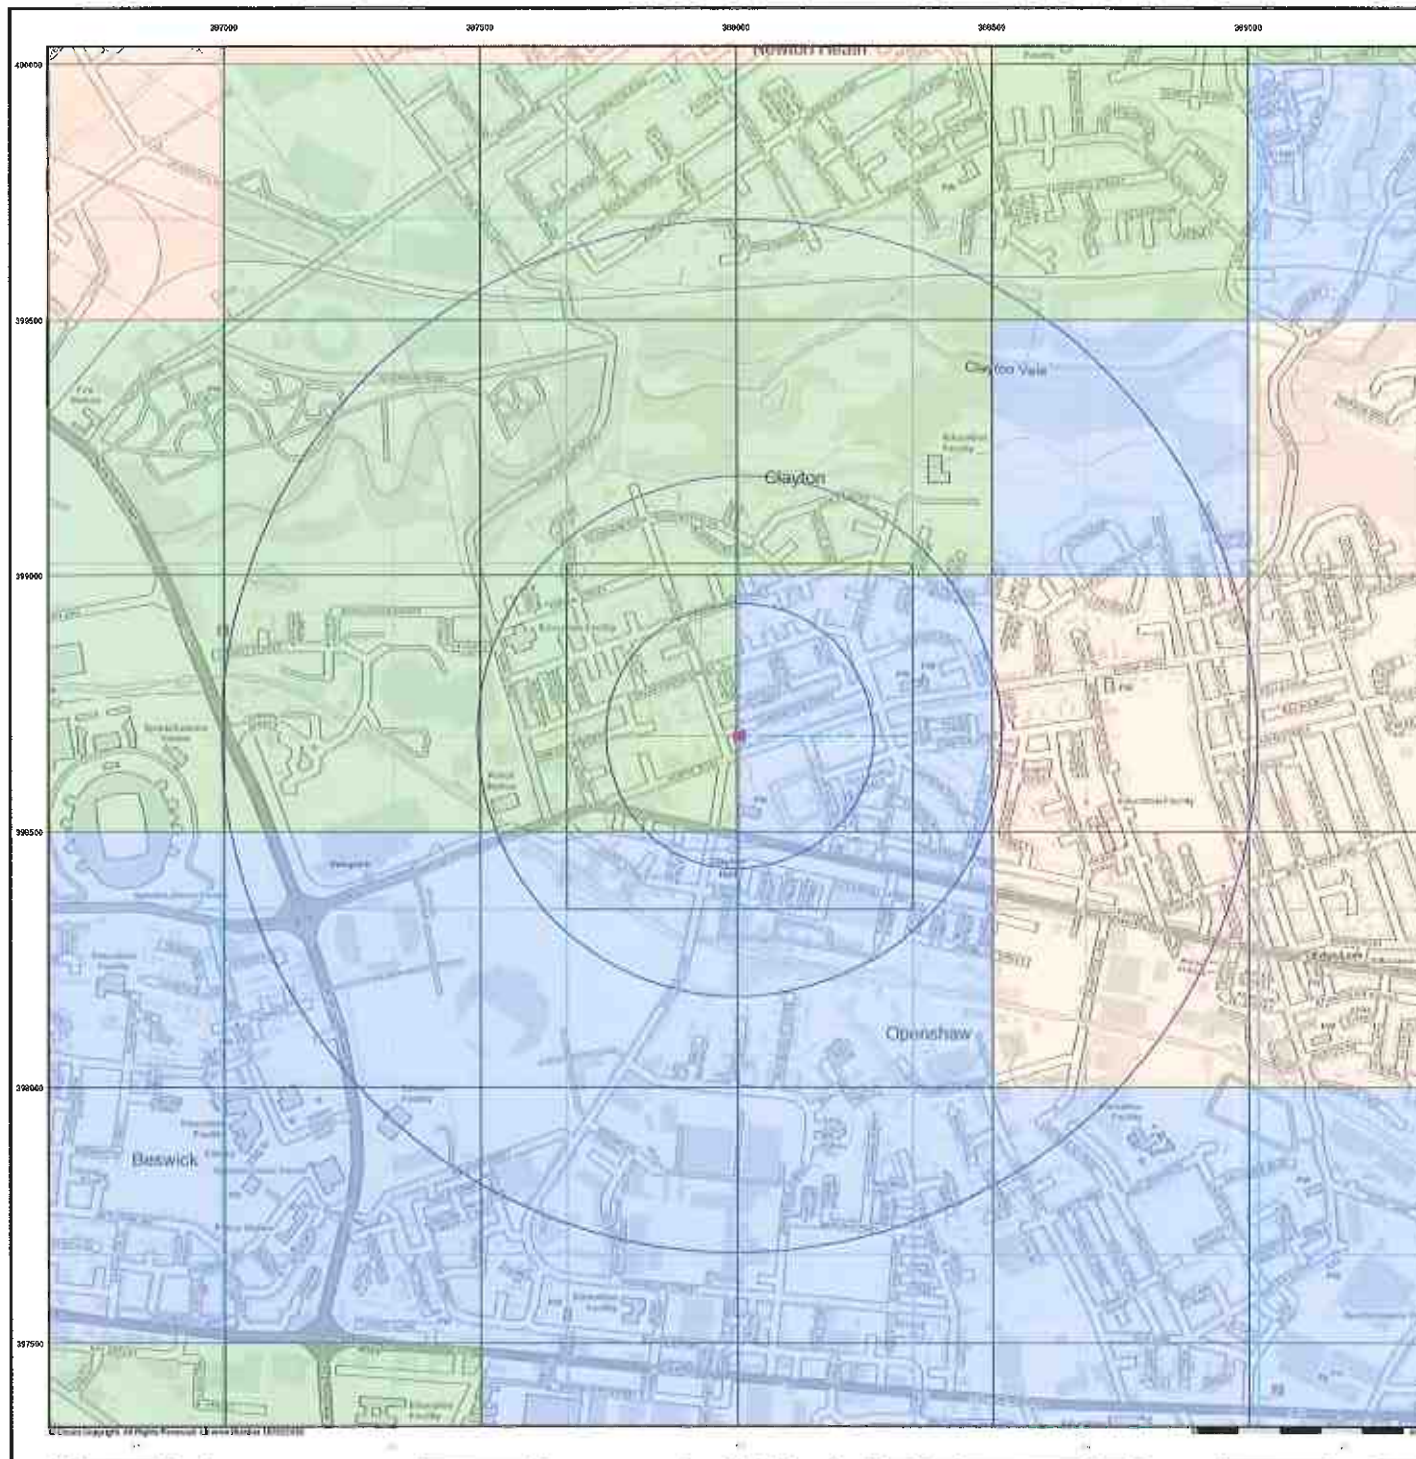

Envirocheck®


LANDMARK INFORMATION GROUP*

General


Specified Site Specified Buffer(s) Bearing Reference Point

Estimated Soil Chemistry Lead

Lead Concentrations mg/kg

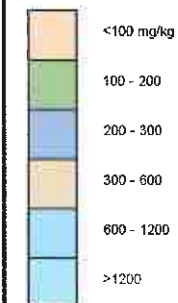

Estimated Soil Chemistry Lead - Slice A

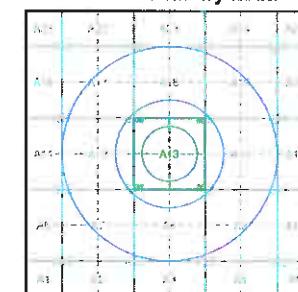

Order Details


Order Details: 284497305_1_1
Customer Ref: 21966
National Grid Reference: 388010, 398690
Slice: A
Site Area (Ha): 0.03
Search buffer (m): 1000

Site Details

Land at Barrington Street, MANCHESTER, M11 4FB

Landmark®
LANDMARK INFORMATION GROUP

Tel: 0844 844 9952
Fax: 0844 844 9951
Web: www.envirocheck.co.uk

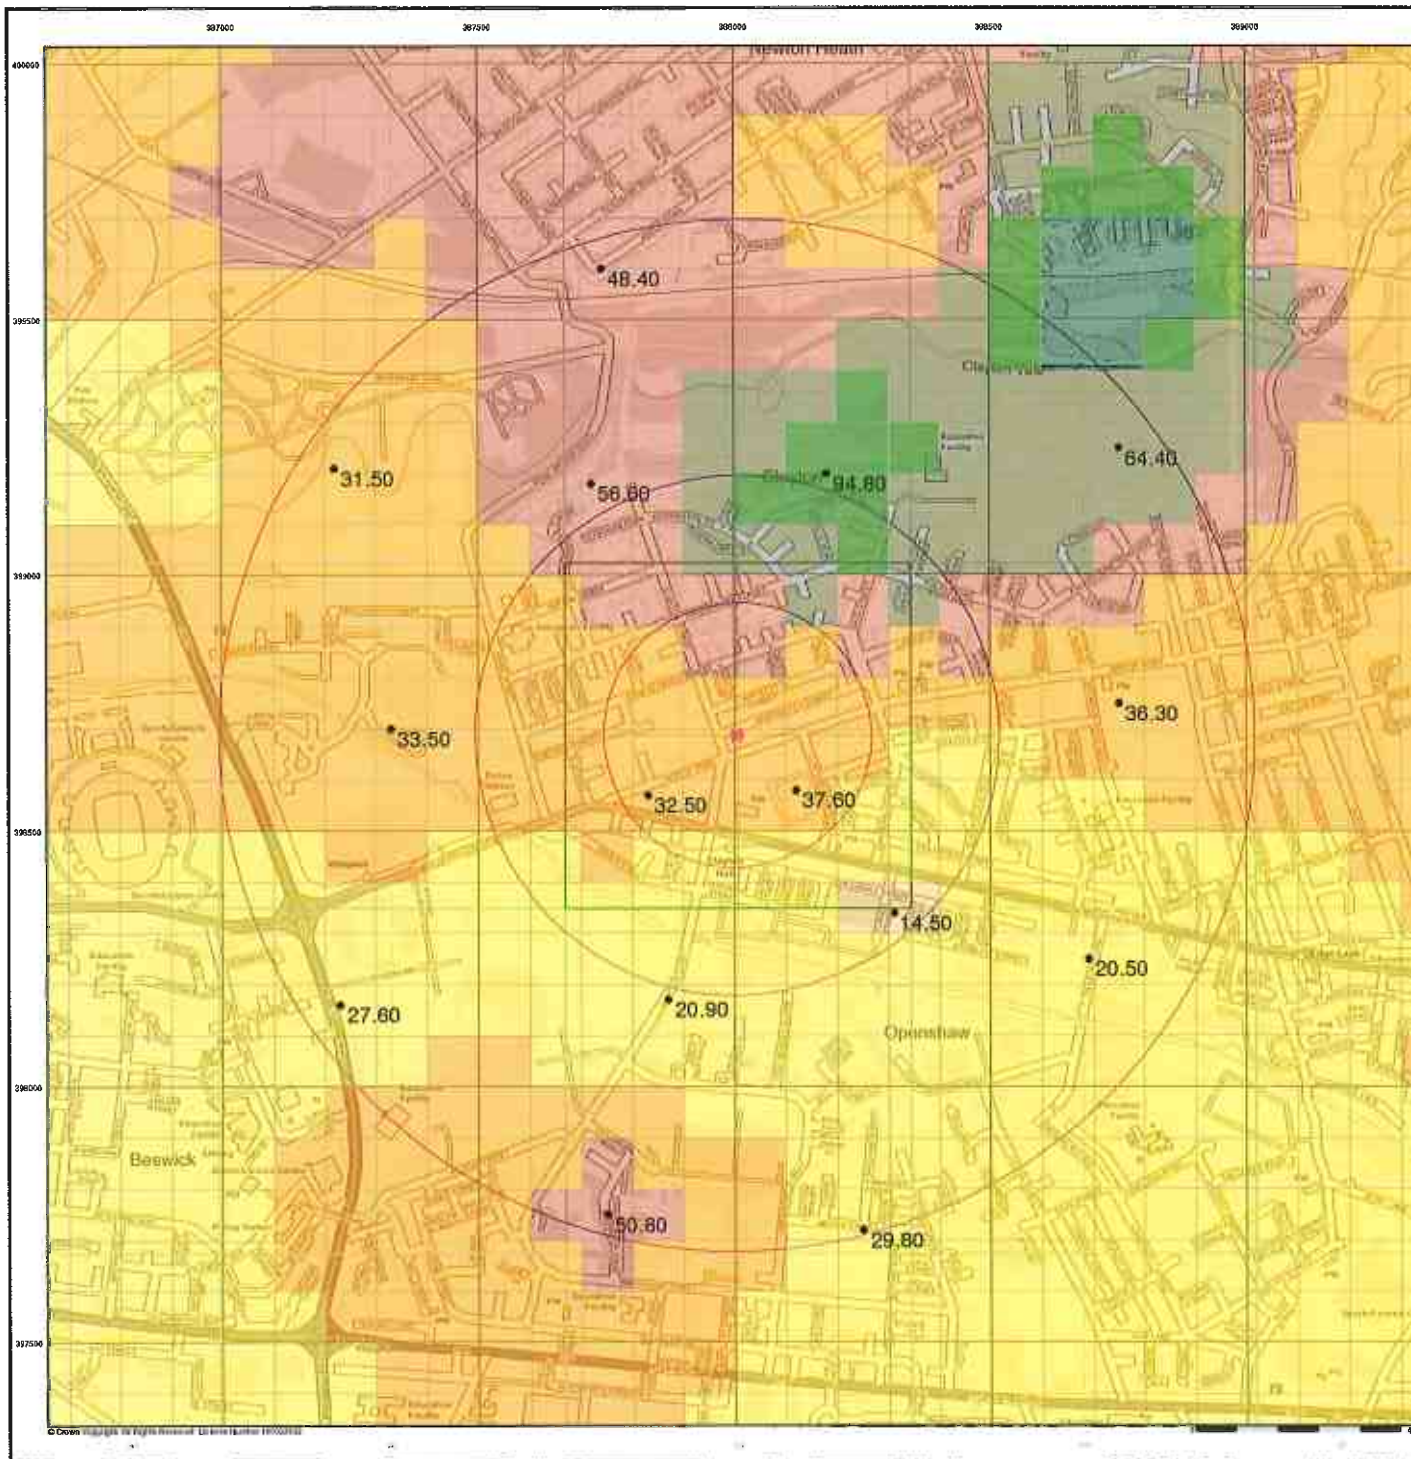

Envirocheck®

LANDMARK INFORMATION GROUP*


General

Specified Site Specified Buffer(s) Bearing Reference Point


Urban Soil Chemistry Nickel

BGS Urban Soil Chemistry Measured Concentration Values (mg/kg)

Nickel Concentrations mg/kg

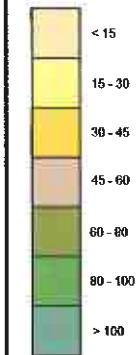

Urban Soil Chemistry Nickel - Slice A

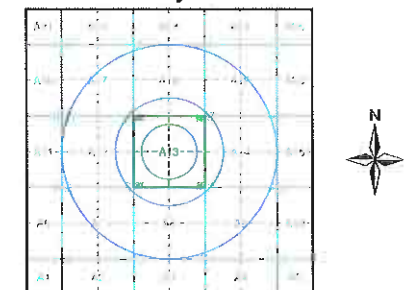

Order Details


Order Details: 284497305_1_1
 Customer Ref: 21986
 National Grid Reference: 388010, 398690
 Slice: A
 Site Area (Ha): 0.03
 Search buffer (m): 1000

Site Details

Land at Barrington Street, MANCHESTER, M11 4FB

Landmark®
 INFORMATION GROUP

Tel: 0844 844 9952
 Fax: 0844 844 9951
 Web: www.envirocheck.co.uk

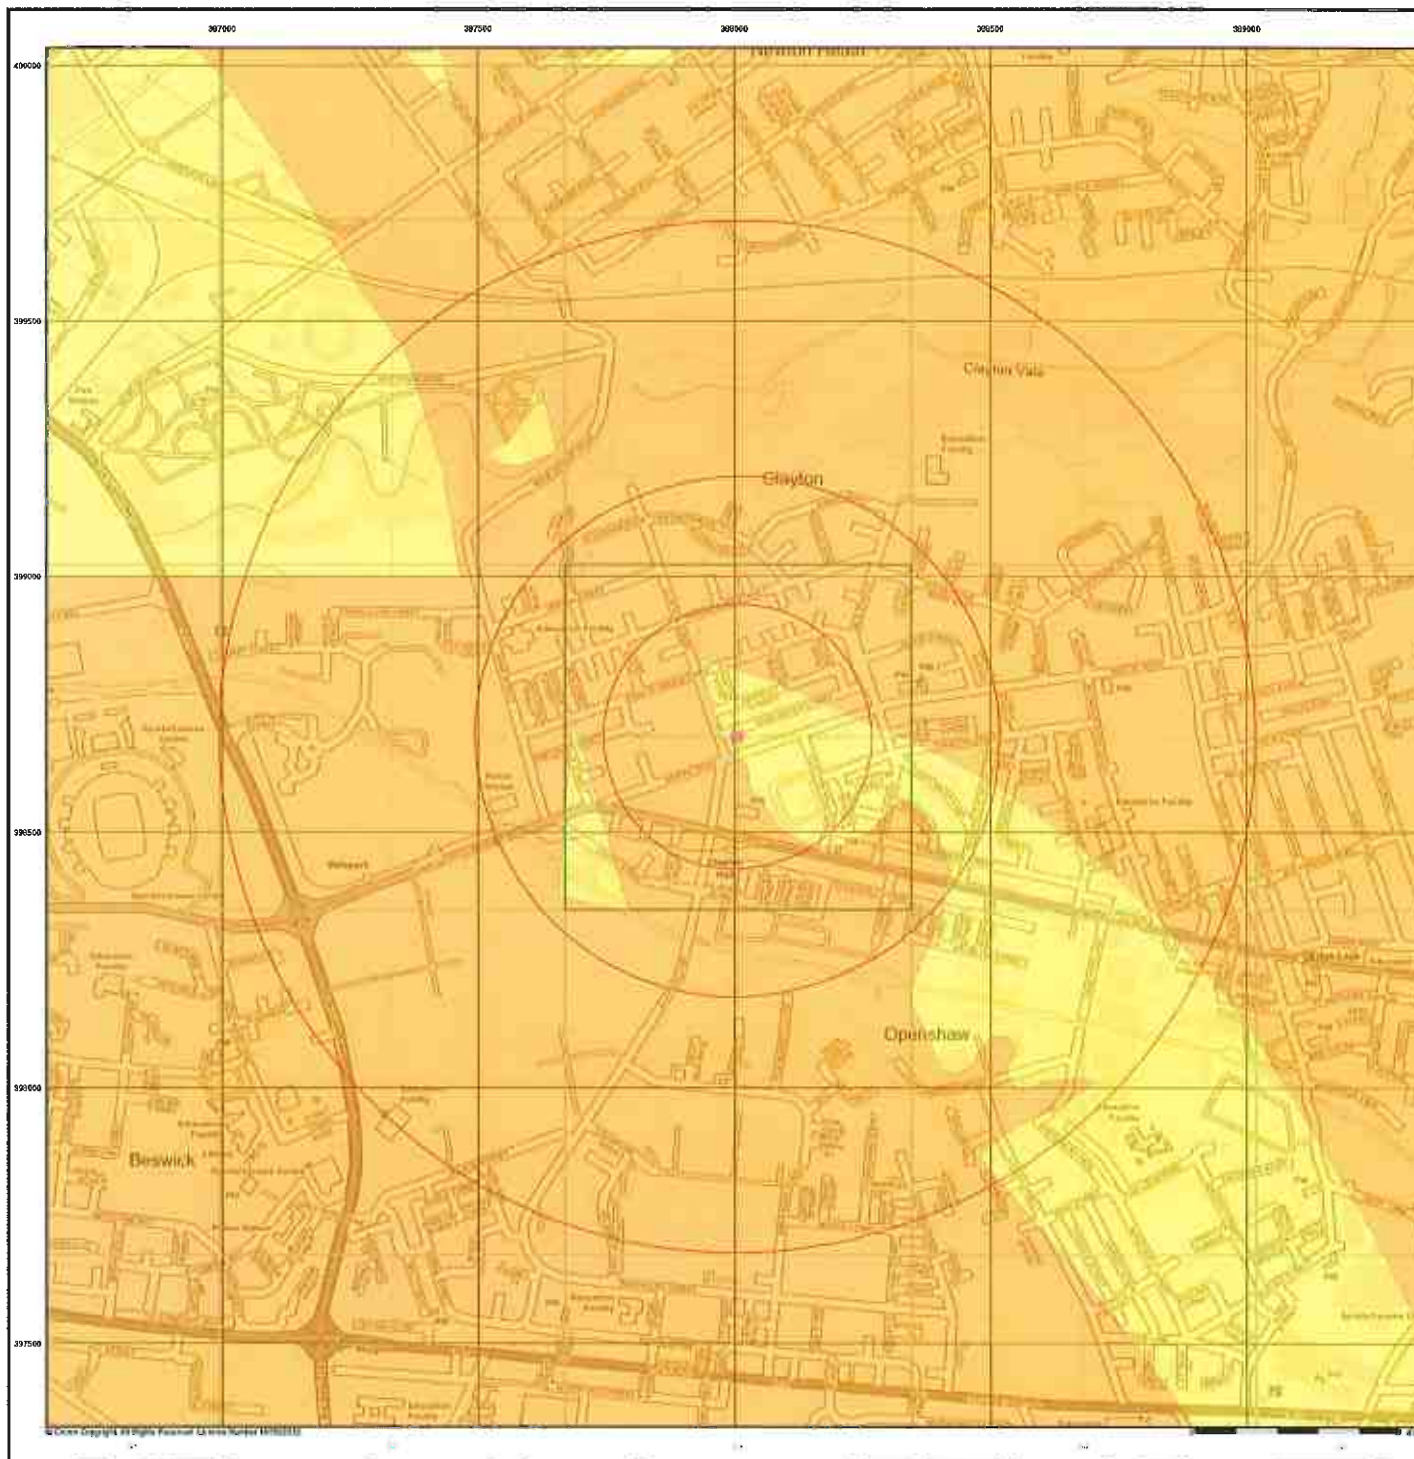

Envirocheck[®]


LANDMARK INFORMATION GROUP*

General


Specified Site Specified Buffer(s) Bearing Reference Point

Estimated Soil Chemistry Nickel

Nickel Concentrations mg/kg

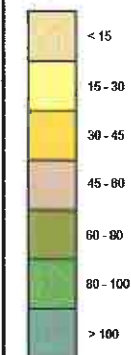

Estimated Soil Chemistry Nickel - Slice A

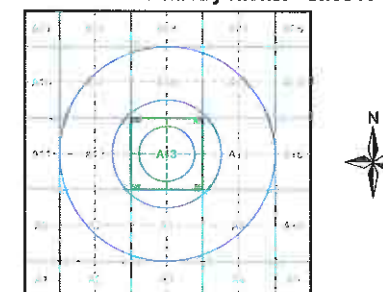

Order Details

Order Details: 284497305_1_1
Customer Ref: 21966
National Grid Reference: 388010, 396690
Slice: A
Site Area (Ha): 0.03
Search buffer (m): 1000

Site Details

Land at Barrington Street, MANCHESTER, M11 4FB

Landmark[®]
INFORMATION GROUP

Tel: 0844 844 8952
Fax: 0844 844 8951
Web: www.envirocheck.co.uk

APPENDIX E

Coal Mining Report



The Coal
Authority

CON29M

coal mining report

LAND AT BARRINGTON STREET, MANCHESTER, LANCASHIRE, M11 4FB



Known or potential coal mining risks

Past underground coal mining	Page 3
Future underground coal mining	Page 3
Withdrawal of support	Page 5



Further action

No further reports from the Coal Authority are required. Further information on any next steps can be found in our Professional opinion.

For more information on our reports please visit
www.groundstability.com



Professional opinion

According to the official mining information records held by the Coal Authority at the time of this search, evidence of, or the potential for, coal mining related features have been identified. It is unlikely that these features will impact on the stability of the enquiry boundary.

Your reference: **284497305_2**
Our reference: **51002653842001**
Date: **6 September 2021**

Client name:
NLIS Hub

If you require any further assistance please
contact our experts on:
0345 762 6848
groundstability@coal.gov.uk



The Law
Society


Enquiry boundary

Key

Approximate position of enquiry boundary shown



We can confirm that the location is
on the coalfield

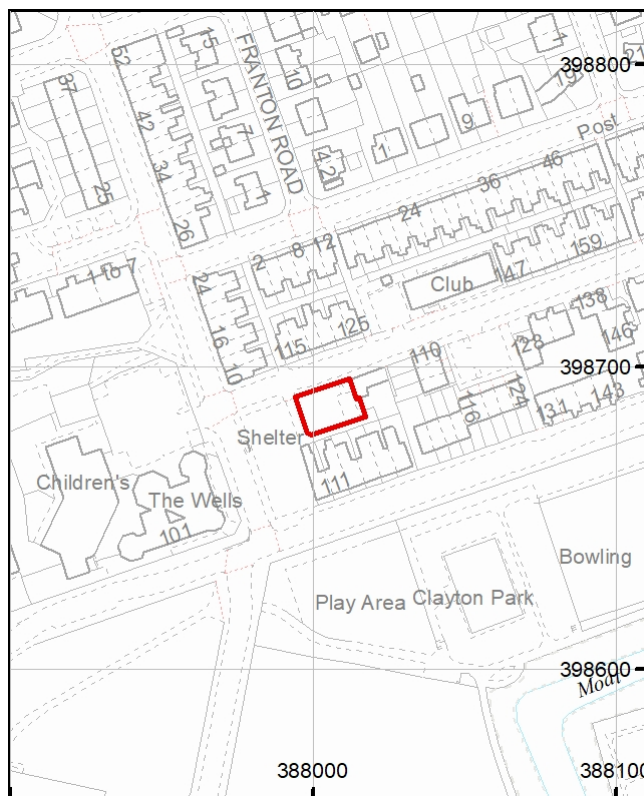

Reproduced by permission of Ordnance Survey on behalf of HMSO. © Crown copyright and database right 2018. All rights reserved.
Ordnance Survey Licence number: 100020315.

This report is prepared in accordance with the latest Law Society's Guidance Notes 2018, the User Guide 2018 and the Coal Authority's Terms and Conditions applicable at the time the report was produced.



Accessibility

If you would like this information in an alternative format, please contact our communications team on 0345 762 6848 or email communications@coal.gov.uk.

Detailed findings

Information provided by the Coal Authority in this report is compiled in response to the Law Society's CON29M Coal Mining enquiries. The said enquiries are protected by copyright owned by the Law Society of 113 Chancery Lane, London WC2A 1PL.

The Coal Authority owns the copyright in this report and the information used to produce this report is protected by our database rights. All rights are reserved and unauthorised use is prohibited. If we provide a report for you, this does not mean that copyright and any other rights will pass to you. However, you can use the report for your own purposes.

1 Past underground coal mining

The property is in a surface area that could be affected by underground mining in 2 seams of coal at 660m to 710m depth, and last worked in 1961.

Any movement in the ground due to coal mining activity associated with these workings should have stopped by now.

2 Present underground coal mining

The property is not within a surface area that could be affected by present underground mining.

3 Future underground coal mining

The property is not in an area where the Coal Authority has received an application for, and is currently considering whether to grant a licence to remove or work coal by underground methods.

The property is not in an area where a licence has been granted to remove or otherwise work coal using underground methods.

The property is not in an area likely to be affected from any planned future underground coal mining.

However, reserves of coal exist in the local area which could be worked at some time in the future.

No notices have been given, under section 46 of the Coal Mining Subsidence Act 1991, stating that the land is at risk of subsidence.

4 Mine entries

There are no recorded coal mine entries known to the Coal Authority within, or within 20 metres, of the boundary of the property.

5 Coal mining geology

The Coal Authority is not aware of any damage due to geological faults or other lines of weakness that have been affected by coal mining.

6 Past opencast coal mining

The property is not within the boundary of an opencast site from which coal has been removed by opencast methods.

7 Present opencast coal mining

The property does not lie within 200 metres of the boundary of an opencast site from which coal is being removed by opencast methods.

8 Future opencast coal mining

There are no licence requests outstanding to remove coal by opencast methods within 800 metres of the boundary.

The property is not within 800 metres of the boundary of an opencast site for which a licence to remove coal by opencast methods has been granted.

9 Coal mining subsidence

The Coal Authority has not received a damage notice or claim for the subject property, or any property within 50 metres of the enquiry boundary, since 31 October 1994.

There is no current Stop Notice delaying the start of remedial works or repairs to the property.

The Coal Authority is not aware of any request having been made to carry out preventive works before coal is worked under section 33 of the Coal Mining Subsidence Act 1991.

10 Mine gas

The Coal Authority has no record of a mine gas emission requiring action.

11 Hazards related to coal mining

The property has not been subject to remedial works, by or on behalf of the Coal Authority, under its Emergency Surface Hazard Call Out procedures.

12 Withdrawal of support

The property is in an area where a notice to withdraw support was given in 1955.

The property is not in an area where a notice has been given under section 41 of the Coal Industry Act 1994, cancelling the entitlement to withdraw support.

13 Working facilities order

The property is not in an area where an order has been made, under the provisions of the Mines (Working Facilities and Support) Acts 1923 and 1966 or any statutory modification or amendment thereof.

14 Payments to owners of former copyhold land

The property is not in an area where a relevant notice has been published under the Coal Industry Act 1975/Coal Industry Act 1994.

Statutory cover



Coal mining subsidence

In the unlikely event of any coal mining related subsidence damage, the Coal Authority or the mine operator has a duty to take remedial action in respect of subsidence caused by the withdrawal of support from land or property in connection with lawful coal mining operations.

When the works are the responsibility of the Coal Authority, our dedicated public safety and subsidence team will manage the claim. The house or land owner ("the owner") is covered for these works under the terms of the Coal Mining Subsidence Act 1991 (as amended by the Coal Industry Act 1994). Please note, this Act does not apply where coal was worked or gotten by virtue of the grant of a gale in the Forest of Dean, or any other part of the Hundred of St. Briavels in the county of Gloucester.

If you believe your land or property is suffering from coal mining subsidence damage and you need more information on what to do next, please use the following link to our website which sets out what your rights are and what you need to consider before making a claim.

www.gov.uk/government/publications/coal-mining-subsidence-damage-notice-form



Coal mining hazards

Our public safety and subsidence team provide a 24 hour a day, 7 days a week hazard reporting service, to help protect the public from hazards caused by past coal workings, such as a mine shaft or shallow working collapse. To report any hazards please call **01623 646 333**. Further information can be found on our website: www.gov.uk/coalauthority.

Glossary



Key terms

adit - horizontal or sloped entrance to a mine

coal mining subsidence - ground movement caused by the removal of coal by underground mining

Coal Mining Subsidence Act 1991 - the Act setting out the duties of the Coal Authority to repair damage caused by coal mining subsidence

coal mining subsidence damage - damage to land, buildings or structures caused by the removal of coal by underground mining

coal seams - bed of coal of varying thickness

future opencast coal mining - a licence granted, or licence application received, by the Coal Authority to excavate coal from the surface

future underground coal mining - a licence granted, or licence application received, by the Coal Authority to excavate coal underground. Although it is unlikely, remaining coal reserves could create a possibility for future mining, which would be licensed by the Coal Authority

mine entries - collective name for shafts and adits

payments to owners of former copyhold land - historically, copyhold land gave rights to coal to the copyholder. Legislation was set up to allow others to work this coal, but they had to issue a notice and pay compensation if a copyholder came forward

shaft - vertical entry into a mine

site investigation - investigations of coal mining risks carried out with the Coal Authority's permission

stop notice - a delay to repairs because further coal mining subsidence damage may occur and it would be unwise to carry out permanent repairs

subsidence claim - a formal notice of subsidence damage to the Coal Authority since it was established on 31 October 1994

withdrawal of support - a historic notice informing landowners that the coal beneath their property was going to be worked

working facilities orders - a court order which gave permission, restricted or prevented coal mine workings

APPENDIX F

Photographs

Land at Barrington Street, Clayton, Manchester
Photographs – September 2021



Photograph No 1: General View of the Site



Photograph No 2: View Along Southern Boundary (Looking to the West)

Land at Barrington Street, Clayton, Manchester
Photographs – September 2021



Photograph No 3: View Along Eastern Boundary (Looking from the South)



Photograph No 4: Fly-Tipped Material and Spoil from Adjacent Development

Land at Barrington Street, Clayton, Manchester
Photographs – September 2021



Photograph No 5: New Development to the East (Viewed from Barrington Street)



Photograph No 6: Vacant Plot to the West

APPENDIX G

Drawings



Notes

Do not scale from this drawing.

All dimensions are to be checked on site prior to construction, manufacture of any components and ordering of materials and equipment.


Any discrepancies are to be reported to the architect for clarification.

All materials and workmanship to be in accordance with the current British Standards and codes of practice.

SF to 1			
ber	Easting	Northing	Height
115	388008.864	398698.054	77.178
121	387994.294	398690.650	76.848
125	387987.412	398690.002	76.504

Rev	Date	Drawn by	Comments
Client			
Brindle & Yam Solicitors			
Project			
New Build-Land to rear 113-117 North Rd, Manchester, M11 4NE			
Drawing			
Existing Site Survey Plan			
Date	Drawn by	Scales	
AUG 2021	MK&OS GM5	1:200 @ A3	
Job No - Dwg No - Rev			
21061 - S01			

STUDIO TIAN

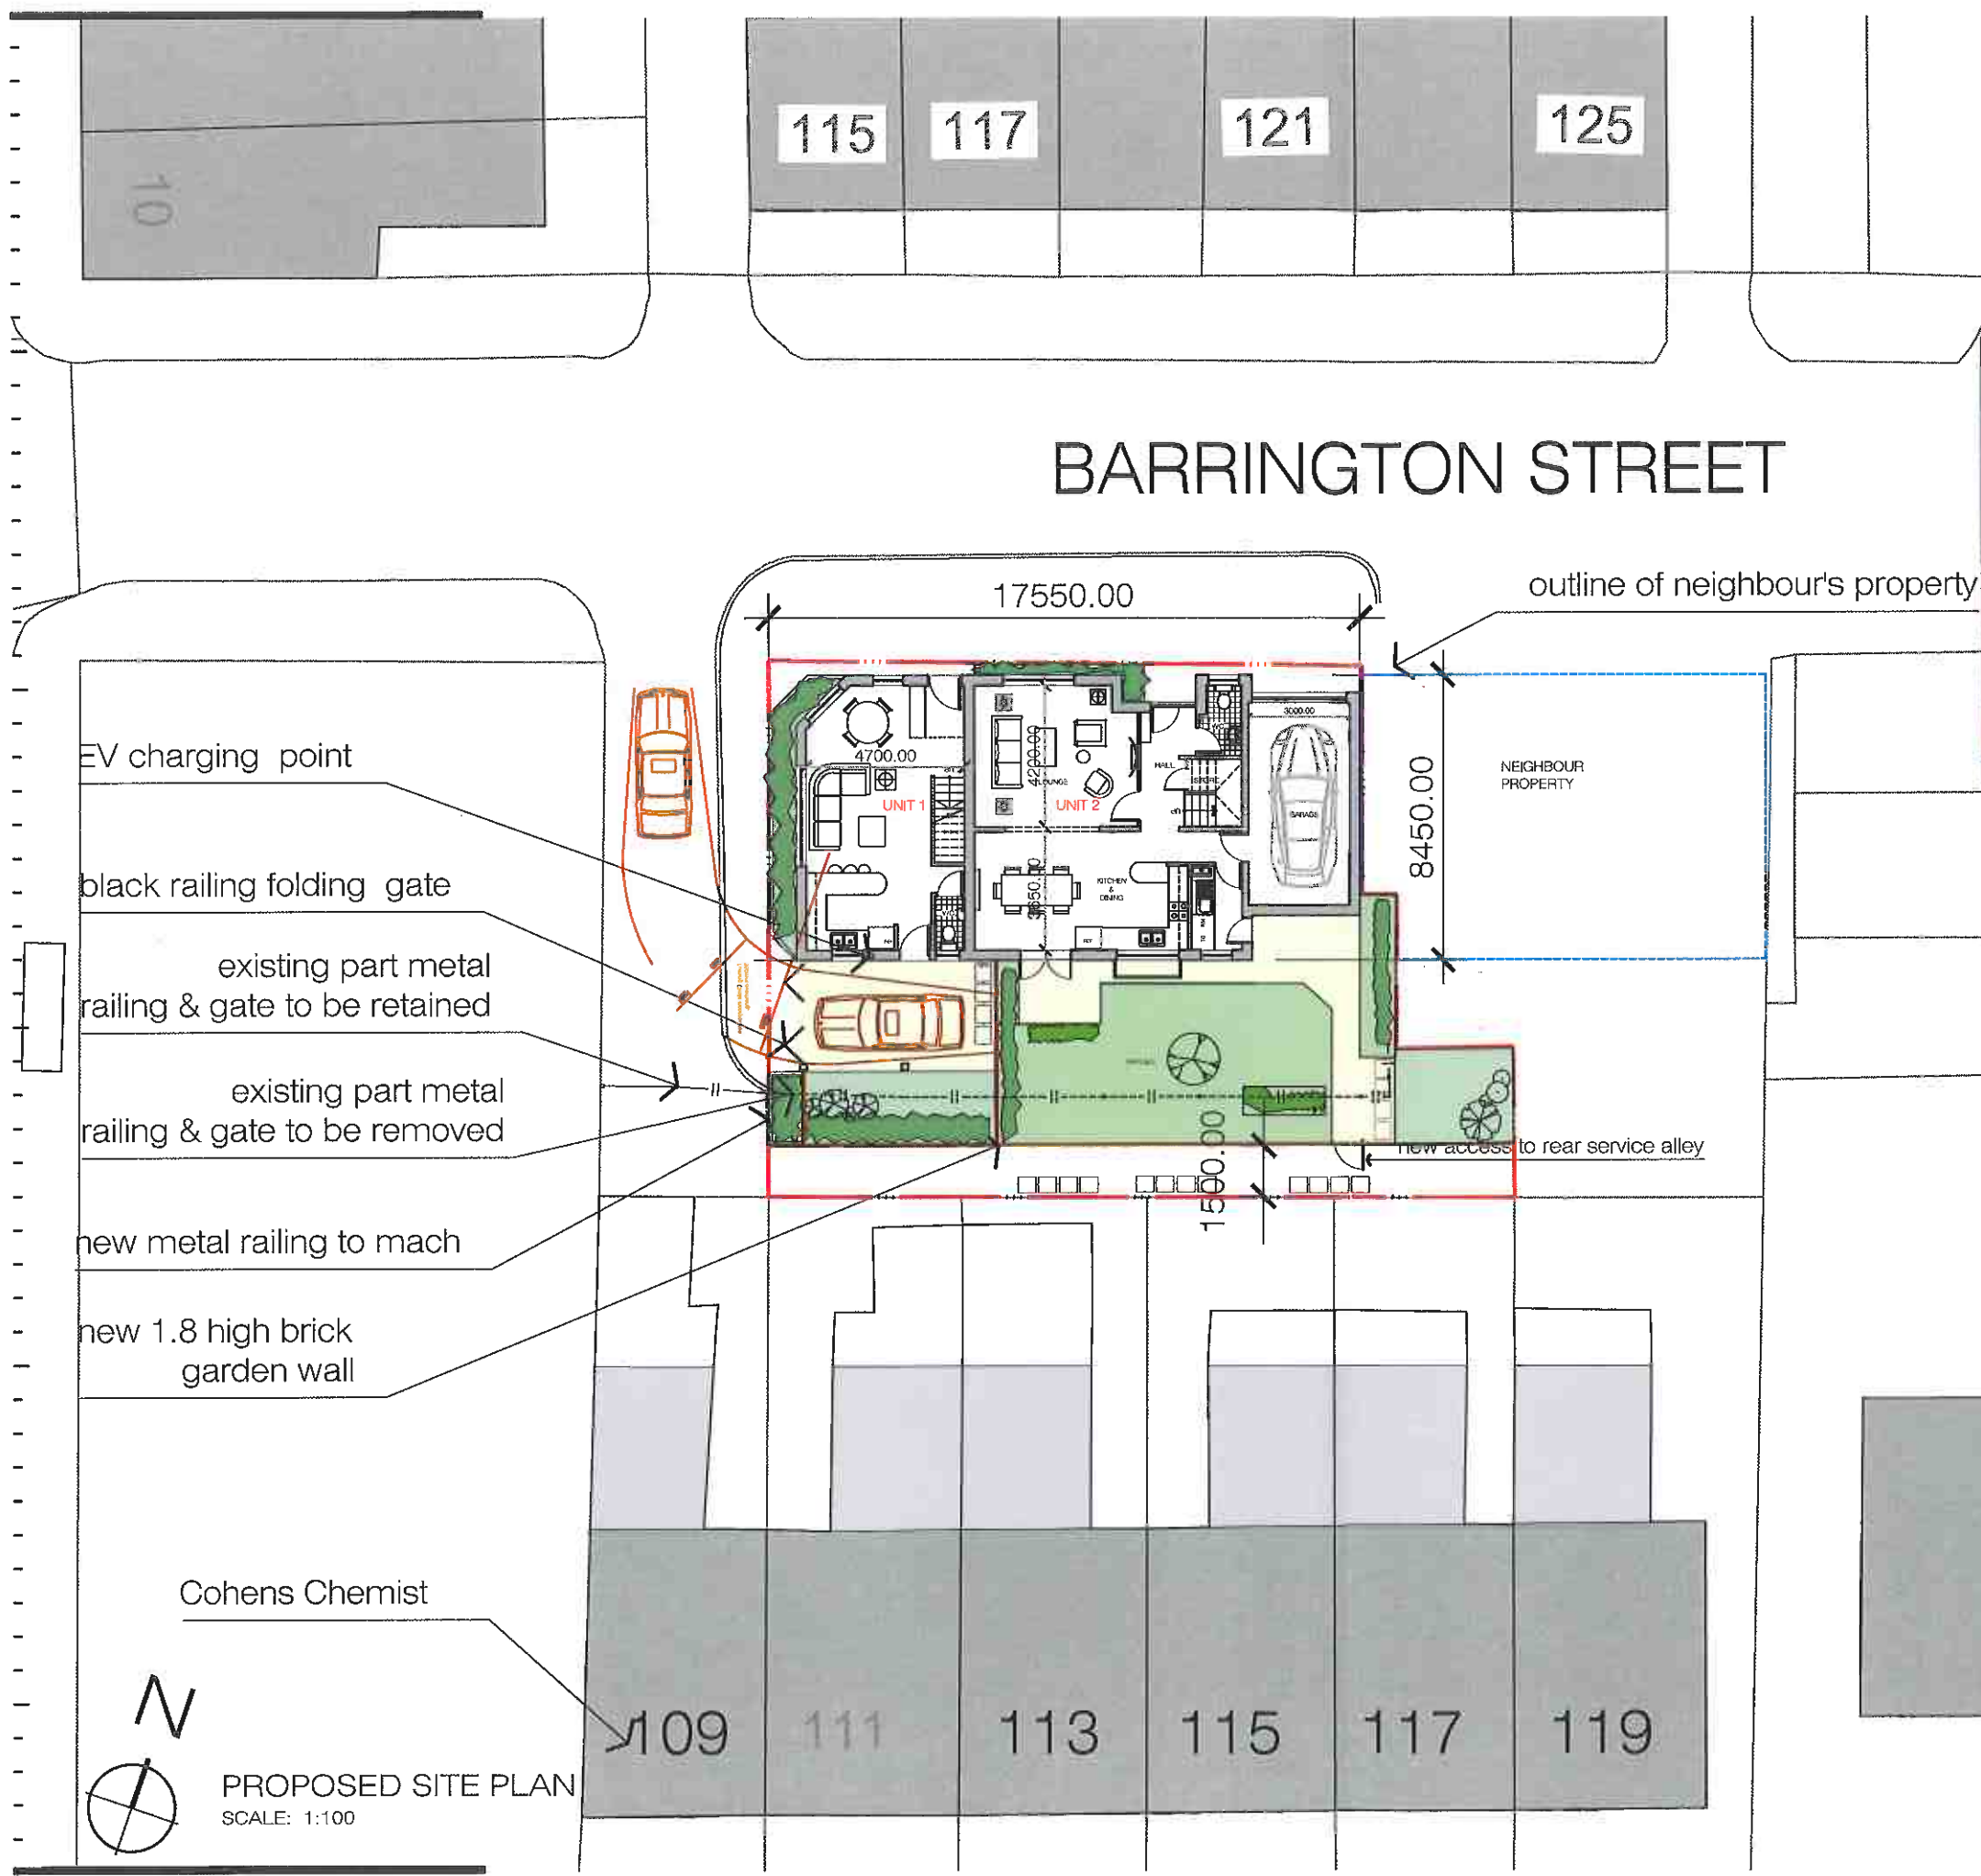

Notes

Do not scale from this drawing.

All dimensions are to be checked on site prior to construction, manufacture of any components and ordering of materials and equipment.

Any discrepancies are to be reported to the architect for clarification.

All materials and workmanship to be in accordance with the current British Standards and codes of practice.



Rev	Date	Drawn by	Comments
Client			
Brindle & Yam Solicitors			
Project			
New Build-Land to rear 113-117 North Rd, Manchester, M11 4NE			
Drawing			
PROPOSED SITE PLAN			
Date	Aug 2021	Drawn by	T Tian
Scales		1:200 @ A3	
Job No - Dwg No - Rev			
21061 - A01			

N


PROPOSED SITE PLAN

SCALE: 1:100

STUDIO TIAN



SOUTH WEST

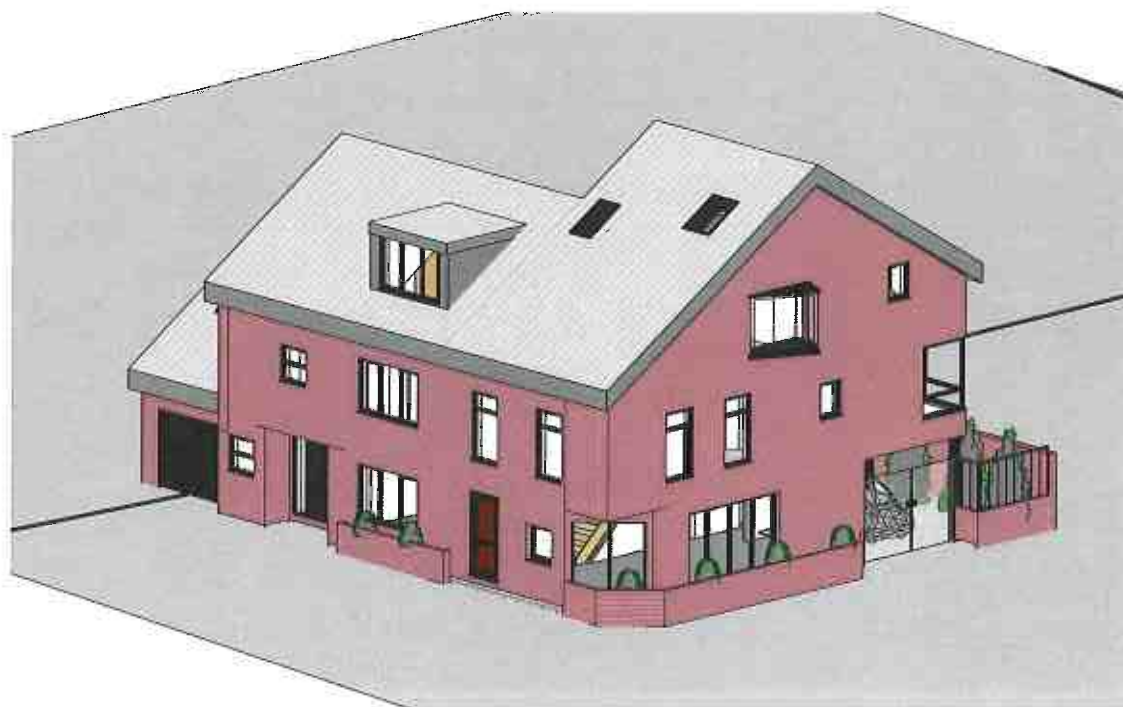

NORTH WEST



SOUTH EAST

NOTES

This drawing is the property of STUDIO TIAN and copyright is reserved by them. This drawing is not to be copied or disclosed by or to any unauthorised persons without the prior written consent of STUDIO TIAN.

Do not scale from this drawing.

All dimensions are to be checked on site prior to construction, manufacture of any components and ordering of materials and equipment.

Any discrepancies are to be reported to the architect for clarification.

All materials and workmanship to be in accordance with the current British Standards and codes of practice.

Rev	Date	Drawn by	Comments
Client			
Brindle & Yam Solicitors			
Project			
New Build-Land to rear 113-117 North Rd, Manchester, M11 4NE			
Drawings			
Planning-	Proposed Houses-3D Models		
Date	Drawn by	Scale	
Aug 2021	T Tian	@A3	
Job No - Dwg No - Rev			
21061-A05			

STUDIO TIAN
ARCHITECTURE & PLANNING

THE ARLEY CONSULTING COMPANY LIMITED

Chorleian House
49-51 St Thomas's Road
Chorley, Lancashire, PR7 1JE

Tel: 01257 278300
Fax: 01257 268063
Email: mailbox@taccl.co.uk