

Room Reference	Element	Description	Significance	Action	Photographs		
1.86	Wall Finish(es)	Paint	None	Remove flaking paint			
	Ceiling Finish	N/A	N/A	Ceiling removed Approx. 4m2 of plaster missing			
	Floor Finish	Red clay tile	Low	Retain			
	Fixtures & Fittings	Urinal Soap dispenser Cistern brackets Timber board	None None None None	Remove all			
	M&E Items	Waste pipe Misc. cable Water pipes	None None None	Remove all			

Room Reference	Element	Description	Significance	Action	Photographs		
1.87	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Paint	Low	Remove flaking paint Approx. 15m2 of plaster missing			
	Floor Finish	Adhesive and carpet over Wood block	None / None / High	Remove adhesive and carpet, retain Wood block			
	Fixtures & Fittings	Fireman's pole and cupboard Radiator brackets Ventilation grill	High Low Low	Retain Remove Retain			
	M&E Items	Heating pipes Conduit Switches Misc. electrical items Light Plug sockets Fire alarm	Low None None None None None Low	Remove all			

Room Reference	Element	Description	Significance	Action	Photographs		
1.88	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Paint	Low	Remove flaking paint Approx. 1m2 of missing plaster			
	Floor Finish	Red clay tile	Low	Retain			
	Fixtures & Fittings	Ventilation grill	Low	Retain			
	M&E Items	Light Conduit Switch Heating pipes Misc. cables	None None None Low None	Remove all			

Room Reference	Element	Description	Significance	Action	Photographs		
1.89	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Paint	Low	Remove flaking paint Approx. 1m2 of missing plaster			
	Floor Finish	Carpet and adhesive over Wood block	None / none / high	Remove carpet and adhesive, retain Wood block			
	Fixtures & Fittings						
	M&E Items	Heating pipes Plug socket Speaker Light Conduit Switch	Low None Low None None None	Remove Remove Retain / relocate Remove Remove Remove	 		

Room Reference	Element	Description	Significance	Action	Photographs		
1.90	Wall Finish(es)	Wallpaper Paint	None None	Remove Remove flaking paint			
	Ceiling Finish	Paint	None	Remove flaking paint Approx 2m2 of plaster missing			
	Floor Finish	Adhesive over Wood block Red clay tile	None / High Low	Remove adhesive and retain Wood block Retain			
	Fixtures & Fittings	Soap dispenser Mirror Speaker Ventilation grill	None None Low Low	Remove Remove Retain / relocate Retain			
	M&E Items	Light Conduit Switches Plug socket	None None None None	Remove all			

Room Reference	Element	Description	Significance	Action	Photographs		
1.91	Wall Finish(es)	Paint	None	Remove flaking paint			
	Ceiling Finish	Paint	None	Remove flaking paint Approx. 3m2 of plaster missing			
	Floor Finish	Red clay tile	Low	Retain			
	Fixtures & Fittings	Mirrors Battens Fixings Speaker Ventilation grill Cistern brackets Timber board and hooks Toilet roll holder	None None None Low Low None None None	Remove Remove Remove Retain / relocate Retain Remove Remove Remove			
	M&E Items	Misc. cables Conduit Lights Radiator Heating pipes	None None None None None	Remove all			

Room Reference	Element	Description	Significance	Action	Photographs		
1.92	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Paint	Low	Remove flaking paint Approx. 10m2 of plaster missing			
	Floor Finish	Adhesive and carpet over Wood block	None / None / High	Remove adhesive and carpet, retain Wood block			
	Fixtures & Fittings	Fireman's pole and cupboard Radiator brackets Ventilation grill	High Low Low	Retain Remove Retain			
	M&E Items	Heating pipes Conduit Switches Misc. electrical items Light Plug sockets Fire alarm	Low None None None None None Low	Remove all			

Room Reference	Element	Description	Significance	Action	Photographs		
1.93	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Paint	Low	Remove flaking paint Approx. 4m2 of plaster missing			
	Floor Finish	Adhesive over Wood block	None / high	Remove adhesive and retain Wood block			
	Fixtures & Fittings	Ventilation grills	Low	Retain			
	M&E Items	Radiators Heating pipes Light Conduit Switches Plug sockets	None None None None None None	Remove all			

Room Reference	Element	Description	Significance	Action	Photographs		
1.94	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Ceiling paper	None	Remove Approx. 0.5m2 of plaster missing			
	Floor Finish	Adhesive over Wood block	None / high	Remove adhesive and retain Wood block			
	Fixtures & Fittings	Battens	None	Remove			
	M&E Items	Switch Conduit	None None	Remove			

Room Reference	Element	Description	Significance	Action	Photographs		
1.95	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Ceiling paper	None	Remove Approx. 3m2 of plaster missing			
	Floor Finish	Carpet and adhesive over Wood block	None / none / high	Remove carpet and adhesive, retain Wood block			
	Fixtures & Fittings						
	M&E Items	Plug sockets Switches Light	None None None	Remove all			

Room Reference	Element	Description	Significance	Action	Photographs		
1.96	Wall Finish(es)	Paint	Low	Remove flaking paint			
	Ceiling Finish	Paint	Low	Remove flaking paint Approx. 1m2 of plaster missing			
	Floor Finish	Wood block (lifted)	High	Retain			
	Fixtures & Fittings	Cupboard and shelves	Low	Remove			
	M&E Items	Modern light switch Conduit Misc. cables Plug sockets	None None None None	Remove all			

Room Reference	Element	Description	Significance	Action	Photographs		
1.97	Wall Finish(es)	White tile Wallpaper Paint	None None Low	Remove Remove Remove flaking paint			
	Ceiling Finish	Paint	Low	Remove flaking paint Approx. 1m2 of plaster missing			
	Floor Finish	Wood block (lifted)	High	Retain			
	Fixtures & Fittings	Batten Timber boards Soap dispenser	None None None	Remove Remove Remove			
	M&E Items	Water pipes Switch Conduit Light Misc. cables	None None None None None	Remove all			

Room Reference	Element	Description	Significance	Action	Photographs		
1.98	Wall Finish(es)	Paint	Low	Remove flaking paint			
	Ceiling Finish	Paint	Low	Remove flaking paint Approx. 4m2 of plaster missing			
	Floor Finish	Wood block Glazed tile	High Low	Retain Retain			
	Fixtures & Fittings						
	M&E Items	Modern light Conduit Misc. electrical items	None None None	Remove all			

Room Reference	Element	Description	Significance	Action	Photographs		
1.99	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Paint	Low	Remove flaking paint Approx. 10m2 of plaster missing			
	Floor Finish	Wood block (lifted) Glazed tile	High Low	Retain Retain			
	Fixtures & Fittings						
	M&E Items	Early light switch Conduit Modern light	Low None None	Retain / re-use Remove Remove			

Room Reference	Element	Description	Significance	Action	Photographs		
1.100	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Paint	Low	Remove flaking paint Approx. 3m2 of plaster missing			
	Floor Finish	Red clay tile	Low	Retain			
	Fixtures & Fittings						
	M&E Items	Modern light Conduit Plug socket Misc. cables	None None None None	Remove all			

Room Reference	Element	Description	Significance	Action	Photographs		
1.101	Wall Finish(es)	Paint	Low	Remove flaking paint			
	Ceiling Finish	Paint	Low	Remove flaking paint			
	Floor Finish	Vinyl over red clay tile	None / low	Remove vinyl and retain red clay tile			
	Fixtures & Fittings	Shelf Battens	None None	Remove all			
	M&E Items	Light Early switch Conduit / cable	None Low None	Remove Retain for re-use if possible Remove			

Room Reference	Element	Description	Significance	Action	Photographs		
1.102	Wall Finish(es)	Paint White tile	Low None	Remove flaking paint Remove white tile			
	Ceiling Finish	Paint	Low	Remove flaking paint			
	Floor Finish	Vinyl over red clay tile	None / low	Remove vinyl and retain red clay tile			
	Fixtures & Fittings	Toilet roll holder Shelf bracket Timber boards	None None None	Remove all			
	M&E Items	Early light switch Conduit Light	Low None None	Re-use if possible Remove Remove			

Room Reference	Element	Description	Significance	Action	Photographs		
1.103	Wall Finish(es)	Paint Wallpaper	Low None	Remove flaking paint Remove			
	Ceiling Finish	Paint	Low	Remove flaking paint			
	Floor Finish	Floor tile	None	Remove			
	Fixtures & Fittings						
	M&E Items						

Room Reference	Element	Description	Significance	Action	Photographs		
1.104	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Paint	Low	Remove flaking paint			
	Floor Finish	Wood block	High	Retain			
	Fixtures & Fittings						
	M&E Items	Light switch Conduit Lights Misc. electrical items	None None None None	Remove all			

Room Reference	Element	Description	Significance	Action	Photographs		
1.105	Wall Finish(es)	Paint	Low	Remove flaking paint			
	Ceiling Finish	Paint	Low	Remove flaking paint			
	Floor Finish	Wood block	High	Retain			
	Fixtures & Fittings						
	M&E Items	Light switch Conduit Light Heating pipe	None None None Low	Remove all			

Room Reference	Element	Description	Significance	Action	Photographs		
1.106	Wall Finish(es)	Paint	Low	Remove flaking paint			
	Ceiling Finish	Paint	Low	Remove flaking paint Approx. 1m2 of plaster missing			
	Floor Finish	Red clay tile	Low	Retain			
	Fixtures & Fittings	Timber mounts Shelf brackets	None None	Remove Remove			
	M&E Items	Misc. electrical items Modern light Conduit Misc. cables Misc. gas pipes	None None None None Low	Remove all			

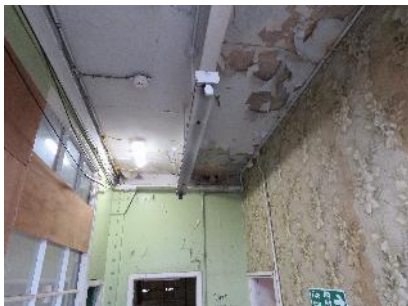
Room Reference	Element	Description	Significance	Action	Photographs		
1.107	Wall Finish(es)	Paint	None	Remove			
	Ceiling Finish	Paint	None	Remove flaking paint Approx. 4m2 of plaster missing			
	Floor Finish	Carpet over wood block	None / High	Remove carpet and adhesive, retain wood block			
	Fixtures & Fittings	Staircase and balustrade	High	Retain			
	M&E Items	Misc. electrical items Modern light Conduit Misc. cables	None None None None	Remove all			

Room Reference	Element	Description	Significance	Action	Photographs		
1.108	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Paint	Low	Remove flaking paint			
	Floor Finish	Wood block	High	Retain			
	Fixtures & Fittings	Staircase and balustrade	High	Retain			
	M&E Items	Misc. electrical items Modern light Conduit Misc. cables Misc. gas pipes	None None None None Low	Remove all			

Room Reference	Element	Description	Significance	Action	Photographs		
1.109	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Paint	Low	Remove flaking paint Approx. 2m2 of plaster missing			
	Floor Finish	Wood block (lifted)	High	Retain			
	Fixtures & Fittings	Staircase and balustrade	High	Retain			
	M&E Items	Misc. electrical items Modern light Light switches Conduit Misc. cables Misc. gas pipes	None None Low None None Low	Remove all			

Room Reference	Element	Description	Significance	Action	Photographs		
1.110	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Paint	None	Remove flaking paint Approx. 3m2 of plaster missing			
	Floor Finish	Red clay tile	Low	Retain			
	Fixtures & Fittings	Timber boards	None	Remove			
	M&E Items	Gas pipe Switch Conduit Light Socket Fuseboard Misc. cables	Low None None None None None None	Remove all			

Room Reference	Element	Description	Significance	Action	Photographs		
1.111	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Ceiling paper Paint	None None	Remove Remove flaking paint Approx. 1m2 of plaster missing			
	Floor Finish	Carpet tile and adhesive over red clay tile	None / Low	Remove carpet and adhesive, retain tile			
	Fixtures & Fittings						
	M&E Items	Misc. electrical items Gas pipe	None Low	Remove all			

Room Reference	Element	Description	Significance	Action	Photographs		
1.112	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Paint	Low	Remove flaking paint			
	Floor Finish	Vinyl Carpet	None None	Remove Remove			
	Fixtures & Fittings	Timber mounting brackets for fire extinguishers	None	Remove			
	M&E Items	Heating pipes Switch Conduit Light Fire alarm Smoke detector	Low None None None None None	Remove all			

Room Reference	Element	Description	Significance	Action	Photographs		
1.113	Wall Finish(es)	Paint	None	Remove flaking paint			
	Ceiling Finish	Paint	None	Remove flaking paint			
	Floor Finish	Timber floorboards	High	Retain			
	Fixtures & Fittings	Staircase Timber cupboard Signalling box	High None Medium	Retain Remove Relocate			
	M&E Items	Large tank Misc. telephone wires and junction box Gas pipe and lamp outlet	Medium None Low	Remove Remove all Remove pipe and retain outlet			

Room Reference	Element	Description	Significance	Action	Photographs		
1.114	Wall Finish(es)	Painted glazed brick Plyboard to lift shaft	None / High None	Remove paint and retain glazed brick Remove			
	Ceiling Finish	Paint	Low	Remove flaking paint			
	Floor Finish	Terrazzo tile Floor paint	Medium None	Retain Remove			
	Fixtures & Fittings	Timber hand rail Lift door Hose pipe outlet	Medium Medium High	Retain Retain Retain			
	M&E Items	Misc. conduit Misc. electrical items Misc. cables Fire hose pipe	None None None High	Remove Remove Remove Retain			

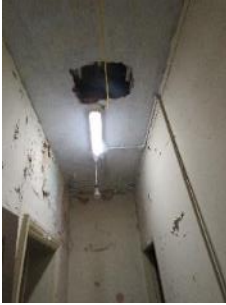
Room Reference	Element	Description	Significance	Action	Photographs		
1.115	Wall Finish(es)	Wallpaper Paint	None Low	Remove Remove flaking paint			
	Ceiling Finish	Paint	Low	Remove flaking paint Approx. 1m2 of plaster missing			
	Floor Finish	Wood block Red clay tile	High Low	Retain Retain			
	Fixtures & Fittings	Battens Shelf bracket	None None	Remove Remove			
	M&E Items	Heating pipe Brackets Switch Conduit Ceiling Light Misc. cables	Low None None None None None	Remove all			

Room Reference	Element	Description	Significance	Action	Photographs		
1.116	Wall Finish(es)	Paint	Low	Remove flaking paint			
	Ceiling Finish	Paint	Low	Remove flaking paint Approx. 1m2 of plaster missing			
	Floor Finish	Red clay tile	Low	Retain			
	Fixtures & Fittings	Shelf Brackets Curtain rail Misc. fixings	None None None None	Remove Remove Remove Remove all			
	M&E Items	Heating pipes Switches Conduit Gas pipe Plug socket Ceiling light	Low None None Low None None	Remove all			

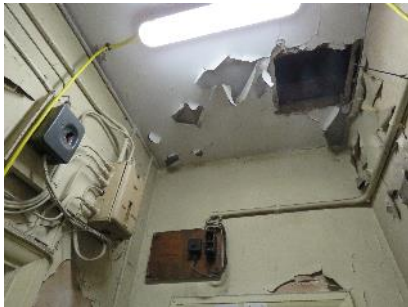
Room Reference	Element	Description	Significance	Action	Photographs		
1.117	Wall Finish(es)	Paint	Low	Remove flaking paint			
	Ceiling Finish	Paint	Low	Remove flaking paint Approx. 1m2 of plaster missing			
	Floor Finish	Wood block	High	Retain			
	Fixtures & Fittings	Staircase and balustrade	High	Retain			
	M&E Items	Heating pipe Light switch Light	Low None None	Remove all			

Room Reference	Element	Description	Significance	Action	Photographs		
1.118	Wall Finish(es)	Paint Wallpaper	Low None	Remove flaking paint Remove			
	Ceiling Finish	Paint	Low	Remove flaking paint			
	Floor Finish	Wood block	High	Retain			
	Fixtures & Fittings						
	M&E Items	Heating pipe Light	Low None	Remove all			

Room Reference	Element	Description	Significance	Action	Photographs		
1.119	Wall Finish(es)	Paint White tile (non-original)	Low None	Remove flaking paint Remove white tile			
	Ceiling Finish	Ceiling Paper	None	Remove			
	Floor Finish	Red clay tile	Low	Retain			
	Fixtures & Fittings	Urinal Soap dispenser Mirror Timber mounting battens	None None None None	Remove all			
	M&E Items	Water pipe Conduit Switch	None None None	Remove all			

Room Reference	Element	Description	Significance	Action	Photographs		
1.120	Wall Finish(es)	Paint	Low	Remove flaking paint			
	Ceiling Finish	Paint	Low	Remove flaking paint			
	Floor Finish	Red clay tile	Low	Retain			
	Fixtures & Fittings						
	M&E Items	Light Conduit	None None	Remove all			

Room Reference	Element	Description	Significance	Action	Photographs		
1.121	Wall Finish(es)	Paint	Low	Remove flaking paint			
	Ceiling Finish	Paint	Low	Remove flaking paint			
	Floor Finish	Red clay tile	Low	Retain			
	Fixtures & Fittings	Boxing in	None	Remove			
	M&E Items	Switch Cable Light	None None None	Remove all			

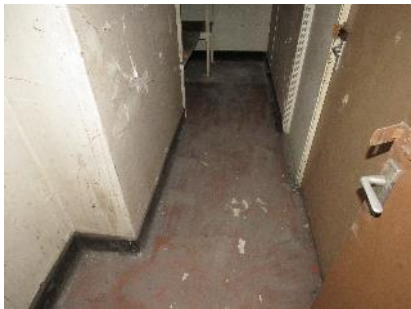
Room Reference	Element	Description	Significance	Action	Photographs		
1.122	Wall Finish(es)	Paint	Low	Remove flaking paint			
	Ceiling Finish	Paint	Low	Remove flaking paint Approx. 1m2 of plaster missing			
	Floor Finish	Vinyl	None	Remove			
	Fixtures & Fittings	Timber mounting boards Brackets	None None	Remove Remove			
	M&E Items	Gas pipes Conduit Misc. electrical items Switch	Low None None None	Remove all	 		

Room Reference	Element	Description	Significance	Action	Photographs		
1.123	Wall Finish(es)	Paint	Low	Remove flaking paint			
	Ceiling Finish	Paint	Low	Remove flaking paint			
	Floor Finish	Carpet	None	Remove			
	Fixtures & Fittings	Misc. timber boards Hooks to beam	None Low	Remove Retain			
	M&E Items	Misc. electrical items Telephone wires Gas pipe	None None Low	Remove all			

Room Reference	Element	Description	Significance	Action	Photographs		
1.124	Wall Finish(es)	Paint	Low	Remove flaking paint			
	Ceiling Finish	Paint	Low	Remove flaking paint Approx. 1m2 of plaster missing			
	Floor Finish	Red clay tile	Low	Retain			
	Fixtures & Fittings	Batten	None	Remove			
	M&E Items	Conduit Light Misc. electrical items	None None None	Remove all			

Room Reference	Element	Description	Significance	Action	Photographs		
1.125	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Paint	Low	Remove flaking paint Approx. 3m2 of plaster missing			
	Floor Finish	Adhesive and carpet over Wood block	None / None / High	Remove adhesive and carpet, retain Wood block			
	Fixtures & Fittings	Fireman's pole and cupboard Radiator brackets Ventilation grill	High Low Low	Retain Remove Retain	 		
	M&E Items	Heating pipes Conduit Switches Misc. electrical items Light Plug sockets Fire alarm	Low None None None None None Low	Remove all			

Room Reference	Element	Description	Significance	Action	Photographs		
1.126	Wall Finish(es)	Paint	Low	Remove flaking paint			
	Ceiling Finish	Paint	Low	Remove flaking paint Approx. 1m2 of plaster missing			
	Floor Finish	Red clay tile	Low	Retain			
	Fixtures & Fittings						
	M&E Items	Switch Conduit Light	None None None	Remove all			

Room Reference	Element	Description	Significance	Action	Photographs		
1.127	Wall Finish(es)	Paint	Low	Remove flaking paint			
	Ceiling Finish	Paint	Low	Remove flaking paint Approx. 2m2 of plaster missing			
	Floor Finish	Red clay tile	Low	Retain			
	Fixtures & Fittings	Shelving Ventilation grill	None Low	Remove Remove			
	M&E Items	Switch Conduit Light Gas pipe	None None None Low	Remove all			

Room Reference	Element	Description	Significance	Action	Photographs		
1.128	Wall Finish(es)	White tile Wallpaper	None None	Remove Remove			
	Ceiling Finish	Paint	Low	Remove flaking paint Approx. 2m2 of plaster missing			
	Floor Finish	Red clay tile	Low	Retain			
	Fixtures & Fittings	Glass screen Dishwasher unit No smoking sign Battens Towel rail Cistern and sink brackets Shelf	None None None None None None None	Remove all			
	M&E Items	Misc. electrical items Modern lights Ventilation ductwork and filter Switches Conduit Waste pipe	None None None None None None	Remove all			

Room Reference	Element	Description	Significance	Action	Photographs		
1.129	Wall Finish(es)	Paint	Low	Remove flaking paint			
	Ceiling Finish	Paint	Low	Remove flaking paint			
	Floor Finish	Red clay tile	Low	Retain			
	Fixtures & Fittings	Battens Misc. pipe fixings	None None	Remove all			
	M&E Items	Heating pipe Fuse box	Low None	Remove all			

Room Reference	Element	Description	Significance	Action	Photographs		
1.130	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Paint	Low	Remove flaking paint			
	Floor Finish	Vinyl over wood block	None/ high	Remove vinyl and retain wood block			
	Fixtures & Fittings	Batten	None	Remove			
	M&E Items	Heating pipes Early switch Conduit Light Double socket Misc. cables	Low Low None None None None	Remove all			

Room Reference	Element	Description	Significance	Action	Photographs		
1.131	Wall Finish(es)	Glazed brick	High	Retain			
	Ceiling Finish	Paint	Low	Remove flaking paint			
	Floor Finish	Exposed concrete Concrete steps	N/A High	N/A Retain			
	Fixtures & Fittings	Staircase balustrade	High	Retain			
	M&E Items	Misc. pipes Misc. electrical items Misc. wires / cables Light switch Conduit Light	Low None None None None None	Remove all			

SECOND FLOOR – ROOM SCHEDULE

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.01	Wall Finish(es)	Paint	Low	Remove flaking paint			
	Ceiling Finish	Paint	Low	Remove flaking paint Approx. 1m2 of plaster missing			
	Floor Finish	Wood block Glazed tile	High Low	Retain Retain			
	Fixtures & Fittings						
	M&E Items	Misc. wires Light switch Conduit Light Plug Socket	None None None None None	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.02	Wall Finish(es)	Paint	Low	Remove flaking paint			
	Ceiling Finish	Paint	Low	Remove flaking paint Approx. 15m2 of plaster missing			
	Floor Finish	Wood block (lifted) Glazed tile	High Low	Retain Retain			
	Fixtures & Fittings	Fireplace	High	Retain			
	M&E Items	Misc. wires Light switch Conduit Light	None None None None	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.03	Wall Finish(es)	Paint	Low	Remove flaking paint			
	Ceiling Finish	Paint	Low	Remove flaking paint Approx. 6m2 of plaster missing			
	Floor Finish	Red clay tile	Low	Retain			
	Fixtures & Fittings	Timber conduit Battens Timber boards	Low None Low	Remove all			
	M&E Items	Conduit Light	None None	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.04	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Paint	Low	Remove flaking paint Approx. 10m2 of plaster missing			
	Floor Finish	Red clay tile	Low	Retain			
	Fixtures & Fittings	Timber boards Raised hearth	Low None	Remove Remove			
	M&E Items	Conduit Light	None None	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.05	Wall Finish(es)	Paint White Tile	Low None	Remove flaking paint Remove			
	Ceiling Finish	Paint	Low	Remove flaking paint			
	Floor Finish	Red clay tile	Low	Retain			
	Fixtures & Fittings	Shelf Batten	None None	Remove Remove			
	M&E Items	Gas pipe Plug socket Conduit Light	Low None None None	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.06	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Ceiling paper	None	Remove Approx. 1m2 of plaster missing			
	Floor Finish	Wood block	High	Retain			
	Fixtures & Fittings	Modern fireplace	None	Remove			
	M&E Items	Conduit Light Misc. cables Plug socket	None None None None	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.07	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Ceiling paper	None	Remove Approx. 2m2 of plaster missing			
	Floor Finish	Wood block Glazed tile	High Low	Retain Retain			
	Fixtures & Fittings	Timber boards (boxing in) Battens Cupboards	None None Low	Remove Remove Remove			
	M&E Items	Conduit Light switch mount Light	None None None	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.08	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Ceiling paper	None	Remove Approx. 8m2 of plaster missing			
	Floor Finish	Floor tile over Wood block	None / High	Remove floor tile and retain Wood block			
	Fixtures & Fittings	Timber boards Boxing in	None None	Remove Remove			
	M&E Items	Conduit	None	Remove			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.09	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Paint Ceiling paper	Low None	Remove flaking paint Remove			
	Floor Finish	Wood block	High	Retain			
	Fixtures & Fittings						
	M&E Items	Plug socket Early light switch Conduit Modern light	None Low None None	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.10	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Paint	Low	Remove flaking paint Approx. 2m2 of plaster missing			
	Floor Finish	Wood block Glazed tile	High Low	Retain Retain			
	Fixtures & Fittings	Fireplace	High	Retain			
	M&E Items	Light switch Conduit Light Double plug socket Misc. cables	None None None None None	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.11	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Ceiling paper	None	Remove Approx. 1m2 of plaster missing			
	Floor Finish	Wood block Glazed tile	High Low	Retain Retain			
	Fixtures & Fittings	Curtain rail Fireplace	None High	Remove Retain			
	M&E Items	Light switch Conduit Light	None None None	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.12	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Paint	Low	Remove flaking paint			
	Floor Finish	Wood block (lifted)	High	Retain			
	Fixtures & Fittings	Hooks	None	Remove			
	M&E Items	Misc. electrical items Early light switches Conduit	None Low None	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.13	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Paint	Low	Remove flaking paint			
	Floor Finish	Floor tile over Wood block	None / high	Remove floor tile and retain Wood block			
	Fixtures & Fittings	Timber boards	Low	Remove			
	M&E Items	Conduit Light	None None	Remove Remove			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.14	Wall Finish(es)	Wallpaper White tile	None None	Remove Remove			
	Ceiling Finish	Ceiling paper	None	Remove			
	Floor Finish	Wood block	High	Retain			
	Fixtures & Fittings	Timber boards	Low	Remove			
	M&E Items	Conduit Light	None None	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.15	Wall Finish(es)	Wallpaper White tile	None None	Remove Remove			
	Ceiling Finish	Paint	Low	Remove flaking paint Approx. 5m2 of plaster missing			
	Floor Finish	Wood block (lifted)	High	Retain			
	Fixtures & Fittings	Timber boards Early built in fridge	Low Medium	Remove Retain			
	M&E Items	Light switch Conduit Plug socket	None None None	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.16	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Paint	Low	Remove flaking paint Approx. 2m2 of plaster missing			
	Floor Finish	Wood block Glazed tile	High Low	Retain Retain			
	Fixtures & Fittings	Fireplace	High	Retain			
	M&E Items	Light switch mount Conduit	Low None	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.17	Wall Finish(es)	Wallpaper (largely removed) White tile	None None	Remove Remove			
	Ceiling Finish	Paint	Low	Remove flaking paint Approx 1m2 of plaster missing			
	Floor Finish	Wood block Glazed tile	High Low	Retain Retain			
	Fixtures & Fittings	Timber batten	None	Remove all			
	M&E Items	Early light switch Conduit Light Plug socket Misc. cable	Low None None None None	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.18	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Paint	Low	Remove flaking paint Approx. 10m2 of plaster missing			
	Floor Finish	Wood block Glazed tile	High Low	Retain Retain			
	Fixtures & Fittings						
	M&E Items	Early light switch Conduit Light Plug socket Misc. cable	Low None None None None	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.19	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Paint	Low	Remove flaking paint Approx. 10m2 of plaster missing			
	Floor Finish	Red lay tile	Low	Retain			
	Fixtures & Fittings	Timber switch mount	Low	Remove			
	M&E Items	Early light switch Conduit Plug socket Misc. cable	Low None None None	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.20	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Paint	Low	Remove flaking paint Approx. 1m2 of plaster missing			
	Floor Finish	Red lay tile	Low	Retain			
	Fixtures & Fittings	Timber boards	Low	Remove			
	M&E Items	Conduit Sockets Misc. electrical items Gas pipe	None None None Low	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.21	Wall Finish(es)	Wallpaper White tile	None None	Remove Remove			
	Ceiling Finish	Ceiling paper Paint	None Low	Remove Remove flaking paint			
	Floor Finish	Floor tile	None	Remove			
	Fixtures & Fittings	Timber boxing in Timber boards	None None	Remove Remove			
	M&E Items	Light Conduit Sockets Misc. wires	None None None None	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.22	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Paint	Low	Remove flaking paint Approx. 6m2 of plaster missing			
	Floor Finish	Red lay tile	Low	Retain			
	Fixtures & Fittings						
	M&E Items	Conduit Light	None None	Remove Remove			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.23	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Ceiling paper	None	Remove Approx. 1m2 of plaster missing			
	Floor Finish	Wood block	High	Retain			
	Fixtures & Fittings	Ventilation grill	Low	Retain			
	M&E Items	Light switch Plug sockets Misc. wires	None None None	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.24	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Ceiling paper	None	Remove Approx. 10m2 of plaster missing			
	Floor Finish	Wood block	High	Retain			
	Fixtures & Fittings	Ventilatin grill	Low	Retain			
	M&E Items	Light switch Conduit	None None	Remove Remove			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.25	Wall Finish(es)	Wallpaper White tile	None None	Remove Remove			
	Ceiling Finish	Paint	Low	Remove flaking paint Approx. 8m2 of plaster missing			
	Floor Finish	Raised Floor	None	Remove			
	Fixtures & Fittings						
	M&E Items	Light switch Conduit	None None	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.26	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Paint	Low	Remove flaking paint Approx. 12m2 of plaster missing			
	Floor Finish	Wood block	High	Retain			
	Fixtures & Fittings	Ventilation grill	Low	Retain			
	M&E Items	Light switch Conduit Gas pipe	None None Low	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.27	Wall Finish(es)	Wallpaper Paint	None Low	Remove Remove flaking paint			
	Ceiling Finish	Paint	Low	Remove flaking paint Approx. 2m2 of plaster missing			
	Floor Finish	Red clay tile	Low	Retain			
	Fixtures & Fittings	Timber boards	None	Remove			
	M&E Items	Modern light Conduit Misc. electrical equipment Gas pipes Sockets Wires	None None None Low None None	Remove all			

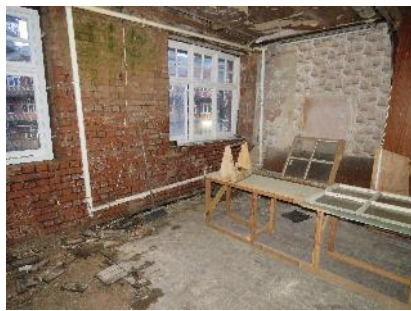
Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.28	Wall Finish(es)	Wallpaper Paint	None Low	Remove Remove flaking paint			
	Ceiling Finish	Paint	Low	Remove flaking paint Approx. 3m2 of plaster missing			
	Floor Finish	Wood block	High	Retain			
	Fixtures & Fittings						
	M&E Items	Light switch Conduit	None None	Remove Remove			

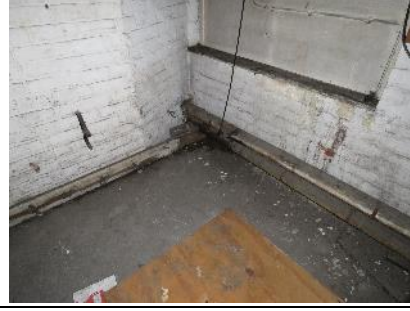
Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.29	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Paint	Low	Remove flaking paint Approx. 4m2 of plaster missing			
	Floor Finish	Wood block	High	Retain			
	Fixtures & Fittings						
	M&E Items	Modern light Plug socket Cables	None None None	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.30	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Paint	Low	Remove flaking paint Approx. 6m2 of plaster missing			
	Floor Finish	Red clay tile	Low	Retain			
	Fixtures & Fittings	Timber battens	None	Remove			
	M&E Items	2no. Vertical pipes Plug sockets Conduit Modern light Switches	Low None None None None	Retain Remove Remove Remove Remove			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.31	Wall Finish(es)	Paint	Low	Remove flaking paint			
	Ceiling Finish	Paint	Low	Remove flaking paint			
	Floor Finish	Vinyl	None	Remove			
	Fixtures & Fittings	Battens Modern hooks	None None	Remove Remove			
	M&E Items	Heating pipes Misc. electrical items Modern lighting Modern switch Conduit	Low None None None None	Remove all	 		

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.32	Wall Finish(es)	Paint	Low	Remove flaking paint			
	Ceiling Finish	Paint	Low	Remove flaking paint			
	Floor Finish	Carpet	None	Remove			
	Fixtures & Fittings	Battens Modern hooks	None None	Remove Remove			
	M&E Items	Heating pipes Misc. electrical items Modern lighting Modern switch Conduit	Low None None None None	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.33	Wall Finish(es)	Wallpaper Timber effect panels	None None	Remove Remove			
	Ceiling Finish	Ceiling paper	None	Remove			
	Floor Finish	Wood block	High	Retain			
	Fixtures & Fittings	Fixed bench seating Radiator brackets Exit sign	None None None	Remove Remove Remove			
	M&E Items	Modern lights Heating pipes Misc. cables	None Low None	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.34	Wall Finish(es)	Painted brick	None	Remove flaking paint			
	Ceiling Finish	Paint	Low	Remove flaking paint			
	Floor Finish	Carpet	None	Remove			
	Fixtures & Fittings	Timber shelves Timber battens	None None	Remove Remove			
	M&E Items	Ventilation units Plug sockets Heating pipes Modern lighting	Low None Low None	Remove all	  		

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.35	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Paint	Low	Remove flaking paint			
	Floor Finish	Wood block Entrance mat	High None	Retain Replace			
	Fixtures & Fittings	Timber battens	None	Remove			
	M&E Items	Fire alarm Ventilation unit Misc. electrical items Light Light switches	Low None None Medium None	Retain Remove Remove Retain Remove			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.36	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Paint	Low	Remove flaking paint Approx. 10m2 of plaster missing			
	Floor Finish	Wood block (partially lifted)	High	Retain			
	Fixtures & Fittings	Ceiling vent Radiator brackets Exit sign	High None None	Retain Remove Remove			
	M&E Items	Lighting Heating pipes Misc. cables Plug sockets	None Low None None	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.37	Wall Finish(es)	Paint	None	Remove flaking paint			
	Ceiling Finish	Paint	None	Remove flaking paint Approx. 3m2 of plaster missing			
	Floor Finish	Wood block Glazed tile	High Low	Retain Retain			
	Fixtures & Fittings						
	M&E Items	Heating pipes Fuse board Fuse box Lighting Switch Conduit	Low None None None None None	Remove all			

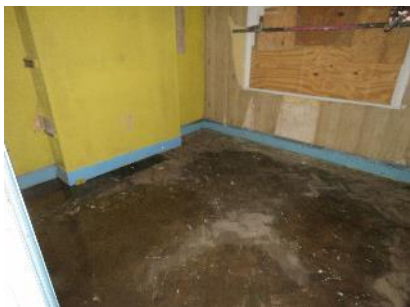
Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.38	Wall Finish(es)	Paint	None	Remove flaking paint			
	Ceiling Finish	Paint	None	Remove flaking paint Approx. 5m2 of plaster missing			
	Floor Finish	Wood block Red clay tile	High Low	Retain Retain			
	Fixtures & Fittings						
	M&E Items	Heating pipes Lighting Switch Conduit	Low None None None	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.39	Wall Finish(es)	Paint White Tile	Low None	Remove flaking paint Remove			
	Ceiling Finish	Paint	None	Remove flaking paint Approx. 6m2 of plaster missing			
	Floor Finish	Wood block Glazed tile	High Low	Retain Retain			
	Fixtures & Fittings						
	M&E Items	Heating pipes Wall light Switch Conduit Plug socket	Low None None None None	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.40	Wall Finish(es)	Paint White Tile	Low None	Remove flaking paint Remove			
	Ceiling Finish	Paint	None	Remove flaking paint Approx. 8m2 of plaster missing			
	Floor Finish	Red clay tile	Low	Retain			
	Fixtures & Fittings	Mirrors	None	Remove all			
	M&E Items	Light Conduit Plug socket Light switches	None None None None	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.41	Wall Finish(es)	Paint	Low	Remove flaking paint			
	Ceiling Finish	Paint	None	Remove flaking paint Approx. 5m2 of plaster missing			
	Floor Finish	Wood block Glazed tile	High Low	Retain Retain			
	Fixtures & Fittings	Ventilation grill Timber batten	Low None	Retain Remove			
	M&E Items	Heating pipes Plug socket Switch Conduit Light	Low None None None None	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.42	Wall Finish(es)	Paint White Tile	Low None	Remove flaking paint Remove			
	Ceiling Finish	Paint	None	Remove flaking paint Approx. 6m2 of plaster missing			
	Floor Finish	Red clay tile	Low	Retain			
	Fixtures & Fittings	Urinal Cistern brackets Mirror Timber batten	Low None None None	Remove all			
	M&E Items	Heating pipes Plug socket Switch Conduit Light Fuse box	Low None None None None None	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.43	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Paint	None	Remove flaking apint Approx. 3m2 of plaster missing			
	Floor Finish	Wood block Glazed tile	High Low	Retain Retain			
	Fixtures & Fittings	Timber batten	None	Remove			
	M&E Items	Light switch Conduit Light Plug socket Cable	None None None None None	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.44	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Paint	Low	Remove flaking paint Approx. 3m2 of plaster missing			
	Floor Finish	Red clay tile	Low	Retain			
	Fixtures & Fittings	Cistern brackets Timber boards	None None	Remove Remove			
	M&E Items	Waste pipe Conduit Light	None None None	Remove Remove Remove			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.45	Wall Finish(es)	Wallpaper Paint	None Low	Remove Remove flaking paint			
	Ceiling Finish	Paint	Low	Remove flaking paint			
	Floor Finish	Red clay tile	Low	Retain			
	Fixtures & Fittings	Shelf brackets Timber battens Timber switch mounting	None None None	Remove Remove Remove			
	M&E Items	Gas pipe Conduit Misc. wires and cables Switches Misc. electrical items Heating pipes	Low None None None None Low	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.46	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Ceiling paper	None	Remove Approx. 4m2 of plaster missing			
	Floor Finish	Red clay tile White tile	Low Low	Retain Retain			
	Fixtures & Fittings						
	M&E Items	Conduit Light	None None	Remove Remove			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.47	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Paint	Low	Remove flaking paint			
	Floor Finish	Wood block Glazed tile	High Low	Retain Retain			
	Fixtures & Fittings						
	M&E Items	Switch Conduit Light Plug socket Misc. cable	None None None None None	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.48	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Ceiling paper	None	Remove Approx. 5m2 of plaster missing			
	Floor Finish	Wood block	High	Retain			
	Fixtures & Fittings						
	M&E Items	Switch Conduit Light Plug socket	None None None None	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.49	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Paint	Low	Remove flaking paint			
	Floor Finish	Wood block	High	Retain			
	Fixtures & Fittings						
	M&E Items	Light switch Conduit Heating pipe	None None Low	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.50	Wall Finish(es)	Wall paper	None	Remove			
	Ceiling Finish	Ceiling paper	None	Remove Approx. 10m2 of plaster missing			
	Floor Finish	Wood block	High	Retain			
	Fixtures & Fittings						
	M&E Items	Switch Conduit Light Plug socket Misc. wires	None None None None None	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.51	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Paint	Low	Remove flaking paint Approx. 3m2 of plaster missing			
	Floor Finish	Wood block Glazed tile	High Low	Retain Retain			
	Fixtures & Fittings						
	M&E Items	Early switch Conduit Light Plug socket	Low None None None	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.52	Wall Finish(es)	Wallpaper White tile	None None	Remove Remove			
	Ceiling Finish	Paint	Low	Remove flaking paint Approx. 4m2 of plaster missing			
	Floor Finish	Red clay tile	Low	Retain			
	Fixtures & Fittings						
	M&E Items	Conduit Light Timber conduit	None None None	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.53	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Paint	Low	Remove flaking paint Approx. 1m2 of plaster missing			
	Floor Finish	Red clay tile	Low	Retain			
	Fixtures & Fittings	Timber boards	None	Remove			
	M&E Items	Early light switch misc. electrical items Light Conduit Gas pipe	Low None None None Low	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.54	Wall Finish(es)	Wallpaper White tile	None None	Remove Remove			
	Ceiling Finish	Paint Ceiling tile	Low None	Remove flaking paint Remove Approx. 10m2 of plaster missing			
	Floor Finish	Red clay tile	Low	Retain			
	Fixtures & Fittings	Timber boards	None	Remove			
	M&E Items	Timber conduit Conduit Gas pipe Switches Plug socket Light	None None Low None None None	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.55	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Paint	Low	Remove flaking paint Approx. 20m2 of plaster missing			
	Floor Finish	Wood block	High	Retain			
	Fixtures & Fittings						
	M&E Items	Early light switch Conduit	Low None	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.56	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Paint	Low	Remove flaking paint Approx. 5m2 of plaster missing			
	Floor Finish	Wood block	High	Retain			
	Fixtures & Fittings						
	M&E Items	Conduit Gas pipe Early switch Plug socket Light	None Low None None None	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.57	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Ceiling paper	None	Remove Approx. 15m2 of plaster missing			
	Floor Finish	Wood block	High	Retain			
	Fixtures & Fittings	Ventilation grill	Low	Retain			
	M&E Items	Early light switch Conduit Light Misc. pipes	Low None None Low	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.58	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Paint	Low	Remove flaking paint Approx. 1m2 of plaster missing			
	Floor Finish	Red clay tile	Low	Retain			
	Fixtures & Fittings	Timber battens Shelf brackets	None None	Remove Remove			
	M&E Items	Misc. electrical items Switch Conduit Gas pipe Early switch	None None None Low Low	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.59	Wall Finish(es)	Paint	Low	Remove flaking paint			
	Ceiling Finish	Paint	Low	Remove flaking paint Approx. 4m2 of plaster missing			
	Floor Finish	Red clay tile	Low	Retain			
	Fixtures & Fittings	Shelves	None	Remove			
	M&E Items	Misc. cables Conduit	None None	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.60	Wall Finish(es)	Wallpaper Paint	None Low	Remove Remove flaking paint			
	Ceiling Finish	Paint	Low	Remove flaking paint Approx. 10m2 of plaster missing			
	Floor Finish	Red clay tile	Low	Retain			
	Fixtures & Fittings						
	M&E Items	Early switch Conduit Light Plug socket Gas pipe Misc. electrical items	Low None None None Low None	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.61	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Paint	Low	Remove flaking paint Approx. 2m2 of plaster missing			
	Floor Finish	Wood block	High	Retain			
	Fixtures & Fittings						
	M&E Items	Plug socket Early light switch Conduit	None Low None	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.62	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Paint	Low	Remove flaking paint Approx. 6m2 of plaster missing			
	Floor Finish	Wood block	High	Retain			
	Fixtures & Fittings						
	M&E Items	Early light switch Conduit Light	Low None None	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.63	Wall Finish(es)	Paint	Low	Remove flaking paint			
	Ceiling Finish	Paint	Low	Remove flaking paint Approx. 1m2 of plaster missing			
	Floor Finish	Red clay tile	Low	Retain			
	Fixtures & Fittings						
	M&E Items	Light switch Conduit Light Misc. cable Misc. pipe	None None None None None	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.64	Wall Finish(es)	Wallpaper White tile	None None	Remove Remove			
	Ceiling Finish	Ceiling paper	None	Remove			
	Floor Finish	Red clay tile	Low	Retain			
	Fixtures & Fittings	Timber batten	None	Remove			
	M&E Items	Switch Conduit Plug sockets Misc. cables	None None None None	Remove all			

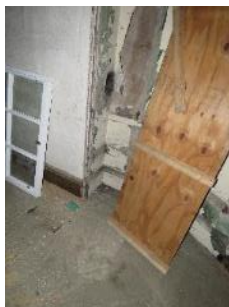
Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.65	Wall Finish(es)	Wallpaper White tile	None None	Remove Remove			
	Ceiling Finish	Paint	Low	Remove flaking paint Approx. 5m2 of plaster missing			
	Floor Finish	Red clay tile	Low	Retain			
	Fixtures & Fittings	Cupboard Shelving Timber boards Timber battens	Low Low None None	Remove Remove Remove Remove			
	M&E Items	Misc. cables Conduit Light	None None None	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.66	Wall Finish(es)	Paint	Low	remove flaking paint			
	Ceiling Finish	Paint	Low	Remove flaking paint Approx. 3m2 of plaster missing			
	Floor Finish	Red clay tile	Low	Retain			
	Fixtures & Fittings	Timber light mount	None	Remove			
	M&E Items	Light Heating pipe Redundant pipe	None Low Low	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.67	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Paint	Low	Remove flaking paint Approx. 5m2 of plaster missing			
	Floor Finish	Wood block	High	Retain			
	Fixtures & Fittings						
	M&E Items	Switch Conduit Modern light Heating pipe Gas pipe Misc. wires	None None None Low Low None	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.68	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Paint	Low	Remove flaking paint Approx. 20m2 of plaster missing			
	Floor Finish	Wood block (lifted)	High	Retain			
	Fixtures & Fittings						
	M&E Items	Light switch Heating pipe	None Low	Remove Remove			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.69	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Paint	Low	Remove flaking paint Approx. 6m2 of plaster missing			
	Floor Finish	Wood block Vinyl and plastic nosing to steps	High None	Retain Remove			
	Fixtures & Fittings	Hooks Radiator brackets	None Low	Remove Remove			
	M&E Items	Heating pipe Modern light Conduit Switch Plug socket	Low None None None None	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.70	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Paint	Low	Remove flaking paint Approx. 15m2 of plaster missing			
	Floor Finish	Wood block	High	Retain			
	Fixtures & Fittings	Radiator brackets	Low	Remove			
	M&E Items	Heating pipe Switch Modern light	Low None None	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.71	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Ceiling paper	None	Remove Approx. 10m2 of plaster missing	 		
	Floor Finish	Wood block	High	Retain			
	Fixtures & Fittings	Ventilation grill Radiator brackets	Low Low	Retain Remove			
	M&E Items	Heating pipes Switch Conduit Modern light	Low None None None	Remove all			

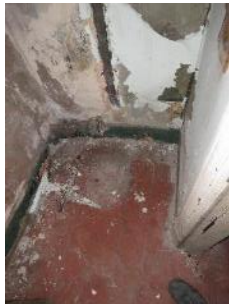
Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.72	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Ceiling paper	None	Remove Approx. 3m2 of plaster missing			
	Floor Finish	Adhesive over wood block	None / High	Remove adhesive and retain wood block			
	Fixtures & Fittings	Radiator brackets	Low	Remove			
	M&E Items	Misc. wires Modern light Heating pipe	None None Low	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.73	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Ceiling paper	None	Remove Approx. 15m2 of plaster missing			
	Floor Finish	Wood block (partly lifted) Glazed tile Carpet and adhesive	High Low None / none	Retain Retain Remove			
	Fixtures & Fittings	Radiator brackets	Low	Remove			
	M&E Items	Switch Conduit Modern light Heating pipe 2no. Radiators	None None None Low Low	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.74	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Paint	Low	Remove flaking paint			
	Floor Finish	Wood block Red clay tile	High Low	Retain Retain			
	Fixtures & Fittings						
	M&E Items	Switch Conduit Heating pipe	None None Low	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.75	Wall Finish(es)	Paint	Low	Remove flaking paint			
	Ceiling Finish	Paint	Low	Remove flaking paint			
	Floor Finish	Red clay tile	Low	Retain			
	Fixtures & Fittings	Cistern brackets	None	Remove			
	M&E Items	Light switch Conduit Lights Plug socket Heating pipe	None None None None Low	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.76	Wall Finish(es)	Wallpaper Paint	None Low	Remove Remove flaking paint			
	Ceiling Finish	Paint	Low	Remove flaking paint Approx. 5m2 of plaster missing			
	Floor Finish	Red clay tile	Low	Retain			
	Fixtures & Fittings	Speaker	Medium	Retain			
	M&E Items	Light switch Conduit Lights Gas pipe	None None None Low	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.77	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	N/A	N/a	4m2 of plaster missing			
	Floor Finish	Red clay tile	Low	Retain			
	Fixtures & Fittings	Toilet roll holder	None	Remove			
	M&E Items	Light switch Conduit Heating pipe Water pipe	None None Low Low	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.78	Wall Finish(es)	Wallpaper Paint	None Low	Remove Remove flaking paint			
	Ceiling Finish	Paint	Low	Remove flaking paint Approx. 8m2 of plaster missing			
	Floor Finish	Wood block	High	Retain			
	Fixtures & Fittings	Wall hatch Timber batten Radiator bracket	Low None Low	Retain Remove Remove			
	M&E Items	Light switch Conduit Light Heating pipe Radiator	None None None Low Low	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.79	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Paint	Low	Remove flaking paint Approx. 6m2 of plaster missing			
	Floor Finish	Adhesive over wood block	None / High	Remove adhesive and retain wood block			
	Fixtures & Fittings	Timber board Radiator brackets	None Low	Remove Remove			
	M&E Items	Light switch Conduit Light Heating pipe Radiator	None None None Low Low	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.80	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Ceiling paper on plasterboard	None	Remove ceiling paper			
	Floor Finish	Carpet and adhesive over wood block	None / None / High	Remove carpet and adhesive and retain wood block			
	Fixtures & Fittings	Wall hatch	Low	Retain			
	M&E Items	Plug sockets Switches Modern lights	None None None	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.81	Wall Finish(es)	Paint	Low	remove flaking paint			
	Ceiling Finish	Paint	Low	remove flaking paint			
	Floor Finish	Red clay tile	Low	Retain			
	Fixtures & Fittings	Shelves Various hooks on timber board	None Various	Remove Retain earlier hooks			
	M&E Items						

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.82	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Paint	Low	Remove flaking paint Approx. 5m2 of plaster missing			
	Floor Finish	Adhesive over wood block	None / High	Remove adhesive and retain wood block			
	Fixtures & Fittings	Built in cupboard Wall hatch Radiator brackets	None Low Low	Remove Remove Remove			
	M&E Items	Light switch Conduit Modern lights Heating pipe Radiator	None None None Low Low	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.83	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Paint	Low	Remove flaking paint Approx. 2m2 of plaster missing			
	Floor Finish	Adhesive over wood block	None / High	Remove adhesive and retain wood block			
	Fixtures & Fittings	Timber batten Radiator brackets Shelves Wall hatch	None Low None Low	Remove Remove Remove Remove			
	M&E Items	Light switch Conduit Modern light Misc. wires and electrical boxes Heating pipe Radiator Plug socket	None None None None None Low Low None	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.84	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Paint	Low	Remove flaking paint Approx. 100m2 of plaster missing			
	Floor Finish	Wood block (50% lifted)	High	Retain			
	Fixtures & Fittings	Fireman's cupboard Curtain rails	High None	Retain Remove			
	M&E Items	Light switch Conduit Plug socket Misc. cables	None None None None	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.85	Wall Finish(es)	Paint	Low	Remove flaking paint			
	Ceiling Finish	Paint	Low	Remove flaking paint			
	Floor Finish	Red clay tile	Low	Retain			
	Fixtures & Fittings	Timber board Toilet roll holder	None None	Remove Remove			
	M&E Items	Light switch Conduit Light Waster pipe	None None None None	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.86	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	N/A	N/A	12m2 of missing ceiling			
	Floor Finish	Wood block	High	Retain			
	Fixtures & Fittings	Raised hearth	None	Remove			
	M&E Items	Conduit	None	Remove			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.87	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Paint	Low	Remove flaking paint Approx. 10m2 of plaster missing			
	Floor Finish	Carpet and adhesive over wood block Red clay tile	None / None / High Low	Remove carpet and adhesive and retain wood block Retain			
	Fixtures & Fittings	Cupboard Ventilation grill Fireman's cupboard	None Low High	Remove Retain Retain			
	M&E Items	Fuse box Switches Wall lights Plug sockets	None None None None	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.88	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Paint	Low	Remove flaking paint Approx. 3m2 of plaster missing			
	Floor Finish	Red clay tile White tile	Low Low	Retain Retain			
	Fixtures & Fittings	Shelf Timber batten	None None	Remove Remove			
	M&E Items	Switch Conduit Light Misc. pipe	None None None None	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.89	Wall Finish(es)	Wallpaper White tile	None None	Remove Remove			
	Ceiling Finish	Ceiling paper	None	Remove Approx. 6m2 of plaster missing			
	Floor Finish	Red clay tile	Low	Retain			
	Fixtures & Fittings	Timber boards Misc. timber item	None None	Remove Remove			
	M&E Items	Conduit Ventilation ductwork Misc. cables	None None None	Remove Remove Remove			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.90	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Ceiling paper	None	Remove Approx. 4m2 of plaster missing			
	Floor Finish	Adhesive over wood block	None / High	Remove adhesive and retain wood block			
	Fixtures & Fittings	Wall hatch Ventilation grill	Low Low	Retain Retain			
	M&E Items	Light switch Conduit Modern light Plug socket	None None None None	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.91	Wall Finish(es)	Wallpaper White tile	None None	Remove Remove			
	Ceiling Finish	Ceiling paper Paint	None Low	Remove Remove flaking paint Approx. 5m2 of plaster missing			
	Floor Finish	Red clay tile White tile	Low Low	Retain Retain			
	Fixtures & Fittings	Timber batten	None	Remove			
	M&E Items	Switches Conduit Light Plug socket	None None None None	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.92	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Paint	Low	Remove flaking paint Approx. 8m2 of plaster missing			
	Floor Finish	Wood block Glazed tile	High Low	Retain Retain			
	Fixtures & Fittings	Fireman's cupboard Ventilation grill	High Low	Retain Retain			
	M&E Items	Early light switch Conduit Light	Low None None	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.93	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Ceiling paper	None	Remove Approx. 10m2 of plaster missing			
	Floor Finish	Wood block Glazed tile	High Low	Retain Retain			
	Fixtures & Fittings	Light switch mount	None	Remove			
	M&E Items	Plug socket Conduit Misc. cables	None None None	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs
2.94	Wall Finish(es)				
	Ceiling Finish				
	Floor Finish				
	Fixtures & Fittings				
	M&E Items				

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.95	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Ceiling paper	None	Remove Approx. 6m2 of plaster missing			
	Floor Finish	Wood block	High	Retain			
	Fixtures & Fittings						
	M&E Items	Early light switch Conduit Light Ventilation ductwork Plug socket	Low None None Low None	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs
2.96	Wall Finish(es)				
	Ceiling Finish				
	Floor Finish				
	Fixtures & Fittings				
	M&E Items				

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.97	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Paint	Low	Remove flaking paint Approx. 2m2 of plaster missing			
	Floor Finish	Wood block Glazed tile	High Low	Retain Retain			
	Fixtures & Fittings	Timber plug socket mount Ventilation grill	None Low	Remove Retain			
	M&E Items	Early light switch Conduit Light	Low None None	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.98	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Paint	Low	Remove flaking paint Approx. 0.5m2 of plaster missing			
	Floor Finish	Wood block	High	Retain			
	Fixtures & Fittings	Timber plug socket mount Ventilation grill Fireman's cupboard and pole	None Low High	Remove Retain Retain			
	M&E Items	Conduit Light Plug socket	None None None	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.99	Wall Finish(es)	Wallpaper White tile	None None	Remove Remove			
	Ceiling Finish	Paint	Low	Remove flaking paint Approx. 6m2 of plaster missing			
	Floor Finish	Red clay tile White tile	Low Low	Retain Retain			
	Fixtures & Fittings	Timber board	None	Remove			
	M&E Items	Light switch Conduit Light Plug socket Cable	None None None None None	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.100	Wall Finish(es)	Wallpaper Tile	None None	Remove Remove			
	Ceiling Finish	Paint	Low	Remove flaking paint Approx. 8m2 of plaster missing			
	Floor Finish	Red clay tile	Low	Retain			
	Fixtures & Fittings	Timber batten Timber board	None None	Remove Remove			
	M&E Items	Conduit Misc. cable Ventilation ductwork	None None Low	Remove all			

Room Reference	Element	Description	Significance	Removed or Retained	Photographs		
2.101	Wall Finish(es)	Wallpaper	None	Remove			
	Ceiling Finish	Paint	Low	Remove flaking paint Approx. 6m2 of plaster missing			
	Floor Finish	Red clay tile Yellow tile	Low Low	Retain Retain			
	Fixtures & Fittings						
	M&E Items						