



4Geo-Environmental Desk Study, Kenyon Lane, Moston, Manchester

Prepared for Adelphi Developments Ltd

July 2020

10/1559/001 Rev. 04

Clancy Consulting Limited
Dunham Court
2 Dunham Road
Altrincham
Cheshire
WA14 4NX

T: 0161 613 6000
enquiries@clancy.co.uk
www.clancy.co.uk

DOCUMENT CONTROL SHEET

Issued by	Clancy Consulting Ltd Dunham Court 2 Dunham Road Altrincham WA14 4NX	Tel: 0161 613 6000 Email: enquiries@clancy.co.uk Website: www.clancy.co.uk
Client	Adelphi Developments Ltd Reedham House 31- 33 King Street West Manchester M3 2PN	
Document	Geo-Environmental Appraisal Report	
Project Name	Kenyon Lane, Moston, Manchester	
Reference	10/1559/001 Rev 04.	
Date	July 2020	

"This document has been prepared for the titled project, or named part thereof, and should not be relied upon or used for any other project or part as the case may be, without an independent check being made on it. Clancy Consulting shall not be liable for the consequences of using this document other than for the purpose for which it was commissioned, and any user and any other person using or relying on this document for such other purpose, agrees and will by such use or reliance be taken to confirm this agreement to indemnify Clancy Consulting for all loss or damage resulting therefrom".

Document Production Record

Revision	Date	Revision Description		Name
00	June 2020	Original	Prepared	Rhys Pyke Geo-Environmental Engineer rhys.pyke@clancy.co.uk
			Reviewed	Lisa Cookson Senior Geo-Environmental Engineer lisa.cookson@clancy.co.uk
			Approved	Nick Riding Divisional Director nick.riding@clancy.co.uk
01	June 2020	Updated with UXO pre-desk study assessment	Prepared	Rhys Pyke Geo-Environmental Engineer
			Reviewed	Lisa Cookson Senior Geo-Environmental Engineer
			Approved	Nick Riding Divisional Director
02	June 2020	Updated with new development plans	As above	As above
03	July 2020	Updated with new development plans	As above	As above
04	July 2020	Updated with new development plans	As above	As above

Executive Summary

Client	Adelphi Developments Ltd
Location	110 and 112 Kenyon Lane, Moston, Manchester, M40 9DH, at OS grid reference 387240, 401470.
Description	The site is an irregularly shaped parcel of land with an area of approximately 0.42 hectares. The site currently comprises a DIY store (Deanway DIY) within the largest building on the site, a former cinema, covering the majority of the site. On the west of the site is a plumbing supplies company (Steve Sutton Plumbing and Heating Supplies) within a converted residential building and sheds. There are also hardstanding 'yard' areas currently used for storing construction supplies.
Development	The proposed development comprises a four-storey apartment block with associated parking spaces, soft landscaping and a communal garden.
Site History	Historical OS maps dating back to 1850 indicate the site to have been part of agricultural land in the 1800s with a pond in the east of the site. The west of the site was part of a brick works in the early 1900s before later being the site of a cinema, which was later replaced by a newer cinema and the building that is currently used as a DIY store was constructed. In the wider area residential development dominates, although a number of clay pits were noted historically.
UXO	The site is indicated to be at 'moderate' risk from UXO. A pre-desk study assessment (PDSA) has been obtained from Zetica, which concluded that a "detailed desk study, whilst always prudent, is not considered essential in this instance.
Geology	Geological mapping indicates that the site is underlain by superficial deposits of Till (diamicton). Bedrock underlying the site comprises the Pennine Middle Coal Measures Formation (mudstone, siltstone and sandstone).
Mining	According to the Coal Authority, the site is located within a coal mining reporting area, a Consultants Coal Mining Report indicates that one seam was mined below the site at a depth of 447m, there are no shallow mining features on or in the vicinity of the site. Based on the depth of the mining, and lack of shallow mining activity, it is considered that the site is not at risk from coal mining. There are three BGS recorded mineral sites located within 500m of the site, all of which were opencast mine removing clay. A review of historical maps did identify evidence of historical mining activities in the area including a brick works on the site, although it is not clear whether extraction of clay occurred on the site or just the production of bricks.
Flood Risk	According to Environment Agency records, the site is located within an area not susceptible to flooding from rivers or the sea. The site is located within a BGS groundwater flood susceptibility mapping area and is in an area with limited potential for groundwater flooding to occur.
Environmental Setting	The closest surface water feature is located 442m north-east. Based on mapping this appears to be a small stream or brook located within a wooded area. The superficial deposits underlying the site are classified as a Secondary Undifferentiated Aquifer and the bedrock is classified as a Secondary A Aquifer. The site is not located within a Groundwater Source Protection Zone and there are no groundwater abstraction points within 500m of the site.

Landfill

There are four historical landfill sites within 500m of the site and a further four within 1km, the closest of which is located 134m south-west of the site. Based on the age of infilling, the identified landfills could have a ground gas generation potential of 'moderate' to 'high'.

There are ten recorded instances of potentially infilled land, two non-water and eight water, located within 250m of the site. The closest area is a non-water entry recorded on the site which the mapping shows it affects the west of the site and is related to the former brickworks. The bulk of the entries are related to infilled ponds. Although not listed within the environmental database report, the historical mapping also shows a pond on the east of the site, possibly now infilled.

Potential Geotechnical Constraints

Potential geotechnical constraints on the site include the following:

- The potential infilled land associated with the former brickworks
- The potential infilled pond located in the north-east of the site

Further Works

The Phase I Risk Assessment and Preliminary Conceptual Site Model has identified plausible contaminant linkages. As a result, the following additional works / precautions are recommended as a minimum:

- Carry out an intrusive site investigation to confirm ground conditions at the site. The ground investigation should allow for excavations / boreholes to be taken through any Made Ground soils and into the underlying natural strata.
- In-situ testing / geotechnical soil sampling should be carried out during the intrusive investigation to provide adequate recommendations for foundation design.
- Chemical testing of shallow soils, to include heavy metals and metalloids, hydrocarbons and asbestos screening to confirm contaminant levels in the soils and to confirm whether pollutant linkages are present at the site.
- Combined gas and groundwater monitoring wells should be installed in selected boreholes with an initial 6 no. return monitoring visits undertaken to establish if gas protective measures are required for the proposed new structures

Contents

1.0	Introduction	6
1.1	Background	6
1.2	Objectives	6
1.3	Limitations of the Study	6
2.0	Desk Study	6
2.1	General	6
2.2	Site Setting and Description	7
2.3	Site History	7
2.4	Unexploded Ordnance (UXO) Risk Assessment	8
2.5	Geology	9
2.6	Soil Geochemistry	9
2.7	Mining & Ground Stability	9
2.8	Hydrogeology	10
2.9	Hydrology	10
2.10	Flood Risk	10
2.11	Radon Risk Potential	10
2.12	Landfill Sites	11
2.13	Industrial Land Uses	11
2.14	Sensitive Land Uses	12
2.15	Potential Geotechnical Constraints	12
3.0	PHASE 1 RISK ASSESSMENT	12
3.1	General	12
3.2	Preliminary Conceptual Site Model	12
4.0	Desk Study Conclusions	16

Drawings

Site Location Plan
Proposed Site Layout Plan

Appendices

Appendix I	Drawings
Appendix II	Ordnance Survey Historical Mapping
Appendix III	Zetica UXO Risk Mapping
Appendix IV	British Geological Survey (BGS) Sheets
Appendix V	Mining and Ground Stability Report
Appendix VI	Coal Mining Reports
Appendix VII	Site Sensitivity & Flood Risk Maps
Appendix VIII	Environmental Datasheets

1.0 Introduction

1.1 Background

Clancy Consulting Limited has been instructed by Adelphi Developments Ltd to carry out a Geo-environmental Appraisal report for a site located at 110 and 112 Kenyon Lane, Moston, Manchester, M40 9DH.

The proposed development comprises a four-storey apartment block with associated parking spaces, soft landscaping and a communal garden.

A site location plan and proposed layout plan are presented in Appendix I.

1.2 Objectives

The objectives of this investigation are summarised below:

- Provide a review of the sites land use history by reference to ordnance survey maps of the area.
- Assess the environmental setting, geology, hydrology, hydrogeology, mining and subsidence history of the site and surrounding area.
- Develop a detailed 'preliminary risk assessment' and 'conceptual site model' with regard to potential contamination sources, pathways and receptors.
- Consider the potential risk to end users of the site from hazardous ground gas.
- Consider and assess the potential risk of the site from UXO.
- Provide recommendations regarding the requirement for further investigations, if required, to satisfy the Local Planning Authority.

1.3 Limitations of the Study

Clancy Consulting Limited cannot be held responsible for any omissions, misrepresentation, errors or inaccuracies with the supplied third party report information. The report is written in the context of an agreed scope of work and budget and should not be used in a different context. New information or improved practices and changes in legislation may require a reinterpretation of the report in whole or in part.

Clancy Consulting Limited reserves the right to amend either conclusions or recommendations in light of any further information that may become available. The report is provided for the sole use of Adelphi Developments Ltd for the objectives discussed previously only and is confidential to them.

The report may not be relied upon by any other party without prior written consent of Clancy Consulting Limited. Those using this information in subsequent assessments or evaluations do so at their own risk.

2.0 Desk Study

2.1 General

Background information was sought from the following sources:

- Ordnance Survey Historical Mapping (selected copies included in Appendix II)
- Zetica UXO Risk Mapping (Appendix III)
- British Geological Survey (BGS) Sheets (Appendix IV)
- Mining and Ground Stability Report (Appendix V)
- Coal Mining Reports (Appendix VI)

- Site Sensitivity & Flood Risk Maps (Appendix VII)
- Environmental Datasheets (Appendix VIII)

2.2 Site Setting and Description

The site is located at 110 and 112 Kenyon Lane, Moston, Manchester, M40 9DH, at national grid reference 387240, 401470. The site is an irregularly shaped parcel of land with an area of approximately 0.42 hectares. The site currently comprises a DIY store (Deanway DIY) within the largest building on the site, a former cinema, covering the majority of the site. On the west of the site is a plumbing supplies company (Steve Sutton Plumbing and Heating Supplies) within a converted residential building and sheds. There are also hardstanding 'yard' areas currently used for storing construction supplies.

The site is situated in a predominantly residential area, with some commercial properties. The site is bound to the south by residential houses and a disused Scout Hut surrounded by overgrown land. To the east is a church, Lightbowne Evangelical Church. To the north is Kenyon Lane, with residential properties beyond and a salon, takeaway food restaurant, dentist and funeral home. To the west are further residential properties.

2.3 Site History

To investigate the development history and previous land uses at the site and surrounding area, historical Ordnance Survey (OS) maps were examined. Selected copies of the maps are presented in Appendix II.

Table 1 below is not intended to provide a comprehensive review of all the changes which have occurred at the site and instead provides a summary of the most salient points. The most significant historical land uses are highlighted in bold text for ease of reference.

Table 1 – Site History

Date(s)	Site	Surrounding Land
1848	The site is part of an area of agricultural land . There is road shown cutting across the site from the north-west terminating on the south-east boundary of the site.	The surrounding area is predominantly agricultural , with a number of farms in the surrounding area, the closest is Bluestone Farm 60m north. A road borders the north of the site running east-west. There are number of ponds located in the surrounding area, the closest of which are located 70m east, 95m north-east and 103m north-west. Moston Brook passes approximately 475m south of the site flowing from east to west. There is a railway located 600m south.
1893	A pond is shown in the northeast of the site, approximately 35m in diameter.	The road directly north is named Dean Lane. Further ponds are noted in the immediate surrounding area, the closest of which is 20m north. Residential houses are shown from 15m east. A clay pit is shown 291m north-west. The railway to the south is named Lancashire and Yorkshire and has expanded to include sidings, an engine shed and works . Old Sand Pits are shown 650m northeast and 700m to the east.
1908 - 1909	The road and pond are no longer shown on site. The west of the site is within the site boundary of a brick works .	A church is shown immediately to the east and a brick works is shown 30m south. A club and bowling green are shown 20m north. Increased residential development is shown to the north-west, east and south-east. The ponds in the surrounding area are no longer shown, with the exception of one pond located 95m north-east. The railway has further expanded with additional railway lines and supporting buildings and is now present from 500m south of the site.

Date(s)	Site	Surrounding Land
1923 - 1933	A cinema building is shown on the east of the site. A track from Dean Lane to a triangular parcel of land on the south-west of the site, with a number of buildings present, is shown. The brick works is no longer shown.	Further residential development is shown in the surrounding area. The brick works to the northwest are no longer shown however the area is still labelled as a clay pit . The railway has further expanded, with sidings located 410m south.
1938	No pertinent changes.	Brendon Street is shown immediately south, with further residential development shown in the surrounding area. An unnamed building is shown 5m south. A clay pit is shown 150m south-west. A brick works is shown 290m north-west. Mineral Water Works are shown 300m north-east.
1948 - 1952	The cinema building in the east is no longer shown. The Adelphi Cinema is shown in the centre of the site, in its current location. A triangular parcel of land in the south-west of the site appears to have a series of small unnamed buildings present.	Further residential development is shown in the surrounding area. The building 5m south is Century Hall. The Moston Labour Hall is now present 15m south-east. Refuse heaps are shown 180m south-west, in the location of the clay pit and 300m north-west associated with the brick works. A shelter and public wash house are located 150m east and 50m north-east respectively.
1975 – 1978	No pertinent changes.	Dean Lane is now labelled as Kenyon Lane. A scrap metal yard is shown 72m north. A coal yard is shown 95m north. Precast concrete works are shown 240m north-west. The public wash house to the north-east is now a public laundry . Bluestone Farm is now longer shown. The sidings to the south are no longer present.
1977 - 1988	The cinema is listed as a Hall .	The brick works to the north-west are no longer shown. An industrial estate is located 230m north-west.
1985 - 1992	The cinema is now labelled as Adelphi Social Club .	Century Hall to the south is now residential housing . The Labour Hall to the south is no longer present. A Scout Hall is shown 8m south. More residential properties are shown to the south, including where allotment gardens were previously noted. The coal yard to the north is no longer shown. A garage is noted 48m east. The Mineral Water Works is now listed as an unspecified works .
2020	No pertinent changes.	The garage to the east is no longer present. Further residential development is shown in the surrounding area, including opposite the site, in the former location of the club,.

An internet search for the site indicated that the current hardware store building was originally the Adelphi Cinema and was built in 1937 and closed in 1962. It was later used as a bingo club which later closed. It was more recently taken over as the hardware store.

2.4 Unexploded Ordnance (UXO) Risk Assessment

A review of publicly available bomb risk mapping from Zetica (accessed June 2019) indicates that the site is within a 'moderate' bomb risk zone. A pre-desk study assessment (PDSA) has been obtained from Zetica, which concluded that a "detailed desk study, whilst always prudent, is not considered essential in this instance.

The review of historical maps did not identify any damage on site or in the immediate surrounding area.

A copy of the bomb risk mapping for the local area and the PDSA is presented in Appendix III.

2.5 Geology

The 1:50,000 British Geological Survey (BGS) scale map for the area indicates that the site is underlain by superficial strata comprising Till (Diamicton) over bedrock of the Pennine Middle Coal Measures Formation (mudstone, siltstone and sandstone).

Geological faults are noted in the surrounding area bedrock, the closest of which are located 170m east and 200m west of the site.

Artificial ground is noted in the surrounding area however the closest deposits are located 600m south of the site.

The nearest historical boreholes record by the BGS (SD80SE92/A to D) are located from 160m to 410m east of the site. The boreholes, undertaken as part of a sewer construction, identified Made Ground to depths between 0.38m and 1.83m below ground level (bgl) which was underlain by superficial strata to a maximum proven depth of 10.05m, generally comprising sandy clay, with bands of sand and silt. Another borehole record by the BGS (SD80SE46) located 360m north-west proved superficial soils to a depth of 33.22m bgl. Bedrock was not encountered.

Geological maps of the local area are provided in Appendix IV.

2.6 Soil Geochemistry

According to the BGS National Geoscience Information Service no elevated background concentrations of arsenic, cadmium, lead or zinc are anticipated in the natural soils beneath the site.

It is noted that the soil underlying the site may have chromium concentrations between 90 and 120 mg/kg however these concentrations are not considered to be significant.

It should be noted that the soil geochemistry has been estimated solely on the basis of published geology and is not based on empirical data.

2.7 Mining & Ground Stability

According to Coal Authority, the site is located within a coal mining reporting area and therefore a 'Mining and Ground Stability' report was obtained through Envirocheck. The report indicated the site may be at risk of mining instability and noted "inconclusive coal mining". The mining report also noted four instances of potential mining areas within 1km of the site, all related to coal mining, with the closest located 404m east of the site.

In addition to the above; a Consultants Coal Mining Report was obtained from the Coal Authority. A non-residential CON29M was also provided. The Coal Authority reports indicate past underground mining of the Roger seam at a depth of 447m bgl, last worked in 1900. There are no recorded shallow workings and no probable unrecorded shallow workings. There are no outcrops, faults or spine roadways at shallow depth beneath the site. There are no mine entries recorded within 100m.

There are three BGS recorded mineral sites located within 500m of the site, all of which were opencast mine removing clay; Siltan Street located 198m west, Tulketh Street Brickworks located 398m west and Moston Brickworks located 425m south-west.

The Envirocheck mining report notes the presence of extractive industries or potential excavations on site, namely the brick works noted on the 1908-1909 mapping which encroached onto the western part of the site. An unspecified pit is also noted as being located 70m south of the site in 1922.

A review of historical maps did identify evidence of historical mining activities in the area, namely brick works and clay pits as noted above, including a brick works on the site, although it is not clear whether extraction of clay occurred on the site or just the production of bricks.

The environmental database report indicates that there are very low / no risks at the site from ground stability hazards including landslides, ground dissolution, collapsible ground, running sand hazards, compressible ground and shrinking or swelling clays.

Given the depth of the historic underground mining (447m bgl) and the absence of known and probable shallow mining activity at the site, it is considered that the site is not at risk from historic coal mining and no further coal mining risk assessment is required.

The Envirocheck Mining and Ground Stability report is provided in Appendix V and the Coal Authority CON29M and Consultants reports are provided in Appendix VI.

2.8 Hydrogeology

According to the Environment Agency groundwater vulnerability maps, the superficial deposits underlying the site are classified as a Secondary Undifferentiated Aquifer and the bedrock is classified as a Secondary A Aquifer.

The site is not located within a groundwater Source Protection Zone (SPZ).

There are no active groundwater abstraction points, including for potable water supply, recorded within 1km of the site.

There are no groundwater discharge consents recorded within 1km of the site.

2.9 Hydrology

The environmental database report identifies the closest surface water feature as being located 442m north-east of the site. A review of mapping indicates that this water feature is a small stream or brook located within a wooded area which may be connected to Moston Brook, located 750m south-west, via culverting.

No currently active surface water abstraction licences have been recorded within 1km of the site. Two surface water discharge consents have been recorded within 500m of the site the closest of which is located 451m north-east of the site and is associated with storm sewage overflow. This license is noted as being revoked.

There are no pollution incidents to controlled waters recorded within 500m of the site.

2.10 Flood Risk

According to Environment Agency records, the site is not located within an area susceptible to flooding from rivers or the sea. The site is located within a BGS groundwater flood susceptibility mapping area and is in an area with limited potential for groundwater flooding to occur.

However, the Local Authority may have the site listed under their Critical Drainage Area Plan and a Flood Risk Assessment may still need to be undertaken. Consultations should be undertaken with the Local Authority as part of the drainage strategy to verify their requirements.

Copies of the hydrological site sensitivity and flood risk maps are included in Appendix VII.

2.11 Radon Risk Potential

The Radon Guidance on protective measures for new dwellings indicates that the site is in a lower probability radon area, with less than 1% of homes estimated to be at or above the action level. As such, radon gas protective measures are not required in new buildings at the site.

2.12 Landfill Sites

There are four historical landfill sites identified within 500m of the site and a further four within 1km. Historical landfills located within 500m of the site are:

- 'Land Adjacent to Church Lane North', located 134m south-west of the site. This site is listed as accepting commercial and household waste until 1977. No input start date is provided within the Envirocheck report.
- 'Land at Moston College', located 230m west of the site. This site is listed as accepting commercial and household waste from 1947. No last input date is provided.
- 'Land off Bluestone Road', located 339m northeast of the site. No information is supplied regarding deposited waste or waste acceptance dates.
- 'Lightbowne Phase II', located 418m southeast of the site. This site is listed as accepting inert and industrial waste and accepted waste between 1980 and 1981.

There are no BGS recorded landfill sites, registered landfill sites or local authority registered landfill sites within 1km of the site. There are no licenced waste management facilities within 500m of the site.

In accordance with BS8576:2013 'Guidance on Investigations for Ground Gas', based on the age of infilling the identified landfills could have a ground gas generation potential of 'moderate' to 'high'.

There are ten recorded instances of potentially infilled land within 250m of the site, two 'non-water' and eight 'water'. These are located:

- On-site (non-water) infilled circa 1990.
- 79m south-east (water) infilled circa 1848.
- 112m north-east (water) infilled circa 1910.
- 132m west (water) infilled circa 1909.
- 137m north-west (water) infilled circa 1894.
- 170m south (water) infilled circa 1956.
- 208m south-west (water) infilled circa 1923.
- 210m west (non-water) infilled circa 1990.
- 218m south (water) infilled circa 1848.
- 220m northwest (water) infilled circa 1894.

Whilst an area of infilled land (non-water) has been identified on the site, mapping indicates that this is likely associated with the former brickworks which were present in the west of the site. Historical mapping also shows a pond in the north-east of the site from circa 1893 to 1909.

In accordance with BS8576:2013 'Guidance on Investigations for Ground Gas', based on the age of infilling, the identified areas of infilled land (water and non-water) are likely to have a very low gas generation potential. However; infilling in 1990 on-site may have anywhere from a 'very low' to 'high' gas generation potential depending on the materials used for infilling. The infilled pond identified on historical mapping is likely to have a 'very low' gas generation potential.

In addition to this above, Made Ground associated with the construction of the buildings and car parking currently present on site is to be expected, though this is likely to be limited to construction materials and therefore would not be capable of producing hazardous ground gases.

It should also be noted that the site is underlain by coal measures strata which may be capable of producing hazardous ground gases, particularly CO₂.

2.13 Industrial Land Uses

One active contemporary trade directory entry is located within 250m of the site, identified as being 238m north-west of the site and comprising waste disposal services.

There are no Local Authority Pollution Prevention and Control authorisations recorded within 250m of the site.

2.14 Sensitive Land Uses

The site is located within an area designated as a surface water nitrate vulnerable zone.

Ancient woodland and local nature reserves are located 818m and 771m north of the site.

2.15 Potential Geotechnical Constraints

Potential geotechnical constraints on the site include the following:

- The potential infilled land associated with the former brickworks
- The potential infilled pond located in the north-east of the site

3.0 PHASE 1 RISK ASSESSMENT

3.1 General

The “suitable for use” approach is adopted for the assessment of contaminated land and remedial measures are only undertaken where unacceptable risk to human health or the environment can be proven when considering the proposed use of the site and environmental setting.

A risk assessment process should be carried out to determine potential hazards to human health and the environment and be based on the “source” “pathway” “receptor” principal. For a potential risk to be present there must be a viable pollutant linkage whereby a contamination source may impact upon a receptor. The absence of one or more of these key components (source, pathway or receptor) prohibits a viable pollution linkage being formed.

3.2 Preliminary Conceptual Site Model

In accordance with CLR11 “Model Procedures for the Management of Land Contamination” (2004) and BSI 10175 “Code of Practice for Investigation of Potentially Contaminated Land” (2011), a Preliminary Conceptual Site Model was developed to identify potential contamination sources, migration pathways and receptors within the study area.

The following potential contamination sources have been identified:

- Possible Made Ground and contamination associated with historic development and demolition at the site.
- Possible Made Ground and associated mobile contamination in the area surrounding the site from historical and current land uses including railway lines, refuse tips, historic landfill sites, construction and demolition of nearby buildings, brick works, clay pits and infilled land (water and non-water).
- Possible mobile hazardous ground gas associated with Made Ground soils at the site and in the surrounding areas (including nearby historical landfilling and infilled land – water and non-water).
- Possible mobile hazardous ground gas associated with the underlying coal measures strata.
- Possible hazardous ground gas associated with organic deposits in the location of the former pond in the north-east of the site.

Based on the site history, the potential contaminants of concern include asbestos containing materials (ACMs) / fibres, heavy metals and metalloids, PAHs and TPHs. Ground gases of concern include carbon dioxide and methane.

Potential pollutant pathways include:

- Dermal contact.
- Inhalation and ingestion of particulates.
- Migration of leachable contaminants (vertical).
- Migration of possible ground gas/vapours (and possible ingress into buildings).
- Aggressive ground conditions affecting building infrastructure.

The following contamination receptors have been identified:

- Future site users.
- Construction workers.
- Controlled waters (underlying aquifers).
- Buildings and infrastructure.

A preliminary risk assessment can be carried out using guidance outlined in Section 6.3 of CIRIA Document C552 "Contaminated Land Risk Assessment – A Guide to Good Practice" (2001).

For a risk to be present there must be a viable pollutant linkage whereby a contamination source can impact on a receptor via a pathway. To carry out the risk assessment an estimate must be made of the potential severity of the risk and the likelihood of the risk occurring. The following Tables set out the criteria for this principal.

Table 2 - Severity of Risk

Severity	Description
Severe	Acute risk to human health likely to result in 'significant harm' i.e. very high concentrations of contamination or ground gases. Catastrophic damage to building i.e. by explosion from high gassing sites or VOC concentrations. Major pollution of controlled waters i.e. surface watercourses and Principal aquifers, source protection zones. Short term damage to ecosystems.
Medium	Long term risk to human health likely to result in 'significant harm' i.e. elevated concentrations of contaminants or ground gases. Pollution of sensitive controlled watercourses i.e. Principal or Secondary Aquifers. Significant effects on sensitive ecosystems or species.
Mild	Pollution of non-sensitive waters i.e. smaller surface watercourses or unproductive strata. Significant damage to crops, buildings, structures or services i.e. by explosion from sites with medium gassing potential, elevated concentrations of contaminants.
Minor	Non-permanent human health effects i.e. requirement for protective equipment during site works to mitigate health effects. Damage to non-sensitive ecosystems or species. Minor damage to buildings, structures or services.

Table 3 - Probability of Risk Occurring

Probability	Description
High Likelihood	Pollutant linkage may be present that appears very likely in the short term and risk is almost certain to occur in long term or evidence of harm to receptor exists.
Likely	Pollutant linkage may be present and is likely that the risk will occur over the long term.
Low Likelihood	Pollutant linkage may be present and there is a possibility of the risk occurring although no certainty that it will do so.
Unlikely	Pollutant linkage may be present but the circumstances under which harm would occur even in the long term are improbable.

Table 4 - Comparison of Risk & Probability

Probability	Severity			
	Severe	Medium	Mild	Minor
High Likelihood	Very High	High	Moderate	Moderate/Low
Likely	High	Moderate	Moderate/Low	Low
Low Likelihood	Moderate	Moderate/Low	Low	Very Low
Unlikely	Moderate/Low	Low	Very Low	Very Low

A summary of potential pollutant linkages and perceived risks for this site are outlined in the Table below:

Table 5 - Pollutant Linkages & Perceived Risk

Sources of Contamination	Pathways	Receptors	Severity	Probability	Risk	Justification	Further Action Required
On site: Possible Made Ground and contamination associated with historic development demolition and infilling at the site.	Inhalation, ingestion and dermal contact of soil or particulates	Future site users	Medium Long term risk to human health	Likely	Moderate	Made Ground associated with the former construction and demolition of buildings at the site and from the development of the surrounding area is likely to be present, however its location, depth and composition are not known. There is also the possibility for relatively deep Made Ground deposits associated with potentially infilled land on the site (the former brick works on the west and the infilled pond in the north-east). It is possible that any contamination associated with historical development at the site could have dispersed and diluted over time, however, this is less likely is deeper deposits are encountered. The future development comprises residential land use with soft landscaping and a communal garden.	Intrusive investigation with chemical testing of shallow soils undertaken to assess whether contamination is present underlying the site.
		Construction workers during development	Mild Human health effects limited by short term occupational exposure scenario	Likely	Moderate / Low	Made Ground associated with the former construction and demolition of buildings at the site and from the development of the surrounding area is likely to be present, however its location, depth and composition are not known. There is also the possibility for relatively deep Made Ground deposits associated with potentially infilled land on the site (the former brick works on the west and the infilled pond on the east). Construction workers are expected to come into direct contact with potentially contaminated soils during demolition, earthworks and an initial construction phase. Such contact will likely be short term and occupational, limiting potential exposure.	
	Acidic ground conditions affecting future site buildings	Building Infrastructure	Minor Minor damage to buildings	Low Likelihood	Very Low	If contamination associated with Made Ground is present underlying the site, it is considered possible that damage could be caused to subsurface structures associated with any new buildings. Chemical testing for water soluble sulphate and pH should be undertaken to inform concrete classification for foundations at the site.	
	Vertical migration	Underlying superficial Secondary Undifferentiated Aquifer and underlying bedrock Secondary A Aquifer	Medium Pollution of sensitive waters	Low Likelihood	Moderate / Low	Made Ground associated with historical development and potentially infilled features is likely to be present, although the depth and composition are not known. It is possible that any contamination associated with the Made Ground at the site could have dispersed and diluted over time. The presence of the cohesive soils underlying the site could limit the vertical migration of contamination to the underlying aquifers, however it is unknown whether sufficient cohesive soils underlie the site to prohibit this movement.	
Off site: Possible Made Ground and associated mobile contamination associated with development of the surrounding area, nearby landfilling and infilled land.	Lateral migration onto site with subsequent dermal contact of soils	Future site users	Medium Long term risk to human health	Unlikely	Low	Made Ground associated with historical development of the surrounding area could be present, although it is considered to be limited in nature. The presence of cohesive deposits underlying the site is likely to the migration potential of contamination onto the site however if present contamination could pose a chronic health risk to future site users.	
Ground Gas: Possible ground gas generation associated with potential Made Ground both on and off site, potentially infilled land on site and in the surrounding area, historic landfills and underlying mine workings and coal measures.	Migration of ground gas	Future site users	Severe Acute risk to human health (asphyxiation)	Low Likelihood	Moderate	Made Ground associated with the historical development of the site, the possible infilled features on the site is likely to be present and may have a gas generation potential. The age of the infilled features generally indicates a low gas generation potential, however some more recent areas of infilling could have a 'high' gas generation potential.	Intrusive investigation to confirm extent and nature of Made Ground and natural deposits at the site. Installation of monitoring wells to assess the ground gas regime at the site.
		Building Infrastructure	Mild Significant damage to buildings (explosion)	Low Likelihood	Low	The underlying coal mines and coal measures are unlikely to affect the site based on the depth and the presence of clay underlying the site, however it does remain a possibility if faults / granular bands are present. Given the distance from site of the identified landfills and the likely presence of clay underlying the site, there is a low likelihood that ground gas could accumulate in such volumes as to affect future site users or buildings at the site.	

4.0 Desk Study Conclusions

The site is located at 110 and 112 Kenyon Lane, Moston, Manchester, M40 9DH, at national grid reference 387240, 401470. The site is an irregularly shaped parcel of land with an area of approximately 0.42 hectares. The site currently comprises a DIY store within the largest building on the site, a former cinema. On the west of the site is a plumbing supplies company, Steve Sutton Plumbing and Heating Supplies, within a converted residential building and sheds. There are also hardstanding 'yard' areas currently used for storing construction supplies.

The proposed development comprises a four-storey apartment block with associated parking spaces, soft landscaping and a communal garden.

Historical OS maps dating back to 1850 indicate the site to have been part of agricultural land in the 1800s, with a pond in the east of the site. The west of the site was part of a brick works in the early 1900s before later being the site of a cinema, which was later replaced by a newer cinema and the building that is currently used as a DIY store. In the wider area residential development dominates, although a number of clay pits were noted historically.

Given the development history of the site and the surrounding land, it is considered possible that Made Ground deposits and associated ground contamination may be present. The potential presence of asbestos should also be considered during any future site investigation/development works.

Geological mapping indicates that the site is underlain by superficial deposits of Till (diamicton). Bedrock underlying the site comprises the Pennine Middle Coal Measures Formation (mudstone, siltstone and sandstone).

According to the Coal Authority, the site is located within a coal mining reporting area, a Consultants Coal Mining Report indicates that one seam of coal was mined below the site at a depth of 447m however there are no shallow mining features on or in the vicinity of the site. Based on the depth of the mining, and lack of shallow mining activity, it is considered that the site is not at risk from coal mining hazards and further coal mining risk assessment is not required.

There are three BGS recorded mineral sites located within 500m of the site, all of which were opencast sites removing clay. A review of historical maps did identify a brick works on the site, although it is not clear whether extraction of clay occurred on the site or just the production of bricks.

The closest surface water feature is located 442m north-east. Based on mapping this appears to be a small stream or brook located within a wooded area.

The superficial deposits underlying the site are classified as a Secondary Undifferentiated Aquifer and the bedrock is classified as a Secondary A Aquifer. The site is not located within a Groundwater Source Protection Zone and there are no groundwater abstraction points within 500m of the site.

There are four historical landfill sites within 500m of the site and a further four within 1km, the closest of which is located 134m south-west of the site. Based on the age of infilling, the identified landfills could have a ground gas generation potential of 'moderate' to 'high'.

There are ten recorded instances of potentially infilled land, two non-water and eight water, located within 250m of the site. The closest area is a non-water entry recorded on the site which the mapping shows it affects the west of the site and is related to the former brickworks. The bulk of the entries are related to infilled ponds. Although not listed within the environmental database report, the historical mapping also shows a pond on the east of the site, possibly now infilled.

With regard to hazardous ground gas there are identified areas of potentially infilled land (non-water and water) located on the site (associated with the pond and former brick works) and within the surrounding area. Landfills

have been identified in close proximity to the site. The underlying coal measures and mining also present a potential ground gas source. Given the potential ground gas sources present both on and in the vicinity of the site, it is considered that gas monitoring is necessary to adequately assess the ground gas regime at the site.

Based on the desk study information the environmental setting of the site is considered to be of 'moderate' risk with the underlying Secondary A bedrock aquifer identified as the most sensitive receptor. The proposed development will include areas of soft landscaping which could increase infiltration of surface water and mobility of any shallow contamination present at the site.

Given the proposed development (residential apartments), the risk to human health is considered to be 'moderate' as the development plans include a communal garden and areas of soft landscaping which would provide direct contact for future site users if contamination is present.

The Phase I Risk Assessment and Preliminary Conceptual Site Model has identified plausible contaminant linkages. As a result, the following additional works / precautions are recommended as a minimum:

- Carry out an intrusive site investigation to confirm ground conditions at the site. The ground investigation should allow for excavations / boreholes to be taken through any Made Ground soils and into the underlying natural strata.
- In-situ testing / geotechnical soil sampling should be carried out during the intrusive investigation to provide adequate recommendations for foundation design.
- Chemical testing of shallow soils, to include heavy metals and metalloids, hydrocarbons and asbestos screening to confirm contaminant levels in the soils and to confirm whether pollutant linkages are present at the site.
- Combined gas and groundwater monitoring wells should be installed in selected boreholes with an initial 6 no. return monitoring visits undertaken to establish if gas protective measures are required for the proposed new structures

APPENDIX I
DRAWINGS



A	05/06/2020	Site Location Plan	RAP	DK	NR
Rev	Date	Description	By	Check	App.

COPYRIGHT: THE COPYRIGHT OF THIS DRAWING IS VESTED IN CLANCY CONSULTING.
IT SHALL NOT BE USED WITHOUT PERMISSION BY ANYONE FOR ANY PURPOSE.
DO NOT SCALE THIS DRAWING ELECTRONICALLY OR MANUALLY.
WORK TO FIGURED DIMENSIONS ONLY.
ALL DIMENSIONS ARE IN MILLIMETRES UNLESS STATED OTHERWISE.
DO NOT TURN ON LAYERS THAT HAVE BEEN TURNED OFF.
DO NOT THAW LAYERS THAT HAVE BEEN FROZEN.

Client
Adelphi Developments Ltd

Project
Kenyon Lane
Moston
Manchester

Office
Altrincham

Discipline
GeoEnvironmental

Title
Site Location Plan


Scale @ A3
NTS

Status
FINAL



Originator	Job Number	Discipline	Building/Zone
CCL	10/1559	GEO	-
Type	Level	Drawing No.	Revision
GA	00	001	A

Kenyon Lane

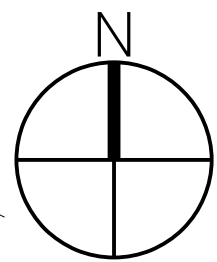


**FALCONER
CHESTER
HALL**



Rev C	15.07.2020	Car park layout updated
Rev B	03.07.2020	Issued for Planning
Rev A	17.06.2020	Refuse store included adjacent to entrance lobby

Project Title		Project No.
Kenyon Lane, Moston		P19-008
Drawing Title		Drawing No.
Proposed: Site Plan		02-01-002C
Client		
GDMJ LTD		
Drawn By	Date	
AW	March 2020	
Scale		
1:200 @ A1		

Kenyon Lane

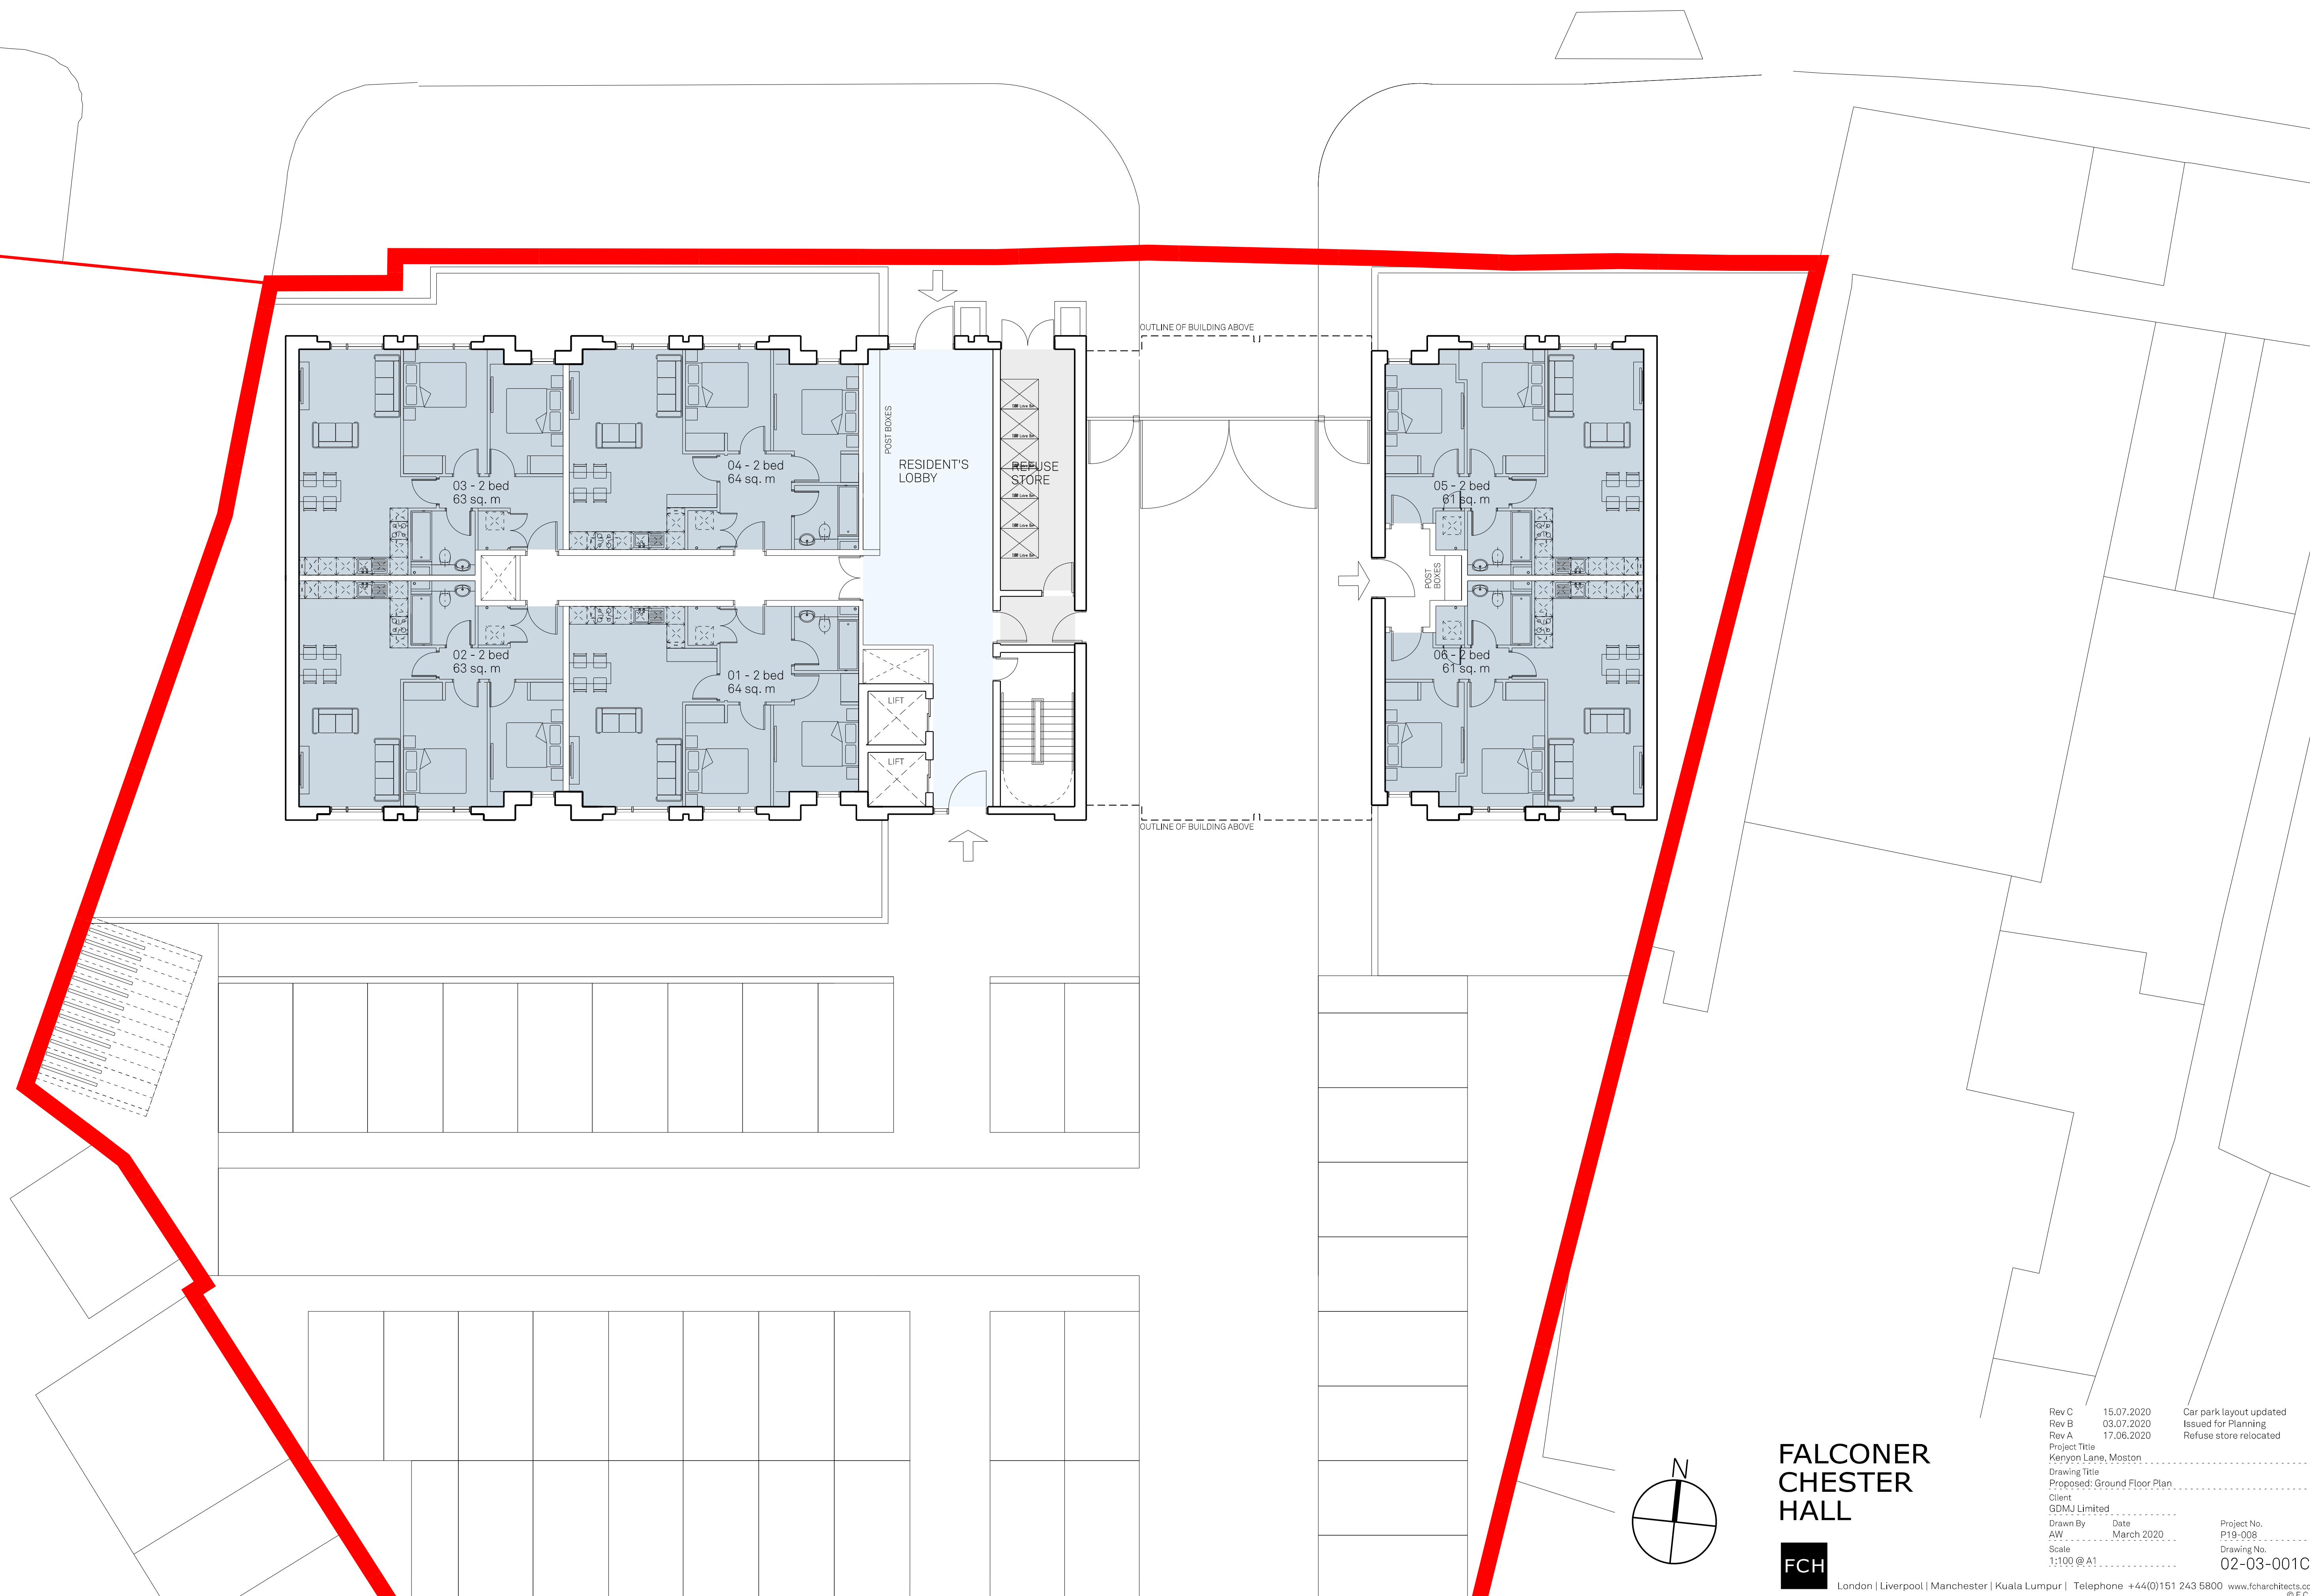

**FALCONER
CHESTER
HALL**





Rev C 15.07.2020 Car park layout updated
Rev B 03.07.2020 Issued for Planning
Rev A 17.06.2020 Refuse store relocated

Project Title
Kenyon Lane, Moston
Drawing Title
Proposed: Ground Floor Plan
Client
GDMJ Limited
Drawn By
Date
March 2020
Scale
1:100 @ A1

Project No.
P19-008
Drawing No.
02-03-001C

Kenyon Lane

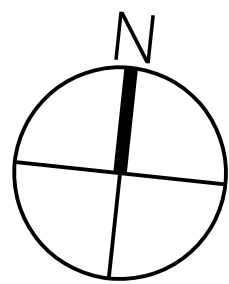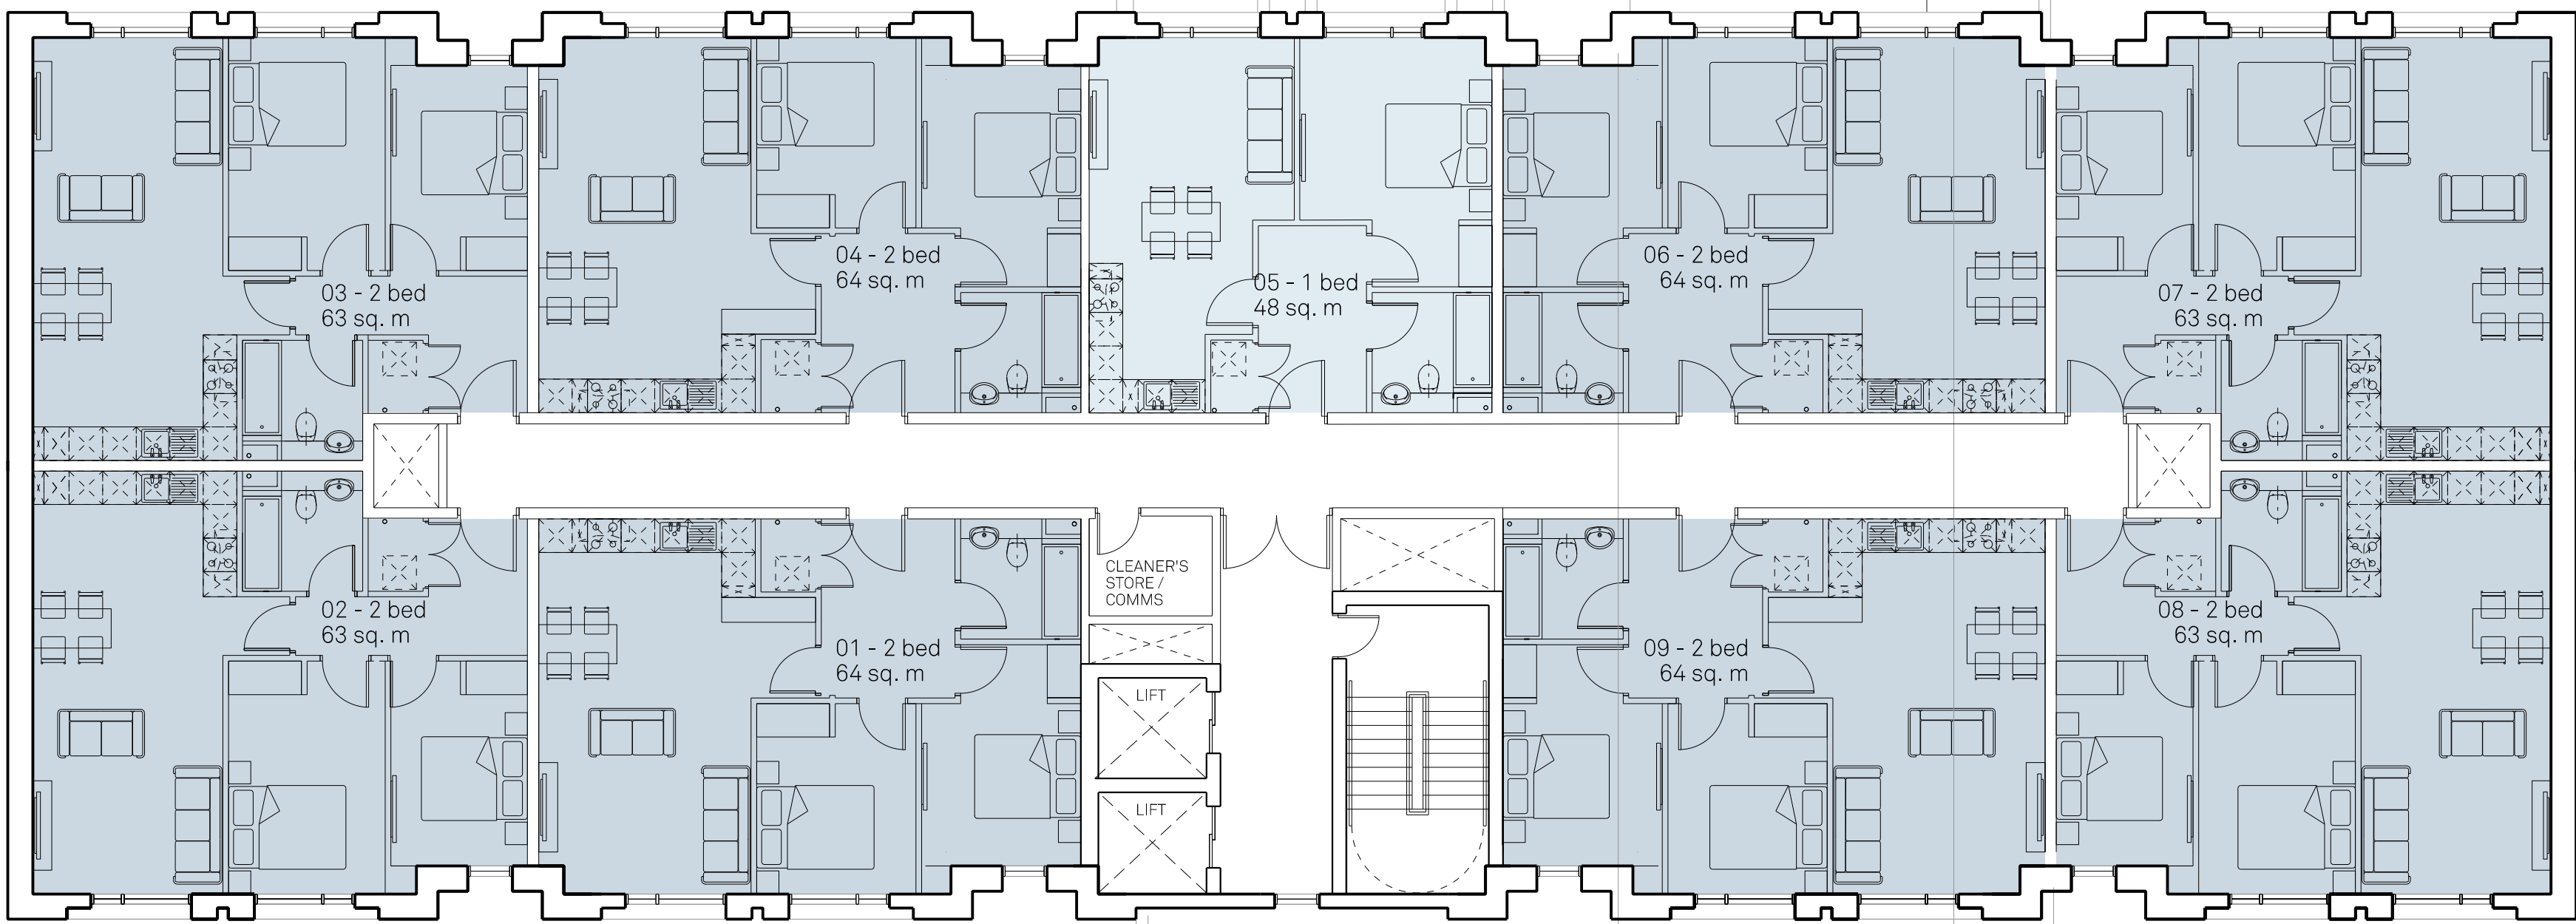

**FALCONER
CHESTER
HALL**





Rev D 20.07.2020 Car park arrangement updated
Rev C 09.07.2020 Drawing title amended
Rev B 03.07.2020 Issued for Planning
Rev A 17.06.2020 Landscaping updated.

Project Title
Kenyon Lane, Moston
Drawing Title
Proposed: First, Second and Third Floor Plan
Client
GDMJ Limited
Drawn By Date
AW March 2020
Scale
1:100 @ A1

Project No.
P19-008
Drawing No.
02-03-002D

Kenyon Lane

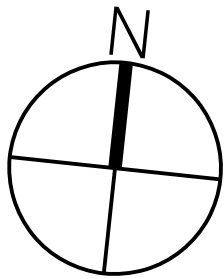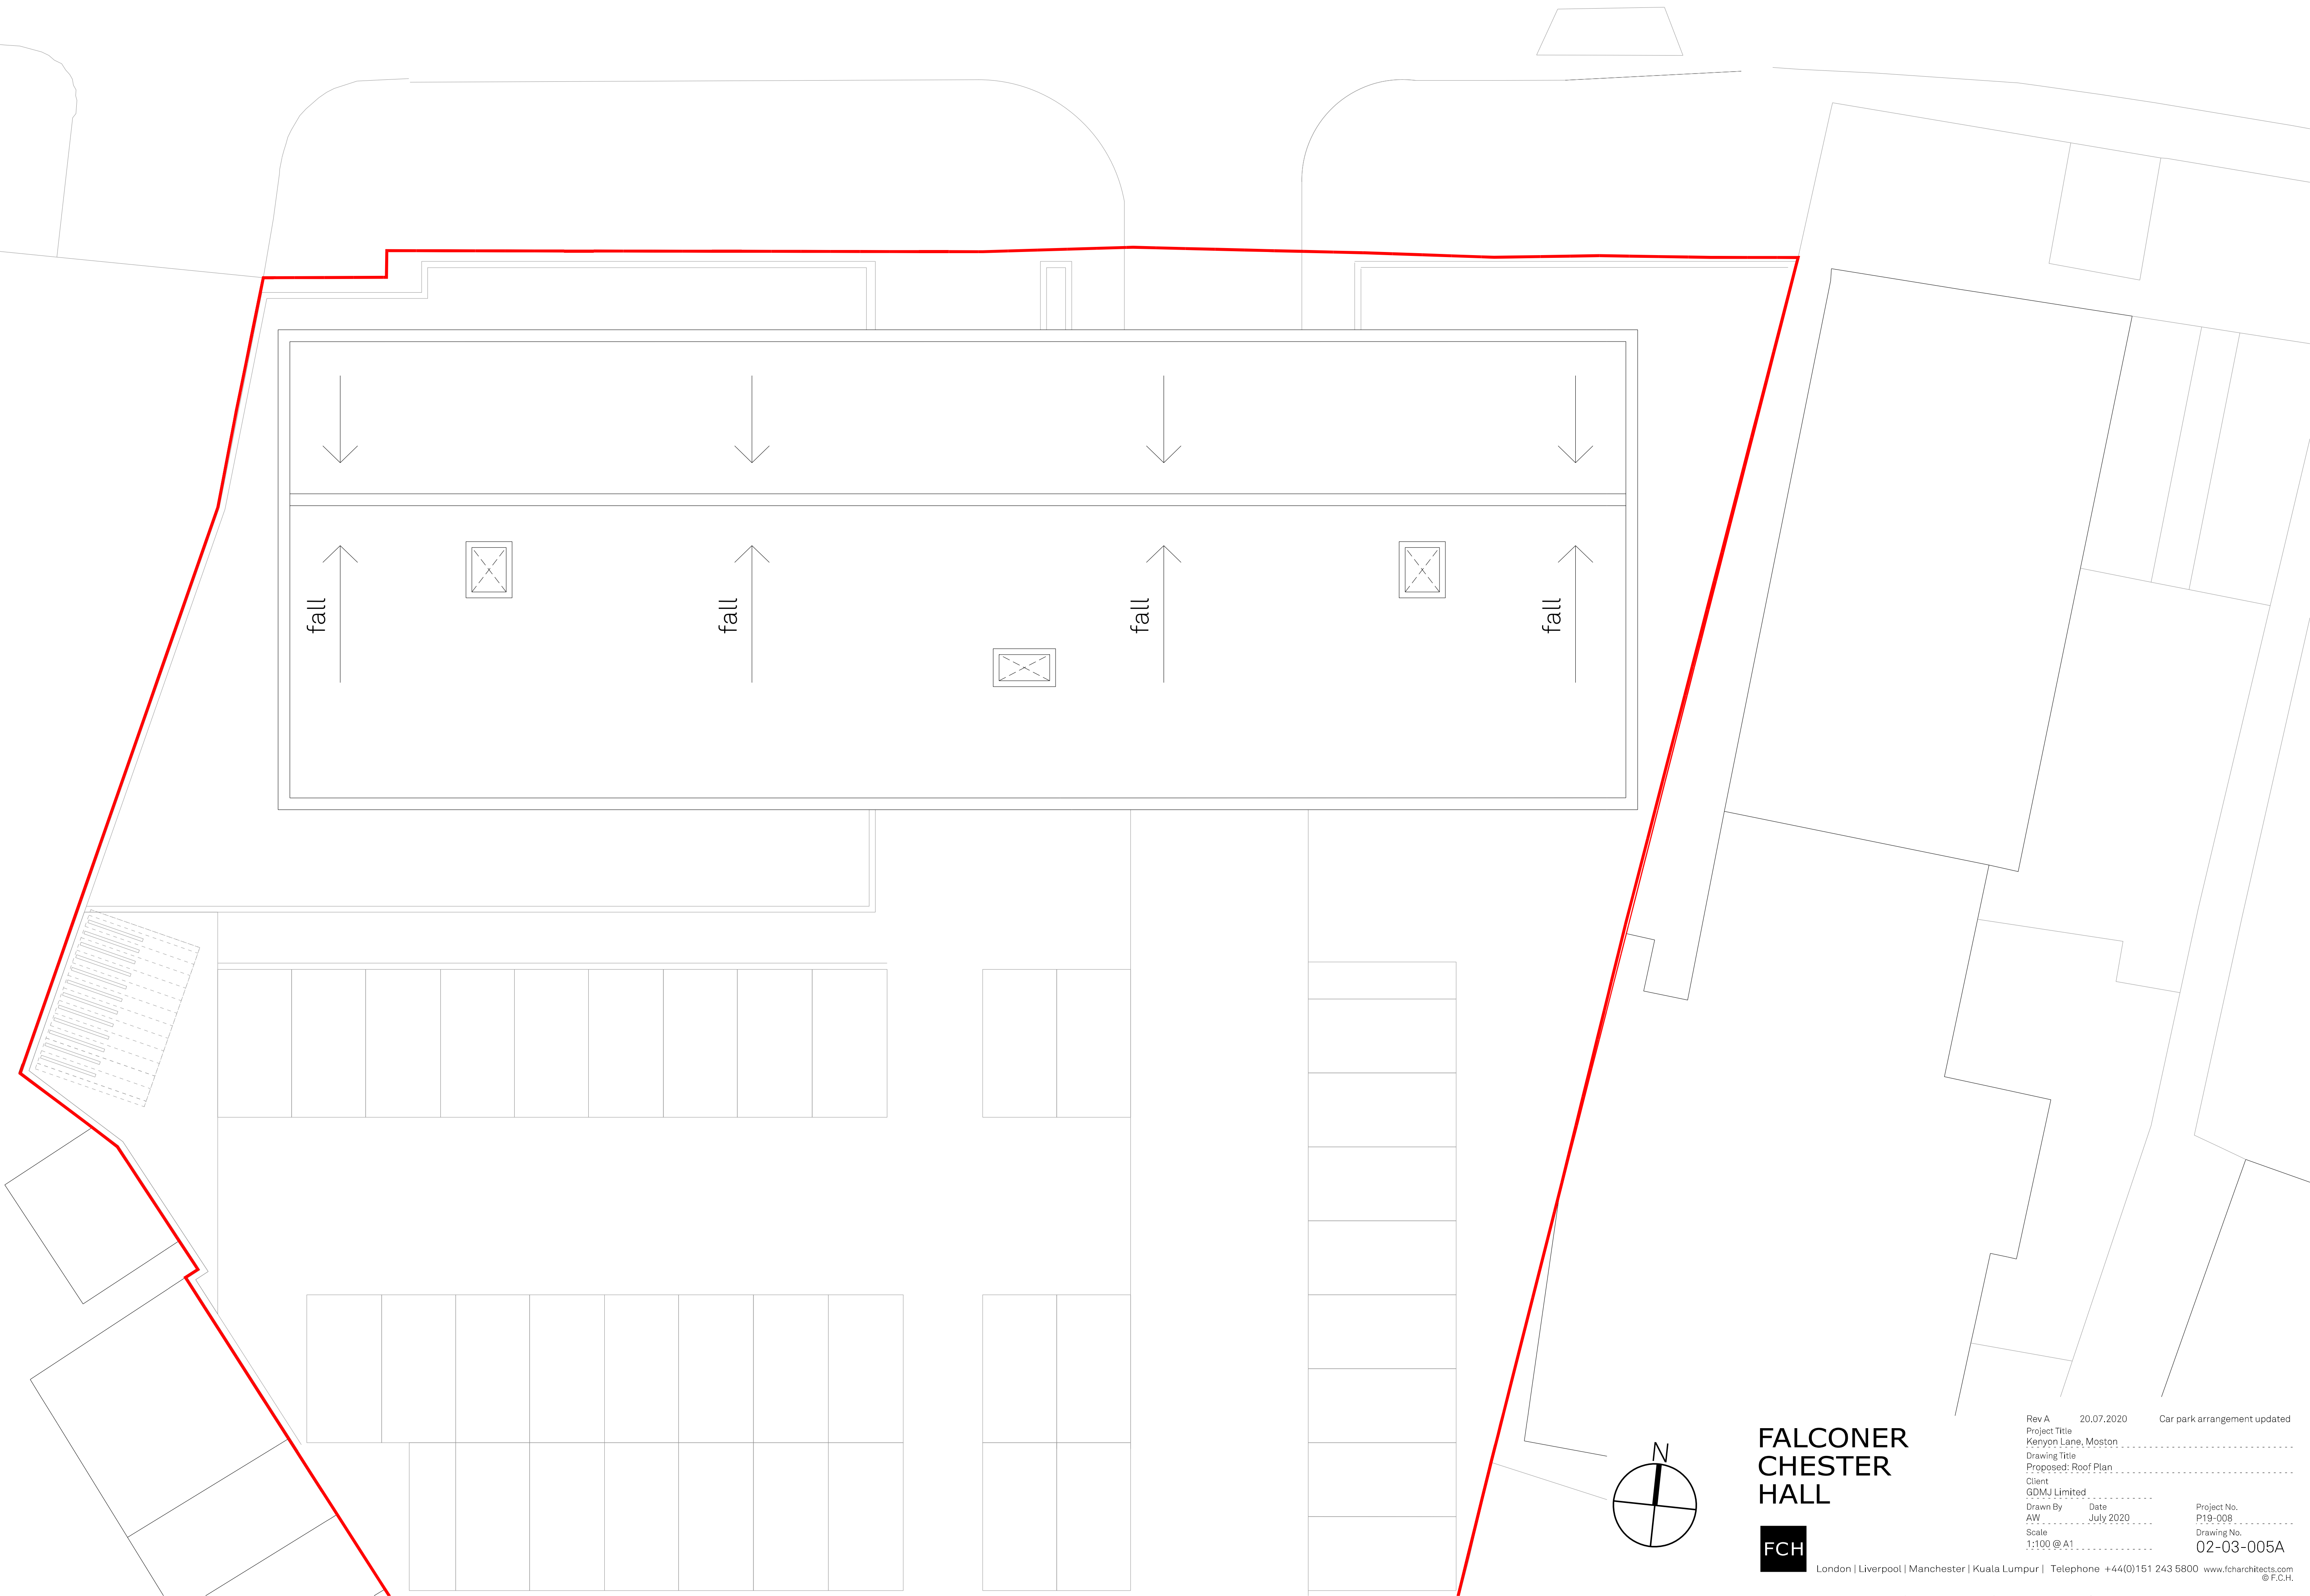

**FALCONER
CHESTER
HALL**



London | Liverpool | Manchester | Kuala Lumpur | Telephone +44(0)151 243 5800 www.fcharchitects.com © F.C.H.

Rev A	20.07.2020	Car park arrangement updated
Project Title Kenyon Lane, Moston		
Drawing Title Proposed: Roof Plan		
Client GDMJ Limited		
Drawn By	Date	Project No.
AW	July 2020	P19-008
Scale		Drawing No.
1:100 @ A1		02-03-005A

APPENDIX II
ORDNANCE SURVEY HISTORICAL MAPPING

Historical Mapping Legends

Ordnance Survey County Series 1:10,560

	Gravel Pit		Sand Pit		Other Pits
	Quarry		Shingle		Orchard
	Osiers		Reeds		Marsh
	Mixed Wood		Deciduous		Brushwood
	Fir		Furze		Rough Pasture
	Arrow denotes flow of water		Trigonometrical Station		
	Site of Antiquities		Bench Mark		
	Pump, Guide Post, Signal Post		Well, Spring, Boundary Post		
	•285 Surface Level				
	Sketched Contour		Instrumental Contour		
	Main Roads		Minor Roads		
	Sunken Road		Raised Road		
	Road over Railway		Railway over River		
	Railway over Road		Level Crossing		
	Road over River or Canal		Road over Stream		
	Road over Stream				
	County Boundary (Geographical)				
	County & Civil Parish Boundary				
	Administrative County & Civil Parish Boundary				
	County Borough Boundary (England)				
	County Burgh Boundary (Scotland)				
	Rural District Boundary				
	Civil Parish Boundary				

Ordnance Survey Plan 1:10,000

	Chalk Pit, Clay Pit or Quarry		Gravel Pit
	Sand Pit		Disused Pit or Quarry
	Refuse or Slag Heap		Lake, Loch or Pond
	Dunes		Boulders
	Coniferous Trees		Non-Coniferous Trees
	Orchard		Scrub
	Bracken		Heath
	Marsh		Reeds
	Building		Glasshouse
	Sloping Masonry		Pylon
	Cutting		Embankment
	Road Under		Road Over
	Level Crossing		Foot Bridge
	Standard Gauge Multiple Track		Standard Gauge Single Track
	Siding, Tramway or Mineral Line		Narrow Gauge
	Geographical County		Administrative County, County Borough or County of City
	Municipal Borough, Urban or Rural District, Burgh or District Council		Borough, Burgh or County Constituency
	Civil Parish		
	BP, BS Boundary Post or Stone		Police Station
	Church		Post Office
	Club House		Public Convenience
	Fire Engine Station		Public House
	Foot Bridge		Signal Box
	Fountain		Spring
	Guide Post		Telephone Call Box
	Mile Post		Telephone Call Post
	Mile Stone		Well

1:10,000 Raster Mapping

	Gravel Pit		Refuse tip or slag heap
	Rock		Rock (scattered)
	Boulders		Boulders (scattered)
	Shingle		Mud
	Sand		Sand Pit
	Slopes		Top of cliff
	General detail		Underground detail
	Overhead detail		Narrow gauge railway
	Multi-track railway		Single track railway
	County boundary (England only)		Civil, parish or community boundary
	District, Unitary, Metropolitan, London Borough boundary		Constituency boundary
	Area of wooded vegetation		Non-coniferous trees
	Non-coniferous trees (scattered)		Coniferous trees
	Coniferous trees (scattered)		Positioned tree
	Orchard		Coppice or Osiers
	Rough Grassland		Heath
	Scrub		Marsh, Salt Marsh or Reeds
	Water feature		Flow arrows
	Mean high water (springs)		Mean low water (springs)
	Telephone line (where shown)		Electricity transmission line (with poles)
	Bench mark (where shown)		Triangulation station
	Point feature (e.g. Guide Post or Mile Stone)		Pylon, flare stack or lighting tower
	Site of (antiquity)		Glasshouse
	General Building		Important Building


Envirocheck®

LANDMARK INFORMATION GROUP®

Historical Mapping & Photography included:

Mapping Type	Scale	Date	Pg
Lancashire And Furness	1:10,560	1848	3
Cheshire	1:10,560	1882	4
Lancashire And Furness	1:10,560	1894	5
Lancashire And Furness	1:10,560	1909 - 1910	6
Lancashire And Furness	1:10,560	1923	7
Lancashire And Furness	1:10,560	1932 - 1933	8
Lancashire And Furness	1:10,560	1938	9
Ordnance Survey Plan	1:10,000	1956	10
Ordnance Survey Plan	1:10,000	1966	11
Manchester	1:25,000	1975	12
Ordnance Survey Plan	1:10,000	1978	13
Ordnance Survey Plan	1:10,000	1982	14
Ordnance Survey Plan	1:10,000	1990	15
10K Raster Mapping	1:10,000	1999	16
10K Raster Mapping	1:10,000	2006	17
VectorMap Local	1:10,000	2020	18

Historical Map - Slice A

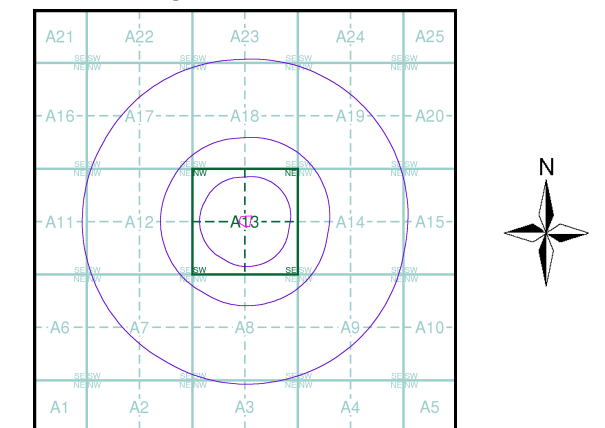

Order Details

Order Number: 243731150_1_1
Customer Ref: 10/1559
National Grid Reference: 387240, 401470
Slice: A
Site Area (Ha): 0.42
Search Buffer (m): 1000

Site Details

112, Kenyon Lane, MANCHESTER, M40 9DH

Landmark®
INFORMATION GROUP

Tel: 0844 844 9952
Fax: 0844 844 9951
Web: www.envirocheck.co.uk

Russian Military Mapping Legends

1:5,000 and 1:10,000 mapping

a. Not drawn to scale b. Drawn to scale

Government and Administrative Buildings Military and Industrial Buildings

Military and Communication Areas Subway Entrance

Fireproof Building Prominent Fireproof Building

Non-fireproof Building Non-fireproof Building (non-dwelling)

Factory, mill, and flour mill, with chimneys Factory, mill, and flour mill, without chimneys

Power Station, drawn to scale Hydroelectric Power Station

Radio Station, drawn to scale Telephone Station, drawn to scale

Abandoned Open-pit Mine or Quarry Open-pit Salt Mine

Pit Oil Deposit or Well Oil Seepage

Tailings Pile Fuel Storage Tanks Natural Gas Tank

Bench Mark Drill Hole Burial Mound Triangulation Point on Burial Mound

Single-track Railroad Double-track Railroad and Station Building

Coniferous Forest Deciduous Forest Mixed Forest

Lawns Citrus Orchard Wet Ground Scattered Vegetation

243.8 Values for prominent elevations

186.0 Numbers for spot elevations, depth soundings, contour lines, etc.

0.2 Velocity of the current, width of river bed, depth of river

180/12 Fractional terms: length and capacity of bridges; depth of fords and condition of the river bottom; height of forest and the diameter of trees

Russian Alphabet (For reference and phonetic interpretation of map text)

А а (A)	З з (Z)	П п (P)	Ч ч (CH)
Б б (B)	И и (I)	Р р (R)	Ш ш (SH)
В в (V)	Й й (Y)	С с (S)	Щ щ (SHCH)
Г г (G)	К к (K)	Т т (T)	Ъ (-)
Д д (D)	Л л (L)	У у (U)	Ы (Y)
Е е (E)	М м (M)	Ф ф (F)	Ь (')
Ё ё (YO)	Н н (N)	Х х (KH)	Э э (E)
Ж ж (ZH)	О о (O)	Ц ц (TS)	Ю ю (YU or IU)
			Я я (YA or IA)

1:25,000 mapping

a. Not drawn to scale b. Drawn to scale

Government and Administrative Buildings Military and Industrial Buildings

Military and Communication Areas Subway Entrance

Partly Demolished Buildings Demolished Buildings

Built-Up Area with Fireproof Buildings Predominant Built-Up Area with Non-Fireproof Buildings Predominant

Individual Fireproof Building Prominent Industrial Building

Individual Dwelling, Fireproof Ruins of an Individual Dwelling

Factory or Mill Chimney Factory or Mill with Chimney Factory or Mill without Chimney Mine or Open Pit Mine

Operating Shaft or Mine Non-Operating Shaft or Mine Salt Mine Tailings Pile

Pit Stone Quarry Gas Pump or Service Station Fuel Storage or Natural Gas Tank

Oil or Natural Gas Derrick Small Hydroelectric Power Station Power Station Transformer Station

Cemetery Burial Mound (height in metres) Triangulation Point on Burial Mound Triangulation Point

Bench Mark Bench Mark (monumented) Telegraph Office Telephone Station

Radio Station Radio Tower Airfield or Seaplane Base Landing Strip

Telegraph/Telephone Lines Main Highway Highway under Construction Improved Dirt Road (former truck road)

Double-track Railroad with First Class Station Dismantled Railroad Railroad Under Construction

Shore Embankment River or Ditch with Embankment Direction and velocity of current Water Gauge Water Level Mark

Well Water Reservoir or Rain Water Pit Spring Isobath with value

Heavy (Index) Contour Line Contour Line and Value Half Contour Line Spot Elevation Value

Coniferous Deciduous Mixed Scrub

Key to Numbers on Mapping

SD80_Manchester

No.	Description
24	Depot (Railway)
75	Factory (Locomotives And Railway Carriage Repairs)
111	Factory (Radio Electronics)
233	Factory (Textiles)


Envirocheck®

LANDMARK INFORMATION GROUP®

Historical Mapping & Photography included:

Mapping Type	Scale	Date	Pg
Lancashire And Furness	1:10,560	1848	3
Cheshire	1:10,560	1882	4
Lancashire And Furness	1:10,560	1894	5
Lancashire And Furness	1:10,560	1909 - 1910	6
Lancashire And Furness	1:10,560	1923	7
Lancashire And Furness	1:10,560	1932 - 1933	8
Lancashire And Furness	1:10,560	1938	9
Ordnance Survey Plan	1:10,000	1956	10
Ordnance Survey Plan	1:10,000	1966	11
Manchester	1:25,000	1975	12
Ordnance Survey Plan	1:10,000	1978	13
Ordnance Survey Plan	1:10,000	1982	14
Ordnance Survey Plan	1:10,000	1990	15
10K Raster Mapping	1:10,000	1999	16
10K Raster Mapping	1:10,000	2006	17
VectorMap Local	1:10,000	2020	18

Russian Map - Slice A

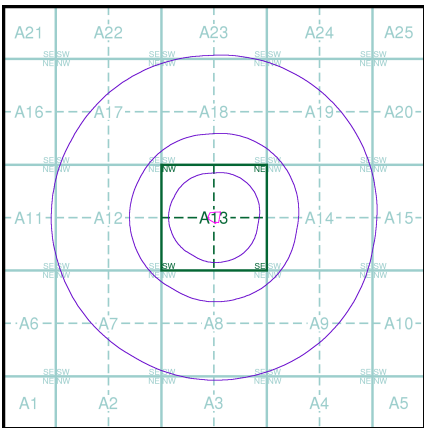

Order Details

Order Number: 243731150_1_1
Customer Ref: 10/1559
National Grid Reference: 387240, 401470
Slice: A
Site Area (Ha): 0.42
Search Buffer (m): 1000

Site Details

112, Kenyon Lane, MANCHESTER, M40 9DH

Landmark®
INFORMATION GROUP

Tel: 0844 844 9952
Fax: 0844 844 9951
Web: www.envirocheck.co.uk