
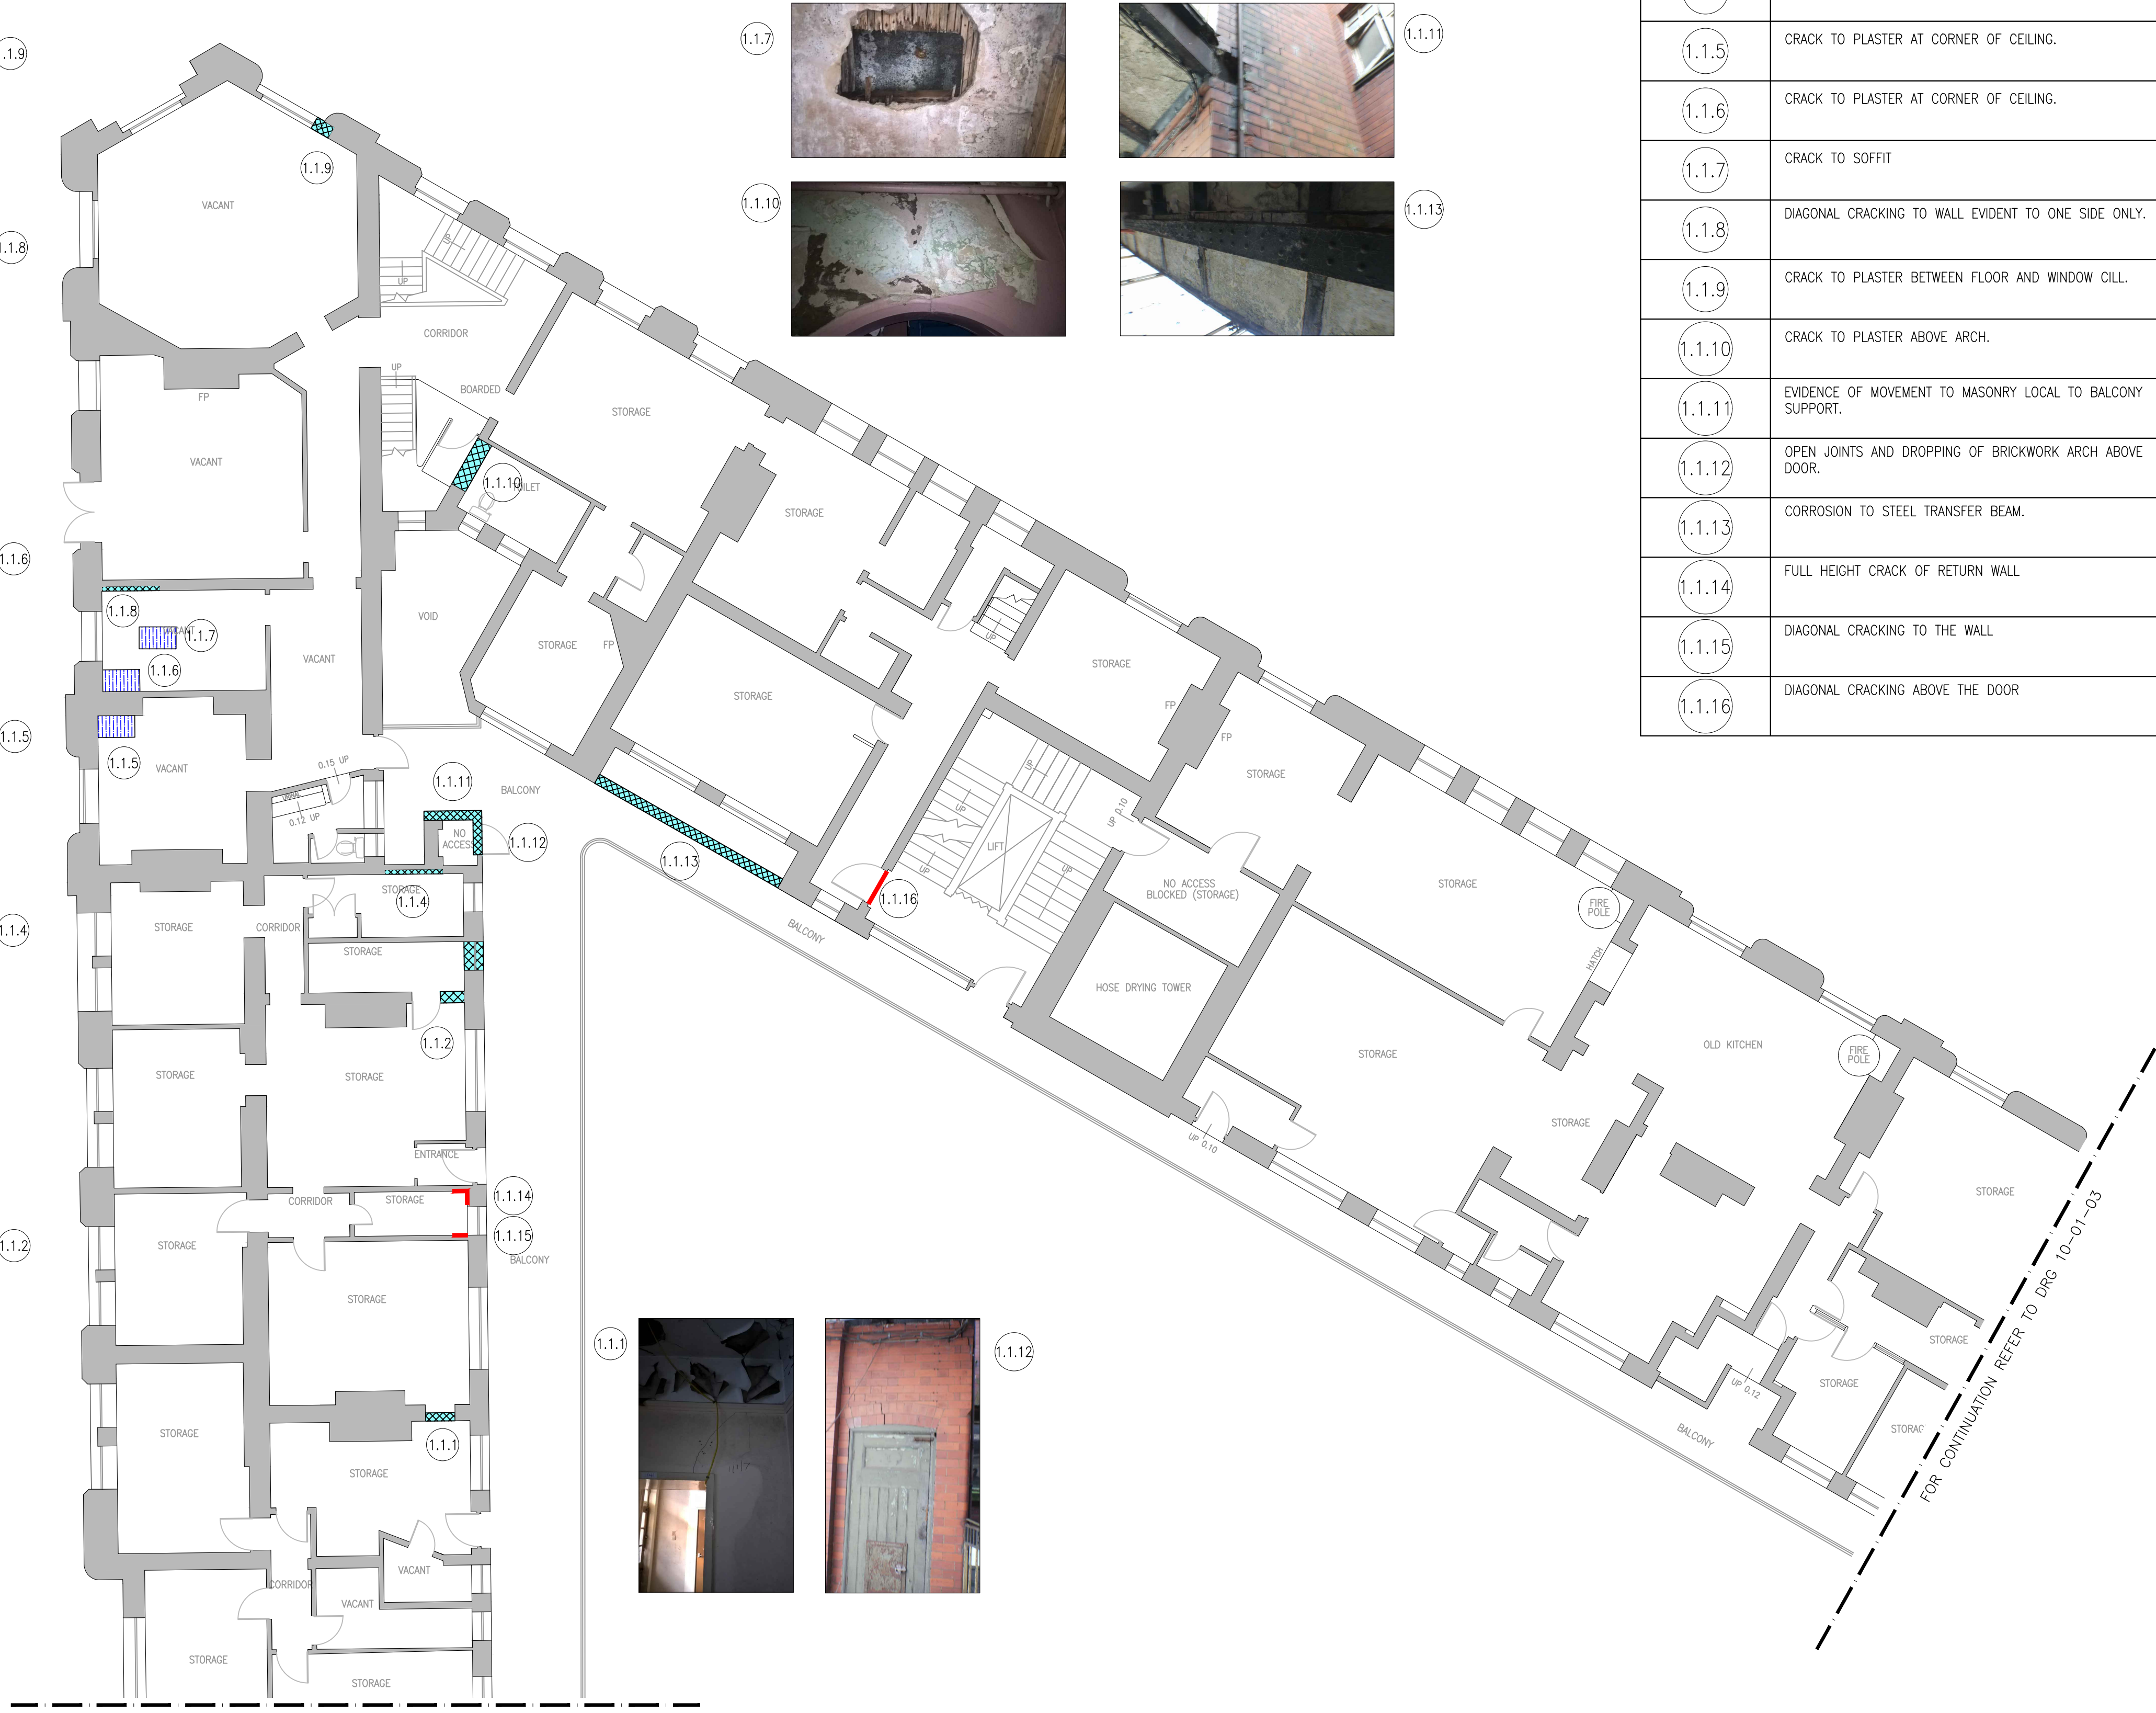
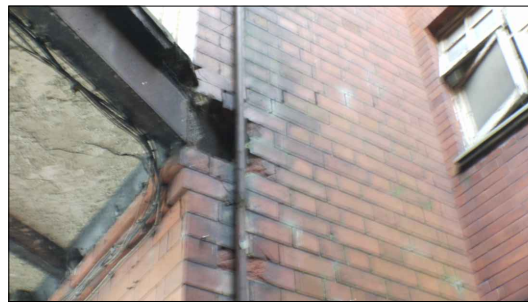
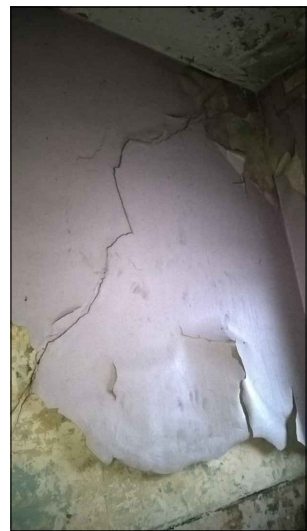
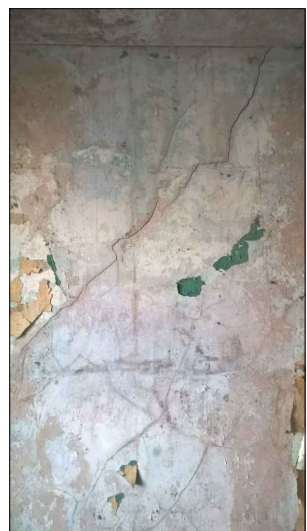


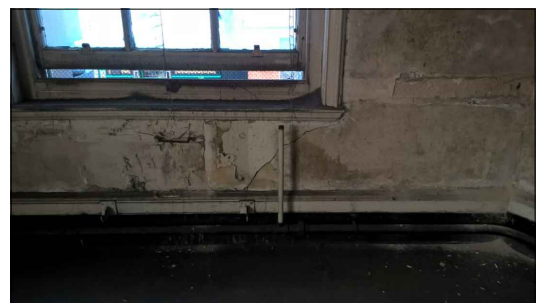


PLAN ON EXISTING FIRST FLOOR
SCALE 1:100

REF	OBSERVATION
1.1.1	CRACK ABOVE DOOR. EXISTING MONITORING POINTS 40-42.
1.1.2	HIGH LEVEL CRACK BETWEEN WALL AND DOOR HEAD.
1.1.4	DIAGONAL CRACKING TO WALL EVIDENT TO ONE SIDE ONLY.
1.1.5	CRACK TO PLASTER AT CORNER OF CEILING.
1.1.6	CRACK TO PLASTER AT CORNER OF CEILING.
1.1.7	CRACK TO SOFFIT
1.1.8	DIAGONAL CRACKING TO WALL EVIDENT TO ONE SIDE ONLY.
1.1.9	CRACK TO PLASTER BETWEEN FLOOR AND WINDOW CILL.
1.1.10	CRACK TO PLASTER ABOVE ARCH.
1.1.11	EVIDENCE OF MOVEMENT TO MASONRY LOCAL TO BALCONY SUPPORT.
1.1.12	OPEN JOINTS AND DROPPING OF BRICKWORK ARCH ABOVE DOOR.
1.1.13	CORROSION TO STEEL TRANSFER BEAM.
1.1.14	FULL HEIGHT CRACK OF RETURN WALL
1.1.15	DIAGONAL CRACKING TO THE WALL
1.1.16	DIAGONAL CRACKING ABOVE THE DOOR

NOTES:

1. THIS DRAWING IS TO BE READ IN CONJUNCTION WITH ALL RELEVANT ARCHITECTS AND ENGINEERS DRAWINGS AND SPECIFICATIONS.
2. DO NOT SCALE THIS DRAWING.
3. ALL DIMENSIONS ARE IN MILLIMETRES UNLESS NOTED OTHERWISE.
4. DRAWING TO BE READ IN CONJUNCTION WITH DETAILED VISUAL SURVEY REPORT BY CURTINS CONSULTING.

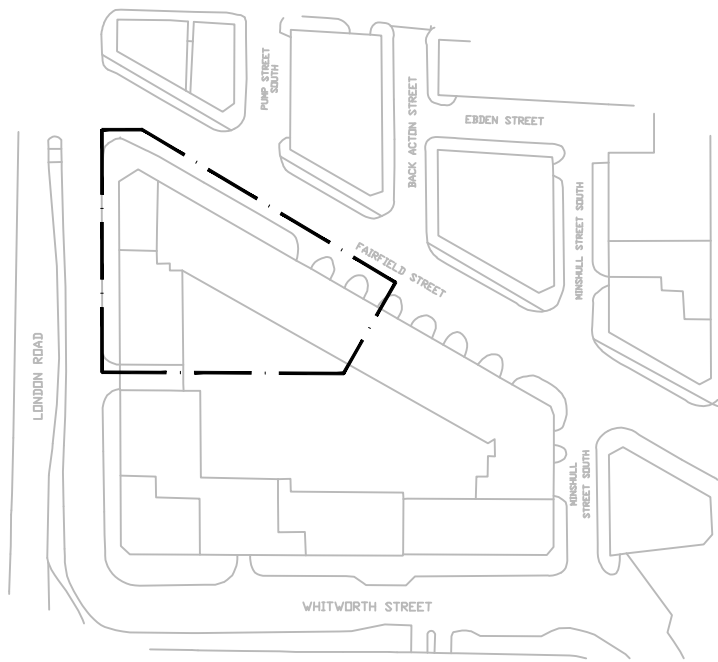

KEY
SCALE 1:1500

V01	INITIAL ISSUE	21/01/20	PC	DS
Rev:	Description:	Date:	By:	Chkd:



Curtins Consulting Ltd,
Merchant Exchange, 17-19 Whitworth Street West, M1 5WG
t: 0161 236 2394
e: manchester@curtins.com
www.curtins.com

Structures • Civils • Environmental • Infrastructure • Transport Planning • Sustainability • Expert Advisory Services
Birmingham • Bristol • Cardiff • Douglas • Edinburgh • Kendal • Leeds • Liverpool • London • Manchester • Nottingham

Status:	INFORMATION
---------	-------------

Project:	LONDON ROAD FIRE STATION
----------	--------------------------

Drg Title:	FIRST FLOOR OBSERVATIONS SHEET 1 OF 3
------------	--

Scale:	Size:	First Issue:	Drawn:	Checked:
AS SHOWN	A1	05.04.16	CH	PB

Drg No:	Rev:
060270 / 10-01-01	V01