WinCan

Project

Project Name:	UPPER CAMPFIELD MARKET MANCHESTER
Project Date:	21/04/2025
Inspection Standard:	MSCC5 Sewers & Drainage GB (SRM5 Scoring)

WinCan

Table of Contents

Project Name	Project Number	Project Date
UPPER CAMPFIELD MARKET MANCHESTER		21/04/2025

Project Information P-1

Section Item 1: RE09 > BR (RE09X) 1

Section Item 2: EXMH01 > EXMH EXT (EXMH01X) 2

Section Item 3: EXMH02 > EXMH01 (EXMH02X) 3

Section Item 4: EXMH04 > EXMH02 (EXMH04X) 4

Section Item 5: EXMH03 > EXMH02 (EXMH03X) 5

Section Item 6: RE21 > EXMH03 (RE21X) 6

Section Item 7: RE23 > EXMH03 (RE23X) 7

Section Item 8: EX RE20 > EX MH04 (EX RE20X) 8

Section Item 9: RE22 > EXMH04 (RE22X) 9

Section Item 10: RE24.1 > EX MH04 (RE24.1X) 10

Section Item 11: EXMH05 > EXMH01 (EXMH05X) 11

Section Item 12: RE13 > EX MH05 (RE13X) 12

Section Item 13: RE15 > EX MH05 (RE15X) 13

Section Item 15: RE01 > SUBMAIN (RE01X) 14

Section Item 16: RE03 > SUBMAIN (RE03X) 15

Section Item 17: RE04 > SUBMAIN (RE04X) 16

Section Item 18: RE07 > SUBMAIN (RE07X) 17

Section Item 19: RE10 > SUBMAIN (RE10X) 18

Section Item 20: RE11 > SUBMAIN (RE11X) 19

Section Item 21: RE12 > SUBMAIN (RE12X) 20

Section Item 22: RE14 > SUBMAIN (RE14X) 21

Section Item 23: RE17 > SUBMAIN (RE17X) 22

Section Item 24: RE19 > SUBMAIN (RE19X) 23

Section Item 25: RE24 > SUBMAIN (RE24X) 24

Section Item 26: RE25 > SUBMAIN (RE25X) 25

WinCan

Project Information

Project Name	Project Number	Project Date
UPPER CAMPFIELD MARKET MANCHESTER		21/04/2025

WinCan

Section Inspection - 21/04/2025 - RE09X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
1	1	21/04/25	9:56	Not Specified	Not Specified	Not Specified	RE09X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
Not Specified	Not Specified	Not Specified	Not Specified	Not Specified	Not Specified

Town or Village:		**Inspection Direction:**	Upstream	**Upstream Node:**	RE09
Road:		**Inspected Length:**	3.59 m	**Upstream Pipe Depth:**	
Location:		**Total Length:**	3.59 m	**Downstream Node:**	BR
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:		**Dia/Height:**	100 mm
Flow Control:		**Material:**	Vitrified clay
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:		**Lining Material:**	No Lining

Comments:
Recommendations:

Scale: 1:50	Position [m]	Code	Observation	MPEG	Photo	Grade
Depth: m BR						
	0.00	BR	Start node, major connection without manhole, reference: BR			
	3.59	REF	Finish node, rodding eye, reference: RE09			
RE09 Depth: m						

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WinCan

Section Inspection - 21/04/2025 - EXMH01X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
2	1	21/04/25	9:58	Not Specified	Not Specified	Not Specified	EXMH01X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
Not Specified	Not Specified	Not Specified	Not Specified	Not Specified	Not Specified

Town or Village:		**Inspection Direction:**	Downstream	**Upstream Node:**	EXMH01
Road:		**Inspected Length:**	7.56 m	**Upstream Pipe Depth:**	
Location:		**Total Length:**	7.56 m	**Downstream Node:**	EXMH EXT
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:		**Dia/Height:**	225 mm
Flow Control:		**Material:**	Vitrified clay
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:		**Lining Material:**	No Lining

Comments:
Recommendations:

Scale: 1:66	Position [m]	Code	Observation	MPEG	Photo	Grade
Depth: m EXMH01						
	0.00	MH	Start node, manhole, reference: EXMH01			
	7.11	CN	Connection other than junction at 9 o'clock, 150mm dia			
	7.56	MHF	Finish node, manhole, reference: EXMH EXT			
EXMH EXT Depth: m						

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WinCan

Section Inspection - 21/04/2025 - EXMH02X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
3	1	21/04/25	10:08	Not Specified	Not Specified	Not Specified	EXMH02X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
Not Specified	Not Specified	Not Specified	Not Specified	Not Specified	Not Specified

Town or Village:		**Inspection Direction:**	Downstream	**Upstream Node:**	EXMH02
Road:		**Inspected Length:**	12.91 m	**Upstream Pipe Depth:**	
Location:		**Total Length:**	12.91 m	**Downstream Node:**	EXMH01
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:		**Dia/Height:**	225 mm
Flow Control:		**Material:**	Vitrified clay
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:		**Lining Material:**	No Lining

Comments:
Recommendations:

Scale: 1:112

Position [m]	Code	Observation	MPEG	Photo	Grade
		Depth: m			
		EXMH02			
0.00	MH	Start node, manhole, reference: EXMH02			
9.78	CN	Connection other than junction at 9 o'clock, 150mm dia			
12.91	MHF	Finish node, manhole, reference: EXMH01			
		EXMH01			
		Depth: m			

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WinCan

Section Inspection - 21/04/2025 - EXMH04X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
4	1	21/04/25	10:12	Not Specified	Not Specified	Not Specified	EXMH04X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
Not Specified	Not Specified	Not Specified	Not Specified	Not Specified	Not Specified

Town or Village:		**Inspection Direction:**	Upstream	**Upstream Node:**	EXMH04
Road:		**Inspected Length:**	14.50 m	**Upstream Pipe Depth:**	
Location:		**Total Length:**	14.50 m	**Downstream Node:**	EXMH02
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:		**Dia/Height:**	150 mm
Flow Control:		**Material:**	Vitrified clay
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:		**Lining Material:**	No Lining

Comments:
Recommendations:

Scale: 1:126	Position [m]	Code	Observation	MPEG	Photo	Grade
Depth: m EXMH02						
	0.00	MH	Start node, manhole, reference: EXMH02			
	7.85	CN	Connection other than junction at 3 o'clock, 150mm dia			
	14.50	MHF	Finish node, manhole, reference: EXMH04			
EXMH04 Depth: m						

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WinCan

Section Inspection - 21/04/2025 - EXMH03X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
5	1	21/04/25	10:14	Not Specified	Not Specified	Not Specified	EXMH03X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
Not Specified	Not Specified	Not Specified	Not Specified	Not Specified	Not Specified

Town or Village:		**Inspection Direction:**	Downstream	**Upstream Node:**	EXMH03
Road:		**Inspected Length:**	7.47 m	**Upstream Pipe Depth:**	
Location:		**Total Length:**	7.47 m	**Downstream Node:**	EXMH02
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:		**Dia/Height:**	150 mm
Flow Control:		**Material:**	Vitrified clay
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:		**Lining Material:**	No Lining

Comments:
Recommendations:

Scale: 1:65	Position [m]	Code	Observation	MPEG	Photo	Grade
Depth: m EXMH03						
	0.00	MH	Start node, manhole, reference: EXMH03			
	5.40	CN	Connection other than junction at 3 o'clock, 150mm dia			
	7.47	BRF	Finish node, major connection without manhole, reference: EXMH02: BACK DROP			
EXMH02 Depth: m						

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WinCan

Section Inspection - 21/04/2025 - RE21X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
6	1	21/04/25	10:18	Not Specified	Not Specified	Not Specified	RE21X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
Not Specified	Not Specified	Not Specified	Not Specified	Not Specified	Not Specified

Town or Village:		**Inspection Direction:**	Upstream	**Upstream Node:**	RE21
Road:		**Inspected Length:**	4.03 m	**Upstream Pipe Depth:**	
Location:		**Total Length:**	4.03 m	**Downstream Node:**	EXMH03
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:		**Dia/Height:**	150 mm
Flow Control:		**Material:**	Vitrified clay
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:		**Lining Material:**	No Lining

Comments:
Recommendations:

Scale: 1:50

Position [m]	Code	Observation	MPEG	Photo	Grade
		Depth: m			
		EXMH03			
0.00	MH	Start node, manhole, reference: EXMH03			
0.37	CN	Connection other than junction at 3 o'clock, 150mm dia			
3.44	CN	Connection other than junction at 3 o'clock, 150mm dia			
4.03	REF	Finish node, rodding eye, reference: RE21			
		RE21			
		Depth: m			

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WinCan

Section Inspection - 21/04/2025 - RE23X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
7	1	21/04/25	10:21	Not Specified	Not Specified	Not Specified	RE23X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
Not Specified	Not Specified	Not Specified	Not Specified	Not Specified	Not Specified


Town or Village:		**Inspection Direction:**	Upstream	**Upstream Node:**	RE23
Road:		**Inspected Length:**	14.73 m	**Upstream Pipe Depth:**	
Location:		**Total Length:**	14.73 m	**Downstream Node:**	EXMH03
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:		**Dia/Height:**	150 mm
Flow Control:		**Material:**	Vitrified clay
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:		**Lining Material:**	No Lining

Comments:
Recommendations:

Scale: 1:128 **Position [m]** **Code** **Observation** **MPEG** **Photo** **Grade**

Depth: m
EXMH03

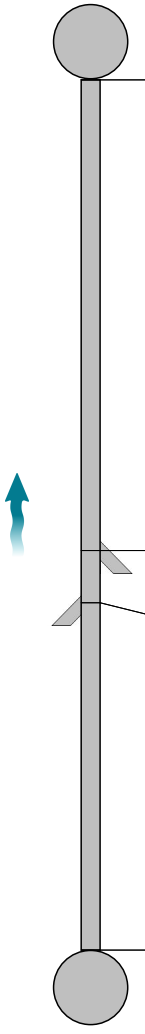

Position [m]	Code	Observation
0.00	MH	Start node, manhole, reference: EXMH03
7.97	CN	Connection other than junction at 9 o'clock, 150mm dia
8.85	CN	Connection other than junction at 3 o'clock, 150mm dia
14.73	REF	Finish node, rodding eye, reference: RE23

RE23
Depth: m

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WinCan

Section Inspection - 21/04/2025 - EX RE20X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
8	1	21/04/25	10:24	Not Specified	Not Specified	Not Specified	EX RE20X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
Not Specified	Not Specified	Not Specified	Not Specified	Not Specified	Not Specified

Town or Village:		**Inspection Direction:**	Upstream	**Upstream Node:**	EX RE20
Road:		**Inspected Length:**	11.57 m	**Upstream Pipe Depth:**	
Location:		**Total Length:**	11.57 m	**Downstream Node:**	EX MH04
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:		**Dia/Height:**	150 mm
Flow Control:		**Material:**	Vitrified clay
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:		**Lining Material:**	No Lining

Comments:
Recommendations:

Scale: 1:101	Position [m]	Code	Observation	MPEG	Photo	Grade
Depth: m EX MH04						
	0.00	MH	Start node, manhole, reference: EX MH04			
	5.26	CN	Connection other than junction at 9 o'clock, 150mm dia			
	9.19	CN	Connection other than junction at 3 o'clock, 150mm dia			
	11.57	REF	Finish node, rodding eye, reference: EX RE20			
EX RE20 Depth: m						

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WinCan

Section Inspection - 21/04/2025 - RE22X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
9	1	21/04/25	10:28	Not Specified	Not Specified	Not Specified	RE22X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
Not Specified	Not Specified	Not Specified	Not Specified	Not Specified	Not Specified

Town or Village:		**Inspection Direction:**	Upstream	**Upstream Node:**	RE22
Road:		**Inspected Length:**	19.20 m	**Upstream Pipe Depth:**	
Location:		**Total Length:**	19.20 m	**Downstream Node:**	EXMH04
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:		**Dia/Height:**	150 mm
Flow Control:		**Material:**	Vitrified clay
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:		**Lining Material:**	No Lining

Comments:
Recommendations:

Scale: 1:167	Position [m]	Code	Observation	MPEG	Photo	Grade
Depth: m EXMH04						
	0.00	MH	Start node, manhole, reference: EXMH04			
	5.26	CN	Connection other than junction at 3 o'clock, 150mm dia			
	7.63	CN	Connection other than junction at 9 o'clock, 150mm dia			
	10.73	CN	Connection other than junction at 3 o'clock, 150mm dia			
	14.89	CN	Connection other than junction at 3 o'clock, 150mm dia			
	17.30	CN	Connection other than junction at 9 o'clock, 150mm dia			
	19.20	REF	Finish node, rodding eye, reference: RE22			
RE22 Depth: m						

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WinCan

Section Inspection - 21/04/2025 - RE24.1X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
10	1	21/04/25	10:30	Not Specified	Not Specified	Not Specified	RE24.1X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
Not Specified	Not Specified	Not Specified	Not Specified	Not Specified	Not Specified

Town or Village:		**Inspection Direction:**	Upstream	**Upstream Node:**	RE24.1
Road:		**Inspected Length:**	5.51 m	**Upstream Pipe Depth:**	
Location:		**Total Length:**	5.51 m	**Downstream Node:**	EX MH04
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:		**Dia/Height:**	150 mm
Flow Control:		**Material:**	Vitrified clay
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:		**Lining Material:**	No Lining

Comments:
Recommendations:

Scale: 1:50	Position [m]	Code	Observation	MPEG	Photo	Grade
Depth: m EX MH04						
	0.00	MH	Start node, manhole, reference: EX MH04			
	1.00	CN	Connection other than junction at 3 o'clock, 150mm dia			
	3.08	CN	Connection other than junction at 3 o'clock, 150mm dia			
	5.51	REF	Finish node, rodding eye, reference: RE24.1			
RE24.1 Depth: m						

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WinCan

Section Inspection - 21/04/2025 - EXMH05X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
11	1	21/04/25	10:33	Not Specified	Not Specified	Not Specified	EXMH05X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
Not Specified	Not Specified	Not Specified	Not Specified	Not Specified	Not Specified

Town or Village:		**Inspection Direction:**	Downstream	**Upstream Node:**	EXMH05
Road:		**Inspected Length:**	20.57 m	**Upstream Pipe Depth:**	
Location:		**Total Length:**	20.57 m	**Downstream Node:**	EXMH01
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:		**Dia/Height:**	150 mm
Flow Control:		**Material:**	Vitrified clay
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:		**Lining Material:**	No Lining

Comments:
Recommendations:

Scale: 1:179	Position [m]	Code	Observation	MPEG	Photo	Grade
Depth: m EXMH05						
	0.00	MH	Start node, manhole, reference: EXMH05			
	20.57	MHF	Finish node, manhole, reference: EXMH01			
EXMH01 Depth: m						

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WinCan

Section Inspection - 21/04/2025 - RE13X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
12	1	21/04/25	10:35	Not Specified	Not Specified	Not Specified	RE13X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
Not Specified	Not Specified	Not Specified	Not Specified	Not Specified	Not Specified

Town or Village:		**Inspection Direction:**	Upstream	**Upstream Node:**	RE13
Road:		**Inspected Length:**	14.73 m	**Upstream Pipe Depth:**	
Location:		**Total Length:**	14.73 m	**Downstream Node:**	EX MH05
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:		**Dia/Height:**	100 mm
Flow Control:		**Material:**	Vitrified clay
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:		**Lining Material:**	No Lining

Comments:
Recommendations:

Scale: 1:128	Position [m]	Code	Observation	MPEG	Photo	Grade
Depth: m EX MH05						
	0.00	MH	Start node, manhole, reference: EX MH05			
	12.45	CN	Connection other than junction at 3 o'clock, 100mm dia			
	14.73	REF	Finish node, rodding eye, reference: RE13			
RE13 Depth: m						

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WinCan

Section Inspection - 21/04/2025 - RE15X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
13	1	21/04/25	10:37	Not Specified	Not Specified	Not Specified	RE15X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
Not Specified	Not Specified	Not Specified	Not Specified	Not Specified	Not Specified

Town or Village:		**Inspection Direction:**	Upstream	**Upstream Node:**	RE15
Road:		**Inspected Length:**	10.50 m	**Upstream Pipe Depth:**	
Location:		**Total Length:**	10.50 m	**Downstream Node:**	EX MH05
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:		**Dia/Height:**	100 mm
Flow Control:		**Material:**	Vitrified clay
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:		**Lining Material:**	No Lining

Comments:
Recommendations:

Scale: 1:91	Position [m]	Code	Observation	MPEG	Photo	Grade
Depth: m EX MH05						
	0.00	MH	Start node, manhole, reference: EX MH05			
	4.30	CN	Connection other than junction at 3 o'clock, 100mm dia			
	10.50	REF	Finish node, rodding eye, reference: RE15			
RE15 Depth: m						

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WinCan

Section Inspection - 21/04/2025 - RE01X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
15	1	21/04/25	10:41	Not Specified	Not Specified	Not Specified	RE01X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
Not Specified	Not Specified	Not Specified	Not Specified	Not Specified	Not Specified

Town or Village:		**Inspection Direction:**	Downstream	**Upstream Node:**	RE01
Road:		**Inspected Length:**	1.87 m	**Upstream Pipe Depth:**	
Location:		**Total Length:**	1.87 m	**Downstream Node:**	SUBMAIN
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:		**Dia/Height:**	100 mm
Flow Control:		**Material:**	Vitrified clay
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:		**Lining Material:**	No Lining

Comments:
Recommendations:

Scale: 1:50	Position [m]	Code	Observation	MPEG	Photo	Grade
Depth: m RE01						
	0.00	RE	Start node, rodding eye, reference: RE01			
	1.87	BRF	Finish node, major connection without manhole, reference: SUBMAIN			
SUBMAIN Depth: m						

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WinCan

Section Inspection - 21/04/2025 - RE03X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
16	1	21/04/25	10:43	Not Specified	Not Specified	Not Specified	RE03X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
Not Specified	Not Specified	Not Specified	Not Specified	Not Specified	Not Specified

Town or Village:		**Inspection Direction:**	Downstream	**Upstream Node:**	RE03
Road:		**Inspected Length:**	3.57 m	**Upstream Pipe Depth:**	
Location:		**Total Length:**	3.57 m	**Downstream Node:**	SUBMAIN
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:		**Dia/Height:**	100 mm
Flow Control:		**Material:**	Vitrified clay
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:		**Lining Material:**	No Lining

Comments:
Recommendations:

Scale: 1:50



Position [m]	Code	Observation	MPEG	Photo	Grade
0.00	RE	Start node, rodding eye, reference: RE03			
3.57	BRF	Finish node, major connection without manhole, reference: SUBMAIN			

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WinCan

Section Inspection - 21/04/2025 - RE04X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
17	1	21/04/25	10:45	Not Specified	Not Specified	Not Specified	RE04X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
Not Specified	Not Specified	Not Specified	Not Specified	Not Specified	Not Specified

Town or Village:		**Inspection Direction:**	Downstream	**Upstream Node:**	RE04
Road:		**Inspected Length:**	3.07 m	**Upstream Pipe Depth:**	
Location:		**Total Length:**	3.07 m	**Downstream Node:**	SUBMAIN
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:		**Dia/Height:**	100 mm
Flow Control:		**Material:**	Vitrified clay
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:		**Lining Material:**	No Lining

Comments:
Recommendations:

Scale: 1:50	Position [m]	Code	Observation	MPEG	Photo	Grade
Depth: m RE04						
	0.00	RE	Start node, rodding eye, reference: RE04			
	3.07	BRF	Finish node, major connection without manhole, reference: SUBMAIN			
SUBMAIN Depth: m						

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WinCan

Section Inspection - 21/04/2025 - RE07X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
18	1	21/04/25	10:46	Not Specified	Not Specified	Not Specified	RE07X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
Not Specified	Not Specified	Not Specified	Not Specified	Not Specified	Not Specified

Town or Village:		**Inspection Direction:**	Downstream	**Upstream Node:**	RE07
Road:		**Inspected Length:**	5.77 m	**Upstream Pipe Depth:**	
Location:		**Total Length:**	5.77 m	**Downstream Node:**	SUBMAIN
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:		**Dia/Height:**	100 mm
Flow Control:		**Material:**	Vitrified clay
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:		**Lining Material:**	No Lining

Comments:
Recommendations:

Scale: 1:50

Position [m]	Code	Observation	MPEG	Photo	Grade
Depth: m					
RE07					
0.00	RE	Start node, rodding eye, reference: RE07			
5.77	BRF	Finish node, major connection without manhole, reference: SUBMAIN			
SUBMAIN					
Depth: m					

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WinCan

Section Inspection - 21/04/2025 - RE10X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
19	1	21/04/25	10:49	Not Specified	Not Specified	Not Specified	RE10X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
Not Specified	Not Specified	Not Specified	Not Specified	Not Specified	Not Specified

Town or Village:		**Inspection Direction:**	Downstream	**Upstream Node:**	RE10
Road:		**Inspected Length:**	5.06 m	**Upstream Pipe Depth:**	
Location:		**Total Length:**	5.06 m	**Downstream Node:**	SUBMAIN
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:		**Dia/Height:**	100 mm
Flow Control:		**Material:**	Vitrified clay
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:		**Lining Material:**	No Lining

Comments:
Recommendations:

Scale: 1:50

Position [m]	Code	Observation	MPEG	Photo	Grade
Depth: m					
RE10					
0.00	RE	Start node, rodding eye, reference: RE10			
5.06	BRF	Finish node, major connection without manhole, reference: SUBMAIN			
SUBMAIN					
Depth: m					

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WinCan

Section Inspection - 21/04/2025 - RE11X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
20	1	21/04/25	10:52	Not Specified	Not Specified	Not Specified	RE11X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
Not Specified	Not Specified	Not Specified	Not Specified	Not Specified	Not Specified

Town or Village:		**Inspection Direction:**	Downstream	**Upstream Node:**	RE11
Road:		**Inspected Length:**	5.51 m	**Upstream Pipe Depth:**	
Location:		**Total Length:**	5.51 m	**Downstream Node:**	SUBMAIN
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:		**Dia/Height:**	100 mm
Flow Control:		**Material:**	Vitrified clay
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:		**Lining Material:**	No Lining

Comments:
Recommendations:

Scale: 1:50

Position [m]	Code	Observation	MPEG	Photo	Grade
Depth: m					
RE11					
0.00	RE	Start node, rodding eye, reference: RE11			
5.51	BRF	Finish node, major connection without manhole, reference: SUBMAIN			
SUBMAIN					
Depth: m					

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WinCan

Section Inspection - 21/04/2025 - RE12X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
21	1	21/04/25	10:53	Not Specified	Not Specified	Not Specified	RE12X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
Not Specified	Not Specified	Not Specified	Not Specified	Not Specified	Not Specified

Town or Village:		**Inspection Direction:**	Downstream	**Upstream Node:**	RE12
Road:		**Inspected Length:**	15.05 m	**Upstream Pipe Depth:**	
Location:		**Total Length:**	15.05 m	**Downstream Node:**	SUBMAIN
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:		**Dia/Height:**	100 mm
Flow Control:		**Material:**	Vitrified clay
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:		**Lining Material:**	No Lining

Comments:
Recommendations:

Scale: 1:131

Position [m]	Code	Observation	MPEG	Photo	Grade
Depth: m					
RE12					
0.00	RE	Start node, rodding eye, reference: RE12			
2.41	CN	Connection other than junction at 9 o'clock, 100mm dia			
15.05	BRF	Finish node, major connection without manhole, reference: SUBMAIN			
SUBMAIN					
Depth: m					

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WinCan

Section Inspection - 21/04/2025 - RE14X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
22	1	21/04/25	10:55	Not Specified	Not Specified	Not Specified	RE14X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
Not Specified	Not Specified	Not Specified	Not Specified	Not Specified	Not Specified

Town or Village:		**Inspection Direction:**	Downstream	**Upstream Node:**	RE14
Road:		**Inspected Length:**	10.72 m	**Upstream Pipe Depth:**	
Location:		**Total Length:**	10.72 m	**Downstream Node:**	SUBMAIN
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:		**Dia/Height:**	100 mm
Flow Control:		**Material:**	Vitrified clay
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:		**Lining Material:**	No Lining

Comments:
Recommendations:

Scale: 1:93

Position [m]	Code	Observation	MPEG	Photo	Grade
Depth: m					
RE14					
0.00	RE	Start node, rodding eye, reference: RE14			
6.04	CN	Connection other than junction at 9 o'clock, 100mm dia			
10.72	BRF	Finish node, major connection without manhole, reference: SUBMAIN			
SUBMAIN					
Depth: m					

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WinCan

Section Inspection - 21/04/2025 - RE17X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
23	1	21/04/25	11:06	Not Specified	Not Specified	Not Specified	RE17X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
Not Specified	Not Specified	Not Specified	Not Specified	Not Specified	Not Specified

Town or Village:		**Inspection Direction:**	Downstream	**Upstream Node:**	RE17
Road:		**Inspected Length:**	10.85 m	**Upstream Pipe Depth:**	
Location:		**Total Length:**	10.85 m	**Downstream Node:**	SUBMAIN
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:		**Dia/Height:**	100 mm
Flow Control:		**Material:**	Vitrified clay
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:		**Lining Material:**	No Lining

Comments:
Recommendations:

Scale: 1:94	Position [m]	Code	Observation	MPEG	Photo	Grade
Depth: m RE17						
	0.00	RE	Start node, rodding eye, reference: RE17			
	10.85	BRF	Finish node, major connection without manhole, reference: SUBMAIN			
SUBMAIN Depth: m						

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WinCan

Section Inspection - 21/04/2025 - RE19X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
24	1	21/04/25	11:09	Not Specified	Not Specified	Not Specified	RE19X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
Not Specified	Not Specified	Not Specified	Not Specified	Not Specified	Not Specified

Town or Village:		**Inspection Direction:**	Downstream	**Upstream Node:**	RE19
Road:		**Inspected Length:**	11.81 m	**Upstream Pipe Depth:**	
Location:		**Total Length:**	11.81 m	**Downstream Node:**	SUBMAIN
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:		**Dia/Height:**	100 mm
Flow Control:		**Material:**	Vitrified clay
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:		**Lining Material:**	No Lining

Comments:
Recommendations:

Scale: 1:103	Position [m]	Code	Observation	MPEG	Photo	Grade
Depth: m RE19						
	0.00	RE	Start node, rodding eye, reference: RE19			
	11.81	BRF	Finish node, major connection without manhole, reference: SUBMAIN			
SUBMAIN Depth: m						

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WinCan

Section Inspection - 21/04/2025 - RE24X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
25	1	21/04/25	11:10	Not Specified	Not Specified	Not Specified	RE24X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
Not Specified	Not Specified	Not Specified	Not Specified	Not Specified	Not Specified

Town or Village:		**Inspection Direction:**	Downstream	**Upstream Node:**	RE24
Road:		**Inspected Length:**	4.09 m	**Upstream Pipe Depth:**	
Location:		**Total Length:**	4.09 m	**Downstream Node:**	SUBMAIN
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:		**Dia/Height:**	100 mm
Flow Control:		**Material:**	Vitrified clay
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:		**Lining Material:**	No Lining

Comments:
Recommendations:

Scale: 1:50

Position [m]	Code	Observation	MPEG	Photo	Grade
Depth: m					
RE24					
0.00	RE	Start node, rodding eye, reference: RE24			
4.09	BRF	Finish node, major connection without manhole, reference: SUBMAIN			
SUBMAIN					
Depth: m					

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WinCan

Section Inspection - 21/04/2025 - RE25X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
26	1	21/04/25	11:13	Not Specified	Not Specified	Not Specified	RE25X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
Not Specified	Not Specified	Not Specified	Not Specified	Not Specified	Not Specified

Town or Village:		**Inspection Direction:**	Downstream	**Upstream Node:**	RE25
Road:		**Inspected Length:**	6.87 m	**Upstream Pipe Depth:**	
Location:		**Total Length:**	6.87 m	**Downstream Node:**	SUBMAIN
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:		**Dia/Height:**	100 mm
Flow Control:		**Material:**	Vitrified clay
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:		**Lining Material:**	No Lining

Comments:
Recommendations:

Scale: 1:60	Position [m]	Code	Observation	MPEG	Photo	Grade
Depth: m RE25						
	0.00	RE	Start node, rodding eye, reference: RE25			
	6.87	BRF	Finish node, major connection without manhole, reference: SUBMAIN			
SUBMAIN Depth: m						

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0