

LK/J005374/8259/01

15 January 2025

ACOUSTIC
CONSULTANTS

**2A & 2B HONOR STREET, LONGSIGHT,
MANCHESTER, M13 0WY**

SOUND INSULATION TESTS REPORT

architectural

environmental

occupational

industrial

noise control at source

project management

planning

legal services

expert witness

Report Prepared For:

John Braiden
Braiden Acoustics Limited
Innovation Forum
51 Frederick Road
Salford
Manchester
M6 6FP

email: john@braidenacoustics.co.uk

Report Prepared By:

Liam Kavaney
PDA Ltd.
3 Bridgewater Court
Barsbank Lane
Lymm
Cheshire
WA13 0ER

Association of Noise Consultants Registration Number: 105
Test Report Number: 105/119294

Philip Dunbavin Acoustics Ltd.

3 Bridgewater Court · Barsbank Lane · Lymm · Cheshire WA13 0ER

Tel: 01925 759380 · www.pdaltd.com

Directors: P. R. Dunbavin · J. A. Dunbavin · M. de Salis · E. Evenden · R. Grant
Registered Number 2302847 England

Registered Office: 3 Bridgewater Court Barsbank Lane Lymm, Cheshire, WA13 0ER





Notice to Building Control Officer

Certification of Test Results

ANC operates an online, secure, paperless certification system for sound insulation tests.

The online verification (certification) system means that Building Control Bodies will need to follow the steps below to verify the results quoted in the relevant test report:

1. Go to the ANC secure server at www.theanc.co.uk
2. Navigate to the [ADvANCE](#) page which links to the ANC site available for use by BCOs.
3. Enter the following in the spaces provided:

Task Number: **119294**

Task Password: **KRF8U2**

4. Select role "Building Control Officer" and press "Login"
5. You will then see a summary list of results of all the Tests undertaken to date for this project (Task) as held on the secure primary server and you can print this table for your records.

CONTENTS

1.0 SUMMARY

2.0 TEST DETAILS

- 2.1 Site Description**
- 2.2 Test Details**
- 2.3 Basic Procedure**
- 2.4 Wall Construction**

3.0 TERMS OF REFERENCE

- 3.1 Building Regulations 2010 Approved Document E (2003) – Resistance to the Passage of Sound**

4.0 RESULTS

- 4.1 Background Noise Levels**
- 4.2 Airborne Sound Insulation – Separating Walls**

5.0 DISCUSSION OF RESULTS

- 5.1 Airborne Sound Insulation – Separating Walls**

Results Summary Tables
Equipment List

APPENDIX

PDA Ltd. Test Certificates


1.0 SUMMARY

PDA Ltd was commissioned to carry out sound insulation tests at the new-build residential development between 2a & 2b Honor Street, Longsight, Manchester, M13 0WY. This report is an ANC Registered Report with the unique registration number 105/119294.

Analysis of the test data has shown that the airborne sound insulation of the separating walls tested has met the performance standards given in the Building Regulations Approved Document E 2003 edition, and can be described as having 'passed'.

Report Prepared By:

.....
Liam Kavaney
MIOA
Acoustic Consultant

Report Approved By:

.....
Tom Dixon
BEng MIOA
Acoustic Consultant

Quality Approved By:

.....
Max DeSalis
BEng Hons PhD CEng MIOA
Director

2.0 TEST DETAILS

2.1 Site Description

The tests were conducted at the new build residential development between 2a & 2b Honor Street, Longsight, Manchester, M13 0WY.

The development consists of 2 no. new build semi-detached dwellings on a vacant plot of land to the rear of 309 Dickenson Road.

2.2 Test Details

The tests were conducted on the 13th January 2025. All measurements were made by Liam Kavaney of PDA Ltd, 3 Bridgewater Court, Barsbank Lane, Lymm, Cheshire, WA13 0ER.

PDA Ltd is accredited by the Association of Noise Consultants (ANC), accreditation number 105, to undertake sound insulation testing to demonstrate compliance with the Building Regulations, Approved Document E (2003 edition).

The equipment used during the tests is as listed in Table 3 at the end of this report. The sound level meter was calibrated before and after the tests as appropriate, during which time no significant calibration deviation was observed. The sound level meters, acoustic calibrators and microphones are all covered by current calibration certificates.

The testing methods for airborne and sound insulation were in full accordance with: the suggested methods presented in BS EN ISO 140-parts 4: 1998 "Field Measurements of Airborne Sound Insulation Between Rooms". The results of the tests were analysed in accordance with BS EN ISO 717-parts 1: 1997, amended 2006.

In addition all the procedures in Annex B of Approved Document E, guidance to the Building Regulations, have been followed except the following:

- Annex B indicates that test rooms should have a volume of at least 25m³. The rooms tested were below this and is reported here as per Annex B requirements.

2.3 Basic Procedure

Airborne Sound Insulation

The field testing of structures for airborne sound insulation involves generating a controlled level of noise in one room (the source room) and measuring the resulting noise in the other room (the receiving room), separated from the source room by the element under test. The method follows test procedure 4 (airborne) as given within the ANC Testers' Manual for sound insulation testing in dwellings (Version 2.1). Two sound sources are used and operated in separate positions simultaneously. Spatial and temporal averaging of the noise level in both rooms is carried out by manually sweeping the microphone through a predetermined circular path of travel in a plane not within 10° of any room surface plane. The sweeps are completed over a minimum 30-second period, with one separate measurement cycle being completed in both the source and receiving rooms.

A minimum 30-second manual sweeping of the microphone through a predetermined circular path of travel in a plane not within 10° of any room surface plane was taken in the receiver room for a background noise measurement when the loudspeaker in the source room was turned off.

Corrections are applied to the measured levels for the effects of background noise and acoustic absorption, the latter being characterised by reverberation time measurements. Background noise is measured in the receiving room using the sweep method over a minimum 30-second period. The corrected, measured source room and receiving room levels are used to derive the Standardised Level Difference and the data, in third octave bands, are compared with reference values using defined matching criteria to determine the single figure Weighted Standardised Level Difference. From this data a Spectrum Adaptation term is calculated which gives an indication of the performance of the element when exposed to particular types of noise. This term is additive to the Weighted Standardised Level Difference and is quoted when referring to the element's sound insulation performance.

Reverberation Time Measurement

The reverberation time measurements were conducted in accordance with the engineering method as presented within ISO3382-2:2008. Measurements were carried out within the receiving rooms for each test by recording the decay from a continuous wide band pink noise generator. The equipment was set to measure T20 reverberation decay. Measurements were taken with one loudspeaker location and three randomly selected microphone locations. Measurements were repeated twice at each microphone location.

The source and receiving rooms were as detailed in the results summary in Table 2 at the end of this report.

2.4 Wall Construction

It is understood that the wall construction between dwellings was as follows;

- *Two leaves of 100mm blockwork with 100mm cavity fully filled with insulation finished either side 1 no. layer of 12.5mm Soundbloc plasterboard mounted on dabs with skim finish.*

3.0 TERMS OF REFERENCE

3.1 Building Regulations 2010 Approved Document E (2003) – Resistance to the Passage of Sound

The development is classed as a new-build project and as such the requirements of the Building Regulations are as follows:

Table 1 – Building Regulations ADE sound insulation requirements

Purpose Built Dwelling Houses and Flats	Airborne Sound Insulation $D_{nT,w} + C_{tr}$ dB (minimum values)	Impact Sound Insulation $L'_{nT,w}$ dB (maximum values)
Walls	≥45	-
Floors	≥45	≤62

4.0 RESULTS

4.1 Background Noise Levels

A measurement of typical noise levels was made within the receiver rooms during the tests. The background noise levels were 34 and 37 dB $L_{Aeq,T}$ and comprised of traffic on Dickenson Road. It should be noted that where low background noise levels exist, these are not taken into account by Approved Document E. Consequently, even if a wall or floor is performing satisfactorily it may still be the case that sound can be heard passing between the adjacent spaces, this being a result of a lack of masking provided by the background noise. Please see Section 2.3 for a brief description of the test procedure for background noise measurements.

The test certificates indicate whether the measurements were limited due to background noise. The implications of any limitations are that the sound insulation performance of the separating element would either be equal to or greater than the level calculated and reported here.

4.2 Airborne Sound Insulation – Separating Walls

The airborne noise measurements obtained on site have been processed to produce the standardised level difference (D_{nT}) between the rooms. The D_{nT} is detailed with the weighted standardised level difference $D_{nT,w}$ and the C_{tr} values in the test certificate at the rear of this report. The $D_{nT,w} + C_{tr}$ allows the sound insulation performance of the elements tested to be compared with the ADE requirements detailed in Section 3 above. The obtained $D_{nT,w} + C_{tr}$ for the separating walls are presented in summary Tables 2 at the end of this report.

5.0 DISCUSSION OF RESULTS

5.1 Airborne Sound Insulation – Separating Walls

The obtained results from the sound insulation tests show that the minimum sound insulation values as stated in ADE 2003 have been met for all separating walls. As such these elements may be regarded as having 'passed' the tests.

Results Summary Tables*Table 2 – Airborne Wall Sound Insulation Test Results:*

ANC Test Reference	Source Room		Receiver Room		Measured $D_{nT,w} + C_{tr}$ dB	Building Regulations ADE Required Sound Insulation Performance, $D_{nT,w} + C_{tr}$ dB	'Pass' or 'Fail'
	Description	Volume, m^3	Description	Volume, m^3			
10511929401	2a Office	18	2b Office	18	54	≥45	Pass
10511929402	2a Bedroom	18	2b Bedroom	18	51	≥45	Pass

Equipment List

Table 3 – Equipment List

Manufacturer	Type	Model	Serial Number	Calibration Date	Calibration Certificate Number	Date of Expiration of Calibration
NTi	Pink Noise Generator	Minirator MR2	G2L-YWCZZ-F2	-	-	-
Nokia	Pink Noise Generator	6303e	587577	-	-	-
Mackie	Sound Source	SRM350	JG0252	-	-	-
Mackie	Sound Source	SRM350	JW0027	-	-	-
Rion	Sound Level Meter	NA-28	30431896	03/10/2023	06454/2	03/10/2025
Rion	Pre-Amplifier	NH-23	21959	03/10/2023	06454/2	03/10/2025
Rion	Half-inch Microphone	UC-59	04959	03/10/2023	06454/2	03/10/2025
Rion	Calibrator	NC-74	34536106	02/10/2023	06923/1	11/10/2025

APPENDIX

PDA LTD. TEST CERTIFICATES

Standardised level difference according to ISO 140-4
Field measurements of airborne sound insulation between rooms

Client: Braiden Acoustics Limited
Address: 2a & 2b Honor Street, Longsight, Manchester, M13 0WY
Date of Test: 13 January 2025



Description of tested construction, test arrangement and direction of measurement :


Source Room: 2a Office
Receiver Room: 2b Office

Wall Construction (Notional)

Two leaves of 100mm blockwork with 100mm cavity fully filled with insulation finished either side 1 no. layer of 12.5mm Soundbloc plasterboard mounted on dabs with skim finish

Source Room Volume : 18 m³
Receiver Room Volume : 18 m³

Frequency Hz	D _{nT} (one-third octave) dB
50	
63	
80	
100	43.9
125	44.3
160	40.0
200	45.0
250	47.5
315	54.8
400	61.0
500	65.0
630	68.3
800	69.4
1000	72.2
1250	70.4
1600	67.7
2000	67.9
2500	67.5
3150	73.3
4000	
5000	

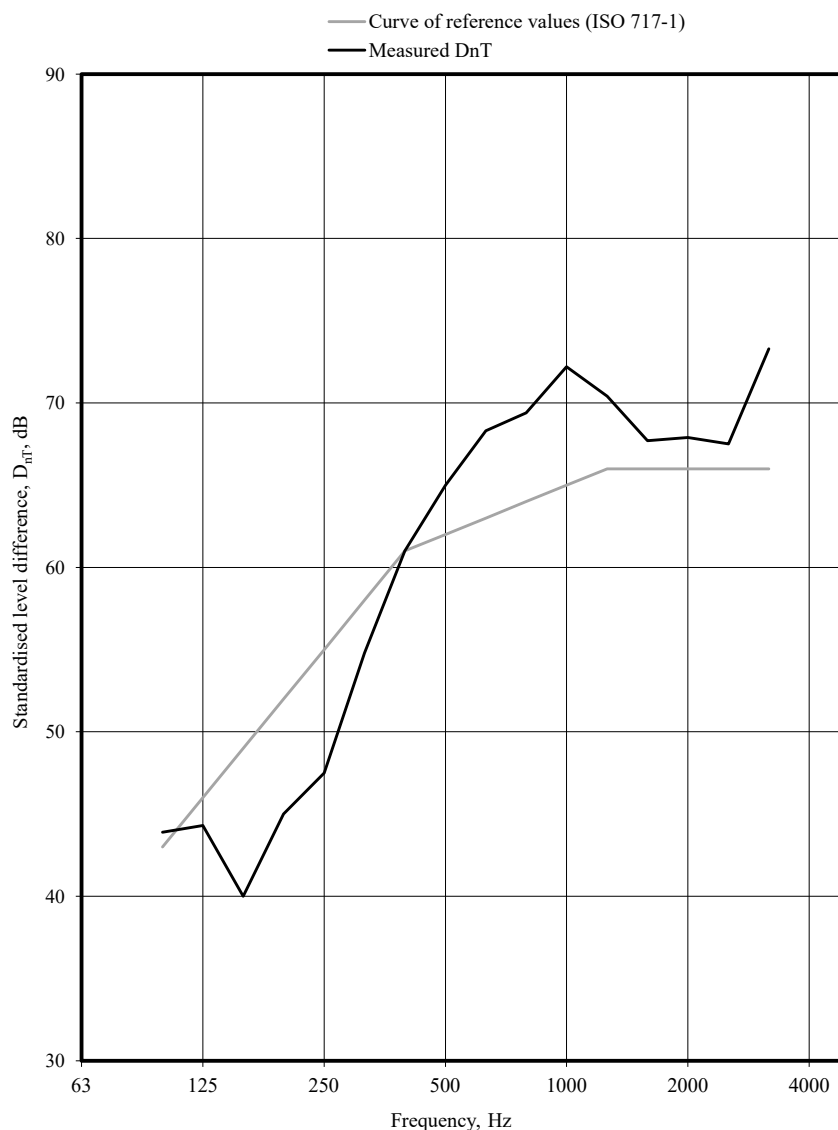

Rating According to ISO 717-1

D_{nT,w} (C; C_{tr}) = **62** -3 -8 dB

Evaluation based on field measurement results obtained by an engineering method

No. of Test Report: 10511929401
Name of Test Institute : PDA Ltd, 3 Bridgewater Court
Barsbank Lane, Lymm
Cheshire, WA13 0ER

Date: 15 January 2025

Notes:

≥ - measurement limited due to background

Signature :

Standardised level difference according to ISO 140-4
Field measurements of airborne sound insulation between rooms

Client: Braiden Acoustics Limited
Address: 2a & 2b Honor Street, Longsight, Manchester, M13 0WY
Date of Test: 13 January 2025



Description of tested construction, test arrangement and direction of measurement :


Source Room: 2a Bedroom
Receiver Room: 2b Bedroom

Wall Construction (Notional)

Two leaves of 100mm blockwork with 100mm cavity fully filled with insulation finished either side 1 no. layer of 12.5mm Soundbloc plasterboard mounted on dabs with skim finish

Source Room Volume : 18 m³
Receiver Room Volume : 18 m³

Frequency Hz	D _{nT} (one-third octave) dB
50	
63	
80	
100	47.3
125	38.6
160	34.7
200	46.6
250	50.7
315	57.8
400	63.7
500	70.2
630	72.0
800	≥ 76.2
1000	≥ 75.0
1250	≥ 73.3
1600	≥ 71.2
2000	≥ 70.0
2500	≥ 73.8
3150	76.3
4000	
5000	

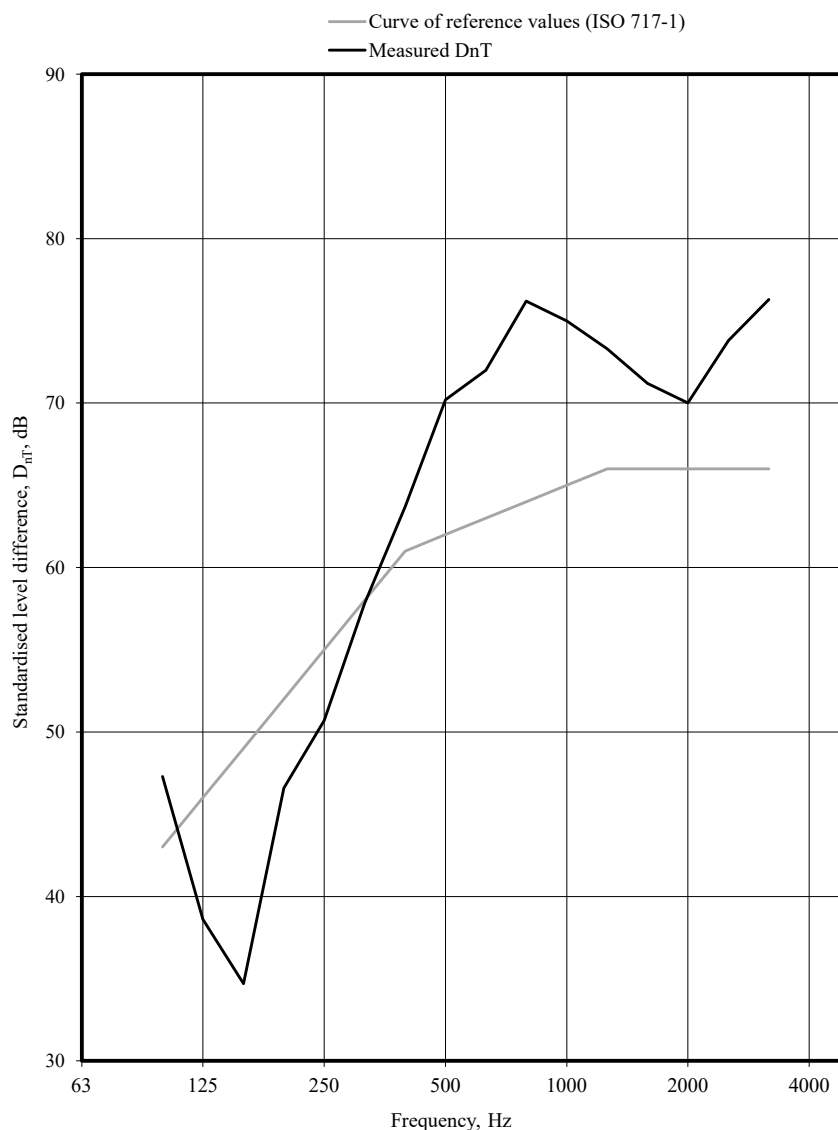

Rating According to ISO 717-1

D_{nT,w} (C; C_{tr}) = **62** -6 -11 dB

Evaluation based on field measurement results obtained by an engineering method

No. of Test Report: 10511929402
Name of Test Institute : PDA Ltd, 3 Bridgewater Court
Barsbank Lane, Lymm
Cheshire, WA13 0ER

Date: 15 January 2025

Notes:

≥ - measurement limited due to background

Signature :