

Monitoring Details:

Level Monitoring

Provider Name: My Home Needs

Monitoring Interval: Every 8 weeks

Instruction Date: 01/03/2024

Number of Visits: 4

Reading Date: 27/06/2024

Visits Completed: 3

Date of Issue: 27/06/2024

Visits Outstanding: 1

Client Details:

Client: Questgates

Engineer / Handler: -

Job Reference:


Monitored Address:

Address: 6 Scarsdale Road, Manchester, M14 5PS

Front Elevation



Site Plan

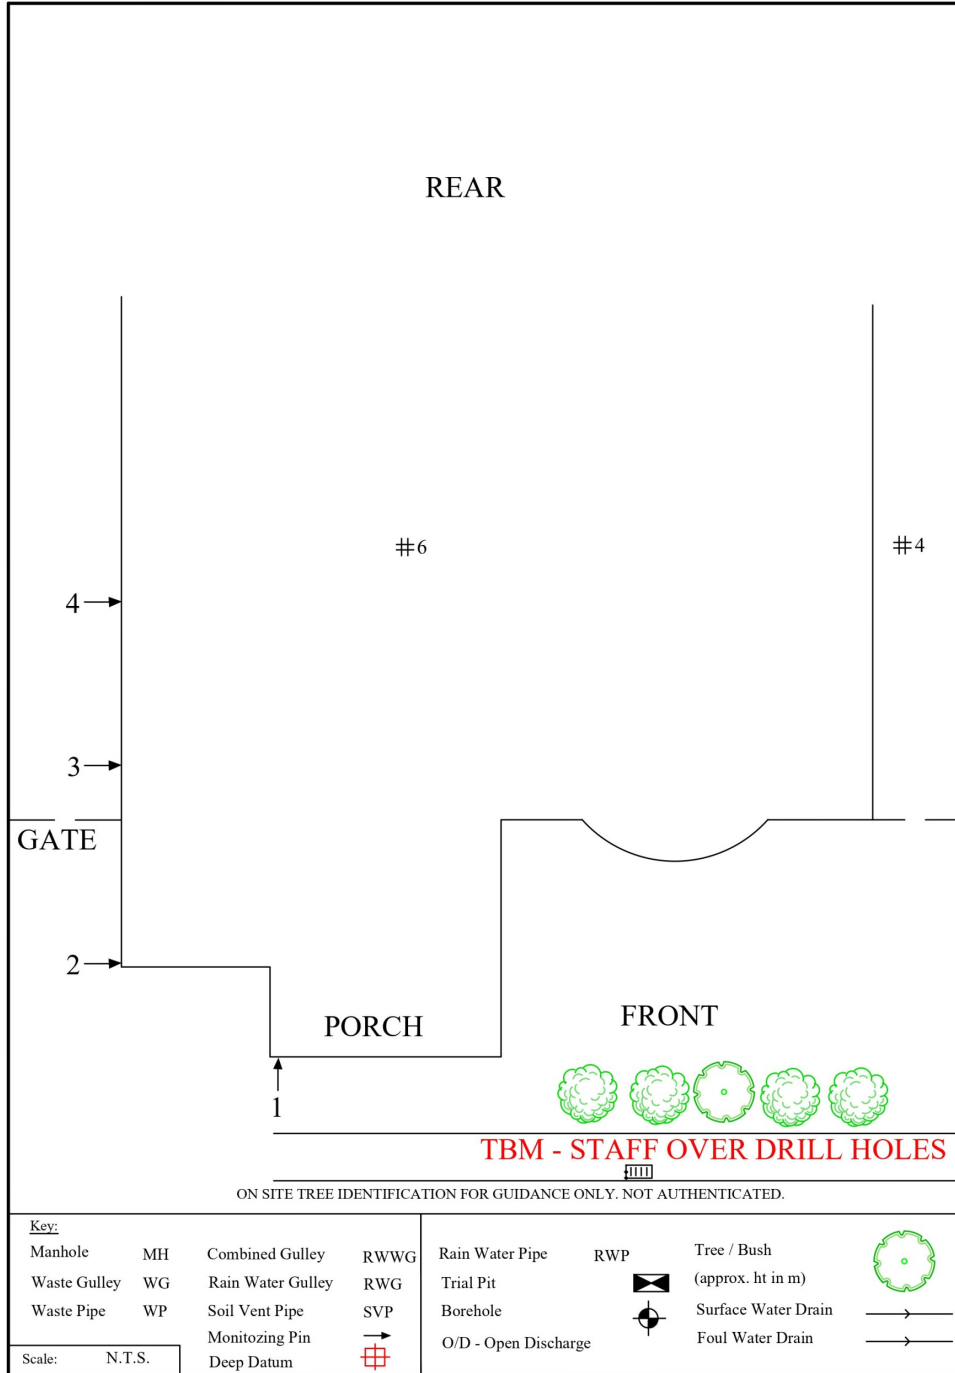

Visit Notes

Visit	Surveyors Note
Visit 3	PH was not at property and was unable to access points 3 and 4 Points 1 and 2 have been double checked. Trees to front of property.

Level Readings

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8
	11/03/24	28/04/24	27/06/24					
1	10.4223	10.4226	10.4171					
2	10.3356	10.3362	10.3317					
3	10.3537	10.3545						
4	10.3381	10.3378						
Taken by	DV	LA	LA					
Serial number	2215057	12120444	1210444					

Level Movement (Displayed in Millimeters)

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8
	11/03/24	28/04/24	27/06/24					
1	0	+0.3	-52					
2	0	+0.6	-39					
3	0	+0.8						
4	0	-0.3						

Level Readings Chart (Points 1 - 4)

