



LAYER SURVEYS LTD

SEE THE COMPLETE PICTURE

LAYER SURVEYS
MEADOWCROFT BUSINESS PARK
PRESTON PR4 4BA
Tel: 01772611634
Fax: 01772611634
Email: darren@layersurveys.co.uk

Project-information

Project name :
EMBASSY VILLAGE

Project Number :


Contact :

Date :
29-Sep-20

Client: **CURTINS**
Contact Name: **ANDY RAIN**
Department: **N/A**
Road: **WHITWORTH STREET**
Town: **MANCHESTER**
County: **GTR MANCHESTER**
Telephone: **0161 2362394**
Fax: **0161 2362394**
Mobile: **07813521074**
E-mail: **andy.rain@curtins.com**

Site: **EMBASSY VILLAGE**
Contact Name: **ANDY RAIN**
Department: **N/A**
Road: **WORSLEY STREET**
Town: **MANCHESTER**
County: **GTR MANCHESTER**
Telephone: **01612362394**
Fax: **01612362394**
Mobile: **07813521074**
E-mail: **andy.rain@curtins.com**

Contractor **LAYER SURVEYS**
Contact Name: **DARREN WEBSTER**
Department: **DIRECTOR**
Road: **MEADOWCROFT BUSINESS PARK**
Town: **PRESTON PR4 4BA**
County: **LANCASHIRE**
Telephone: **01772611634**
Fax: **01772611634**
Mobile: **07341953636**
E-mail: **darren@layersurveys.co.uk**



Inspection report


Date : 29-Sep-20	Job number : N/A	Section Type : unknown	Operator : CHRIS	Section number : 1	PLR SUFFIX: X
Weather no rain or snow	Vehicle : AE19 KCU	Camera : PUSHROD	Preset :	Cleaned : no	Type of Drain : Gravity drain/sewer

Place : Road : Location Inspection	EMBASSY VILLAGE WORSLEY STREET Road CATCHPIT 1 (D/S) CATCHPIT 2	Location details: Catchment: Pipe Shape : Pipe Length	 Circular 	U/S MH : U/S Depth : D/S MH : D/S Depth :	CATCHPIT 1 1.07 CATCHPIT 2
Use: Year laid : Purpose : Total length :	Surface water 1900 Investment planning 13.63 m	Pipe Width : Pipe Diameter : Pipe material : Lining :	 150 mm Vitrified clay 		

Comment :

1:120 Position
Depth: 1.07

Observation

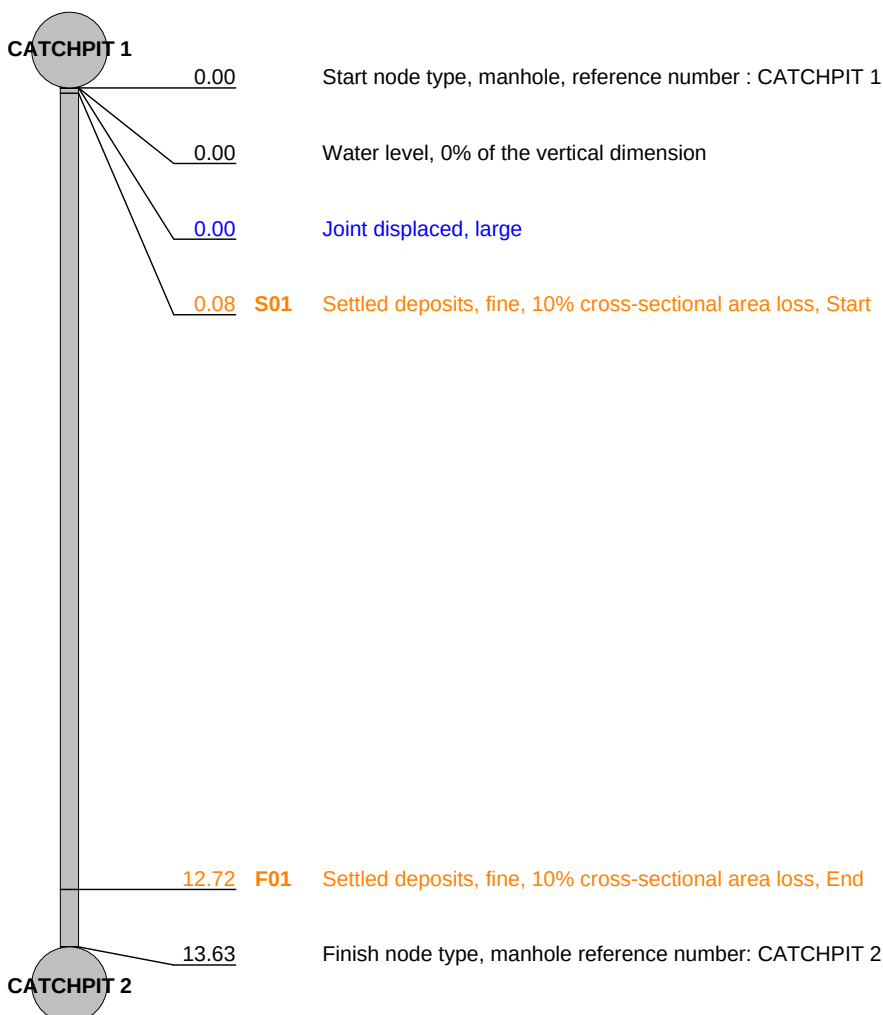

STR no def	STR peak	STR mean	STR total	STR grade	SER no def	SER peak	SER mean	SER total	SER grade
1	2	0.15	2	1	1	2	1.86	25.4	3



Inspection pictures

Place : EMBASSY VILLAGE	Road : WORSLEY STREET	Date : 29-Sep-20	Section number : 1	PLR Suffix : X
-----------------------------------	---------------------------------	----------------------------	------------------------------	--------------------------



Photo: 1_1_3_A.jpg
 0m, Water level, 0% of the vertical dimension



Photo: 1_1_8_A.jpg
 0.08m, Settled deposits, fine, 10% cross-sectional area loss, Start




Inspection pictures

Place : EMBASSY VILLAGE	Road : WORSLEY STREET	Date : 29-Sep-20	Section number : 1	PLR Suffix : X
-----------------------------------	---------------------------------	----------------------------	------------------------------	--------------------------



Photo: 1_1_10_A.jpg

13.63m, Finish node type, manhole reference number: CATCHPIT 2



LAYER SURVEYS LTD

SEE THE COMPLETE PICTURE

LAYER SURVEYS
MEADOWCROFT BUSINESS PARK
Street : PRESTON PR4 4BA
Tel: 01772611634
Fax: 01772611634
Email: darren@layersurveys.co.uk

Inspection report

Date : 29-Sep-20	Job number : N/A	Section Type : unknown	Operator : CHRIS	Section number : 2	PLR SUFFIX: X
Weather no rain or snow	Vehicle : AE19 KCU	Camera : PUSHROD	Preset :	Cleaned : no	Type of Drain : Gravity drain/sewer

Place : Road : Location Inspection	EMBASSY VILLAGE WORSLEY STREET Road OUTFALL (U/S) CATCHPIT 2	Location details: Catchment: Pipe Shape : Pipe Length	 Circular 	U/S MH : U/S Depth : D/S MH : D/S Depth :	CATCHPIT 2 OUTFALL
Use: Year laid : Purpose : Total length :	Surface water 1900 Investment planning 22.80 m	Pipe Width : Pipe Diameter : Pipe material : Lining :	 225 mm Vitrified clay 		

Comment :

1:180 Position

Observation

OUTFALL

0.00

Water level, 0% of the vertical dimension

0.00

Water level, 0% of the vertical dimension

0.51

Settled deposits, fine, 10% cross-sectional area loss

0.51

Cracks, multiple, from 9 to 3 o'clock

4.22

Settled deposits, other, 5% cross-sectional area loss

10.45

General remark

12.71

General remark

20.00

Joint displaced, medium

22.80

Finish node type, manhole reference number: CATCHPIT 2

CATCHPIT 2



0 m



0.51 m



4.22 m



10.45 m



12.71 m

STR no def	STR peak	STR mean	STR total	STR grade	SER no def	SER peak	SER mean	SER total	SER grade
2	40	1.8	41	3	2	2	0.13	3	3



Inspection pictures

Place : EMBASSY VILLAGE	Road : WORSLEY STREET	Date : 29-Sep-20	Section number : 2	PLR Suffix : X
-----------------------------------	---------------------------------	----------------------------	------------------------------	--------------------------



Photo: 3_3_11_A.jpg
 0m, Water level, 0% of the vertical dimension



Photo: 3_3_14_A.jpg
 0.51m, Settled deposits, fine, 10% cross-sectional area loss



Inspection pictures

Place : EMBASSY VILLAGE	Road : WORSLEY STREET	Date : 29-Sep-20	Section number : 2	PLR Suffix : X
-----------------------------------	---------------------------------	----------------------------	------------------------------	--------------------------



Photo: 3_3_16_A.jpg

4.22m, Settled deposits, other, 5% cross-sectional area loss



Photo: 3_3_17_A.jpg

10.45m, General remark



Inspection pictures

Place : EMBASSY VILLAGE	Road : WORSLEY STREET	Date : 29-Sep-20	Section number : 2	PLR Suffix : X
-----------------------------------	---------------------------------	----------------------------	------------------------------	--------------------------



Photo: 3_3_18_A.jpg
 12.71m, General remark



Photo: 3_3_19_A.jpg
 20m, Joint displaced, medium



Inspection pictures

Place : EMBASSY VILLAGE	Road : WORSLEY STREET	Date : 29-Sep-20	Section number : 2	PLR Suffix : X
-----------------------------------	---------------------------------	----------------------------	------------------------------	--------------------------



Photo: 3_3_20_A.jpg

22.8m, Finish node type, manhole reference number: CATCHPIT 2