



GEOSHIELD Verification Report




VERIFICATION ITEM TWO

LOCATION/GRID LINE: Upper Raft Slab - Pour 3

NOTES: Sealed Pipe Penetrations

The Visqueen Standard Gas Barrier has been cut tight the the pipe penetration and double sided butyl tape has been applied and overlapped in a square around it. A top hat has then been placed over the pipe and sealed to the membrane with the applied

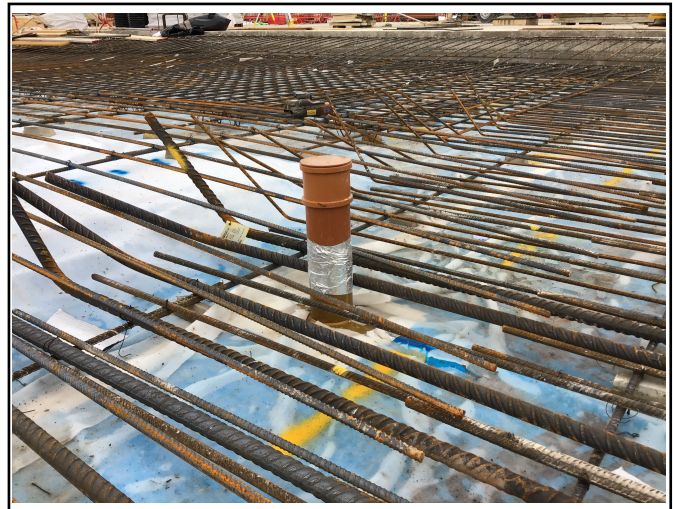

double sided tape. A jubilee clip has then been applied to the neck of the pipe penetration as per design and finished with silver foil tape.



GEOSHIELD Verification Report



VERIFICATION ITEM THREE

LOCATION/GRID LINE: Upper Raft Slab - Pour 3

NOTES: Fleece and Spacer Install

Once the installation of the Visqueen Standard Gas Barrier was complete, a protective fleece was applied. Concrete spacers were then placed onto the fleece before steel rebar was installed. The concrete spacers form a void between the steel



and the fleece, protecting the membrane from potential damage.