

24 June 2022

Our Ref: P20-00073

Mr Graham Lonsdale
Meares Group Plc
5 Hepton Court
York Road
Leeds
LS9 6PW

Re: Crossley Street, Gorton Interim Soil Validation Letter Report –Validation of Plots 24-28 and 42-45

Dear Graham,

Introduction:

Met Engineers have been contracted by Meares Group Plc to carry out the soil Validation works at the above site. The scope of works is based on the Phase II Site Investigation report (ref. 069912-CUR-00-XX-RP-GE-001) by Curtins Consulting Limited dated 17th December 2018, and the subsequent Phase III Remediation Statement (ref. P20-00073-Met-RP-GE-001) by Met Engineers dated 18th February 2022 (Revision 2) to satisfy Manchester City Council Planning Reference: 122797/FO/2019 as amended by 129169/NMC/2021.

The initial intrusive investigation recorded elevated levels of lead, PAH and TPH. Asbestos fibres (<0.001%) were also identified in 1N₀ of the soil samples tested.

3N₀ gas monitoring visits were initially undertaken by Curtins Consulting Limited and this confirmed Characteristic Situation (CS) 1 conditions with no gas protection measures proposed. A supplementary gas risk assessment was carried out by Curtins Consulting Limited (ref: 069912-CUR-00-XX-CO-GE-00002-V01_Fee Proposal) in a letter dated 22nd April 2020 which confirmed the gas classification of CS1.

It is understood that the EHO previously raised queries regarding TPH concentrations in TP08 and TP10. In email correspondence provided to Met Engineers Ltd on 29th October 2021, dated between 27th March to 7th April 2020, between Curtins Consulting Limited and Mears Group Plc it was confirmed that the removal of 600mm surface material would effectively remove the contaminated material recorded in TP08 and TP10. It was also confirmed that levels recorded within TP10 do not exceed the relevant guideline values.

In correspondence dated 6th March 2020, The Local Planning Authority stated that due to the above TPH exceedances, a capillary break layer may be required within the cover system.

The client has retained copies of all email correspondence related to the project which can be provided as an addition to this letter report upon request.

Summary of Proposed Remediation:

Based on the findings of the Phase II Site Investigation report, it was proposed to install 600mm of clean capping material as detailed within the Met Phase III Remediation Statement dated 3rd March 2020. Based on the site investigation logs, it was considered likely that the site strip would remove all Made Ground material from the central area of the site where <0.001% asbestos fibres were previously identified in 1N₀ sample. It was initially proposed to carry out additional sampling around this location following the removal of all Made Ground to confirm no asbestos fibres remained in this area. During

the first validation visit carried out by Met Engineers Ltd on 27th October 2021, it was confirmed that nominal amounts of Made Ground remained at the surface in this area, therefore the supplementary sampling was not carried out. Instead, it was confirmed a high-visibility membrane should be installed as a marker layer around the previous WS03 where Made Ground remains.

At this time, it was also recommended that a high-visibility membrane should be installed in all remaining plots, excluding plots 1-13 and 18-23 which had already been completed at the time of the first validation visit. This was due to the potential for TPH associated with TP08 to remain in the surface soils immediately beneath the proposed 600mm capping layer. Validation of these areas will be carried out over a number of visits, including within this letter report.

Exported Material:

Based on reduced level dig photographs it is determined that sufficient material has been removed from the site within plots 24-26, 28 and 42-45 to facilitate a capping of 600mm of topsoil overlying a high-visibility membrane. Photographs of the site strip and placement of the membrane in these areas are provided in Appendix II. A reduced level dig photograph is not available for the front garden areas of plot 45, however the client has provided a photograph for this area with a trial pit showing 600mm of capping overlying a high-visibility membrane.

It has been confirmed by the client that no additional material has been removed from site since the previous site visit. To date, approximately 5,100 tonnes of material have been removed from site as part of the site strip and enabling works; approximately 4,900 tonnes of this material is recorded as spoil, 80 tonnes as stone, 40 tonnes as soil and stone, 40 tonnes as sand and 40 tonnes as contaminated soil. The exported material tickets are provided within Appendix II of the letter report dated 6th December 2021.

Imported Material:

It was proposed to import topsoil material supplied by Cheshire Soils and Aggregates Limited from a site in Halewood, Liverpool, L26 3UA. It is understood from Cheshire Soils and Aggregates Ltd that Halewood is a greenfield site. Confirmation is provided in the email contained within Appendix III of the previous letter report dated 6th December 2021. Based on the requirements Yorkshire and Lincolnshire Pollution Advisory Group (YALPAG) Document – Verification Requirements for Cover Systems it is recommended that for a greenfield/manufactured source 1N_o sample per 250m³, or 3N_o samples be taken per source, whichever is greater. As such, prior to the material being imported to the site, Met Engineers attended Halewood on 20th September 2021 and collected 11N_o samples of the topsoil material. Photographs of this topsoil stockpile are included in Appendix III of the letter report dated 6th December 2021.

These samples were submitted for laboratory testing for Heavy Metals (CLEA 9), Poly Aromatic Hydrocarbons (PAH -USEPA 16), Asbestos, and Soil Organic Matter. The results were screened against Land Quality Management S4UL's for all contaminants except Lead, for which there is no S4UL available. Results for Lead have been screened against DEFRA C4SL's. A conservative soil organic matter content of 1% has been assumed and the guideline values are based on a 'Residential with Homegrown Produce' land use. No exceedances were identified within the topsoil, and the material is therefore considered **suitable for use** at the Crossley Street, Gorton development.

The screened laboratory results and laboratory certificates can be found in Appendix IV and Appendix V of the letter report 6th December 2021 respectively.

Met Engineers have been supplied topsoil transfer tickets that show that a total of 2780m³ of this soil has been imported to date. This assumes a conversion of 1 tonne of soil per m³ to provide a conservative

frequency of testing for imported material. A summary of all imported tickets to date has been provided in Appendix III of the letter report 18th February 2022.

Summary of 3rd Validation Visit – 13.05.22:

It is proposed to carry out the validation works at the above site over a number of visits. This letter report provides the results of the third visit, confirming the depth of topsoil placed in the garden areas of plots 24-28 and 42-45. The proposed validation works for the whole site are shown on the plan provided in Appendix I. This plan also shows the locations of the hand dug pits carried out to date.

Met Engineers attended site on 13th May 2022 and carried out a total of 5Nø hand dug pits in the garden areas; 4Nø hand dug pits were carried out in the rear gardens of plots 24, 28, 43 and 44, and 1Nø hand dug pit within the front garden of plot 24.

The hands dug pits concluded that a minimum of 600mm topsoil has been placed in the garden areas of plots 24-28 and 42-45.

It is understood that the high-visibility membrane has, to date, been placed in the rear garden areas of plots 14-17 and 38-44, and the front and rear garden areas of 24-28 and 42-45, and was on this occasion observed at the base of HDP15-HDP19.

It is understood all remaining plots yet to be completed will be installed with a membrane overlain by a 600mm capping layer of topsoil.

The photographs of the hand dug pits are provided in Appendix III, and photographs of the completed garden areas are provided in Appendix IV.

The remaining plots, including plots 1-2 and 29-41, will be validated in the next letter report. I trust this is acceptable, however if you have any queries, please do not hesitate to contact me.

Yours sincerely,

A handwritten signature in black ink, appearing to read 'YK/snz', is written over a light blue horizontal line.

Yasemin Kolsuz

Geo-Environmental Engineer

For and on behalf of Met Consultancy Group

The following documents are appended to this letter:

- Appendix I - Validation Plan
- Appendix II - Reduced Level Dig Photographs
- Appendix III - Hand Dug Pit Photographs
- Appendix IV - Photographs of Completed Garden Areas

Appendix I – Validation Plan

1. Do not scale dimensions from this drawing in either paper or electronic format.
2. To be read in conjunction with all relevant Engineers, Architects and Other drawings and specifications.
3. All building products to be used in strict accordance with the manufacturer's recommendations.
4. Any discrepancies are to be reported to the Engineer immediately.
5. Main Contractor to provide a detailed method statement for all works prior to commencement on site.

 Completed hand dug validation pit confirming the depth of topsoil placed meets the requirements for capping

 Proposed hand dug validation pit (16No. remaining)

 Sufficient Made Ground to be removed to leave soft landscaped areas 600mm below final levels. Levels to be made up with clean and certified* imported or re-used subsoil and imported topsoil.

 Garden areas in which a membrane has been installed overlain by 600mm of clean and certified imported or re-used subsoil and imported topsoil.

 Garden areas in which it is understood a membrane will be installed overlain by 600mm of clean and certified imported or re-used subsoil and imported topsoil.

* All material used within the top 600mm should be tested in accordance with YALPAG Verification requirements for cover systems and Section 4.2 of the Remediation Statement.

Should natural clays be encountered at <600mm during the site strip, these should be tested in accordance with the above guidance to confirm suitability for use within the capping layer

4	14.06.22	YK	Updated with hand dug pits HDP15-HDP19 undertaken on 13.05.22 (plots 24-28 & 42-45)	--
3	18.02.22	YK	Updated with hand dug pits HDP10-HDP14 undertaken on 15.02.22 (plots 14-17 & 38-41)	--
2	05.11.21	YK	Updated with hand dug pits HDP01-HDP09 undertaken on 27.10.21 (plots 3-11 & 18-23)	--
1	03.02.20	AEC	Initial Issue	
Issue	Date	Drawn	Description	Chk'd



Met Engineers Ltd
Southgate House
Portertrac Road
Stourton, Leeds
West Yorkshire
LS10 1SW

Tel: 0113 200 8900
Fax: 0113 200 8901
email: admin@metengineers.com
www.metengineers.com

Client
Meares Group

Project
Crossley Street, Gorton
P20-00073

Title
Validation Plan

Drawn	YK	Checked		Scale	NTS
Date	14.06.22	Date		Original Size	A3
Status					

Drawing No	P20-00073-Met-GE-001	Version	4
------------	----------------------	---------	---

Appendix II –Reduced Level Dig Photographs



Photograph 1: Reduced level dig within rear gardens of plots 24-32.



Photograph 2: Reduced level dig within rear gardens of plots 24-32.

Prepared by Met Engineers Ltd (Registered in England no. 07572047. VAT Reg no. 118211255.

T: 0113 200 8900 W: www.metconsultancygroup.com E: admin@metconsultancygroup.com



Photograph 3: Reduced level dig and membrane within rear garden of plot 24.



Photograph 4: Reduced level dig and membrane within rear garden of plot 24.



Photograph 5: Reduced level dig and membrane within front garden of plot 24.



Photograph 6: Reduced level dig and membrane within front garden of plot 24.



Photograph 7: Reduced level dig and membrane within rear garden of plot 25.



Photograph 8: Reduced level dig and membrane within rear garden of plot 25.



Photograph 9: Reduced level dig and membrane within rear garden of plot 26.



Photograph 10: Reduced level dig and membrane within front garden of plot 26.



Photograph 11: Reduced level dig and membrane within rear garden of plot 27.



Photograph 12: Reduced level dig and membrane within rear garden of plot 28.



Photograph 13: Reduced level dig and membrane within front garden of plot 28.



Photograph 14: Reduced level dig and membrane within rear garden of plot 42.



Photograph 15: Reduced level dig and membrane within front garden of plot 42.



Photograph 16: Reduced level dig and membrane within rear garden of plot 43.



Photograph 17: Reduced level dig and membrane within front garden of plot 43.



Photograph 18: Reduced level dig and membrane within rear garden of plot 44.




Photograph 19: Reduced level dig and membrane within front garden of plot 44.



Photograph 20: Reduced level dig and membrane within front garden of plot 44.



Photograph 21: Reduced level dig and membrane within rear garden of plot 45.

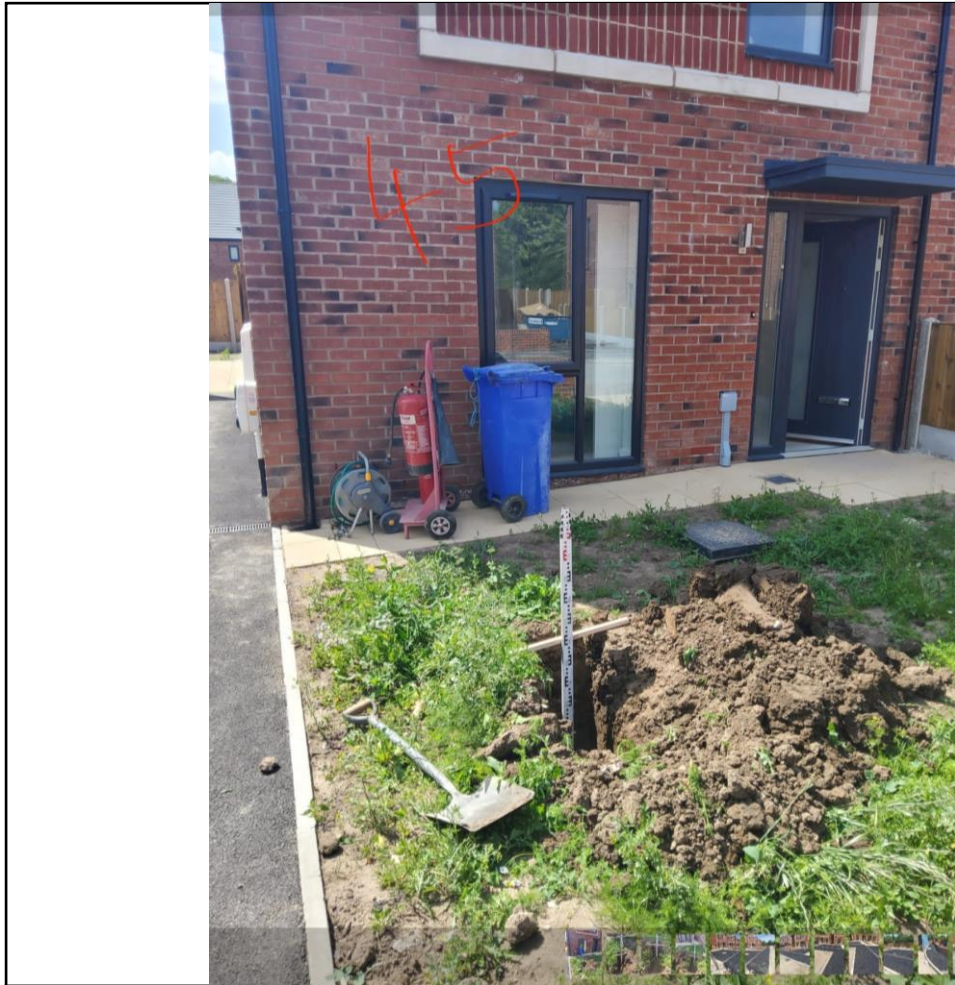

Photograph 22: Trial pit showing 600mm capping overlying high-visibility membrane in front garden area of plot 45.



Photograph 23: Trial pit showing 600mm capping overlying high-visibility membrane in front garden area of plot 45.

Appendix III –Hand Dug Pit Photographs



Photograph 1: Hand Dug Pit Topsoil Depth Validation – HDP15, Plot 44

Photograph 2: Hand Dug Pit Topsoil Arisings – HDP15, Plot 44



Photographs 3 and 4: Hand Dug Pit Topsoil Depth Validation – HDP16, Plot 43



Photographs 5 and 6: Hand Dug Pit Topsoil Depth Validation – HDP17, Plot 28



Photographs 7 and 8: Hand Dug Pit Topsoil Depth Validation – HDP18, Plot 24 Rear



Photographs 9 and 10: Hand Dug Pit Topsoil Depth Validation – HDP19, Plot 24 Front

Appendix IV – Completed Garden Areas



Photograph 1: Finished rear garden areas of plots 24-28.



Photograph 2: Finished rear garden areas of plots 24-28.



Photograph 3: Finished front garden area of plot 24.



Photograph 4: Finished front garden area of plot 25.



Photograph 5: Finished front garden area of plot 26.



Photograph 6: Finished front garden area of plot 27.



Photograph 7: Finished front garden area of plot 28.



Photograph 8: Finished front garden area of plot 42.



Photograph 9: Finished rear garden area of plot 42.

Prepared by Met Engineers Ltd (Registered in England no. 07572047. VAT Reg no. 118211255.

T: 0113 200 8900 W: www.metconsultancygroup.com E: admin@metconsultancygroup.com



Photograph 10: Finished front garden area of plot 43.



Photograph 11: Finished rear garden area of plot 43.



Photograph 12: Finished front garden area of plot 44.



Photograph 13: Finished front and side garden area of plot 44.



Photograph 8: Finished rear garden area of plot 44.



Photograph 9: Finished front garden area of plot 45.



Photograph 8: Finished rear garden area of plot 45.