



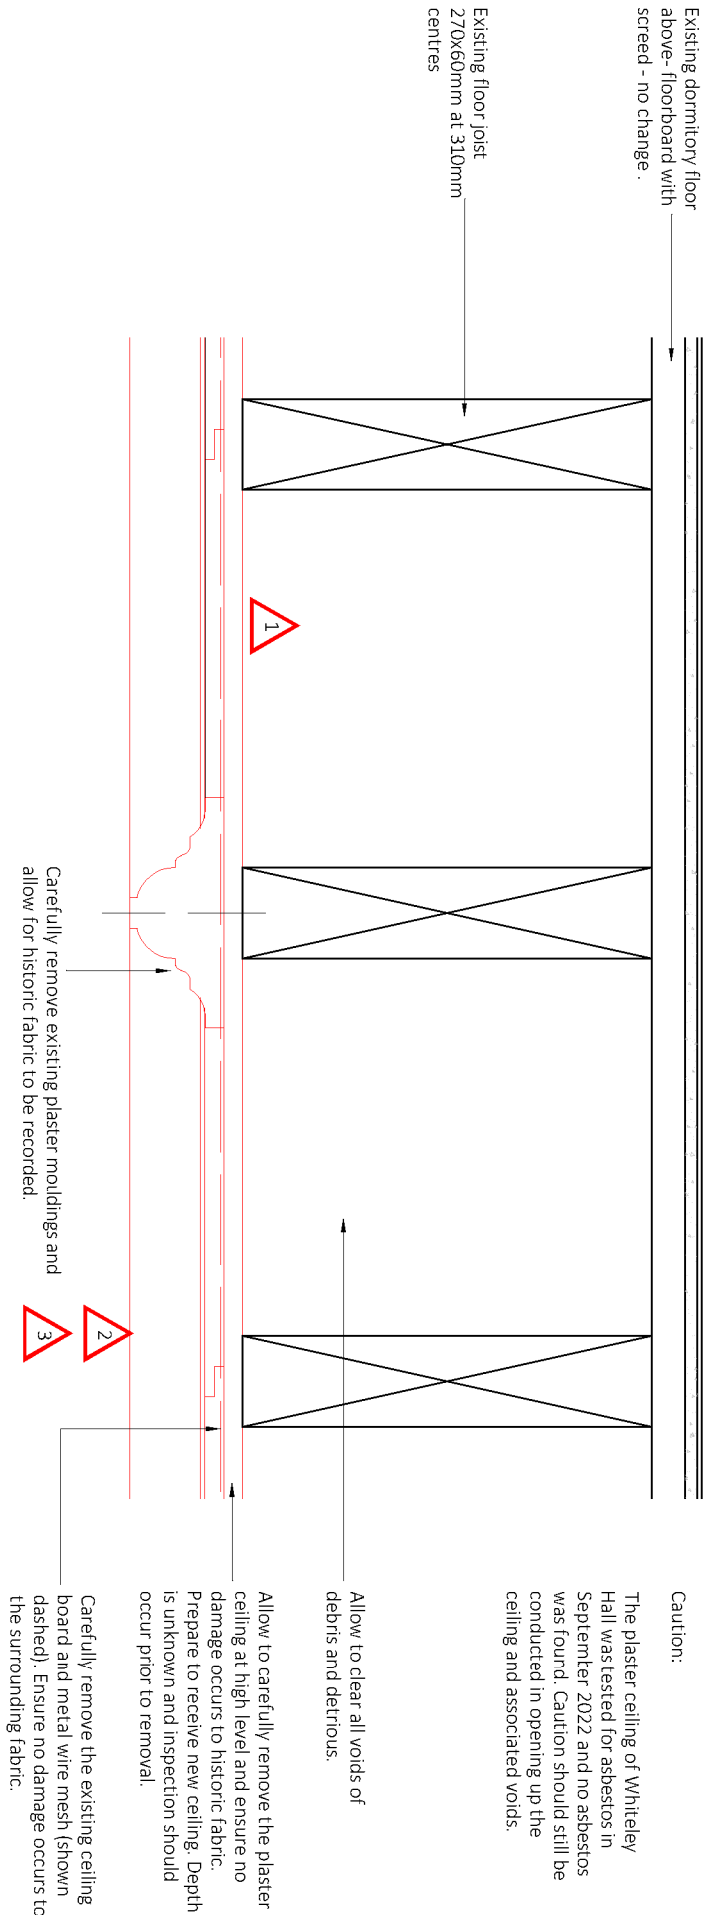


Existing Detail A - Typical Ceiling Detail 1:5

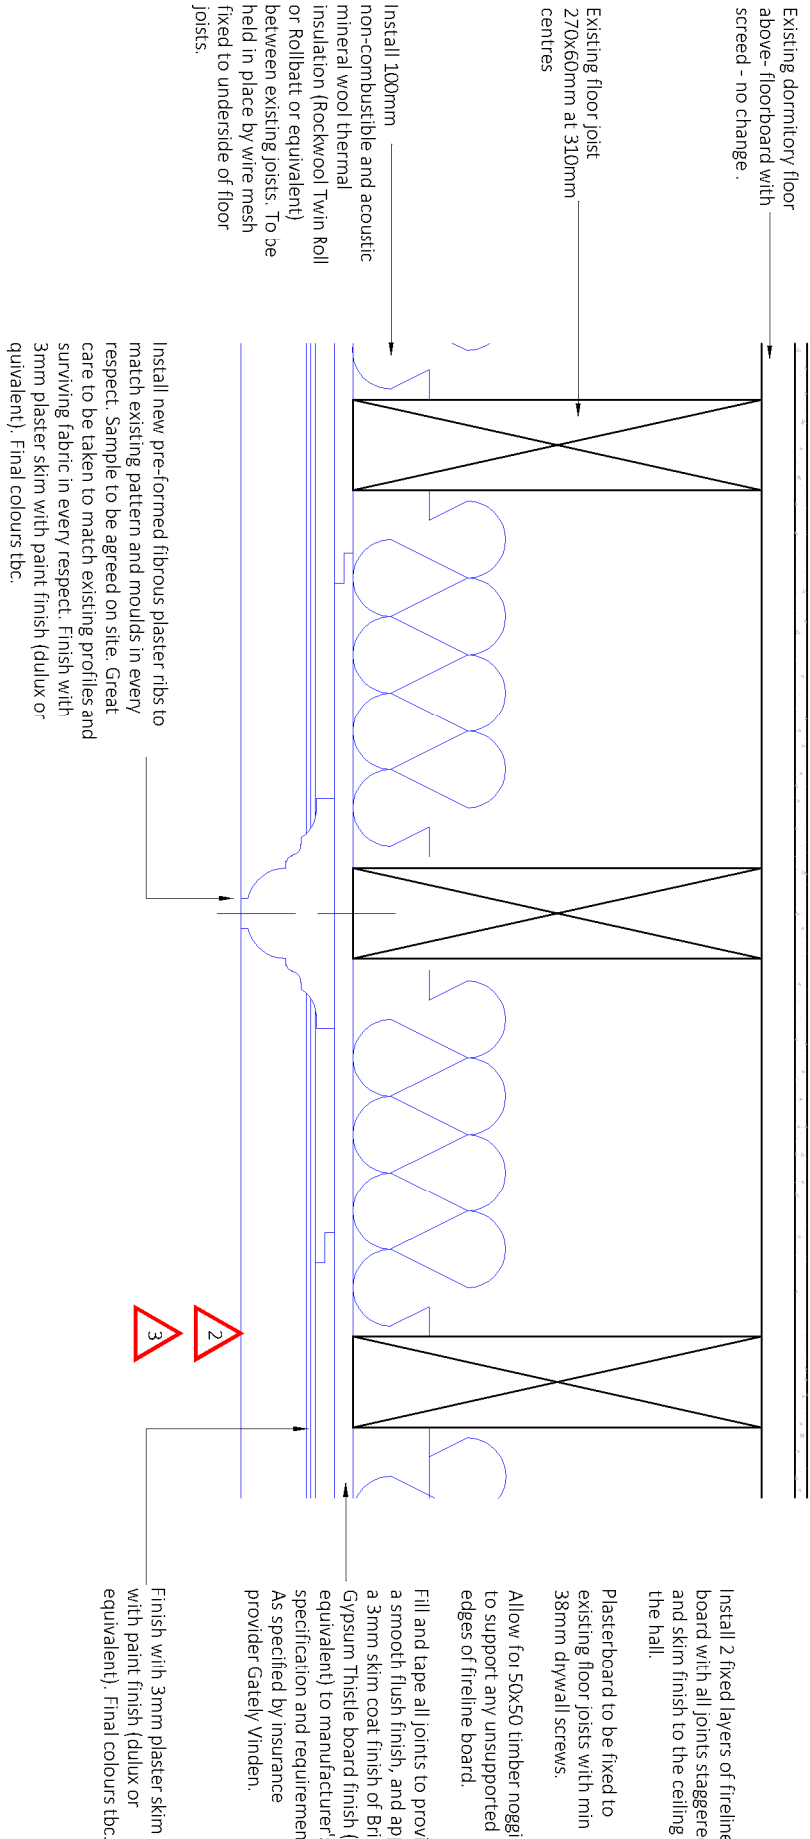

Proposed Detail A - Typical Ceiling Detail 1:5

Location of details - Key:

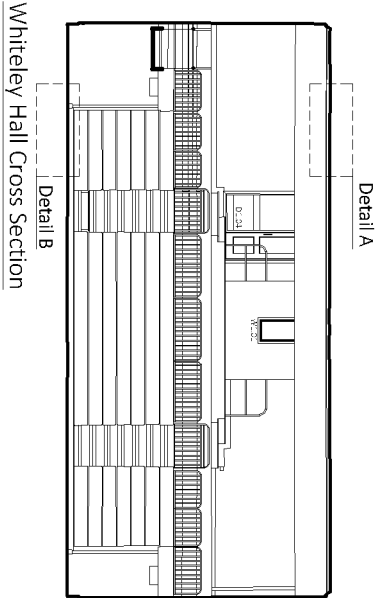

Note:
Do not scale from this drawing.
Dimensions are to be checked on site.
If in doubt please ask.

Key:

- Existing fabric to be removed.
- Proposed fabric to be installed.

CDM risks:

1 Risk - Asbestos - risk of disturbance of asbestos materials and therefore risk of inhalation of hazardous substance. Contractor to consult the asbestos register when planning works. Ensure all asbestos is work areas is removed prior to work on site. Removal of all asbestos fabric to be undertaken in controlled conditions by ACM specialist contractor.

2 Risk - Falling debris and unstable ceiling - risk of falling debris during removal and unstable ceiling fabric during installation. Contractor to ensure temporary work and loose fabric is secured and consider using net supports if appropriate. Contractor ensure correct PPE is provided to those removing high level fabric.

3 Risk - Working at height - Contractor to ensure any tasks that can occur at ground level are arranged. Scaffolds are to be installed by specialist contractor. Principal contractor to ensure these are maintained and safe access is provided at all times.

P2	17/10/22	Revised following client review.
P1	29/09/22	Revised following internal review.
LU		
Rev Date/Ints	Details	

© The moral rights of the author are hereby asserted.
This drawing and design is the sole property of Buttress, and must not be reproduced without permission.
Accuracy date: September 2022 (original file ref: 350893)

Buttress

41, Bengal St
Manchester
M4 6AF
T 0161 236 3303
E contact@buttress.net
W www.buttress.net

Project Title CSM - Whiteley Hall
Client Chetham's School of Music
Location Manchester

Drawing Title Typical Ceiling Detail

Date 12/08/22 Scale 1:5 & 1:100
Checked LU Orig Paper Size A3

Status PLANNING/LBC

Drawing ref Job No Drawing No Revision

9357 BA ZZ 1F DR A (27)001 P2