




 Earth Environmental & Geotechnical Ltd Houldsworth Mill Stockport SK5 6DA				Borehole Log				Borehole No. BH1 Sheet 1 of 3	
Project Name: Old Market Street				Project No. A4932		Co-ords: 385457.00 - 402934.00		Hole Type CP	
Location: Blackley				Level:		Scale 1:25			
Client: CEJ Builders				Dates: 15/08/2022 - 15/08/2022		Logged By BG			
Well	Water Strikes	Samples and In Situ Testing			Depth (m)	Level (m)	Legend	Stratum Description	
		Depth (m)	Type	Results					
		1.50 1.50 - 1.95	D	N=29 (2,3/5,7,9,8)				MADE GROUND: Grey sandy GRAVEL. Sand is fine to coarse, Gravel is fine to coarse subangular concrete, redbrick and sandstone. Contains metal and plastic fragments.	
					2.60			Stiff brown sandy gravelly CLAY. Sand is fine to coarse, Gravel is fine to coarse subangular to subrounded sandstone.	
		3.00		N=19 (3,2/4,4,5,6)	3.00			Medium dense to dense brown slightly gravelly SAND. Sand is fine to coarse, Gravel is fine subrounded sandstone.	
		4.50		N=19 (3,3/4,4,5,6)					
Continued on next sheet								5	
Remarks 1) Location scanned with CAT prior to excavation. 2) Hand dug pits to 1.20m. 3) Monitoring standpipe installed; 1m plain, 4m slotted.									

 Earth Environmental & Geotechnical Ltd Houldsworth Mill Stockport SK5 6DA					Borehole Log			Borehole No. BH1 Sheet 2 of 3	
Project Name: Old Market Street					Project No. A4932		Co-ords: 385457.00 - 402934.00		Hole Type CP
Location: Blackley					Level:		Scale 1:25		Logged By BG
Client: CEJ Builders					Dates: 15/08/2022 - 15/08/2022				

Well	Water Strikes	Samples and In Situ Testing			Depth (m)	Level (m)	Legend	Stratum Description	
		Depth (m)	Type	Results					
		6.00 6.00 - 6.45	D	N=42 (5,6/5,9,13,15)	6.00				6
		7.50 7.50 - 7.95	D	N=50 (5,7/50 for 270mm)				Dense to very dense brown slightly gravelly silty SAND. Sand is fine to coarse, Gravel is fine subrounded sandstone.	7
		9.00 9.00 - 9.45	D	N=28 (3,4/5,7,8,8)					8
									9
									10

Continued on next sheet

10

Remarks

1) Location scanned with CAT prior to excavation.


2) Hand dug pits to 1.20m.

3) Monitoring standpipe installed; 1m plain, 4m slotted.



 Earth Environmental & Geotechnical Ltd Houldsworth Mill Stockport SK5 6DA					Borehole Log			Borehole No. BH1 Sheet 3 of 3		
Project Name: Old Market Street					Project No. A4932		Co-ords: 385457.00 - 402934.00		Hole Type CP	
Location: Blackley					Level:		Scale 1:25		Logged By BG	
Client: CEJ Builders					Dates: 15/08/2022 - 15/08/2022					
Well	Water Strikes	Samples and In Situ Testing			Depth (m)	Level (m)	Legend	Stratum Description		
		Depth (m)	Type	Results						
		10.50		N=48 (3,5/8,10,14,16)					11	
		12.00		N=50 (5,7/50 for 285mm)	12.00				12	
		12.00 - 12.95	D				End of borehole at 12.00 m		13	
									14	
									15	
Remarks 1) Location scanned with CAT prior to excavation. 2) Hand dug pits to 1.20m. 3) Monitoring standpipe installed; 1m plain, 4m slotted.										

 Earth Environmental & Geotechnical Ltd Houldsworth Mill Stockport SK5 6DA				Borehole Log				Borehole No. BH2 Sheet 1 of 3	
Project Name: Old Market Street				Project No. A4932		Co-ords: 385472.00 - 402917.00		Hole Type CP	
Location: Blackley				Level:		Scale 1:25		Logged By BG	
Client: CEJ Builders				Dates: 12/08/2022 - 12/08/2022					

Well	Water Strikes	Samples and In Situ Testing			Depth (m)	Level (m)	Legend	Stratum Description	
		Depth (m)	Type	Results					
							MADE GROUND: Grey sandy GRAVEL. Sand is fine to coarse, Gravel is fine to coarse subangular concrete, redbrick and sandstone. Contains metal and plastic fragments.	1	
		1.50 1.50 1.50	ES ES	N=28 (3,4/4,7,8,9)	1.50		MADE GROUND: Brown sandy gravelly CLAY. Sand is fine to coarse, Gravel is fine to coarse subangular redbrick and sandstone.	2	
		3.00 3.00 3.00	ES ES	N=19 (3,5/4,4,5,6)	3.00		Medium dense brown slightly gravelly SAND. Sand is fine to coarse, Gravel is fine subrounded sandstone.	3	
		4.50 4.50 - 4.95	D	N=19 (3,3/3,4,5,7)	4.50		Medium dense brown slightly gravelly silty SAND. Sand is fine to coarse, Gravel is fine subrounded sandstone.	4	
								5	

Continued on next sheet

Remarks

1) Location scanned with CAT prior to excavation.

2) Hand dug pits to 1.20m.

3) Monitoring standpipe installed; 1m plain, 4m slotted.


Earth Environmental & Geotechnical Ltd

 Earth Environmental & Geotechnical Ltd Houldsworth Mill Stockport SK5 6DA					Borehole Log			Borehole No. BH2 Sheet 2 of 3	
Project Name: Old Market Street					Project No. A4932		Co-ords: 385472.00 - 402917.00		Hole Type CP
Location: Blackley					Level:		Scale 1:25		Logged By BG
Client: CEJ Builders					Dates: 12/08/2022 - 12/08/2022				

Well	Water Strikes	Samples and In Situ Testing			Depth (m)	Level (m)	Legend	Stratum Description	
		Depth (m)	Type	Results					
		6.00 6.00 - 6.50	D	N=22 (3,3/4,5,6,7)					6
		7.50		N=50 (5,8/50 for 265mm)	7.50				7
		9.00 9.00 - 9.50	D	N=50 (3,5/50 for 275mm)				Very dense brown slightly silty SAND. Sand is fine to coarse.	8
									9
									10

Continued on next sheet

Remarks

1) Location scanned with CAT prior to excavation.

2) Hand dug pits to 1.20m.

3) Monitoring standpipe installed; 1m plain, 4m slotted.



 Earth Environmental & Geotechnical Ltd Houldsworth Mill Stockport SK5 6DA					Borehole Log			Borehole No. BH2 Sheet 3 of 3		
Project Name: Old Market Street					Project No. A4932		Co-ords: 385472.00 - 402917.00		Hole Type CP	
Location: Blackley					Level:		Scale 1:25		Logged By BG	
Client: CEJ Builders					Dates: 12/08/2022 - 12/08/2022					
Well	Water Strikes	Samples and In Situ Testing			Depth (m)	Level (m)	Legend	Stratum Description		
		Depth (m)	Type	Results						
		10.50 10.50 - 11.00	D	N=34 (2,3/8,6,10,10)					11	
		12.00		N=50 (5,6/8,11,15,16)	12.00			Very dense brown gravelly SAND. Sand is fine to coarse, Gravel is fine to medium subangular to subrounded sandstone.	12	
		13.50		N=50 (5,7/9,10,16,15)					13	
		14.00 - 14.50	D		14.00			Very stiff brown slightly sandy silty CLAY. Sand is fine to coarse.	14	
		14.50 - 15.00	D		15.00			End of borehole at 15.00 m	15	
Remarks 1) Location scanned with CAT prior to excavation. 2) Hand dug pits to 1.20m. 3) Monitoring standpipe installed; 1m plain, 4m slotted.										



EARTH ENVIRONMENTAL & GEOTECHNICAL
Houldsworth Mill Business & Arts Centre, Houldsworth Street,
Stockport, SK5 6DA
Tel: 0161 975 6088
Email: info@earthenvironmental.co.uk
Web: www.earthenvironmental.co.uk

TRIAL PIT LOG

Project Name: Old Market Street, Blackley

Date: 15/8/22

Project No.: A4932

Client: CEJ Builders


Hole Number: TP01

Logged By: O Quinn

Total Depth: 3.00m

Remarks:

Schematic Profile:

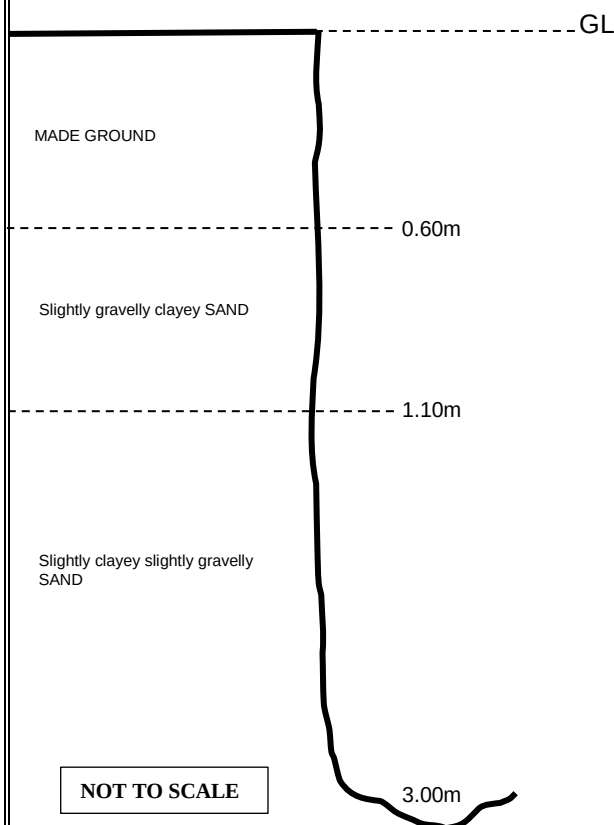

Legend	Depth (m)	Description
	0.00-0.20	MADE GROUND: Brown gravelly SAND with medium cobble content. Cobble is sub-angular red brick. Gravel is fine to coarse sub-angular red brick, concrete, wood, plastic, cable and fabric.
	0.20-0.40	MADE GROUND: Brick tile over concrete layer
	0.40-0.60	MADE GROUND; Reddish brown sandy GRAVEL. Gravel is fine to medium sub-angular to sub-rounded red brick.
	0.60-1.10	Brown clayey slightly gravelly SAND. Gravel is fine to medium sub-rounded sandstone.
	1.10-3.00	Brown slightly clayey slightly gravelly SAND. Gravel is fine to medium sub-angular to sub-rounded sandstone and siltstone.
		ES = 3.00m

Trial pit terminated at 3.00m.


Trial pit stable and dry.

ES = Environmental Sample, D= Geotechnical Sample, HP = Hand Penetrometer

Pictures:



Trial Pit 01: Overview of excavation

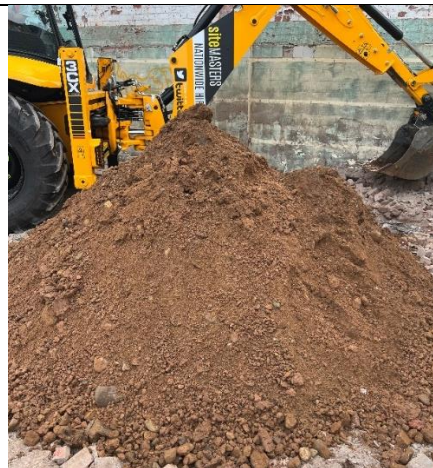

Trial Pit 01: Overview of excavated soils



EARTH ENVIRONMENTAL & GEOTECHNICAL
Houldsworth Mill Business & Arts Centre, Houldsworth Street,
Stockport, SK5 6DA
Tel: 0161 975 6088
Email: info@earthenvironmental.co.uk
Web: www.earthenvironmental.co.uk

TRIAL PIT LOG

Project Name: Old Market Street, Blackley

Date: 15/8/22

Project No.: A4932

Client: CEJ Builders


Hole Number: TP02

Logged By: O Quinn

Total Depth: 1.60m

Remarks:

Schematic Profile:

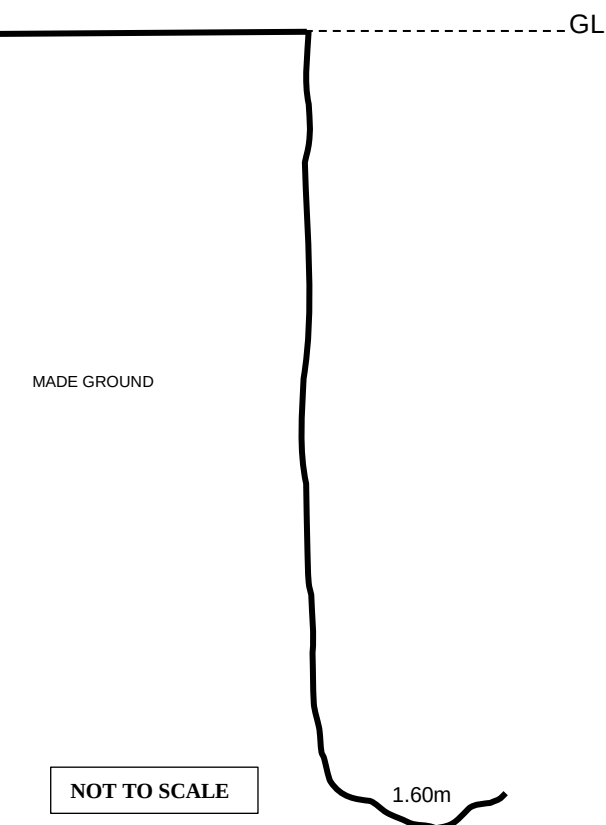

Legend	Depth (m)	Description
	0.00-1.60	MADE GROUND: Brown gravelly SAND with high cobble content. Cobble is sub-angular red brick and concrete. Gravel is fine to coarse sub-angular to sub-rounded red brick and concrete with wiring, plastic, piping and wood. ES = 1.50m

Trial pit terminated at 1.60m due to collapsing of redbrick cobbles.

Trial pit unstable in Made Ground.
No groundwater ingress.

ES = Environmental Sample, D= Geotechnical Sample, HP = Hand Penetrometer

Pictures:



Trial Pit 02: Overview of excavation



Trial Pits 02: Overview of excavated soils



EARTH ENVIRONMENTAL & GEOTECHNICAL
Houldsworth Mill Business & Arts Centre, Houldsworth Street,
Stockport, SK5 6DA
Tel: 0161 975 6088
Email: info@earthenvironmental.co.uk
Web: www.earthenvironmental.co.uk

TRIAL PIT LOG

Project Name: Old Market Street, Blackley

Date: 15/8/22

Project No.: A4932

Client: CEJ Builders


Hole Number: TP03

Logged By: O Quinn

Total Depth: 3.70m

Remarks:

Schematic Profile:

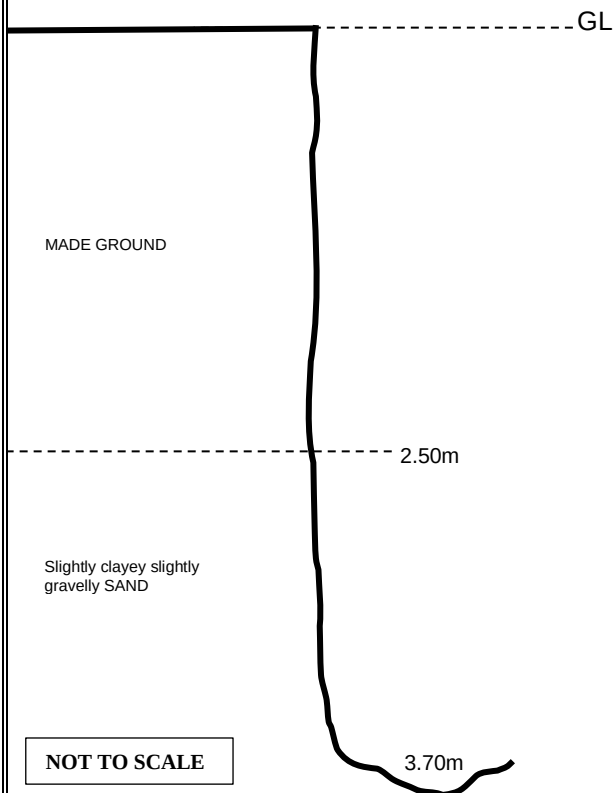

Legend	Depth (m)	Description
	0.00-2.50	MADE GROUND: Brown gravelly SAND with high cobble content. Cobble is sub-angular red brick and concrete. Gravel is fine to coarse sub-angular to sub-rounded red brick and concrete with wiring, plastic, tape, piping and wood.
	2.50-3.70	Brown slightly clayey slightly gravelly SAND. Gravel is fine to medium sub-angular to sub-rounded sandstone and siltstone.

Trial pit terminated at 3.70m.

Trial pit unstable in Made Ground.

No groundwater ingress.

ES = Environmental Sample, HP = Hand Penetrometer

Pictures:



Trial Pit 03: Overview of excavation



Trial Pit 03: Overview of excavated soils



EARTH ENVIRONMENTAL & GEOTECHNICAL
Houldsworth Mill Business & Arts Centre, Houldsworth Street,
Stockport, SK5 6DA
Tel: 0161 975 6088
Email: info@earthenvironmental.co.uk
Web: www.earthenvironmental.co.uk

TRIAL PIT LOG

Project Name: Old Market Street, Blackley

Date: 15/8/22

Project No.: A4932

Client: CEJ Builders


Hole Number: TP04

Logged By: O Quinn

Total Depth: 4.00m

Remarks:

Schematic Profile:

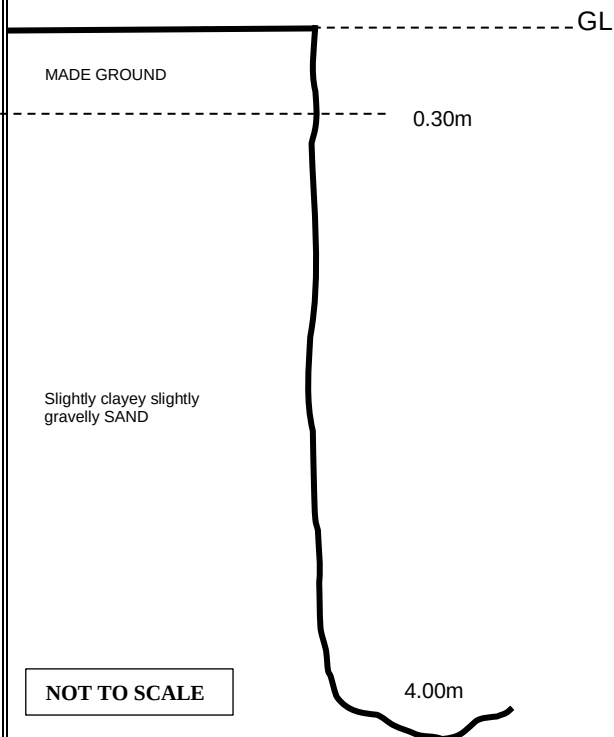

Legend	Depth (m)	Description
	0.00-0.30	MADE GROUND: Dark brown gravelly SAND with medium cobble content. Cobble is sub-angular red brick. Gravel is fine to coarse sub-angular red brick and concrete with plastic, slag and metal.
	0.30-4.00	Brown slightly clayey slightly gravelly SAND. Gravel is fine to medium sub-angular to sub-rounded sandstone and siltstone. ES = 2.00m

Trial pit terminated at 4.00m.

Trial pit stable and dry.

ES = Environmental Sample, HP = Hand Penetrometer

Pictures:



Trial Pit 04: Overview of excavation



Trial Pit 04: Overview of excavated soils