




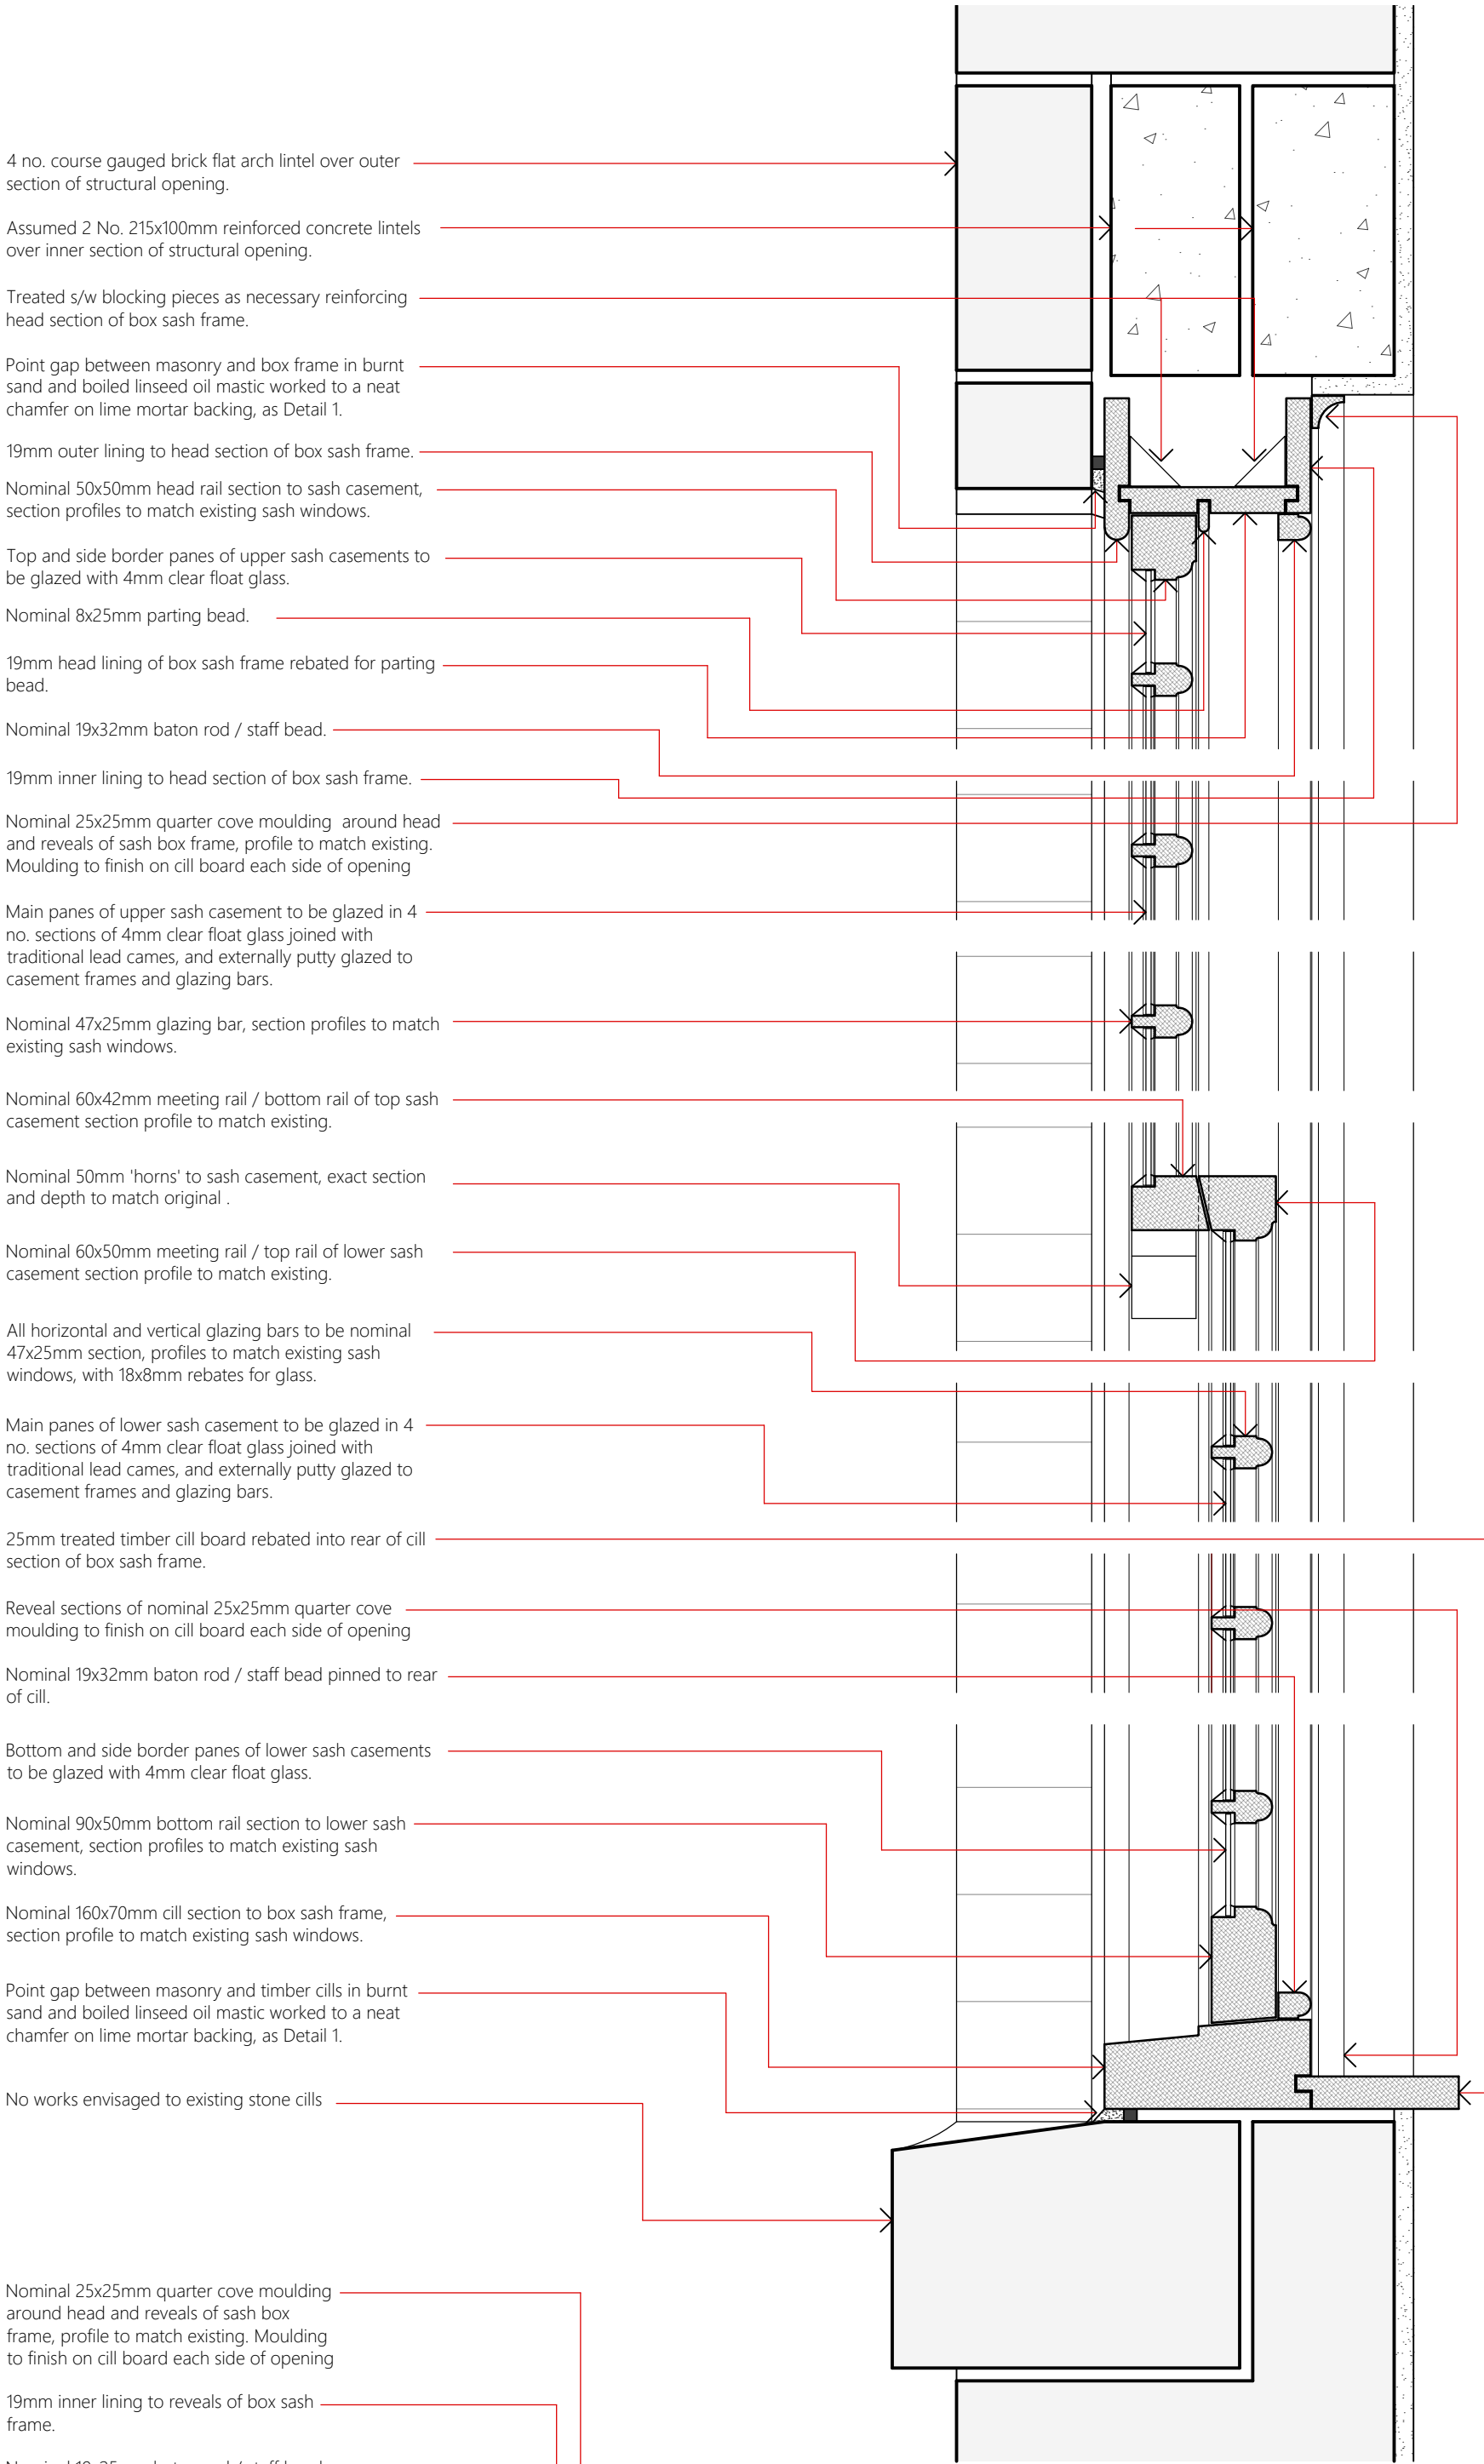


SECTION DETAIL A - A THROUGH NEW SASH WINDOW (1:5)

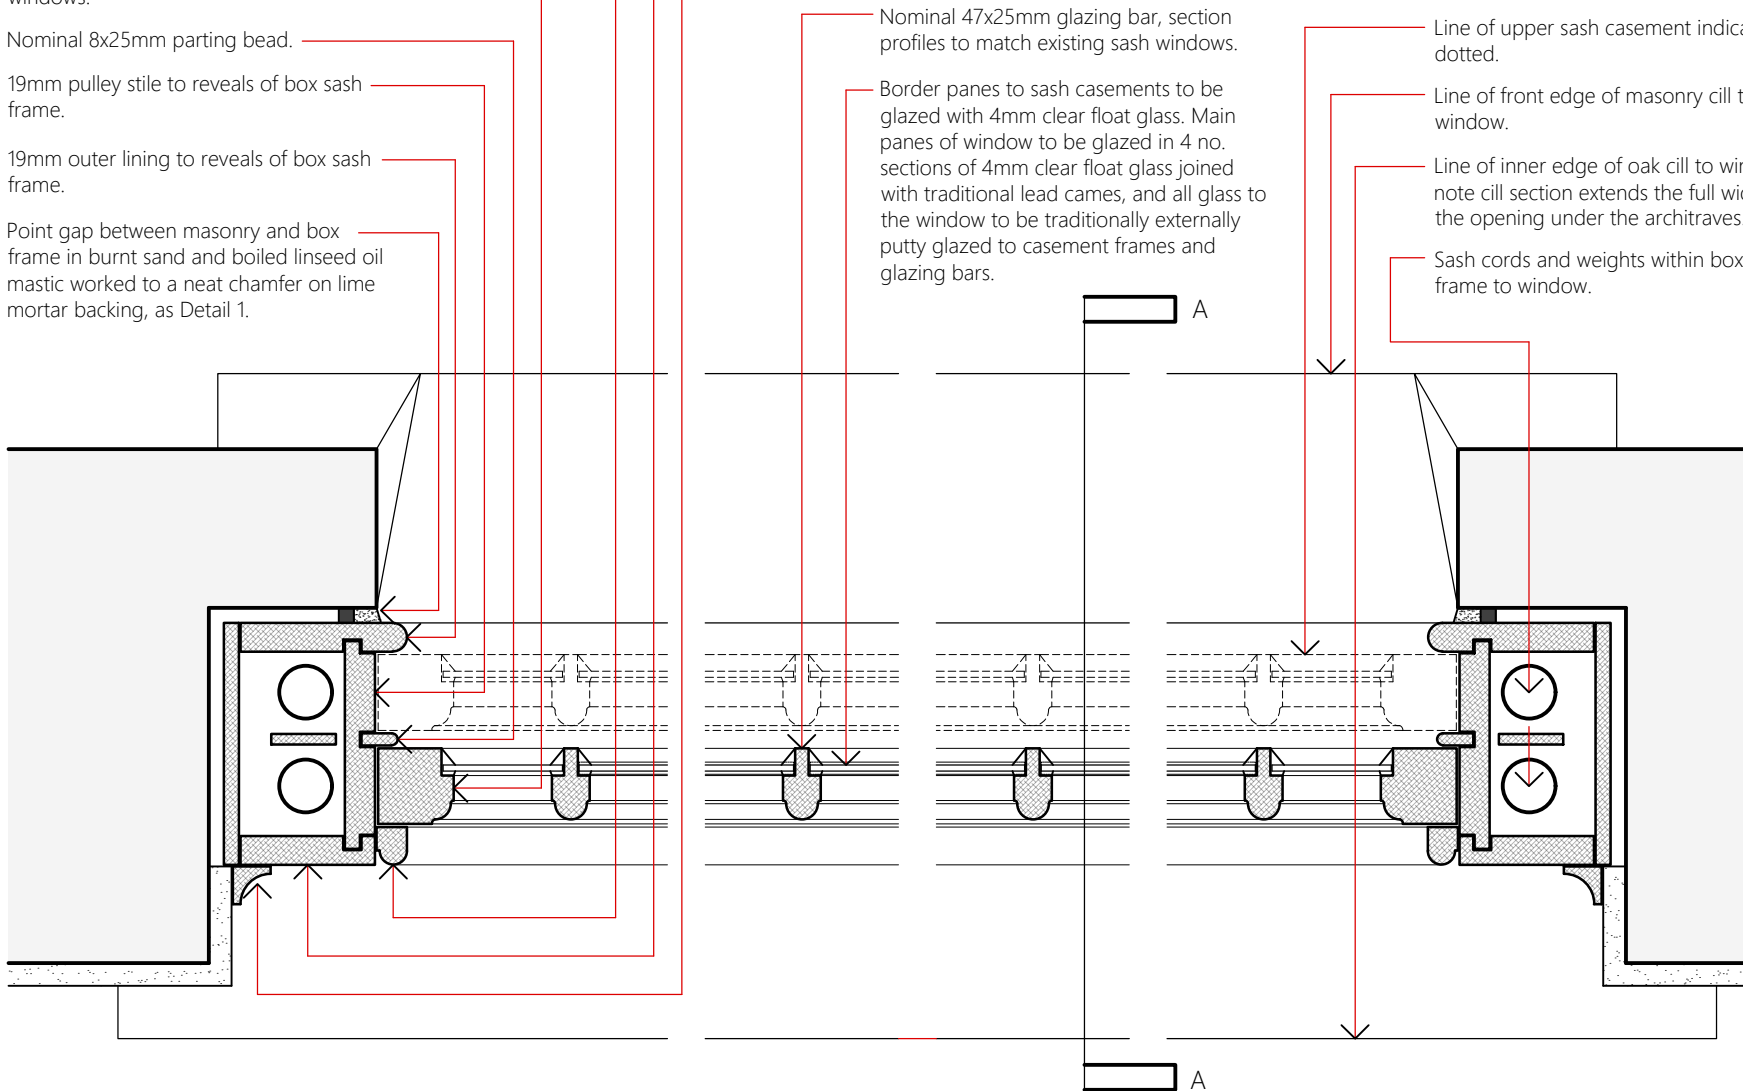


PLAN DETAIL B - B THROUGH BOTTOM CASEMENT OF NEW SASH WINDOW (1:5)

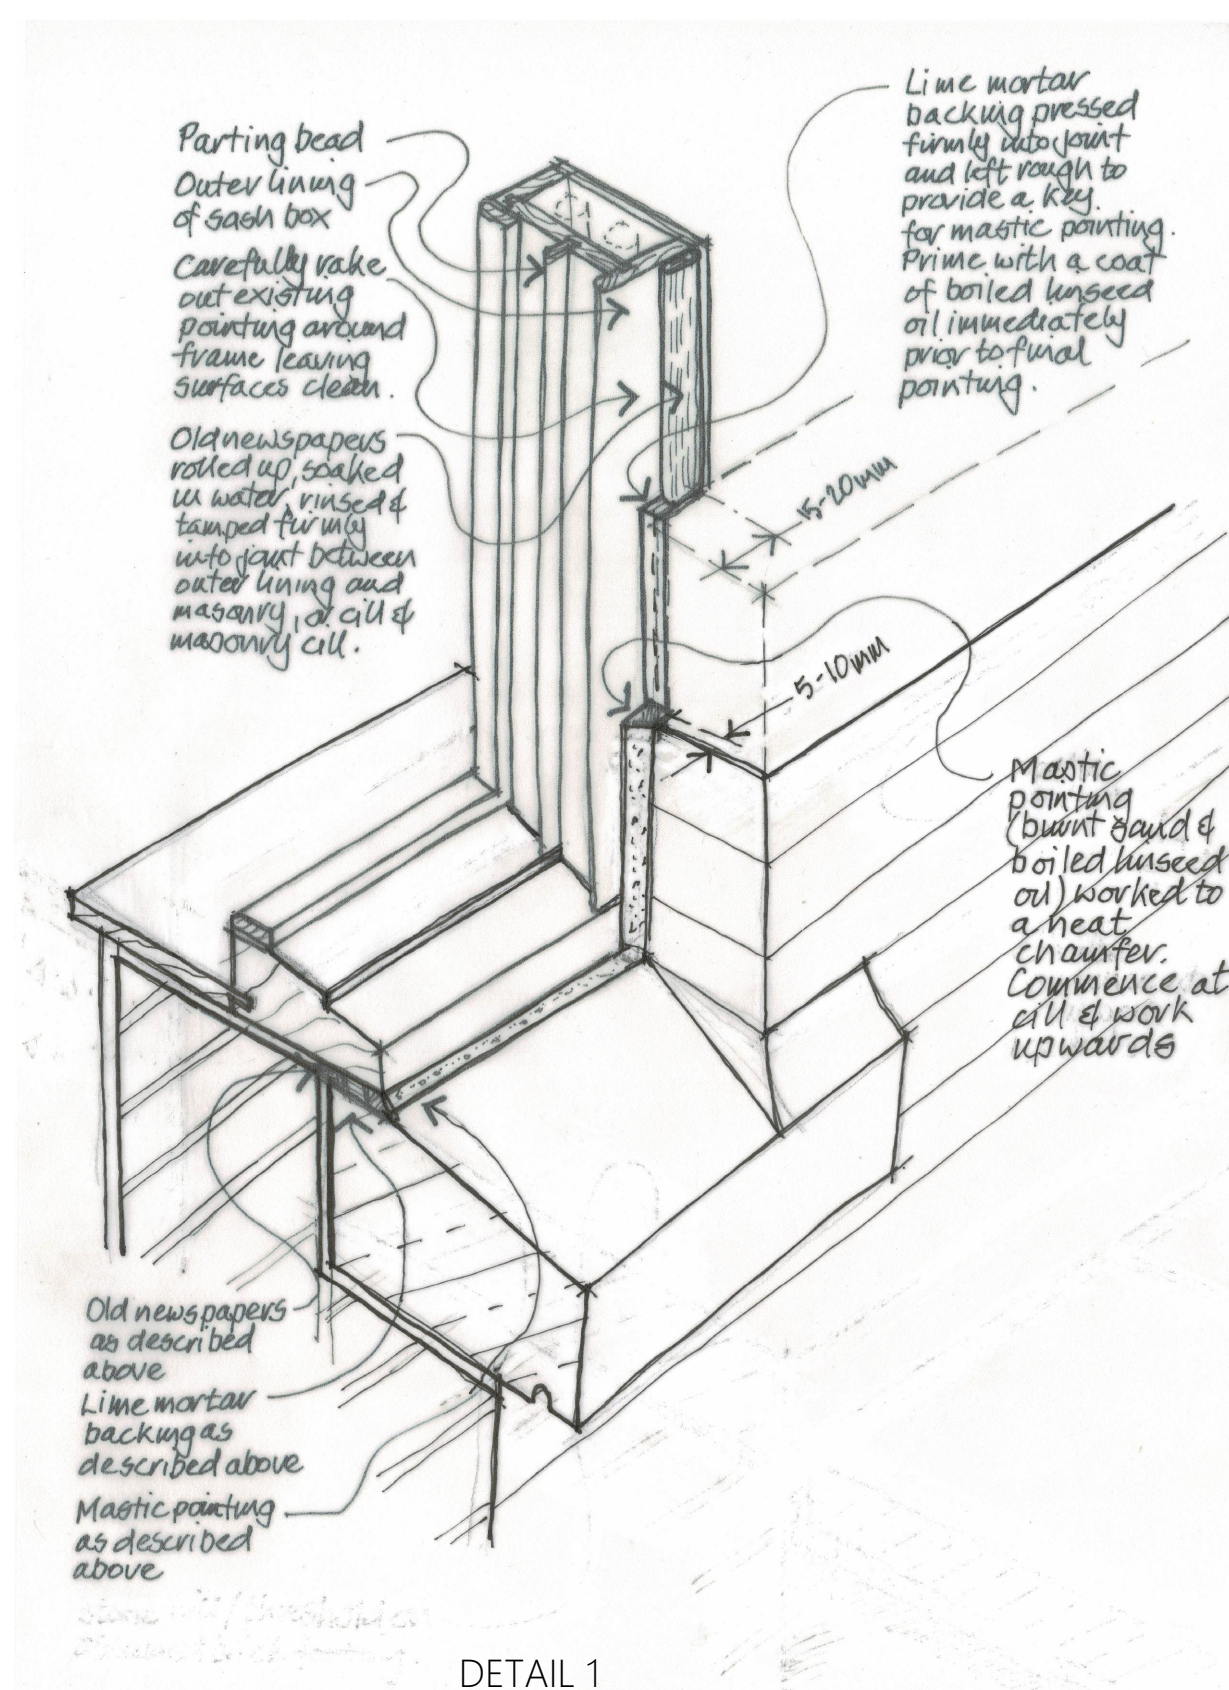


DETAIL 1

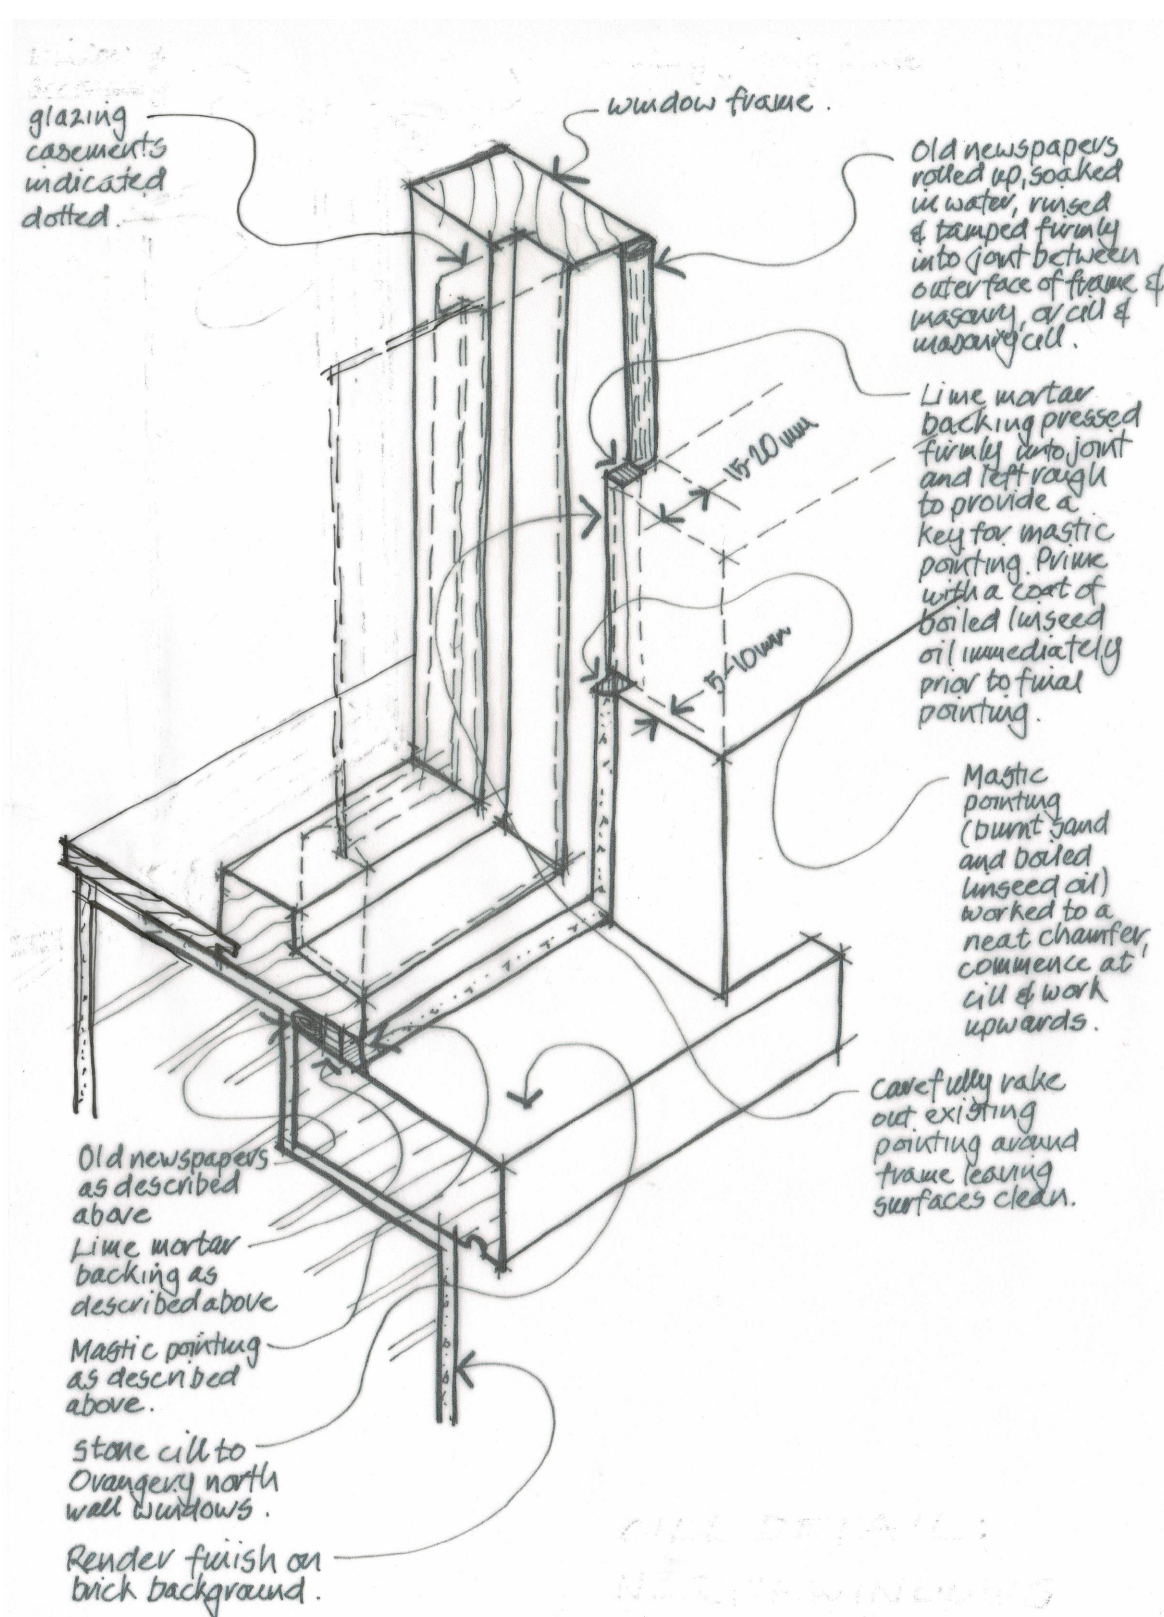


DETAIL 2

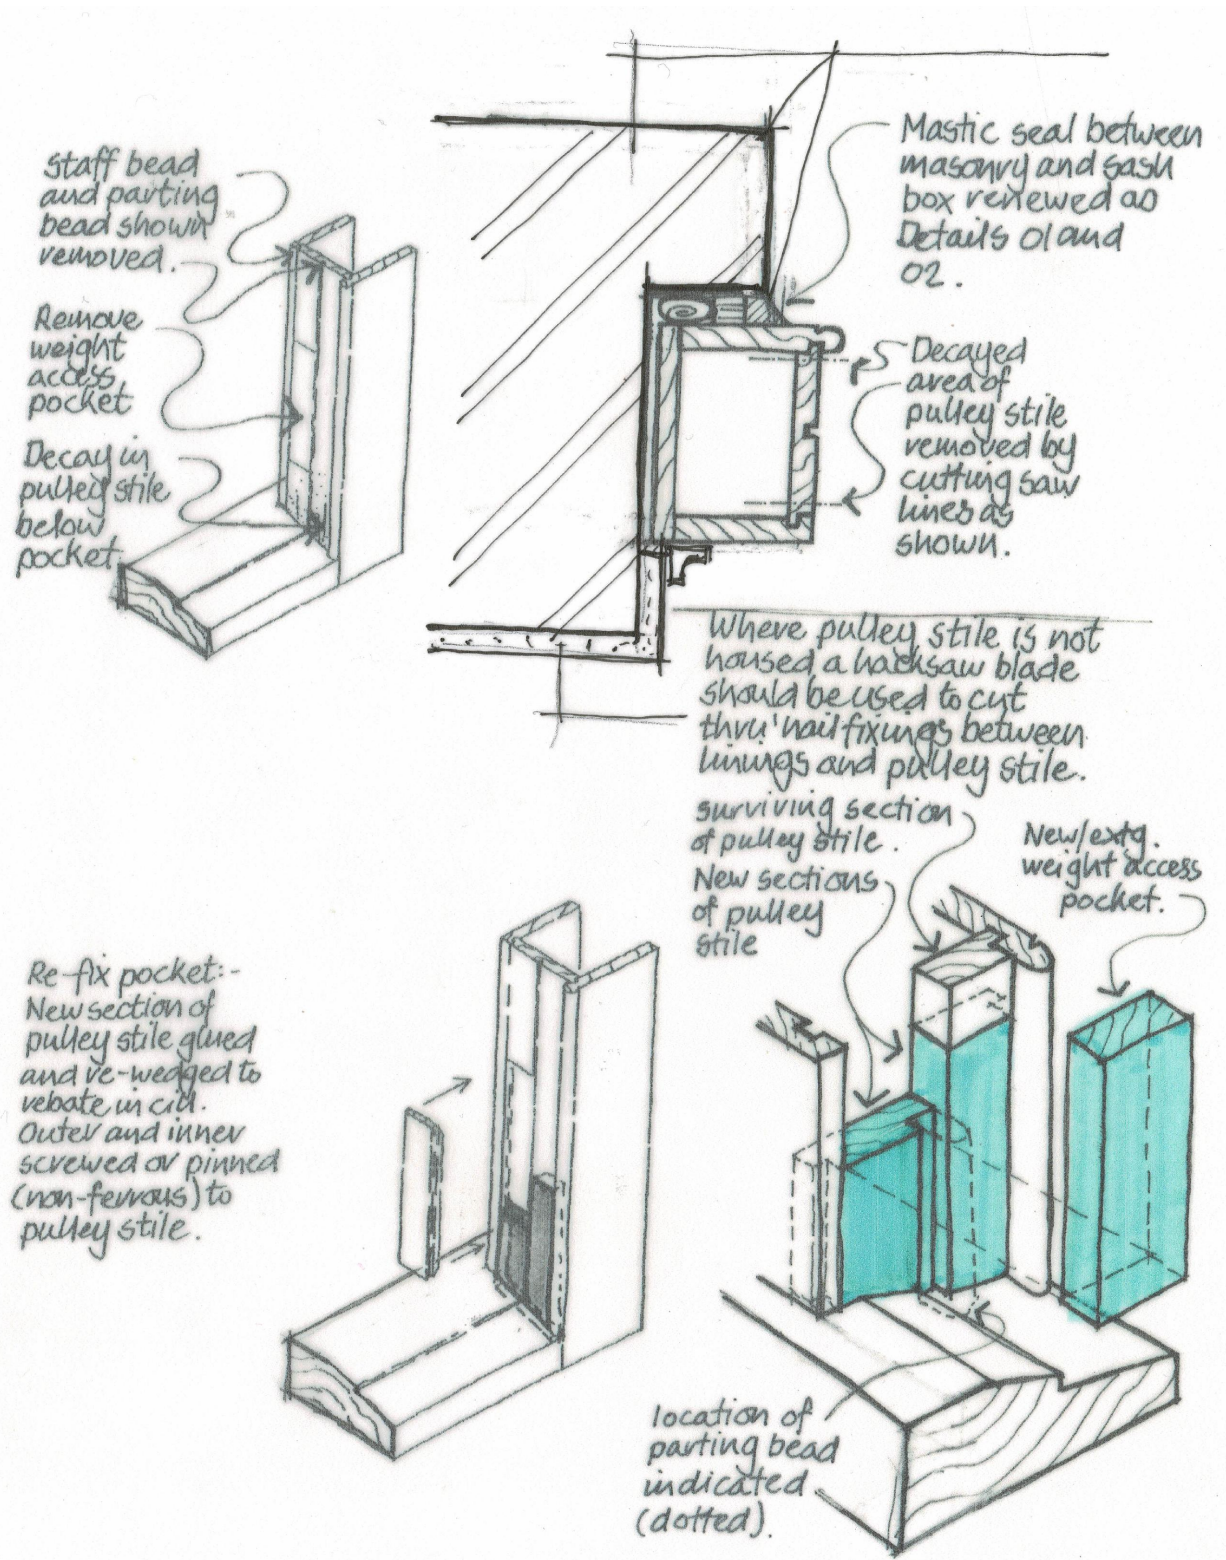


DETAIL 3

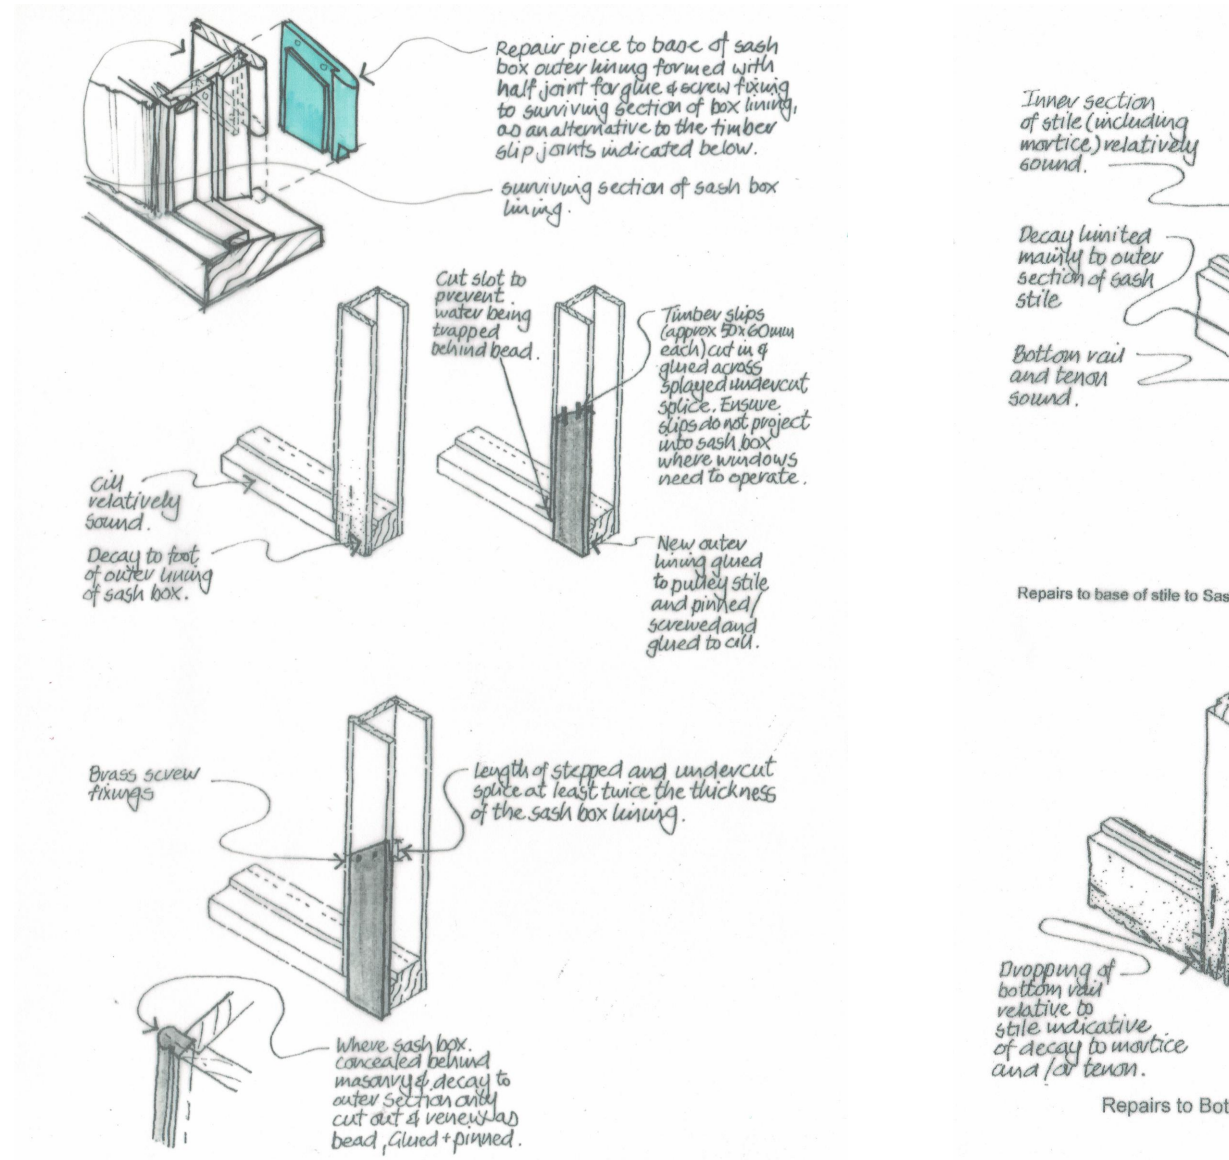


DETAIL 4

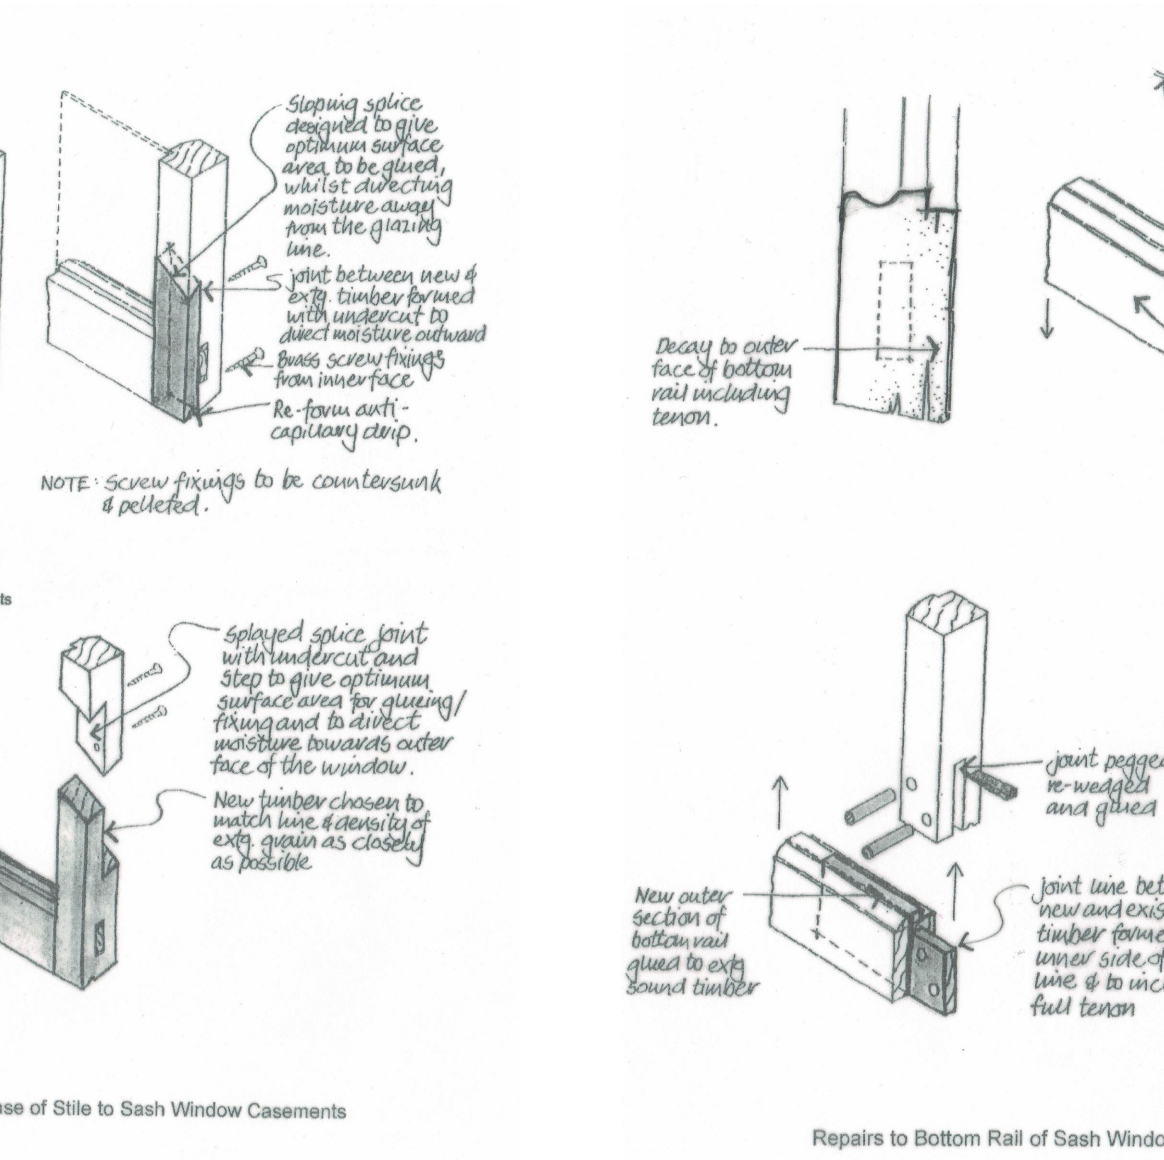


DETAIL 5

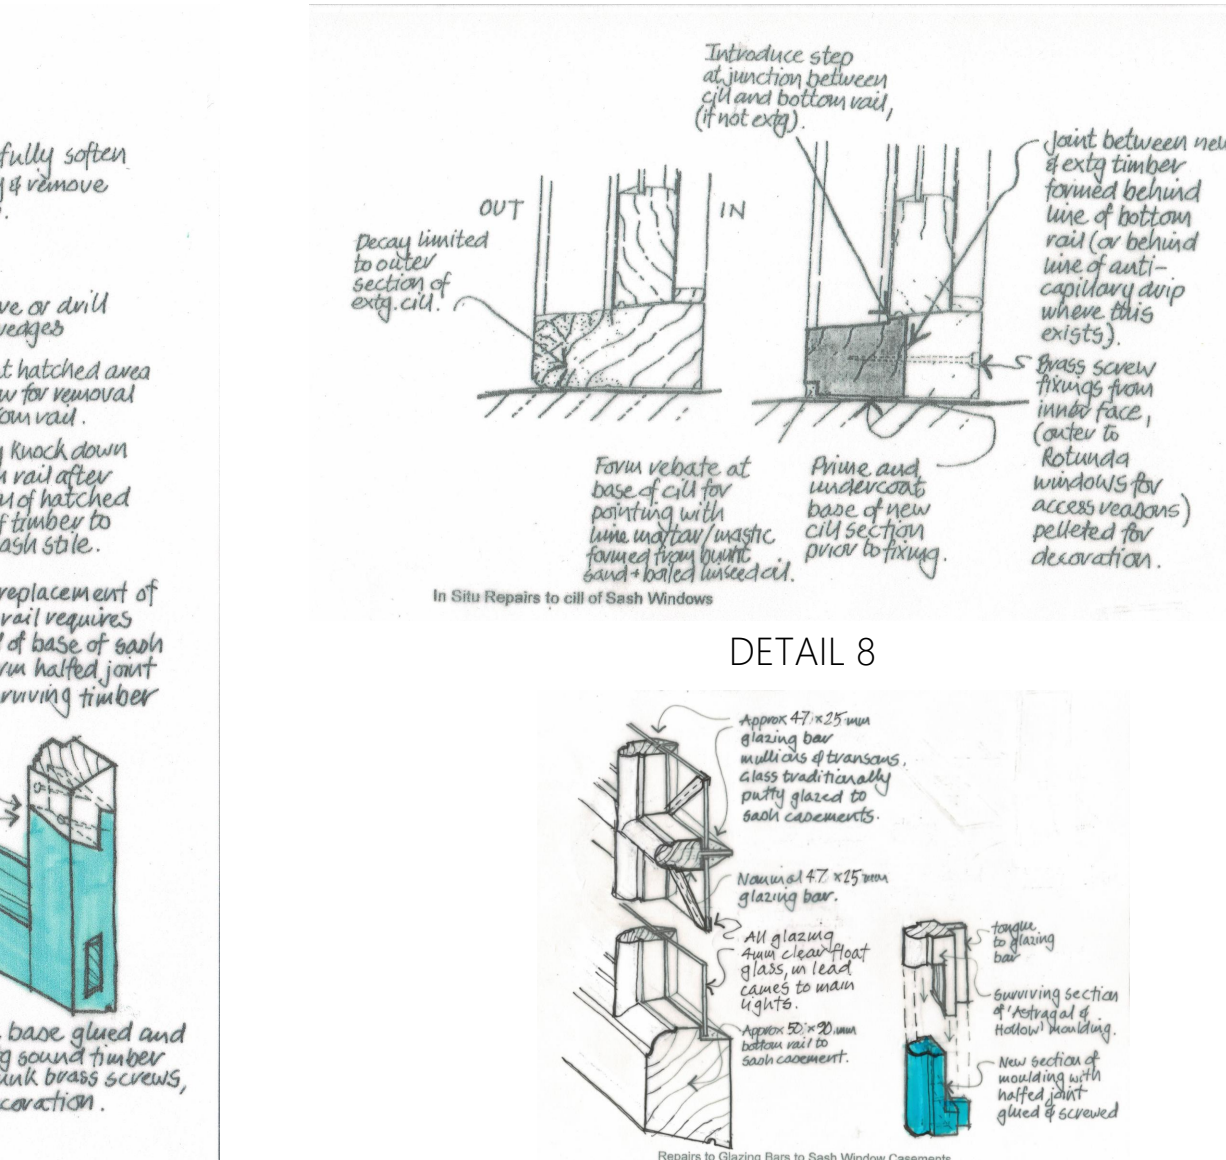


DETAIL 6

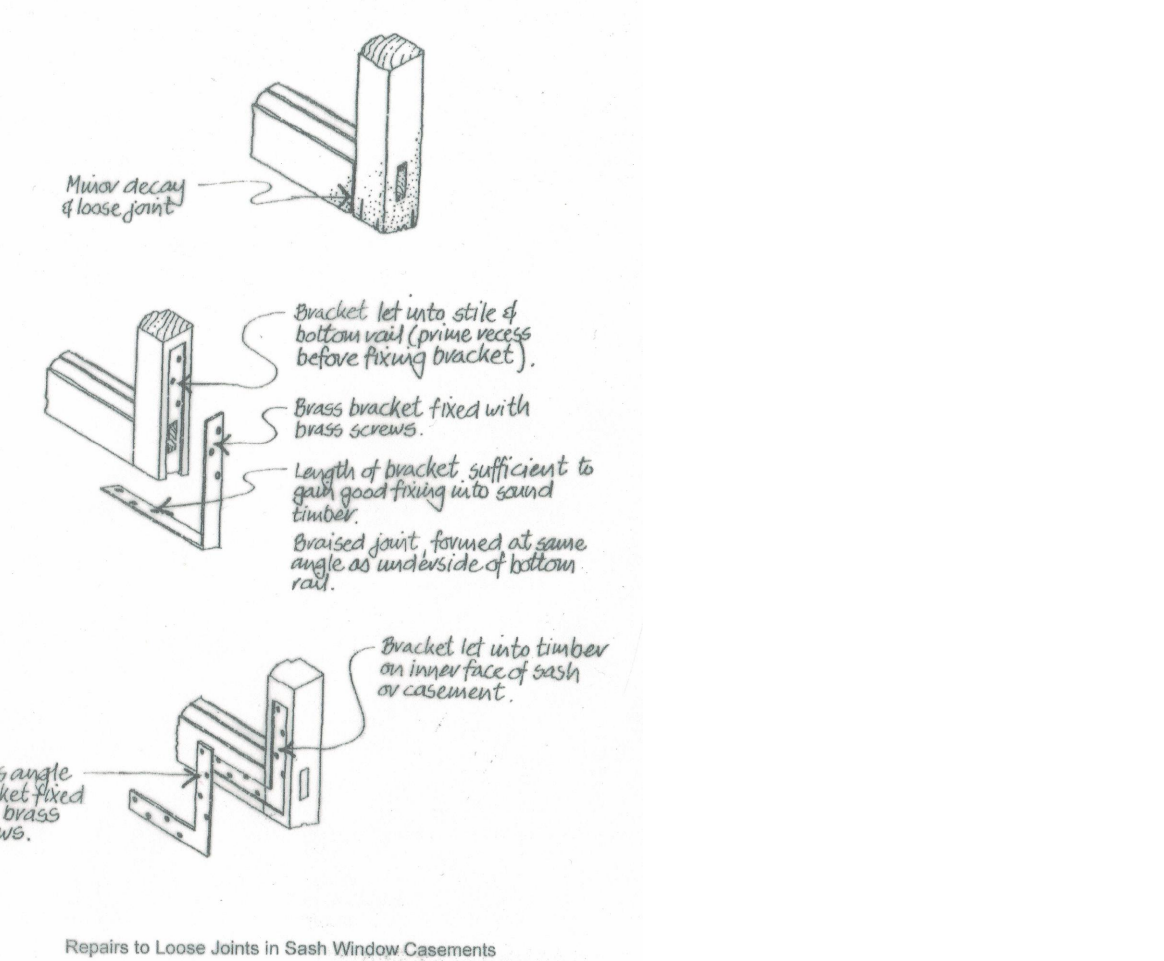

DETAIL 7

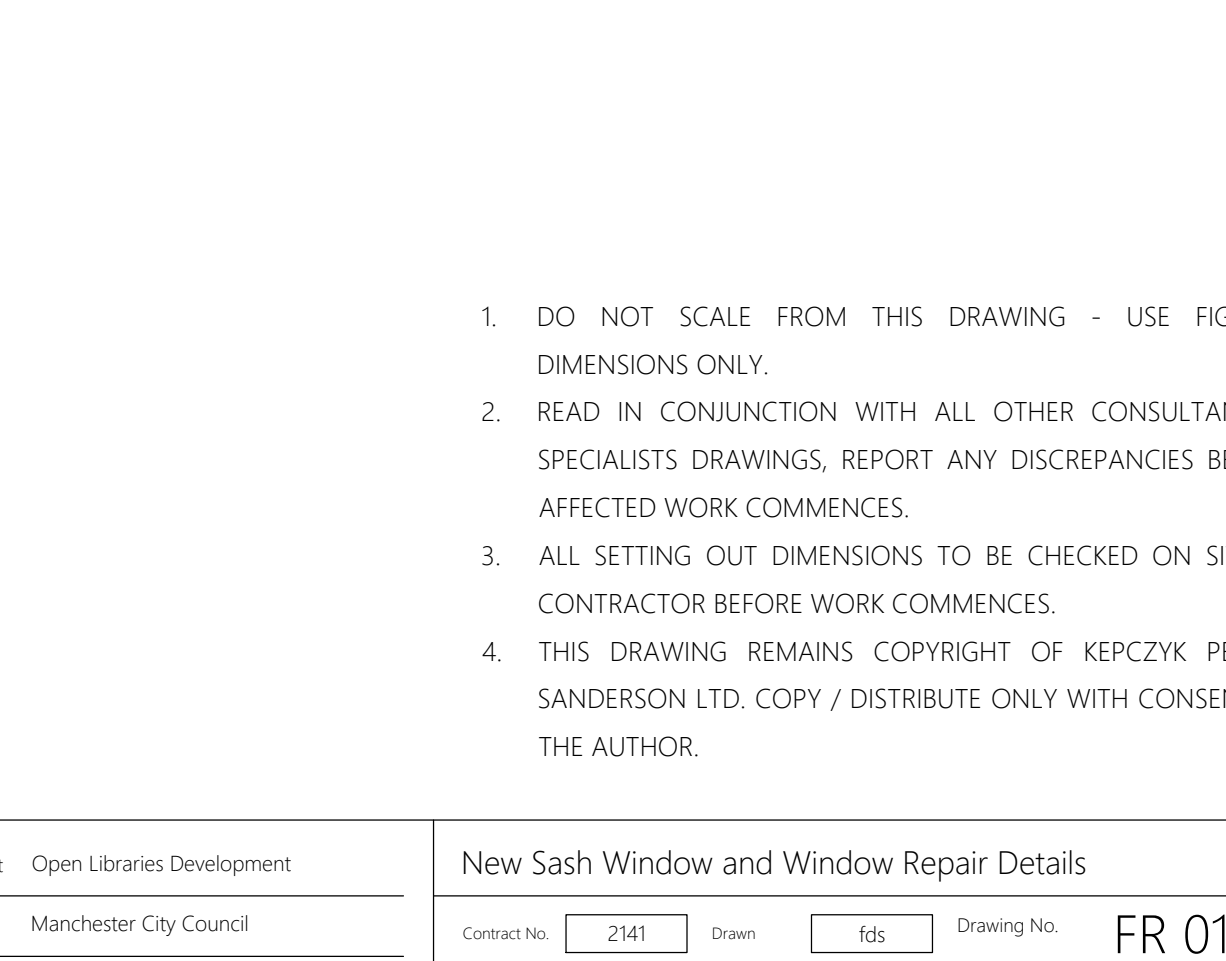

DETAIL 8

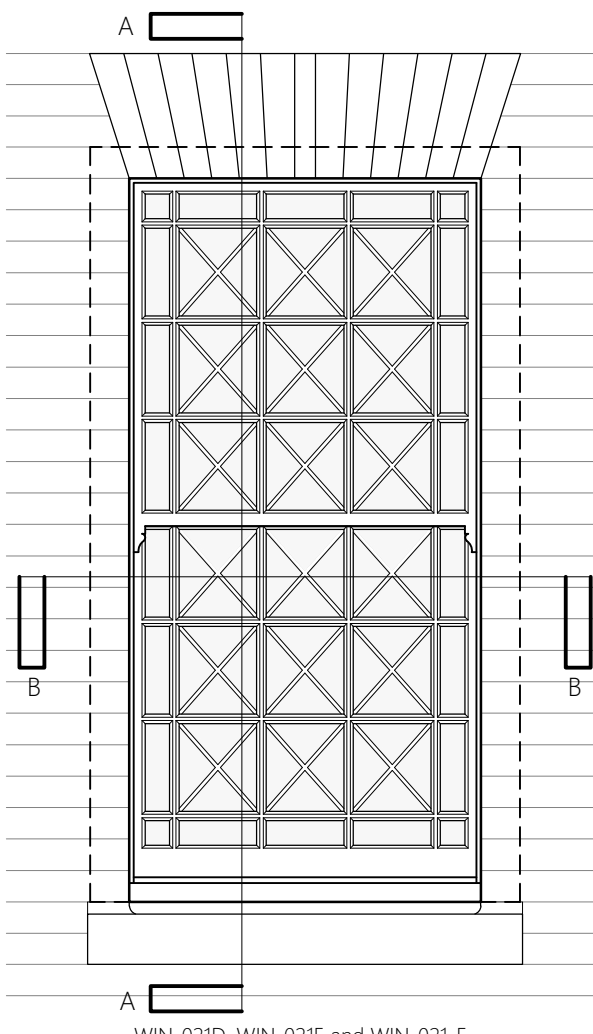

ELEVATION OF NEW SASH WINDOW (1:20)

SASH / CASEMENT WINDOW REPAIR DETAILS (NTS)

Refer to Schedules of Work to Sash and Casement Windows, 4041 / FR 017, for location of repairs.

Contract	Open Libraries Development	New Sash Window and Window Repair Details			
Client	Manchester City Council	Contract No.	2141	Drawn	fdj
Building / Structure	Chorlton District Library, Chorlton-cum-Hardy	Date	June 2022	Revision	-
KEPCZYK PEARCE SANDERSON ARCHITECTS, SURVEYORS & HISTORIC BUILDING CONSULTANTS		Address:	75 Wilmslow Road, Handforth, Cheshire SK9 3EN	As Noted / NTS @ A1	FR 018
		Tel:	01625 400103	Scale	

- DO NOT SCALE FROM THIS DRAWING - USE FIGURED DIMENSIONS ONLY.
- READ IN CONJUNCTION WITH ALL OTHER CONSULTANTS / SPECIALISTS DRAWINGS, REPORT ANY DISCREPANCIES BEFORE AFFECTED WORK COMMENCES.
- ALL SETTING OUT DIMENSIONS TO BE CHECKED ON SITE BY CONTRACTOR BEFORE WORK COMMENCES.
- THIS DRAWING REMAINS COPYRIGHT OF KEPCZYK PEARCE SANDERSON LTD. COPY / DISTRIBUTE ONLY WITH CONSENT OF THE AUTHOR.