

Copyright. This drawing and design and all the information contained therein is the sole copyright of Blik, and reproduction in any form is forbidden unless permission is obtained in writing.

CONTRACTORS PLEASE NOTE:

1) Warning: no dimensions to be scaled from this drawing. All Contractors must visit site and be responsible for taking and checking all dimensions relative to this work. The Designer must be advised of any discrepancies in writing.

2) This drawing must be read in conjunction with the Specification/Bill of Quantities and related drawings. Any structural work must be carried out to the exact specification and requirements of the Client's appointed Structural Engineer and any amendments must have his express prior written authority.

3) All structural work must be inspected at all relevant stages by the Structural Engineer and the Local Authority's Building Surveyor and comply with their requirements. Any costs and claims for damages, loss of trade, etc. incurred by failing so to do are the sole liability of the Contractor.

4) Any discrepancies between drawings and specification should be reported to the Designer prior to any work commencing.

**JBH
DEVELOPMENTS
LTD**

Ian Heald BSc MRICS
JBH Developments Ltd
Silverwell Chambers
15 Silverwell St
Bolton
BL1 1PP



M: 07714 431 608
E: ian.heald@jbh-developments.co.uk

blik
INTERIOR DESIGN & ARCHITECTURAL CONSULTANCY


Job title
**Apollo (Club Apollo)
- Manchester**

Drawing title
Test sites and repairs

Scale 1:50.	Drawing No. 1141 - 01- 04A
Date Jan. 2026	
Drawn by	

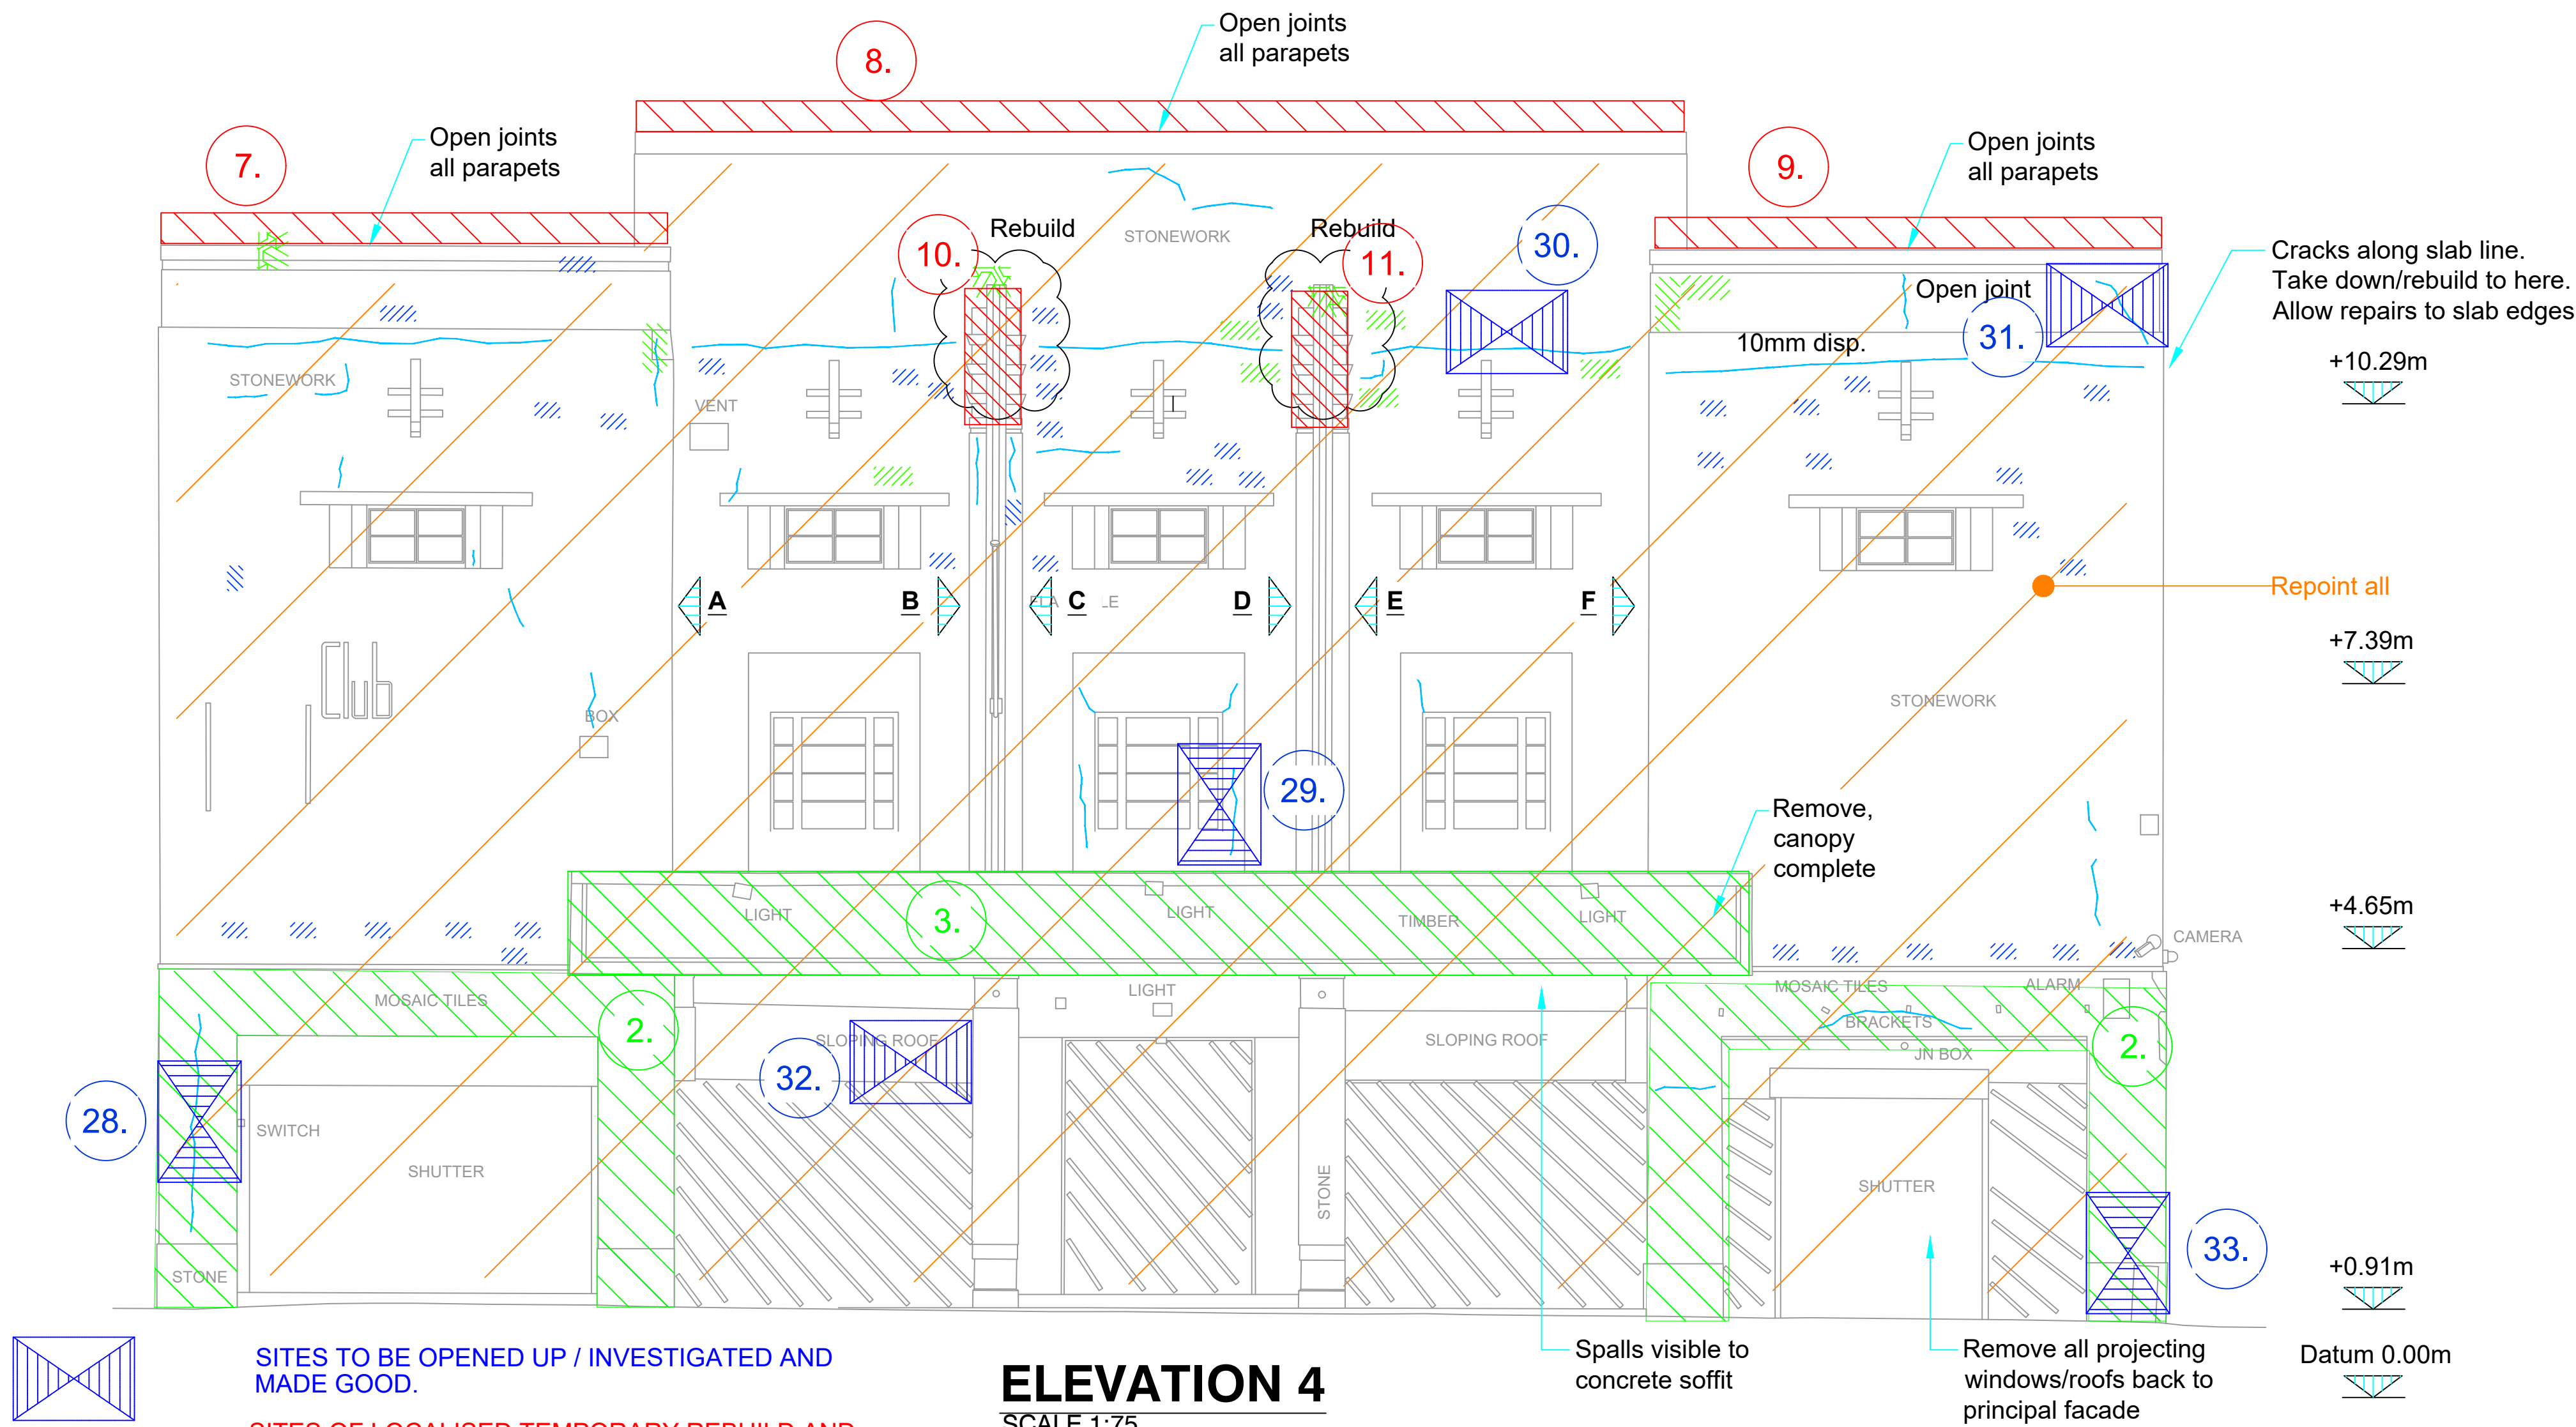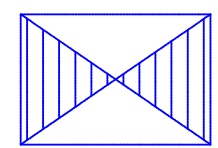


SITES TO BE OPENED UP / INVESTIGATED AND MADE GOOD.

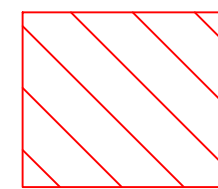

SITES OF LOCALISED TEMPORARY REBUILD AND STABILISATION.

24 Lm OF FAIENCE COPING REMOVED PREPARED AND REBED.

BRICK + FAIENCE LOADBEARING TRADITIONAL MASONRY FEATURES - TAKE DOWN + REBUILD - QUANTITY AS SHOWN..

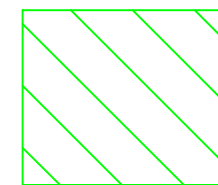

SITES TO BE STRIPPED BACK TO ORIGINAL STRUCTURE.

SITES TO BE STRIPPED BACK TO ORIGINAL STRUCTURE REMOVE MOSAIC AND STONE CLADDING BACK TO ORIGINAL STRUCTURE.

REMOVE ALL CLADDING TO CANOPY SIGNAGE BACK TO ORIGINAL STRUCTURAL STEELWORK.

SITE 28. ASSUME FAIENCE / BRICK FOR PRICING - CRACK INVESTIGATION 1.0 X 0.6

SITE 29. FAIENCE / BRICKWORK REVEALS AND DETAILS ASSUME 0.9 X 0.6

SITE 30. FAIENCE / BRICKWORK - INC. SLAB EDGE EXPOSURE 1.2 X 0.6

SITE 31. FAIENCE / BRICKWORK - INC. SLAB EDGE EXPOSURE 0.9 X 0.6

SITE 32. OPEN UP TILES ROOF AREAS TO FACILITATE ACCESS AND TO IDENTIFY DETAILS - RE-INSTATE ON COMPLETION.

SITE 33. ASSUME FAIENCE / BRICK FOR PRICING - CRACK INVESTIGATION 1.0 X 0.6

LEGEND

- DENOTES SPALL TO FAIRACE
- DENOTES EXISTING REPAIR TO FAIRACE
- DENOTES CRACKING/DEFECTS
- DENOTES LOSS OF BRICK FACE
- DENOTES DETERIORATION OF POINTING
- DENOTES PRESENCE OF VEGETATION
- DENOTES APPROX. LOCATION OF EXISTING STEELWORK (COLUMNS/BEAMS) IMMEDIATELY BEHIND FACADE BASED ON ARCHIVE DRAWING RECORDS

