



CORNBROOK RESIDENTIAL, MANCHESTER

DRAINAGE STRATEGY

Project No: 2306-18

July 2025

Rev: C02

CBR-REN -XX-XX-RP-C-00002

This report has been prepared for the sole benefit, use and information of **Forshaw Group** for the purposes set out in the report or instructions commissioning it. The liability of **renaissance** in respect of the information contained in the report will not extend to any third party. This document should not be used in whole or part by any third parties without the express written permission of **renaissance**. If any unauthorised third party comes into possession of this report, they rely on it at their own risk and **renaissance** do not owe them any Duty of Care.

Author **SELVANA AHMAD**

Date **21.07.2025**

Approved **ARIA SHINO**

Date **21.07.2025**

Contact Details:

2nd Floor Tribeca House,

21-27 Dale Street,

Manchester M1 1EY

t: 0161 393 6509

Rev.	Description	Author	Checked	Date
C02	Updated to discharge planning condition 5A	H Wilkinson	A Shino	06.02.26
C01	Stage 4 gateway submission	S Ahmad	A Shino	21.07.25

CONTENTS

1.0 INTRODUCTION.....	1
1.1 Purpose of this Report.....	1
2.0 THE SITE.....	4
2.1 Site Location.....	4
2.2 Site Description	4
2.3 Existing Site Drainage	4
2.4 Geology	5
2.4.1 Made Ground	5
2.4.2 Superficial Deposits	5
2.5 Hydrogeology & Hydrology.....	5
2.6 Proposed Development.....	6
3.0 EXISTING & PROPOSED SURFACE WATER DISCHARGE RATES.....	7
3.1 Pre-Development Surface Water Run-Off Rates	7
3.2 Proposed Surface Water Discharge Rates	8
4.0 SURFACE WATER DISCHARGE & SUDS ASSESSMENT	9
4.1 Surface Water Discharge Assessment	9
5.0 DRAINAGE STRATEGY	13

APPENDIX A – TOPOGRAPHICAL SURVEY

APPENDIX B – UNITED UTILITIES SEWER MAP

APPENDIX C – DRAINAGE SURVEY

APPENDIX D – PROPOSED DEVELOPMENT PLANS

APPENDIX E – EXISTING DRAINED AREAS PLAN

APPENDIX F – GREENFIELD RUN OFF RATES

APPENDIX G – UNITED UTILITIES CORRESPONDENCE

APPENDIX H – PROPOSED DRAINED AREAS

APPENDIX I – BELOW GROUND DRAINAGE PLAN

APPENDIX J – NETWORK DRAINAGE CALCULATIONS

APPENDIX K – NORTHWEST SUDS PRO-FORMA

APPENDIX L – OVERLAND FLOW ROUTES PLAN

APPENDIX M – FLOW CONTROL AND TANK DETAILS

1.0 INTRODUCTION

1.1 Purpose of this Report

This Drainage strategy report has been prepared to support planning application 139133/FO/2024 – “Erection of a 26-storey mixed use building incorporating 224 residential apartments (Use Class C3a), 87 apart-hotel studios (Use Class C1), amenity space, flexible commercial space (Use Class E), and cafe (Use Class E(b)), together with infrastructure, landscaping, and other associated works.”

This report has been updated to include the information required in respect to Condition 5A of planning application 139133/FO/2024:

“Notwithstanding the Flood Risk Assessment prepared by Renaissance (ref. CBR-REN-XX-XX-RP-C-00001Rev. P04); Drainage Scheme prepared by Renaissance (ref. CBR-REN-XX-XX-RP-C-00002 Rev. P03); received by the City Council, as Local Planning Authority, on the 30 January 2024, (a) the development shall not commence until a scheme for the drainage of surface water from that phase of the new development shall be submitted for approval in writing by the City Council as the Local Planning Authority. This shall include:

- *Progression through the drainage hierarchy must be evidence based and supported by site investigation including assessments of ground conditions and infiltration testing in accordance with BRE365. Proposals of attenuation should achieve half drain time within 24 hours.*

Brownfield Solutions carried out BRE365 infiltration testing as part of their Phase II Site Investigation.

In accordance with the guidance set out in BRE365, each trench was tested three times and the lowest infiltration rates from each trench was used to determine the feasibility of discharging surface water runoff from the site via infiltration.

The recorded worst-case infiltration of all test pits did not achieve the 24-hour half drain down and therefore discharging the surface water runoff from the site via infiltration is not considered to be feasible.

Refer to Appendix D of the Brownfields Phase II Site Investigation for confirmation of half drain down time and Section 4.1 of this report for further details of the Surface Water Discharge Assessment.

In addition to the above, high ground water was recorded over the site which would result in potential ingress of groundwater into any unlined SUD's systems.

The hydraulic modelling outputs in Appendix J indicates a half drain down time of 370 minutes (6 hours) for the attenuation tank and therefore the 24-hour half drain down time for the proposed drainage network is considered to be achieved.

- *Where surface water is connected to the surface water sewer in Dinton Street, identification of the asset owner and evidence of agreement in principle from the asset owner or United Utilities is required. An email of acceptance of proposed flows and/or new connection will suffice. This must include evidence of consultation with United Utilities to determine if the asset is an adopted public sewer.*

Refer to Building Safety Act Narrative (Doc Ref CBR-REN-XX-XX-RP-C-00022) for confirmation of ownership and acceptance of proposed flow rates.

- *Where surface water is connected to the public combined sewer, the strategy shall be designed in accordance with the agreement in principle from United Utilities.*

The surface water drainage network is proposed to connect into the surface water sewer within Dinton street and therefore this requirement is not considered to be applicable.

- *Maximised integration of green SuDS components (utilising infiltration or attenuation) if practicable.*

Due to the high ground water table recorded over the site, infiltration systems are not considered to be feasible (refer to Brownfields Phase II for further information on the groundwater levels over the site) and therefore to prevent groundwater ingress into the network, it is proposed that the surface water flows from the site are attenuated via a wrapped geo-cellular tank.

- *Details of surface water attenuation which achieves a runoff rate no greater than 5 l/s, supported by evidence of agreement in principle from the relevant authority/service provider.*

The maximum surface water discharge rate from site is 3.2 l/s. Refer to Drainage GA in Appendix I and InfoDrainage hydraulic model outputs in Appendix J.

- *A finalised drainage layout showing all components, outfalls, levels and connectivity.*
Refer to Appendix I for finalised below ground drainage GA
- *Hydraulic calculations of the proposed drainage system, including all design parameters. Calculations must include Critical Storm Events for the 1 in 2, 1 in 30 and 1 in 100 + 45% Climate Change. Results must demonstrate no surcharge for the 1 in 2, no flooding in the 1 in 30 and no flooding of buildings for the 1 in 100 + 45% Climate Change.*

The drainage networks have been designed to accommodate the 2, 30 and 100 year return events with 40% and 45% climate change allowances for the 30 and 100 year events respectively.

No surcharge is indicated for the 1 in 2-year storm and no flooding in both the 1 in 30 and 1 in 100 year storms.

Refer to InfoDrainage hydraulic model outputs in Appendix J.

- *Where a public sewer diversion/abandonment is proposed, agreement in principle from United Utilities is required. An email of acceptance will suffice.*

Refer to Building Safety Act Narrative (Doc Ref CBR-REN-XX-XX-RP-C-00022) for email correspondence noting acceptance of sewer abandonment.

- *A blockage risk assessment must be undertaken as part of the drainage strategy to support proposed flows less than 5 l/s.*

The blockage risk for the flow control has been considered.

All surface water runoff will pass through the Vortex Particle separator before passing through the flow control. This will remove any solids that could present blockage risk and therefore the risk is considered to be low.

- *A plan indicating surface water overland flow routes for extreme events to ensure flows are diverted away from existing and proposed buildings (including basements).*

Refer to Appendix L for Overland Flood Flow Routes. External levels have been designed to fall away from buildings and towards highways and landscaping areas.

- *Construction details of flow control and SuDS elements.*

Refer to Appendix M for Flow Control and attenuation tank details

- *A plan indicating easements. SuDS features (including attenuation tanks) should be appropriately positioned, including a 2.5m easement from the existing highway and a 5m easement from any dwellings, guaranteeing accessibility for future maintenance and contingency for asset failure. This practice is in accordance with SuDS Manual (C753).*

Refer to Below Ground Drainage GA in Appendix I for plan showing 5 metre easement around the attenuation tank. All site boundaries and highways are located outside of the easement, however some parts of the structures within the site are within it. In these areas, localised temporary works would be required for any future major dig out.

Refer to Below Ground Drainage GA in Appendix I for plan showing 5 metre easement around the attenuation tank. The highway and site boundary are both outside of the easement area

The attenuation tank is located less than 5 metres from the piled foundations of the proposed building. and therefore any future digging out of the attenuation tank will require temporary works.

The report should be read in conjunction with the following reports

- Renaissance Flood Risk Assessment & Drainage Strategy – CBR-REN-XX-XX-RP-C-00001 – January 2024
- Brownfields Phase II Geo-environmental Assessment Report – AH/C5550/13714 Rev A – February 2025.

2.0 THE SITE

2.1 Site Location

The proposed development site is located off Cornbrook Road. Manchester.

The site location is described below:

- Post Code M15 4YG
- OS Reference 382421 , 397060
- National Grid Reference SJ824970



Figure 2.1: Site Location

2.2 Site Description

The site is circa 0.230 Ha and lies within a developed area, bounded by Dinton Street to the northwest, Cornbrook Road and Bridgewater Way to the south and the Vox residential development to the east. An active tram line and tram stop are present to the northwest of the site.

The site was developed with terraced housing and two public houses during the 1840s before being demolished and replaced by industrial buildings in the early 1980s which remained until recently. All buildings have now been demolished and the site is unoccupied.

The topographical survey (Appendix A) indicates the site to be relatively flat with sitewide levels approximately between 27.55 m AOD and 30.78m AOD.

2.3 Existing Site Drainage

The existing site is 57% impermeable and it is assumed that the previous developments positively drained into the sewer network surrounding the site.

United Utilities sewer records (Appendix B) indicate a 375x510mm diameter Combined Sewer to the northwest of the site within Dinton Street flowing to the southwest before connecting into a 300mm diameter combined sewer within Cornbrook Road to the south of the site.

A 400mm diameter Combined Sewer is indicated beneath the historic Runcorn Street in the central portion of the site flowing from north to south.

A 300x400mm diameter combined sewer is indicated beneath the historic Westminster Street. It is assumed that this sewer was abandoned as part of the works for the adjacent site development.

Based on a review of the planning application of the adjacent site, a surface water sewer is indicated to have been constructed within Dinton Street as part of the works for the Vox Residential development to the east of the site. The sewer is assumed to connect into the Cornbrook Culvert to the southwest of the site. A CCTV survey has been commissioned to confirm its extent and connectivity. Refer to Appendix C

2.4 Geology

Historic SI records indicate there to be between 0.50m and 3.60m of made ground beneath the site, typically consisting of sands and gravels with varying cobble and boulder contents, underlain by between 0.35 and 2.10m of fluvio-glacial deposits consisting of very gravelly sand with variable cobble contents. This is indicated to continue into glacial till consisting of generally firm to stiff slightly gravelly clay down to 9.00mbgl. This is underlain by weathered sandstone bedrock which becomes competent to core at circa 13.00mbgl. The ground conditions on site are to be verified by further site investigations.

2.4.1 Made Ground

BGS mapping does not display any made ground deposits on site, however based on the historical mapping and the development that has taken place, made ground deposits are highly likely to be present.

2.4.2 Superficial Deposits

The majority of the site is indicated to be underlain by Glaciofluvial Sheet Deposits, typically comprising sand and gravel. The far western corner of the site and the land to the west is underlain by glacial Till, which typically comprises clay with small quantities of silt, sand and gravel.

2.4.3 Solid Geology

The deeper solid geology is indicated to be part of the Chester Formation which typically comprises sandstone.

No faults are shown on or within an influencing distance of the site.

2.5 Hydrogeology & Hydrology

The nearest watercourse and surface water feature is the Cornbrook Culvert to the south of the site which runs approximately south-east to north-west.

The table below indicates the aquifer designation of the solid geology within the site.

Stratum	Coverage	Aquifer Designation
Glacial Till, Devensian	Full Site	Secondary Aquifer (Undifferentiated). The classification is assigned where it is not possible to attribute either category A or B to the aquifer
Chester Pebble Bed formation	Full Site	Principal Aquifer. This is the Geology of high intergranular and/or fracture permeability, usually providing a high level of water storage and may support water supply/river base flow on a strategic level.

Table 2.1 –Environment agency aquifer designations of site geology

A summary of the pertinent hydrogeological features within the Phase 1 Desk Study are provided below:

Description	Distance (m) & Direction	Details
Nearest Active Groundwater Abstraction	890m, southwest	-
Nearest Active Potable Groundwater Abstraction	250m, southwest	-
Source Protection Zones	-	Site lies within Zone 2 (Outer Catchment) of a Source Protection Zone and a Zone 1 (Inner Catchment) is located c.50m southwest of the site. Source Protection Zones are associated with the 'Nearest Active Ground Water Abstraction'

Table 2.2 –Summary of Hydrogeological features

2.6 Proposed Development

The Cornbrook Residential development comprises the construction of a 26-storey concrete residential tower providing 88 aparthotels from 2nd to 5th floor and 224 apartments from 6th floor with private amenities and a café at ground floor as well as external landscaping along Bridgewater Way, Cornbrook Road and to the south of the site.

3.0 EXISTING & PROPOSED SURFACE WATER DISCHARGE RATES

3.1 Pre-Development Surface Water Run-Off Rates

The development is considered 57% impermeable consisting of the existing hardstanding from previously developments. The remaining 43% is considered permeable and consists of vegetation. Refer to topographical survey in Appendix A and Existing Impermeable Areas drawing CBR-REN-00-FN-DR-C-00050-P01 in Appendix E.

Existing Brownfield Run-Off Rates

The brownfield run off rate has been calculated using the Modified Rational Method, based on a 60 minute storm duration.

Modified Rational Method: $Q = 2.78Ci_{(peak)}A$

$$C = C_V C_R$$

$$C = 0.84 \times 1.3$$

Areas (ha)	I _(peak) (mm.hr)			Peak Runoff (l/s)		
	1 in 1 Year	1 in 30 Year	1 in 100 Year	1 in 1 Year	1 in 30 Year	1 in 100 Year
0.23	40.398	98.615	129.253	28.207	68.855	90.248

Table 3.1 – Brownfield Run-Off Rates

Existing Greenfield Run-Off Rates

The greenfield run-off for the total site area has been considered, this has been calculated using Microdrainage ICP SuDS method (Appendix F). The rates presented below are what would be typical of a site with an equivalent surface area which remains undeveloped / covered in grass or vegetation. A partly urbanised catchment ratio of 0.75, Q_{bar} has a return period of 2.3 years.

The equivalent greenfield

RETURN PERIOD	Q _{GREENFIELD} (l/s)
1 in 1 year	2.8
1 in 2 year	3.3
1 in 30 year	4.6
1 in 100 year	5.0
Q _{bar} (URBAN)	3.2

Table 3.2 – Greenfield Run-off Rates

3.2 Proposed Surface Water Discharge Rates

The non-Statutory Technical Standards for Sustainable Drainage Systems (2025) state, where the volume of runoff discharged from the development to surface waters or sewers for the 1% AEP, 6-hour rainfall event is greater than the volume of greenfield runoff for the same rainfall event, the peak allowable discharge rate from the development for the 1% AEP event shall be limited to the 50% AEP greenfield runoff rate, which can be considered equivalent to the calculated QBAR (mean annual flood) or QMED (median annual flood) for the site, or 3l/s/ha, whichever is the greater.

Policy JP-S 5 from the Places for Everyone Joint Development Plan expects developments to manage surface water runoff through sustainable drainage systems and as close to source as possible (unless demonstrably inappropriate) so as to not exceed greenfield run-off rates or alternative rates specified in district local plans, such as those identified for areas with critical drainage issues.

As set out within the Manchester Council SFRA, developments should aim of reducing runoff to Greenfield rates up to a 1 in 100-year storm event, considering climate change.

The maximum surface water discharge from the site is therefore proposed to be restricted to QBAR 3.2l/s, to control the flow and volume of runoff from the site.

4.0 SURFACE WATER DISCHARGE & SUDS ASSESSMENT

4.1 Surface Water Discharge Assessment

In accordance with NPPF, the following hierarchy of surface water drainage options has been considered:

- Discharge into the ground (infiltration);
- Discharge to a surface water body;
- Discharge to a surface water sewer, highway drain, or another drainage system;
- Discharge to a combined sewer.

The Phase 1 desktop study identifies the site has been developed historically and as such made ground has been proven to circa 3.6m below ground. This could potentially pose risks to the mobilisation of contaminants should infiltration be utilised. For this reason infiltration has been discounted.

Opportunities for discharge to watercourse have been considered. The closest watercourse is the Cornbrook culvert and it is understood that as part of the Phase 1 of the wider development a surface water sewer was constructed within Dinton Street and a connection made to the Cornbrook Culvert. The design of this surface water sewer included an allowance for this phase and as such a stub connection was constructed. Therefore it is proposed that this phase utilises this connection in order to discharge surface water run-off to the Cornbrook culvert.

Connection to the public sewer will be subject to a S106 application with United Utilities under the water industry act.

4.2 Attenuation requirements

The proposed development area is 0.23ha. This comprises of the building footprint and external landscaping.

Refer to Appendix H for the proposed drained areas.

Due to the nature of the development urban creep has not been considered.

The post development discharge rates will include for an increase in the rainfall intensity of 45% for the 1% annual exceedance probability (AEP), to allow for climate change as is consistent with a design life of the development of 100 years, as outlined by the National Planning Practice Framework (NPPF).

Quick storage estimates for the above return periods, using Micro Drainage, indicate that the approximate attenuation volumes shown in table 4.1 are required to limit the peak surface water discharge to 3.2 l/s.

Return Period	Development Area (ha)	Surface Water Attenuation Estimate (m3)
1:100 Year +45%CC	0.23	107-156

Table 4.1 – Attenuation Volumes

4.3 Sustainable Urban Drainage

Table 4.1 below provides a summary of typical SuDS techniques outlined within CIRIA guide 753 SuDS manual. Based on a review of the suitability of the SuDS techniques it is proposed that the Salford Youth Zone development may incorporate the following:

SUDS TECHNIQUE	DESCRIPTION	SUITABILITY FOR DEVELOPMENT SITE	
Rainwater Harvesting	Collection of rainwater run-off for use	Large impermeable area and limited usage deems this unsuitable	✗
Soft Landscaping	Grassed areas that allow direct infiltration of rainwater	Soft landscaping will be utilised to limit the impermeable area	✓
Filter Drains	Granular filled Linear drains / soakaway with either granular fill and perforated pipe, or dense vegetation that treat runoff from adjacent impermeable areas	Not suitable due to known ground conditions	✗
Swales	Shallow landscape channel that can infiltrate or convey runoff.	Existing trees and limited soft landscaping deem this unsuitable	✗
Infiltration Basins	Depressions in the ground designed to store and infiltration runoff to the ground. Can be landscaped to provide amenity value.	Not suitable due to known ground conditions and limited space	✗
Wet Ponds	Basins with permanent pool of water providing water quality treatment, wildlife, and amenity benefit. Designed to provide temporary storage for additional runoff.	Not suitable due to limited space and poses a health and safety risk to the end users.	✗
Extended Detention Basins	Dry basins that are designed to temporarily store runoff providing water quality treatment.	Not suitable due to limited space and poses a health and safety risk to the end users.	✗
Constructed Wetland	Ponds and shallow wetland areas with vegetation to improve pollution removal and enhance wildlife habitat.	Not suitable due to limited space and poses a health and safety risk to the end users.	✗
Porous Paving	Granular build-up beneath permeable paving systems that can be used to either store runoff (lined system) and increase time of concentration or allow percolation into the ground.	Potential use with the proposed car park – however site levels and proposed drainage depths deem it not suitable.	✗
Trees Pits	Managed permeable paving systems around tree pits that can be used to either store runoff (lined system) and increase time of concentration or allow percolation into the ground.	Not suitable due to site conditions and site layout	✗
Soakaways	Infiltration device to temporarily store runoff and allow it to percolate into the ground.	Not suitable due to known ground conditions	✗
Green Roof	Vegetated roof area that reduces runoff and increases time of concentration.	Not suitable due to roof geometry and structural implications	✗
Blue Roof	Roof area designed to store and reduce peak runoff rates during intense storms.	Not suitable due to roof geometry and structural implications	✗
Underground Storage	Attenuation structures installed below ground to provide runoff storage.	Suitable beneath the car park.	✓

✗ Not suitable

? Potentially suitable subject to further investigation

✓ Suitable

Table 4.2 – SuDS Techniques & Suitability for Development Site

4.4 Water Quality Assessment

To assess the water quality, consideration will be given to the guidance with the National Standard for Sustainable Urban Drainage (NSSUD) and CIRIA Guide C753. The pollution hazard levels for difference land uses are presented in table 4.2 and are based on the definitions in the NSSUD and C753.

POLLUTION HAZARD LEVEL	LAND USE
Very Low	Residential roofs
Low	Individual property driveways, non-residential roofs, residential car parks, low traffic roads, non-residential car parking with infrequent change (e.g. Schools, offices)
Medium	Commercial yards and delivery areas, non-residential car parking with frequent change (e.g. hospital, retail), minor roads
High	Site with heavy pollution (e.g. Haulage yards, lorry parks, waste sites, sites with chemical and fuels are delivered, handled, stored etc.)

Table 4.3 – Pollution Hazard Levels

The pollution hazard level is considered to be low based on Table 4.2 with the primary consideration given to removal of gross solids and sediment.

The Simple Index Approach, as set out in Section 26.2 of the CIRIA SuDS Manual, has been applied to ensure there is adequate water quality treatment prior to discharging from site. The approach states that the Total SuDS Mitigation Index must be more than or equal to the Pollution Hazard Index for each contaminant type. Tables 4.5 shows how the Simple Index Approach method has been applied for the Pollution hazard levels detailed in Table 4.2 above.

Pollution Hazard Index (External hard standing areas)				
Land Use	Pollution Hazard Level	Total Suspended Solids (TSS)	Metals	Hydrocarbons
Individual property driveways, non-residential roofs, residential car parks, low traffic roads, non-residential car parking with infrequent change (e.g. Schools, offices)	Low	0.5	0.4	0.4
SuDS Mitigation Index				
Hydro International Downstream Defender		0.5	0.4	0.8
Total SuDS Mitigation Index¹		0.5 ✓	0.4 ✓	0.8 ✓

¹Where two components (or more) in series are required the Total SuDS mitigation index = mitigation index₁ + 0.5 (mitigation index₂)

Table 4.4 – Simple Index Approach - External hard standing areas

4.5 SuDS Management Plan

In order to ensure the ongoing functioning of the below ground drainage networks a suitable maintenance strategy is to be adopted to ensure the drainage network is cleaned regularly and the routine maintenance and cleansing regime should be documented.

The SuDS and below ground drainage network are to be maintained by the building owners or a maintenance company employed on their behalf. They will be required to maintain the SuDS in line with the recommendations set out within the 'The SuDS Manual C753' and the suppliers' requirements.

The following tables are extracted from The SuDS Manual and provide an indication of the operation and maintenance requirements for the SuDS that are proposed. These requirements should be reviewed as part of the detailed design.

The Main Contractor delivering the development is to update the general requirements to reflect the product specific requirements of the as installed proprietary SuDS and incorporate these into the Operation & Maintenance manual for the building. A Verification Report, including photographic evidence, to demonstrate that the drainage has been constructed as per the design drawings should be produced by the Main Contractor. As-built drawings should be supplied by the Main Contractor where the construction of the drainage varies from the design drawings.

Maintenance Schedule	Required Action	Typical Frequency
Regular Maintenance	Inspect and identify any areas that are not operating correctly. If required, take remedial action	Monthly for 3 months, then annually
	Remove debris from the catchment surface (where it may cause risks to performance)	Monthly
	For systems where rainfall infiltrates into the tank from above, check surface of filter for blockage by sediment, algae or other matter; remove and replace surface infiltration medium as necessary	Annually
	Remove sediment from pre-treatment structures and/ or internal forebays	Annually, or as required
Remedial Actions	Repair/ rehabilitate inlets, outlets, overflows and vents	As required
Monitoring	Inspect/ check all inlets, outlets, vents and overflows to ensure that they are in good condition and operating as designed	Annually
	Survey inside of tanks for sediment build-up and remove if necessary	Every 5 years or as required

Table 4.5 - Operation and Maintenance requirements for Attenuation Storage Tanks (Table 21.3 'The SuDS Manual C753)

Activity	Frequency
Inspection	- Regularly during first year of installation. - Every 6 months after the first year of installation.
Oil and Floatables Removal	- Once per year, with sediment removal. - Following a spill in the drainage area.
Sediment Removal	- Once per year or as needed. - Following a spill in the drainage area.
Note: For most cleanouts it is not necessary to remove the entire volume of liquid in the vessel. Only removing the first few inches of oils/floatables and the sediment storage volume is required.	

Figure 4.6 – Downstream Defender Maintenance Schedule

5 DRAINAGE STRATEGY

Refer to Appendix I for the Below Ground Drainage Plan

5.2 Surface Water System

The development will have a dedicated surface water network that is to collect the rainwater from the proposed building roofs, car park, and impermeable external areas. The system will then discharge under gravity public surface water sewer that is located within Dinton Street, subject to a S106 agreement under the water industry act. The drainage survey has indicated an existing stub connection to the public sewer which will be reused.

The surface water discharge from the site is to be limited to the rate detailed within Section 3.2 of this report using a flow control device within the final manhole on site prior to discharge into the public sewer. Proposed discharge rate is to be confirmed with the Lead Local Flood Authority and United Utilities as part of the detailed design. United Utilities have confirmed via the predevelopment enquiry that a pass forward rate of up to 5 l/s is acceptable to the public sewer.

Attenuation will be provided by a geocellular storage tank beneath the car park.

The surface water discharging from the site will be from the building roof, car park and external hard landscaping. As the run-off is to discharge into a surface water sewer which connects into a water course, treatment is required to improve water quality prior to entering the public sewer. The main source of treatment is to be provided by a vortex separator which has been assessed using the Simple Index Approach. The drainage system is to also include catchpit manholes and silt buckets within channel sumps to assist in removing sediment.

The surface water drainage network is to be designed in accordance with Building Regulation Part H, BS EN 752 and Code for Adoption. In addition, the following requirements will also be adopted in accordance with the Non-Statutory Technical Standards for Sustainable Drainage: Practice Guidance and Salford City Council SuDS requirements for new developments:

- The below ground drainage system will be designed to ensure flooding does not occur on site for the 1 in 30 year and no internal flooding for the 1 in 100-year rainfall events
- The surface water system is to be designed to accommodate the 1, 2, 30 and 100 year return events with 40% and 45% climate change allowances for the 30 and 100 year events respectively. The system will be designed for a maximum storm duration of 6 hours.

Infodrainage calculations for the proposed surface water system are available in Appendix J.

The North-West SuDS Proforma has been completed to support this application, refer to Appendix K.

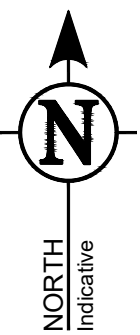
5.3 Foul Water System

The site will have a dedicated foul water network that will collect the foul water associated with the development that will discharge to the public combined sewer adjacent to Dinton Street. A pre-development enquiry with United Utilities has confirmed that foul water will be able to discharge at an unrestricted rate.

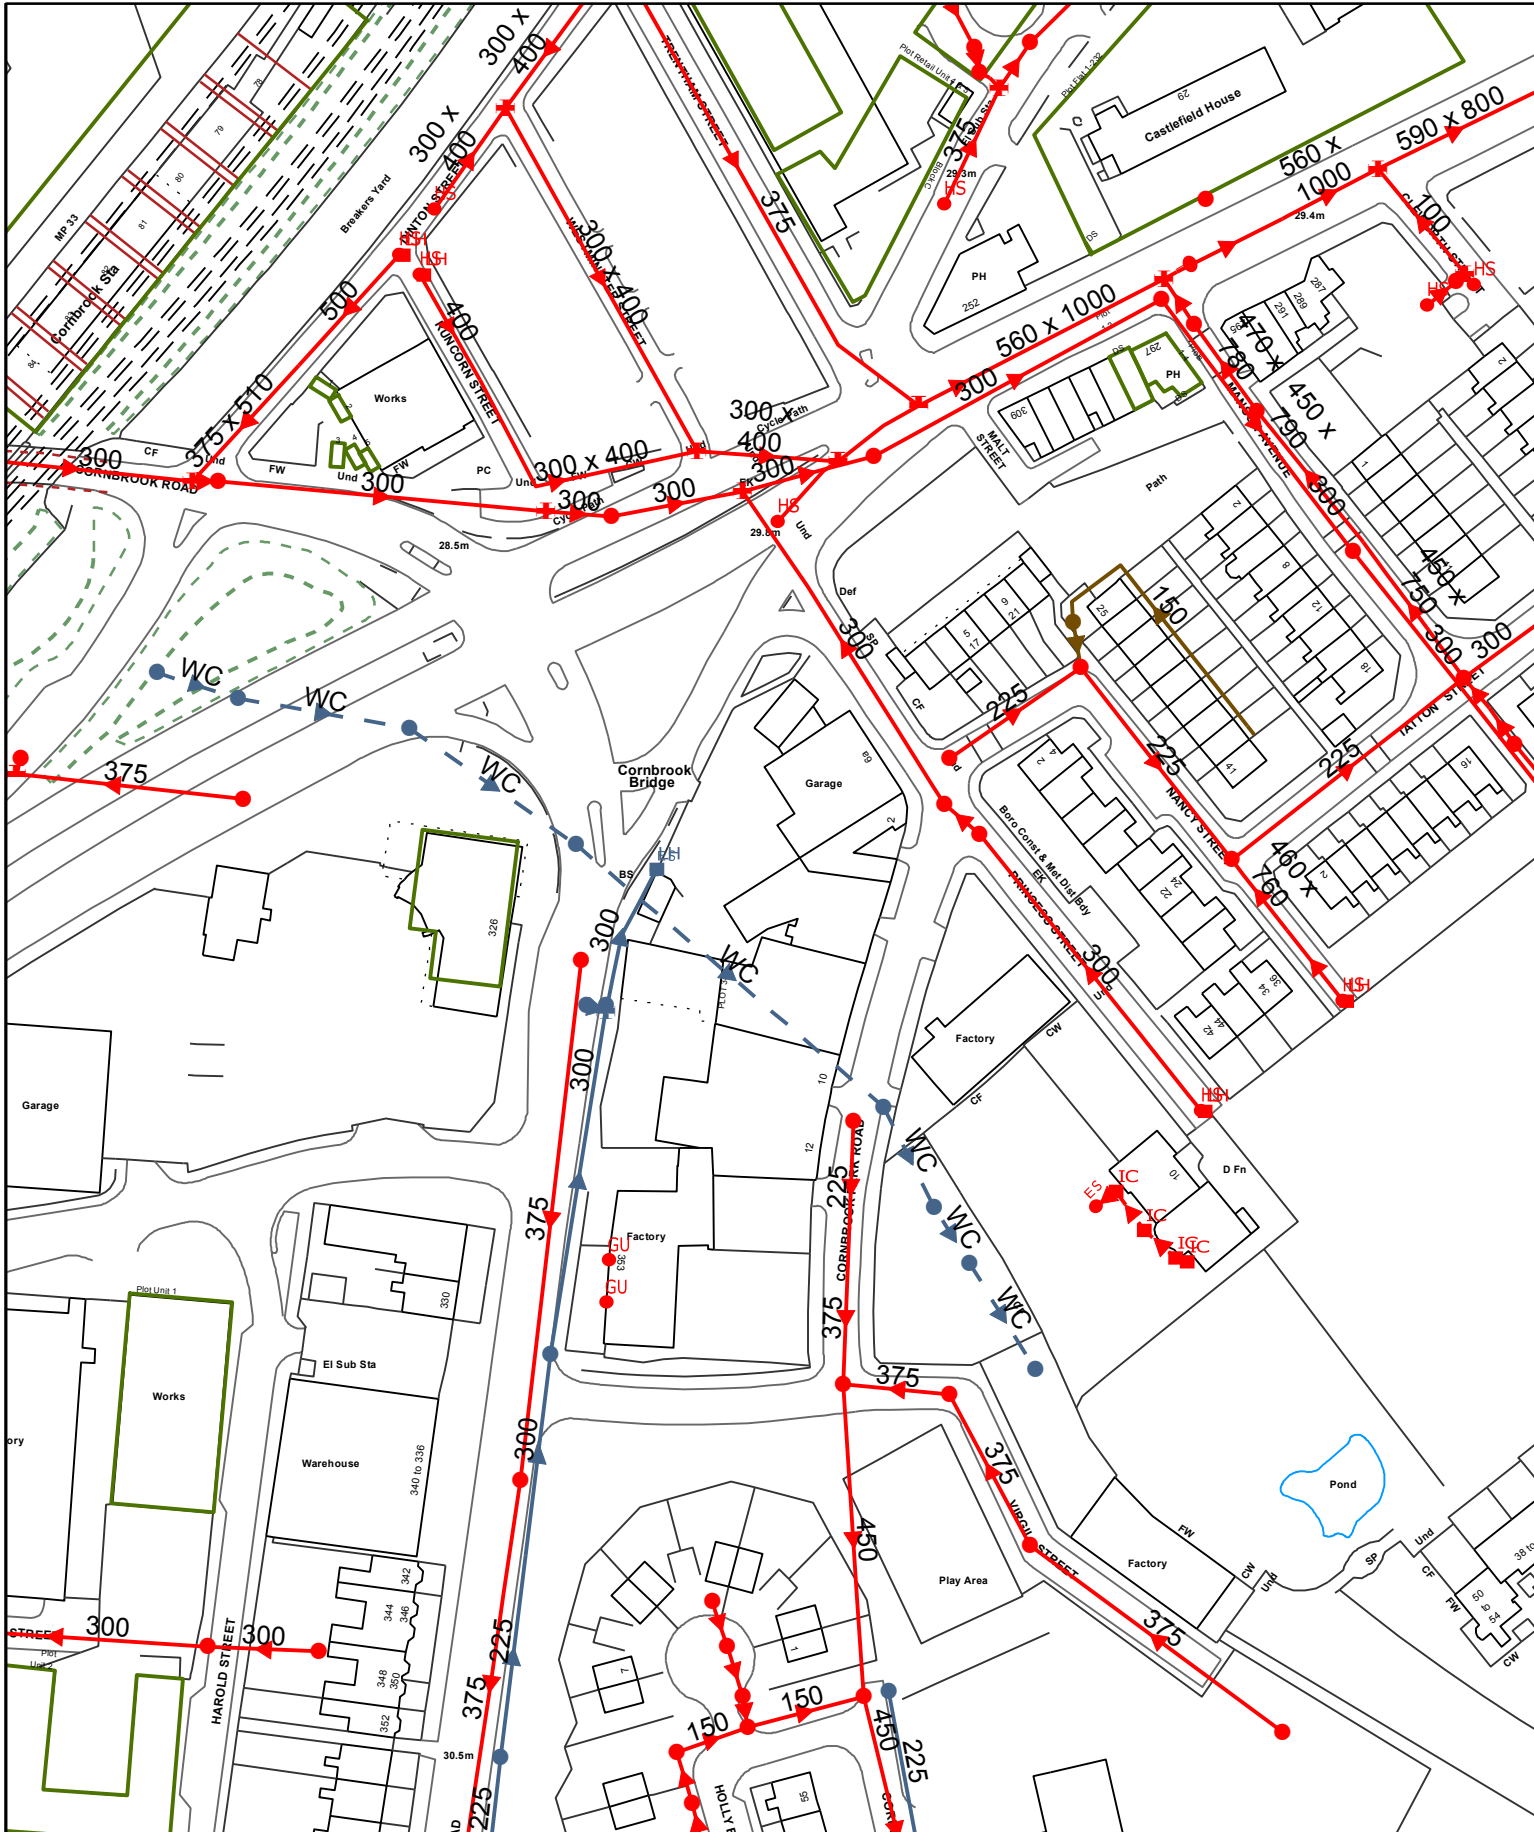
The new foul water drainage connection will be subject to separate section 106 application with United Utilities.

The drainage system is to be designed in accordance with Building Regulations Part H, BS EN 752 and Codes for Adoption.

APPENDIX A TOPOGRAPHICAL SURVEY



APPENDIX B
UNITED UTILITIES SEWER MAP



Date: 20/12/2016

Extract from Map of Public Sewers

Printed By:
Property Searches

Around Cornbrook Park Road Stretford Manchester M15 4EE



The position of this underground apparatus shown on this plan is approximate only and is given in accordance with the best information currently available. The actual positions may be different from those shown on the plan private service pipes may be shown by a broken blue line. United Utilities will not accept any liability for any damage caused by the actual positions being different from those shown

United Utilities Water Limited 2014 The plan is based on the Ordnance Survey Map with the sanction of Controller of H.M. Stationery Office. Crown and Utilities copyrights are reserved. Unauthorised reproduction will infringe these copyrights.

APPENDIX C

DRAINAGE SURVEY

CCTV Report



Project

Cornbrook Road.
Manchester.

Survey Date

23/10/2023

Client

Artal

Surveyor

TH

Job Number

61807CCTV-01

Issue Date

07/11/2023

Checked by

DR

Revision - Issue Date

00/00/00

High Pressure Jetting & Resurvey

Maintenance Visits

Following the initial investigations completed on site we would recommend a quarterly re-survey of the drainage network in order to monitor the ongoing pipework condition.

System Maintenance Survey:

Quarterly Assessment of Existing Defects Due – 23/02/2024

Annual Full System Re-survey Due – 23/11/2024

High Pressure Jetting Required:

(5% - 30%) – MH1-A, MH2-A, MH3 X, MH4-X, MH7-B, MH7-X, MH9-X, MH15-A

(35 % - 60%) –

(65% - 95%) –

Project-information


 Project name:
Cornbrook Road

 Contract number:
61807

 Contact:
Tom Hogan

 Date:
26/10/2023

Client **Artal**
 Contact: **Tom Hogan**
 Position: **Associate Director**
 Road **Jordan Street**
 Town **Knott Mill**
 County
 Telephone:
 Fax:
 Mobile:
 E-Mail:



Site **Cornbrook Road**
 Contact:
 Position:
 Road **Cornbrook Road**
 Town **Manchester**
 County
 Telephone:
 Fax:
 Mobile:
 E-Mail:

Contractor **Survey Solutions**
 Contact: **Thomas Houghton**
 Position: **Surveyor**
 Road **Riverside Business Park, Bollin Walk**
 Town **Wilmslow**
 County **Cheshire**
 Telephone: **01625 533444**
 Fax:
 Mobile:
 E-Mail: **manchester@survey-solutions.co.uk**

Defect Grade Description

 Project name:
Cornbrook Road

 Contract number:
61807

 Contact:
Tom Hogan

 Date:
26/10/2023
1:
 Brick: No Structural Defects
Pipe: No Structural Defects

Acceptable Structural Condition
2:
 Brick: Minor cracking, Surface mortar loss, Spalling slight, wear slight
Pipe: Circumfrential crack, Moderate joint defects, Spalling slight, Wear slight

Minor collapse risk in short term but potential for further deterioration
3:
 Brick: Total mortarloss without other defects, single brick displaced, Deformation up to 5%, Spalling medium, Wear medium
Pipe: Fractures with deformation up tp 5%, Longitudinal cracking or mulitlpe cracking, Minor loss of level, More severe joint defects, Spalling medium, Wear medium

! Collapse unlikely in near future but future deterioration likely !
4:
 Brick: Total mortarloss with deformation greater than 10%, Deformation up to 10% and fractured, Displaced/hanging brickwork, Small number of missing bricks
Pipe: Broken, Deformation up to 10% and broken,, Fractured with deformation 5 - 10%, Multiple fractures, Serious loss of level, spalling large, wear large

!! Collapse likely in foreseeable future !!
5:
 Brick: Already Collapsed, Missing invert, Deformation over 10% and fractured, Displaced/hanging brickwork and deformation over 10%, Extensive missing bricks
Pipe: Already collapsed, Deformation over 10% and broken, Extensive areas of fabric missing, Fractured with deformation over 10%

!!! Collapsed or collapse imminent !!!

Inspection report

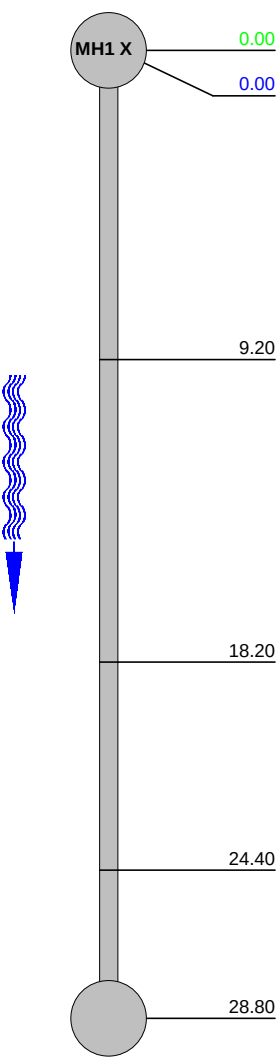
Date: 26/10/2023	Job N°: 61807	Weather: Dry	Operator: TH	section number: 1	PLR: MH1 X X
Present:	Vehicle:	Camera: Solo Pro	Preset:	Cleaned: No	Grade:

Road: Cornbrook Road	Division:	start MH: MH1 X
Place: Cornbrook Road	District:	end MH:
Location:	Tape No.:	Total length: 28.8 m

Purpose:	Shape/Size: Circular dia 300 mm
Use: Surface water	Material: Concrete Pipe length:
Catchment:	Lining:
	Category:

Comment:

Location details:

1:225	position	code	observation	counter	photo	grade
	0.00	MH	Manhole Remark: MH1 X	00:00:00		(Constr) 0
	0.00	WL	Water level, 0 % height/diameter	00:00:00		(Serv) 0
	9.20	GP	General Condition photograph	00:00:00	3_3a	(Misc) 0
	18.20	GP	General Condition photograph	00:00:00	4_4a	(Misc) 0
	24.40	GP	General Condition photograph	00:00:00	5_5a	(Misc) 0
	28.80	FH	Finish Survey, Remark: Unable to survey beyond this point due to restricted leverage.	00:00:00		(Misc) 0

Structural Defects

Constructional Features

Service Defects

Miscellaneous Features

Inspection photos

Place: Cornbrook Road	Road: Cornbrook Road	Date: 26/10/2023	section number: 1	PLR: MH1 X X
---------------------------------	--------------------------------	----------------------------	-----------------------------	------------------------



Photo: 3_3a, 00:00:00
9.2m, General Condition photograph



Photo: 4_4a, 00:00:00
18.2m, General Condition photograph

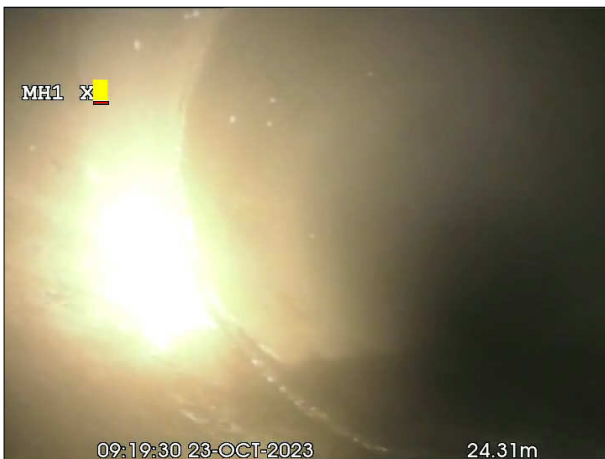


Photo: 5_5a, 00:00:00
24.4m, General Condition photograph

Inspection report

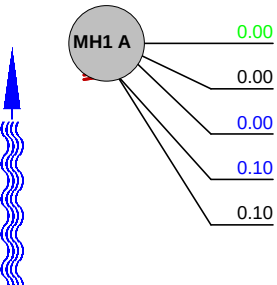
Date: 26/10/2023	Job N°: 61807	Weather: Dry	Operator: TH	section number: 2	PLR: X
Present:	Vehicle:	Camera: Solo Pro	Preset:	Cleaned: No	Grade:

Road: Cornbrook Road	Division:	start MH: MH1 A
Place: Cornbrook Road	District:	end MH:
Location:	Tape No.:	Total length: 0.1 m

Purpose:	Shape/Size: Circular dia 225 mm
Use: Surface water	Material: Concrete Pipe length:
Catchment:	Lining:
	Category:

Comment:

Location details:

1:25	position	code	observation	counter	photo	grade
	0.00	MH	Manhole Remark: MH1 A	00:00:00		(Constr) 0
	0.00	ST	Start of Survey	00:00:00		(Misc) 0
	0.00	WL	Water level, 0 % height/diameter	00:00:00		(Serv) 0
	0.10	DE	Debris, 20 % cross-sectional area loss	00:00:00	10_4a, b	(Serv) 1
	0.10	SA	Survey abandoned, Remark: Unable to survey beyond blockage.	00:00:00		(Misc) 0

Structural Defects

Constructional Features

Service Defects

Miscellaneous Features

Inspection photos

Place: Cornbrook Road	Road: Cornbrook Road	Date: 26/10/2023	section number: 2	PLR: X
---------------------------------	--------------------------------	----------------------------	-----------------------------	------------------



Photo: 10_4a, 00:00:00
0.1m, Debris, 20 % cross-sectional area loss



Photo: 10_4b, 00:00:00
0.1m, Debris, 20 % cross-sectional area loss

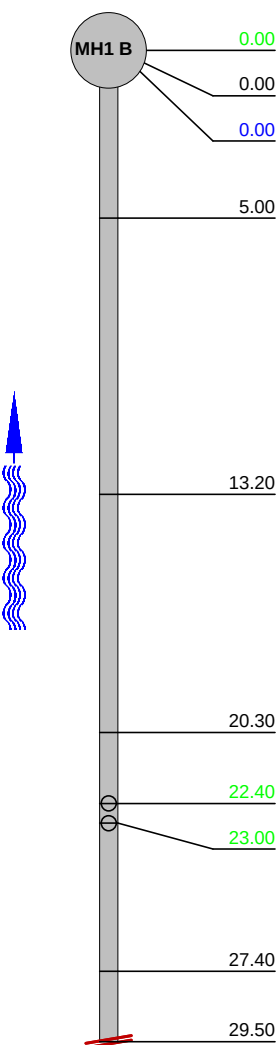
Inspection report

Date: 26/10/2023	Job N°: 61807	Weather: Dry	Operator: TH	section number: 3	PLR: X
Present:	Vehicle:	Camera: Solo Pro	Preset:	Cleaned: No	Grade:

Road: Cornbrook Road	Division:	start MH: MH1 B
Place: Cornbrook Road	District:	end MH:
Location:	Tape No.:	Total length: 29.5 m

Purpose:	Shape/Size: Circular dia 300 mm
Use: Surface water	Material: Concrete Pipe length:
Catchment:	Lining:
	Category:

Comment:
Location details:

1:225	position	code	observation	counter	photo	grade
	0.00	MH	Manhole Remark: MH1 B	00:00:00		(Constr) 0
	0.00	ST	Start of Survey	00:00:00		(Misc) 0
	0.00	WL	Water level, 5 % height/diameter	00:00:00		(Serv) 0
	5.00	GP	General Condition photograph	00:00:00	16_4a	(Misc) 0
	13.20	GP	General Condition photograph	00:00:00	17_5a	(Misc) 0
	20.30	GP	General Condition photograph	00:00:00	18_6a	(Misc) 0
	22.40	JN	Junction at 11 o'clock, dia 150 mm	00:00:00	19_7a	(Constr) 0
	23.00	JN	Junction at 01 o'clock, dia 150 mm	00:00:00	20_8a	(Constr) 0
	27.40	GP	General Condition photograph	00:00:00	21_9a	(Misc) 0
	29.50	SA	Survey abandoned, Remark: Unable to survey beyond this point due to restricted leverage.	00:00:00		(Misc) 0

Structural Defects	Constructional Features
Service Defects	Miscellaneous Features

Inspection photos

Place: Cornbrook Road	Road: Cornbrook Road	Date: 26/10/2023	section number: 3	PLR: X
---------------------------------	--------------------------------	----------------------------	-----------------------------	------------------



Photo: 16_4a, 00:00:00
5m, General Condition photograph



Photo: 17_5a, 00:00:00
13.2m, General Condition photograph



Photo: 18_6a, 00:00:00
20.3m, General Condition photograph



Photo: 19_7a, 00:00:00
22.4m, Junction at 11 o'clock, dia 150 mm

Inspection photos

Place: Cornbrook Road	Road: Cornbrook Road	Date: 26/10/2023	section number: 3	PLR: X
---------------------------------	--------------------------------	----------------------------	-----------------------------	------------------



Photo: 20_8a, 00:00:00
23m, Junction at 01 o'clock, dia 150 mm



Photo: 21_9a, 00:00:00
27.4m, General Condition photograph

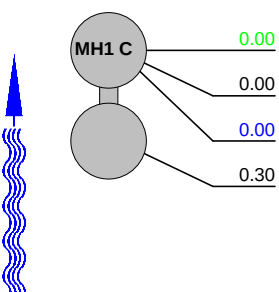
Inspection report

Date: 26/10/2023	Job N°: 61807	Weather: Dry	Operator: TH	section number: 4	PLR: X
Present:	Vehicle:	Camera: Solo Pro	Preset:	Cleaned: No	Grade:

Road: Cornbrook Road	Division:	start MH: MH1 C
Place: Cornbrook Road	District:	end MH:
Location:	Tape No.:	Total length: 0.3 m

Purpose:	Shape/Size: Circular dia 225 mm
Use: Surface water	Material: Concrete Pipe length:
Catchment:	Lining:
	Category:

Comment:
Location details:

1:25	position	code	observation	counter	photo	grade
		MH	Manhole Remark: MH1C	00:00:00		(Constr) 0
		ST	Start of Survey	00:00:00		(Misc) 0
		WL	Water level, 0 % height/diameter	00:00:00		(Serv) 0
		FH	Finish Survey, Remark: Line capped.	00:00:00	26_4a	(Misc) 0

Structural Defects	Constructional Features
Service Defects	Miscellaneous Features

Inspection photos

Place: Cornbrook Road	Road: Cornbrook Road	Date: 26/10/2023	section number: 4	PLR: X
---------------------------------	--------------------------------	----------------------------	-----------------------------	------------------



Photo: 26_4a, 00:00:00
0.3m, Finish Survey, Remark: Line capped.

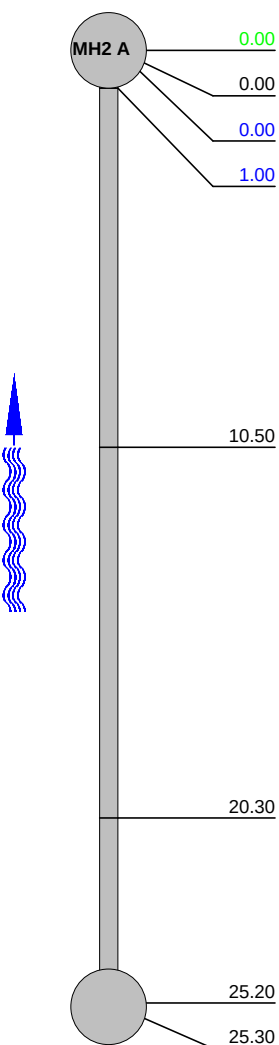
Inspection report

Date: 26/10/2023	Job N°: 61807	Weather: Dry	Operator: TH	section number: 5	PLR: X
Present:	Vehicle:	Camera: Solo Pro	Preset:	Cleaned: No	Grade:

Road: Cornbrook Road	Division:	start MH: MH2 A
Place: Cornbrook Road	District:	end MH:
Location:	Tape No.:	Total length: 25.3 m

Purpose:	Shape/Size: Circular dia 300 mm
Use: Surface water	Material: Concrete Pipe length:
Catchment:	Lining:
	Category:

Comment:
Location details:

1:200	position	code	observation	counter	photo	grade
	0.00	MH	Manhole Remark: MH2 A	00:00:00		(Constr) 0
	0.00	ST	Start of Survey	00:00:00		(Misc) 0
	0.00	WL	Water level, 5 % height/diameter	00:00:00		(Serv) 0
	1.00	DE	Debris, 20 % cross-sectional area loss	00:00:00	30_4a	(Serv) 1
	10.50	GP	General Condition photograph	00:00:00	31_5a	(Misc) 0
	20.30	GP	General Condition photograph	00:00:00	32_6a	(Misc) 0
	25.20	GP	General Condition photograph	00:00:00		(Misc) 0
	25.30	FH	Finish Survey, Remark: Point reached from previous survey of MH1 X	00:00:00		(Misc) 0

Structural Defects	Constructional Features
Service Defects	Miscellaneous Features

Inspection photos

Place: Cornbrook Road	Road: Cornbrook Road	Date: 26/10/2023	section number: 5	PLR: X
---------------------------------	--------------------------------	----------------------------	-----------------------------	------------------



Photo: 30_4a, 00:00:00
1m, Debris, 20 % cross-sectional area loss



Photo: 31_5a, 00:00:00
10.5m, General Condition photograph



Photo: 32_6a, 00:00:00
20.3m, General Condition photograph

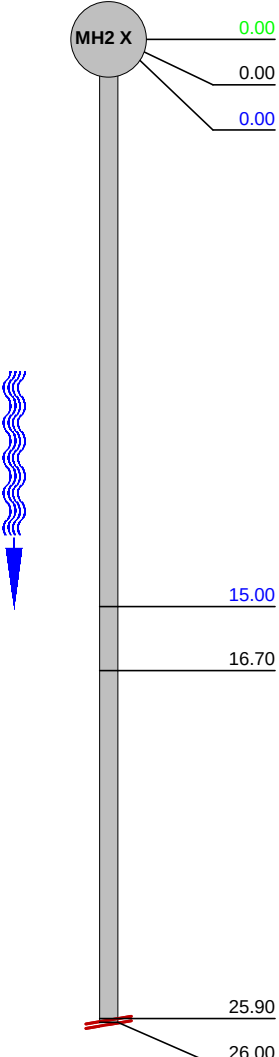
Inspection report

Date: 26/10/2023	Job N°: 61807	Weather: Dry	Operator: TH	section number: 6	PLR: MH2 X X
Present:	Vehicle:	Camera: Solo Pro	Preset:	Cleaned: No	Grade:

Road: Cornbrook Road	Division:	start MH: MH2 X
Place: Cornbrook Road	District:	end MH:
Location:	Tape No.:	Total length: 26 m

Purpose:	Shape/Size: Circular dia 300 mm
Use: Surface water	Material: Concrete Pipe length:
Catchment:	Lining:
	Category:

Comment:
Location details:

1:200	position	code	observation	counter	photo	grade
	0.00	MH	Manhole Remark: MH2 X	00:00:00		(Constr) 0
	0.00	ST	Start of Survey	00:00:00		(Misc) 0
	0.00	WL	Water level, 10 % height/diameter	00:00:00	37_3a	(Serv) 0
	15.00	WL	Water level, 20 % height/diameter	00:00:00		(Serv) 0
	16.70	S1 CU	Camera Underwater, Start, Remark: Loss of vision.	00:00:00		(Misc) 0
	25.90	F1 CU	Camera Underwater, Finish, Remark: Loss of vision.	00:00:00		(Misc) 0
	26.00	SA	Survey abandoned, Remark: Unable to survey beyond this point due to assumed blockage, loss of vision.	00:00:00		(Misc) 0

Structural Defects	Constructional Features
Service Defects	Miscellaneous Features

Inspection photos

Place: Cornbrook Road	Road: Cornbrook Road	Date: 26/10/2023	section number: 6	PLR: MH2 X X
---------------------------------	--------------------------------	----------------------------	-----------------------------	------------------------



Photo: 37_3a, 00:00:00
0m, Water level, 10 % height/diameter

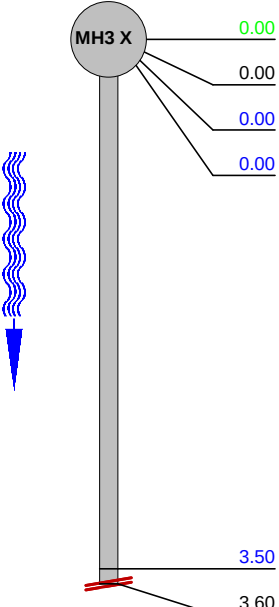
Inspection report

Date: 26/10/2023	Job N°: 61807	Weather: Dry	Operator: TH	section number: 7	PLR: MH3 X X
Present:	Vehicle:	Camera: Solo Pro	Preset:	Cleaned: No	Grade:

Road: Cornbrook Road	Division:	start MH: MH3 X
Place: Cornbrook Road	District:	end MH:
Location:	Tape No.:	Total length: 3.6 m

Purpose:	Shape/Size: Circular dia 300 mm
Use: Combined	Material: Concrete Pipe length:
Catchment:	Lining:
	Category:

Comment:
Location details:

1:50	position	code	observation	counter	photo	grade
	0.00	MH	Manhole Remark: MH3 X	00:00:00		(Constr) 0
	0.00	ST	Start of Survey	00:00:00		(Misc) 0
	0.00	WL	Water level, 5 % height/diameter	00:00:00		(Serv) 0
	0.00	S1 DES	Debris silt, 10 % cross-sectional area loss, Start	00:00:00	45_4a	(Serv) 1
	3.50	F1 DES	Debris silt, 10 % cross-sectional area loss, Finish	00:00:00		(Serv) 1
	3.60	SA	Survey abandoned, Remark: Unable to survey beyond debris.	00:00:00		(Misc) 0

Structural Defects	Constructional Features
Service Defects	Miscellaneous Features

Inspection photos

Place: Cornbrook Road	Road: Cornbrook Road	Date: 26/10/2023	section number: 7	PLR: MH3 X X
---------------------------------	--------------------------------	----------------------------	-----------------------------	------------------------



Photo: 45_4a, 00:00:00
0m, Debris silt, 10 % cross-sectional area loss, Start

Inspection report

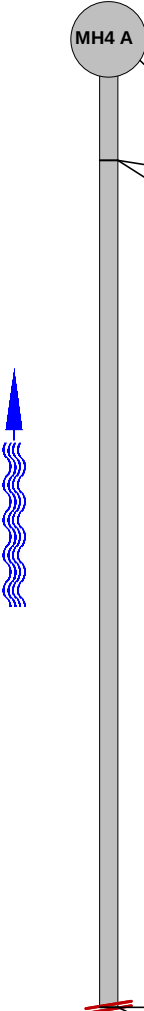
Date: 26/10/2023	Job N°: 61807	Weather: Dry	Operator: TH	section number: 8	PLR: X
Present:	Vehicle:	Camera: Solo Pro	Preset:	Cleaned: No	Grade:

Road: Cornbrook Road	Division:	start MH: MH4 A
Place: Cornbrook Road	District:	end MH:
Location:	Tape No.:	Total length: 9.6 m

Purpose:	Shape/Size: Circular dia 100 mm
Use: Surface water	Material: Vitrified clay Pipe length:
Catchment:	Lining:
	Category:

Comment:

Location details:

1:75	position	code	observation	counter	photo	grade
	0.00	MH	Manhole Remark: MH4 A	00:00:00		(Constr) 0
	0.00	ST	Start of Survey	00:00:00		(Misc) 0
	0.00	WL	Water level, 0 % height/diameter	00:00:00		(Serv) 0
	1.20	WL	Water level, 30 % height/diameter	00:00:00		(Serv) 0
	1.20	S1 CU	Camera Underwater, Start, Remark: Loss of vision.	00:00:00		(Misc) 0
	9.60	F1 CU	Camera Underwater, Finish, Remark: Loss of vision.	00:00:00		(Misc) 0
	9.60	SA	Survey abandoned, Remark: Unable to survey beyond assumed blockage.	00:00:00		(Misc) 0

Structural Defects

Constructional Features

Service Defects

Miscellaneous Features

Inspection report

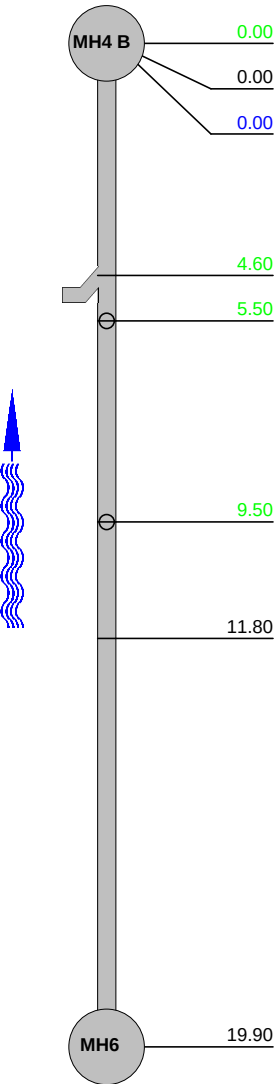
Date: 26/10/2023	Job N°: 61807	Weather: Dry	Operator: TH	section number: 9	PLR: X
Present:	Vehicle:	Camera: Solo Pro	Preset:	Cleaned: No	Grade:

Road: Cornbrook Road	Division:	start MH: MH4 B
Place: Cornbrook Road	District:	end MH: MH6
Location:	Tape No.:	Total length: 19.9 m

Purpose:	Shape/Size: Circular dia 225 mm
Use: Surface water	Material: Polyvinyl chloride Pipe length:
Catchment:	Lining:
	Category:

Comment:

Location details:

1:150	position	code	observation	counter	photo	grade
	0.00	MH	Manhole Remark: MH4 B	00:00:00		(Constr) 0
	0.00	ST	Start of Survey	00:00:00		(Misc) 0
	0.00	WL	Water level, 0 % height/diameter	00:00:00		(Serv) 0
	4.60	JN	Junction at 02 o'clock, dia 100 mm	00:00:00	58_4a	(Constr) 0
	5.50	JN	Junction at 11 o'clock, dia 100 mm	00:00:00	59_5a	(Constr) 0
	9.50	JN	Junction at 12 o'clock, dia 100 mm	00:00:00	60_6a	(Constr) 0
	11.80	GP	General Condition photograph	00:00:00	61_7a	(Misc) 0
	19.90	FH	Finish Survey, Remark: MH6 reached.	00:00:00		(Misc) 0

Structural Defects

Constructional Features

Service Defects

Miscellaneous Features

Inspection photos

Place: Cornbrook Road	Road: Cornbrook Road	Date: 26/10/2023	section number: 9	PLR: X
---------------------------------	--------------------------------	----------------------------	-----------------------------	------------------



Photo: 58_4a, 00:00:00
4.6m, Junction at 02 o'clock, dia 100 mm



Photo: 59_5a, 00:00:00
5.5m, Junction at 11 o'clock, dia 100 mm



Photo: 60_6a, 00:00:00
9.5m, Junction at 12 o'clock, dia 100 mm



Photo: 61_7a, 00:00:00
11.8m, General Condition photograph

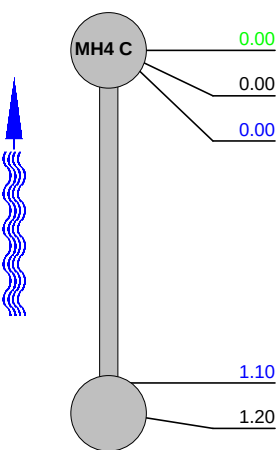
Inspection report

Date: 26/10/2023	Job N°: 61807	Weather: Dry	Operator: TH	section number: 10	PLR: X
Present:	Vehicle:	Camera: Solo Pro	Preset:	Cleaned: No	Grade:

Road: Cornbrook Road	Division:	start MH: MH4 C
Place: Cornbrook Road	District:	end MH:
Location:	Tape No.:	Total length: 1.2 m

Purpose:	Shape/Size: Circular dia 150 mm
Use: Surface water	Material: Polyvinyl chloride Pipe length:
Catchment:	Lining:
	Category:

Comment:
Location details:

1:25	position	code	observation	counter	photo	grade
		MH	Manhole Remark: MH4 C	00:00:00		(Constr) 0
		ST	Start of Survey	00:00:00		(Misc) 0
		WL	Water level, 0 % height/diameter	00:00:00		(Serv) 0
		LU	Line of Sewer deviates up	00:00:00		(Serv) 0
		FH	Finish Survey, Remark: Rest bend reached.	00:00:00		(Misc) 0

Structural Defects	Constructional Features
Service Defects	Miscellaneous Features

Inspection report

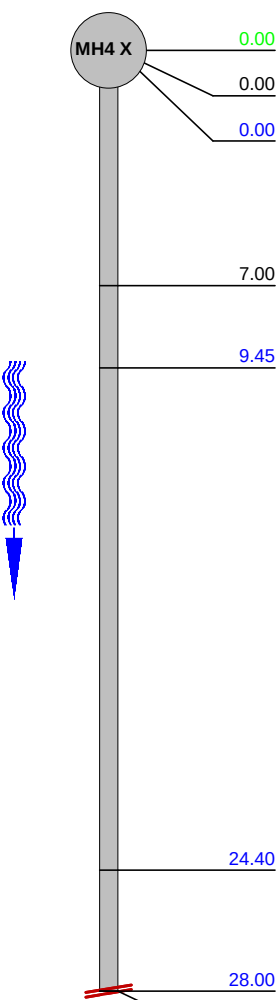
Date: 26/10/2023	Job N°: 61807	Weather: Dry	Operator: TH	section number: 11	PLR: MH4 X X
Present:	Vehicle:	Camera: Solo Pro	Preset:	Cleaned: No	Grade:

Road: Cornbrook Road	Division:	start MH: MH4 X
Place: Cornbrook Road	District:	end MH:
Location:	Tape No.:	Total length: 28 m

Purpose:	Shape/Size: Circular dia 225 mm
Use: Surface water	Material: Polyvinyl chloride Pipe length:
Catchment:	Lining:
	Category:

Comment:

Location details:

1:225	position	code	observation	counter	photo	grade
	0.00	MH	Manhole Remark: MH4 X	00:00:00		(Constr) 0
	0.00	ST	Start of Survey	00:00:00		(Misc) 0
	0.00	WL	Water level, 0 % height/diameter	00:00:00		(Serv) 0
	7.00	GP	General Condition photograph	00:00:00	11_4a	(Misc) 0
	9.45	WL	Water level, 10 % height/diameter	00:00:00		(Serv) 0
	24.40	S1 DES	Debris silt, 10 % cross-sectional area loss, Start	00:00:00	74_6a	(Serv) 1
	28.00	F1 DES	Debris silt, 10 % cross-sectional area loss, Finish	00:00:00		(Serv) 1
	28.00	SA	Survey abandoned, Remark: Unable to survey beyond this point due to blockage	00:00:00		(Misc) 0

Structural Defects

Constructional Features

Service Defects

Miscellaneous Features

Inspection photos

Place: Cornbrook Road	Road: Cornbrook Road	Date: 26/10/2023	section number: 11	PLR: MH4 X X
---------------------------------	--------------------------------	----------------------------	------------------------------	------------------------



Photo: 11_4a, 00:00:00
7m, General Condition photograph



Photo: 74_6a, 00:00:00
24.4m, Debris silt, 10 % cross-sectional area loss, Start

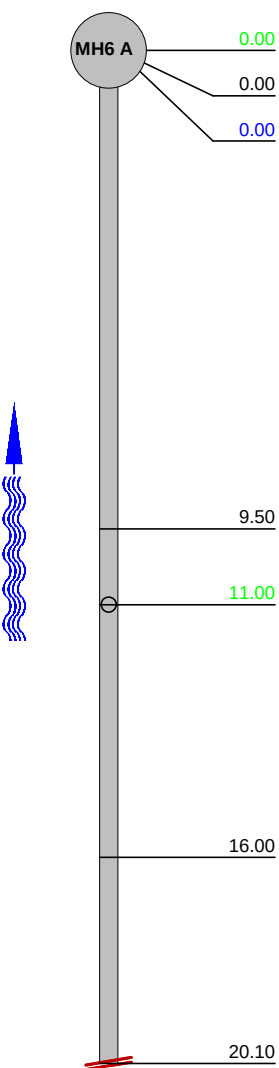
Inspection report

Date: 26/10/2023	Job N°: 61807	Weather: Dry	Operator: TH	section number: 12	PLR: X
Present:	Vehicle:	Camera: Solo Pro	Preset:	Cleaned: No	Grade:

Road: Cornbrook Road	Division:	start MH: MH6 A
Place: Cornbrook Road	District:	end MH:
Location:	Tape No.:	Total length: 20.1 m

Purpose:	Shape/Size: Circular dia 225 mm
Use: Surface water	Material: Polyvinyl chloride Pipe length:
Catchment:	Lining:
	Category:

Comment:
Location details:

1:150	position	code	observation	counter	photo	grade
	0.00	MH	Manhole Remark: MH6 A	00:00:00		(Constr) 0
	0.00	ST	Start of Survey	00:00:00		(Misc) 0
	0.00	WL	Water level, 0 % height/diameter	00:00:00		(Serv) 0
	9.50	GP	General Condition photograph	00:00:00	79_4a	(Misc) 0
	11.00	JN	Junction at 12 o'clock, dia 150 mm	00:00:00	80_5a	(Constr) 0
	16.00	GP	General Condition photograph	00:00:00	81_6a	(Misc) 0
	20.10	SA	Survey abandoned, Remark: Unable to survey beyond this point due to restrict	00:00:00		(Misc) 0

Structural Defects	Constructional Features
Service Defects	Miscellaneous Features

Inspection photos

Place: Cornbrook Road	Road: Cornbrook Road	Date: 26/10/2023	section number: 12	PLR: X
---------------------------------	--------------------------------	----------------------------	------------------------------	------------------



Photo: 79_4a, 00:00:00
9.5m, General Condition photograph



Photo: 80_5a, 00:00:00
11m, Junction at 12 o'clock, dia 150 mm

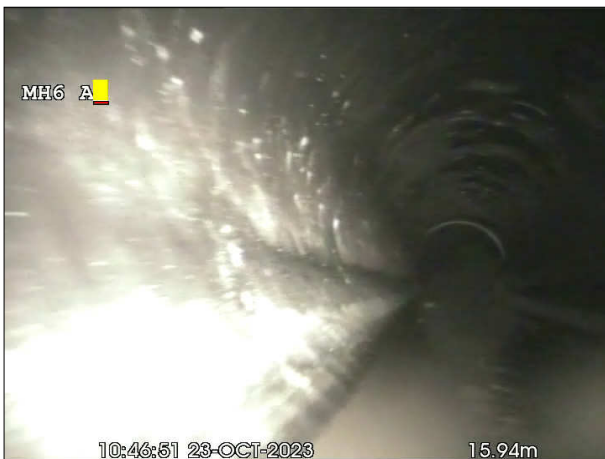
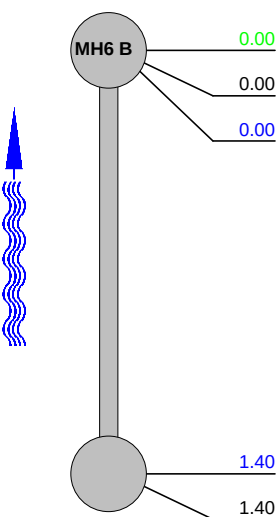


Photo: 81_6a, 00:00:00
16m, General Condition photograph

Inspection report

Date: 26/10/2023	Job N°: 61807	Weather: Dry	Operator: TH	section number: 13	PLR: X
Present:	Vehicle:	Camera: Solo Pro	Preset:	Cleaned: No	Grade:

Road: Cornbrook Road	Division:	start MH: MH6 B
Place: Cornbrook Road	District:	end MH:
Location:	Tape No.:	Total length: 1.4 m
Purpose:	Shape/Size: Circular dia 150 mm	
Use: Surface water	Material: Polyvinyl chloride	Pipe length:
Catchment:	Lining:	
	Category:	
Comment:		
Location details:		

1:25	position	code	observation	counter	photo	grade
	0.00	MH	Manhole Remark: MH6 B	00:00:00		(Constr) 0
	0.00	ST	Start of Survey	00:00:00		(Misc) 0
	0.00	WL	Water level, 0 % height/diameter	00:00:00		(Serv) 0
	1.40	LU	Line of Sewer deviates up	00:00:00		(Serv) 0
	1.40	FH	Finish Survey, Remark: Rest bend reached.	00:00:00		(Misc) 0
Structural Defects				Constructional Features		
Service Defects				Miscellaneous Features		

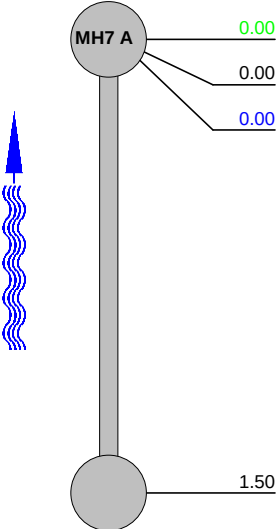
Inspection report

Date: 26/10/2023	Job N°: 61807	Weather: Dry	Operator: TH	section number: 14	PLR: X
Present:	Vehicle:	Camera: Solo Pro	Preset:	Cleaned: No	Grade:

Road: Cornbrook Road	Division:	start MH: MH7 A
Place: Cornbrook Road	District:	end MH:
Location:	Tape No.:	Total length: 1.5 m

Purpose:	Shape/Size: Circular dia 150 mm
Use: Surface water	Material: Polyvinyl chloride Pipe length:
Catchment:	Lining:
	Category:

Comment:
Location details:

1:25	position	code	observation	counter	photo	grade
	MH7 A	0.00	MH Manhole Remark: MH7 A	00:00:00		(Constr) 0
		0.00	ST Start of Survey	00:00:00		(Misc) 0
		0.00	WL Water level, 0 % height/diameter	00:00:00		(Serv) 0
		1.50	FH Finish Survey, Remark: Gully reached.	00:00:00		(Misc) 0

Structural Defects	Constructional Features
Service Defects	Miscellaneous Features

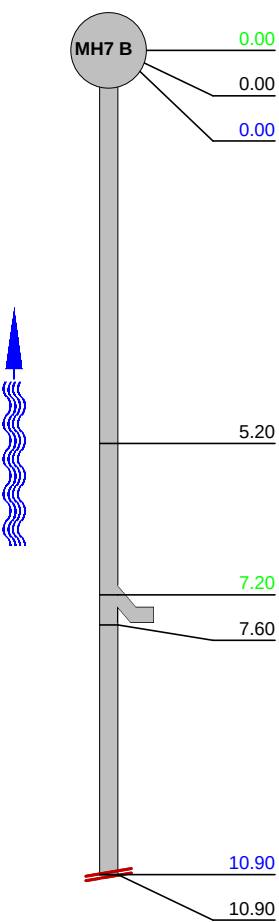
Inspection report

Date: 26/10/2023	Job N°: 61807	Weather: Dry	Operator: TH	section number: 15	PLR: X
Present:	Vehicle:	Camera: Solo Pro	Preset:	Cleaned: No	Grade:

Road: Cornbrook Road	Division:	start MH: MH7 B
Place: Cornbrook Road	District:	end MH:
Location:	Tape No.:	Total length: 10.9 m

Purpose:	Shape/Size: Circular dia 150 mm
Use: Surface water	Material: Polyvinyl chloride Pipe length:
Catchment:	Lining:
	Category:

Comment:
Location details:

1:100	position	code	observation	counter	photo	grade
	0.00	MH	Manhole Remark: MH7 B	00:00:00		(Constr) 0
	0.00	ST	Start of Survey	00:00:00		(Misc) 0
	0.00	WL	Water level, 0 % height/diameter	00:00:00		(Serv) 0
	5.20	GO	General Observation, Remark: Poor vision.	00:00:00	95_4a	(Misc) 0
	7.20	JN	Junction at 09 o'clock, dia 150 mm	00:00:00	96_5a	(Constr) 0
	7.60	DC	Dimension of sewer changes, new dimension dia 100 mm	00:00:00	97_6a	(Misc) 0
	10.90	DE	Debris, 30 % cross-sectional area loss	00:00:00	98_7a	(Serv) 1
	10.90	SA	Survey abandoned, Remark: Unable to survey beyond blockage.	00:00:00		(Misc) 0

Structural Defects	Constructional Features
Service Defects	Miscellaneous Features

Inspection photos

Place: Cornbrook Road	Road: Cornbrook Road	Date: 26/10/2023	section number: 15	PLR: X
---------------------------------	--------------------------------	----------------------------	------------------------------	------------------



Photo: 95_4a, 00:00:00
 5.2m, General Observation, Remark: Poor vision.



Photo: 96_5a, 00:00:00
 7.2m, Junction at 09 o'clock, dia 150 mm



Photo: 97_6a, 00:00:00
 7.6m, Dimension of sewer changes, new dimension dia 100 mm



Photo: 98_7a, 00:00:00
 10.9m, Debris, 30 % cross-sectional area loss

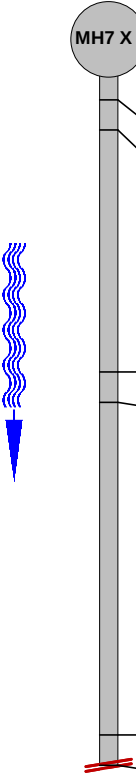
Inspection report

Date: 26/10/2023	Job N°: 61807	Weather: Dry	Operator: TH	section number: 16	PLR: MH7 X X
Present:	Vehicle:	Camera: Solo Pro	Preset:	Cleaned: No	Grade:

Road: Cornbrook Road	Division:	start MH: MH7 X
Place: Cornbrook Road	District:	end MH:
Location:	Tape No.:	Total length: 2.4 m

Purpose:	Shape/Size: Circular dia 150 mm
Use: Surface water	Material: Polyvinyl chloride Pipe length:
Catchment:	Lining:
	Category:

Comment:
Location details:

1:25	position	code	observation	counter	photo	grade
	0.00	MH	Manhole Remark: MH7 X	00:00:00		(Constr) 0
	0.00	ST	Start of Survey	00:00:00		(Misc) 0
	0.00	WL	Water level, 0 % height/diameter	00:00:00		(Serv) 0
	0.20	JDM	Joint displaced. Medium	00:00:00	103_4a	(Struct) 1
	0.30	S1 DES	Debris silt, 10 % cross-sectional area loss, Start	00:00:00	104_5a	(Serv) 1
	1.10	LD	Line of Sewer deviates down	00:00:00		(Serv) 0
	1.20	F1 DES	Debris silt, 10 % cross-sectional area loss, Finish	00:00:00		(Serv) 1
	2.30	DE	Debris, 20 % cross-sectional area loss	00:00:00	16_9a	(Serv) 1
	2.40	SA	Survey abandoned, Remark: Unable to survey beyond blockage.	00:00:00		(Misc) 0

Structural Defects	Constructional Features
Service Defects	Miscellaneous Features

Inspection photos

Place: Cornbrook Road	Road: Cornbrook Road	Date: 26/10/2023	section number: 16	PLR: MH7 X X
---------------------------------	--------------------------------	----------------------------	------------------------------	------------------------

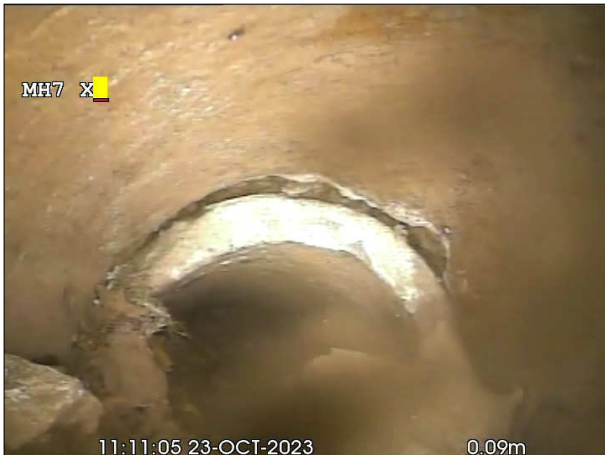


Photo: 103_4a, 00:00:00
0.2m, Joint displaced. Medium



Photo: 104_5a, 00:00:00
0.3m, Debris silt, 10 % cross-sectional area loss, Start



Photo: 16_9a, 00:00:00
2.3m, Debris, 20 % cross-sectional area loss



Inspection report

Date: 26/10/2023	Job N°: 61807	Weather: Dry	Operator: TH	section number: 17	PLR: X
Present:	Vehicle:	Camera: Solo Pro	Preset:	Cleaned: No	Grade:

Road: Cornbrook Road	Division:	start MH: MH8 A
Place: Cornbrook Road	District:	end MH:
Location:	Tape No.:	Total length: 2.7 m

Purpose:	Shape/Size: Circular dia 150 mm
Use: Surface water	Material: Polyvinyl chloride Pipe length:
Catchment:	Lining:
	Category:

Comment:

Location details:

1:25	position	code	observation	counter	photo	grade
	0.00	MH	Manhole Remark: MH8 A	00:00:00		(Constr) 0
	0.00	ST	Start of Survey	00:00:00		(Misc) 0
	0.00	WL	Water level, 0 % height/diameter	00:00:00		(Serv) 0
	0.30	JN	Junction at 06 o'clock, dia 150 mm, Remark: Back drop	00:00:00	17_4a	(Constr) 0
	1.80	LU	Line of Sewer deviates up	00:00:00		(Serv) 0
	2.70	FH	Finish Survey, Remark: Rest bend reached.	00:00:00		(Misc) 0

Structural Defects

Constructional Features

Service Defects

Miscellaneous Features

Inspection photos

Place: Cornbrook Road	Road: Cornbrook Road	Date: 26/10/2023	section number: 17	PLR: X
---------------------------------	--------------------------------	----------------------------	------------------------------	------------------



Photo: 17_4a, 00:00:00
0.3m, Junction at 06 o'clock, dia 150 mm, Remark: Back drop

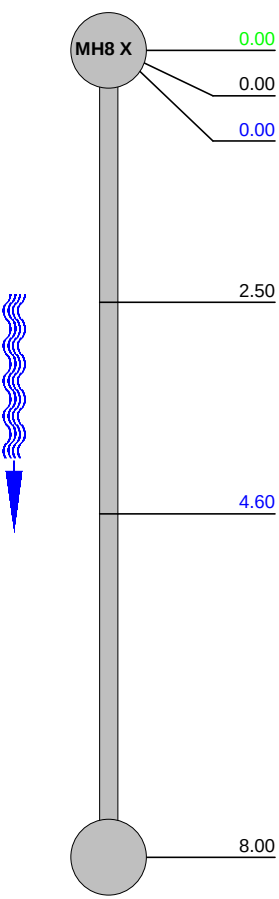
Inspection report

Date: 26/10/2023	Job N°: 61807	Weather: Dry	Operator: TH	section number: 18	PLR: MH8 X X
Present:	Vehicle:	Camera: Solo Pro	Preset:	Cleaned: No	Grade:

Road: Cornbrook Road	Division:	start MH: MH8 X
Place: Cornbrook Road	District:	end MH:
Location:	Tape No.:	Total length: 8 m

Purpose:	Shape/Size: Circular dia 150 mm
Use: Surface water	Material: Polyvinyl chloride Pipe length:
Catchment:	Lining:
	Category:

Comment:
Location details:

1:75	position	code	observation	counter	photo	grade
	0.00	MH	Manhole Remark: MH8 X	00:00:00		(Constr) 0
	0.00	ST	Start of Survey	00:00:00		(Misc) 0
	0.00	WL	Water level, 0 % height/diameter	00:00:00		(Serv) 0
	2.50	GP	General Condition photograph	00:00:00	118_4a	(Misc) 0
	4.60	LL	Line of Sewer deviates left	00:00:00		(Serv) 0
	8.00	FH	Finish Survey, Remark: Drops into sewer line.	00:00:00		(Misc) 0

Structural Defects	Constructional Features
Service Defects	Miscellaneous Features

Inspection photos

Place: Cornbrook Road	Road: Cornbrook Road	Date: 26/10/2023	section number: 18	PLR: MH8 X X
---------------------------------	--------------------------------	----------------------------	------------------------------	------------------------



Photo: 118_4a, 00:00:00
2.5m, General Condition photograph

Inspection report

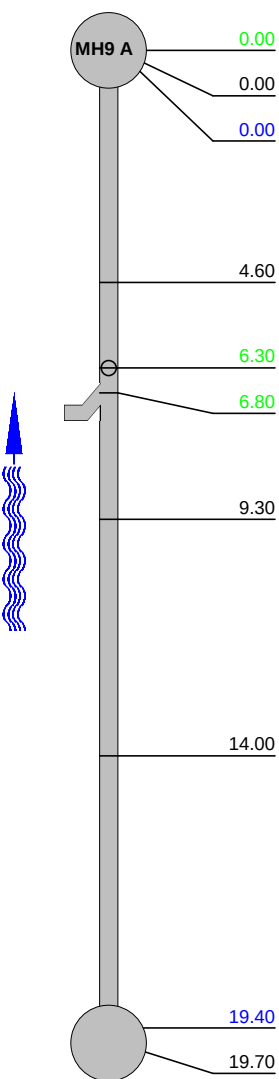
Date: 26/10/2023	Job N°: 61807	Weather: Dry	Operator: TH	section number: 19	PLR: X
Present:	Vehicle:	Camera: Solo Pro	Preset:	Cleaned: No	Grade:

Road: Cornbrook Road	Division:	start MH: MH9 A
Place: Cornbrook Road	District:	end MH:
Location:	Tape No.:	Total length: 19.7 m

Purpose:	Shape/Size: Circular dia 150 mm
Use: Surface water	Material: Polyvinyl chloride Pipe length:
Catchment:	Lining:
	Category:

Comment:

Location details:

1:150	position	code	observation	counter	photo	grade
	0.00	MH	Manhole Remark: MH9 A	00:00:00		(Constr) 0
	0.00	ST	Start of Survey	00:00:00		(Misc) 0
	0.00	WL	Water level, 0 % height/diameter	00:00:00		(Serv) 0
	4.60	GP	General Condition photograph	00:00:00	124_4a	(Misc) 0
	6.30	JN	Junction at 11 o'clock, dia 150 mm	00:00:00	125_5a	(Constr) 0
	6.80	JN	Junction at 03 o'clock, dia 150 mm	00:00:00	126_6a	(Constr) 0
	9.30	GP	General Condition photograph	00:00:00	127_7a	(Misc) 0
	14.00	GP	General Condition photograph	00:00:00	128_8a	(Misc) 0
	19.40	LL	Line of Sewer deviates left	00:00:00		(Serv) 0
	19.70	FH	Finish Survey, Remark: Rest bend reached.	00:00:00		(Misc) 0

Structural Defects

Constructional Features

Service Defects

Miscellaneous Features

Inspection photos

Place: Cornbrook Road	Road: Cornbrook Road	Date: 26/10/2023	section number: 19	PLR: X
---------------------------------	--------------------------------	----------------------------	------------------------------	------------------



Photo: 124_4a, 00:00:00
4.6m, General Condition photograph

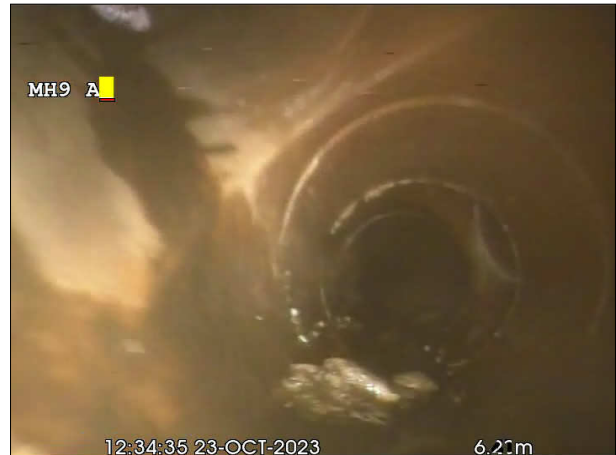


Photo: 125_5a, 00:00:00
6.3m, Junction at 11 o'clock, dia 150 mm

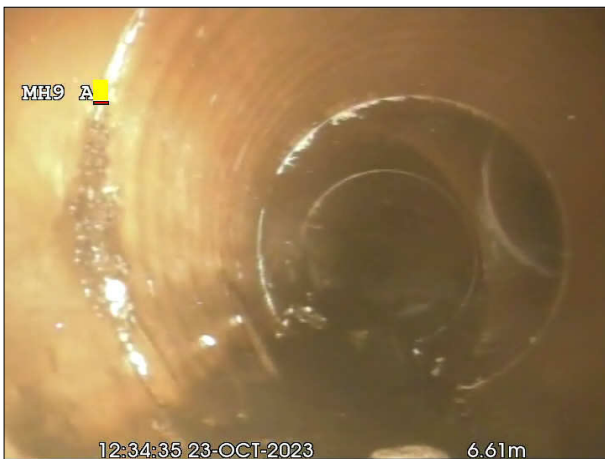


Photo: 126_6a, 00:00:00
6.8m, Junction at 03 o'clock, dia 150 mm



Photo: 127_7a, 00:00:00
9.3m, General Condition photograph

Inspection photos

Place: Cornbrook Road	Road: Cornbrook Road	Date: 26/10/2023	section number: 19	PLR: X
---------------------------------	--------------------------------	----------------------------	------------------------------	------------------



Photo: 128_8a, 00:00:00
14m, General Condition photograph

Inspection report

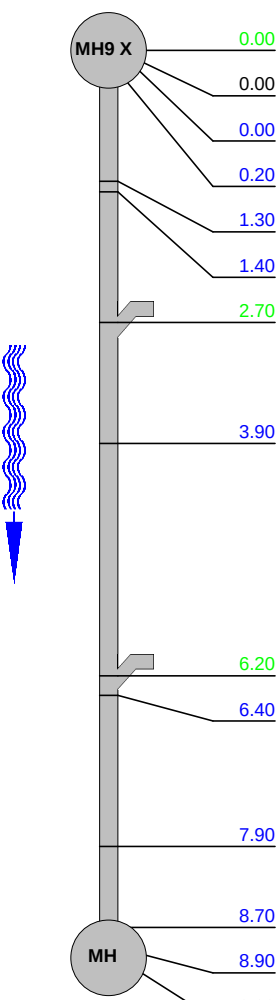
Date: 26/10/2023	Job N°: 61807	Weather: Dry	Operator: TH	section number: 20	PLR: MH9 X X
Present:	Vehicle:	Camera: Solo Pro	Preset:	Cleaned: No	Grade:

Road: Cornbrook Road	Division:	start MH: MH9 X
Place: Cornbrook Road	District:	end MH: MH
Location:	Tape No.:	Total length: 9 m

Purpose:	Shape/Size: Circular dia 150 mm
Use: Surface water	Material: Polyvinyl chloride Pipe length:
Catchment:	Lining:
	Category:

Comment:

Location details:

1:75	position	code	observation	counter	photo	grade
	0.00	MH	Manhole Remark: MH9 X	00:00:00		(Constr) 0
	0.00	ST	Start of Survey	00:00:00		(Misc) 0
	0.00	WL	Water level, 0 % height/diameter	00:00:00		(Serv) 0
	0.20	S1	DES Debris silt, 10 % cross-sectional area loss, Start	00:00:00	134_4a	(Serv) 1
	1.30	F1	DES Debris silt, 10 % cross-sectional area loss, Finish	00:00:00		(Serv) 1
	1.40	LL	Line of Sewer deviates left	00:00:00		(Serv) 0
	2.70	JN	Junction at 09 o'clock, dia 150 mm	00:00:00	137_7a	(Constr) 0
	3.90	S2	DES Debris silt, 5 % cross-sectional area loss, Start	00:00:00	138_8a	(Serv) 1
	6.20	JN	Junction at 09 o'clock, dia 150 mm	00:00:00	139_9a	(Constr) 0
	6.40	F2	DES Debris silt, 5 % cross-sectional area loss, Finish	00:00:00		(Serv) 1
	7.90	S3	DES Debris silt, 5 % cross-sectional area loss, Start	00:00:00	141_11a	(Serv) 1
	8.70	LR	Line of Sewer deviates right	00:00:00		(Serv) 0
	8.90	F3	DES Debris silt, 5 % cross-sectional area loss, Finish	00:00:00		(Serv) 1
	9.00	FH	Finish Survey, Remark: MH reached.	00:00:00		(Misc) 0

Structural Defects

Constructional Features

Service Defects

Miscellaneous Features

Inspection photos

Place: Cornbrook Road	Road: Cornbrook Road	Date: 26/10/2023	section number: 20	PLR: MH9 X X
---------------------------------	--------------------------------	----------------------------	------------------------------	------------------------

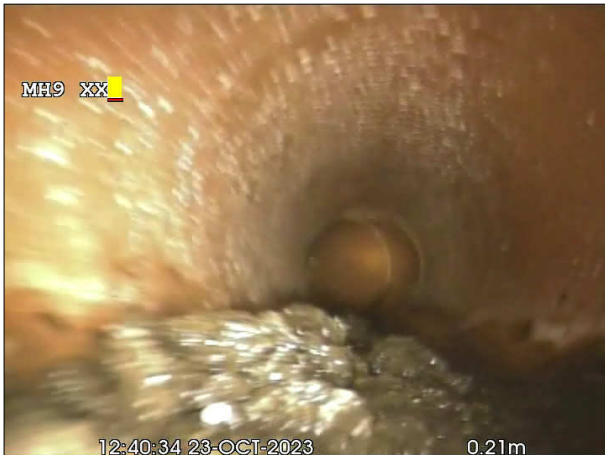


Photo: 134_4a, 00:00:00
0.2m, Debris silt, 10 % cross-sectional area loss, Start

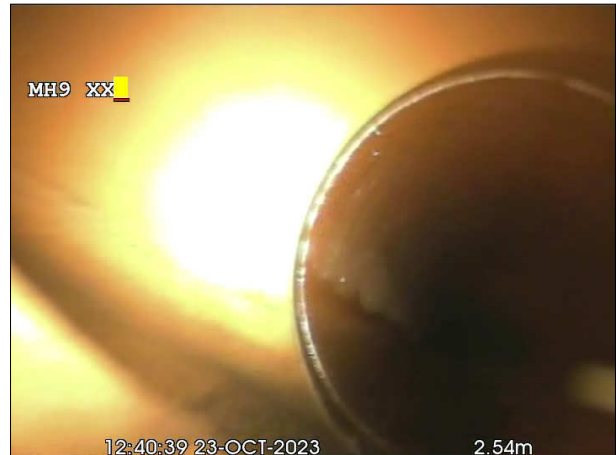


Photo: 137_7a, 00:00:00
2.7m, Junction at 09 o'clock, dia 150 mm

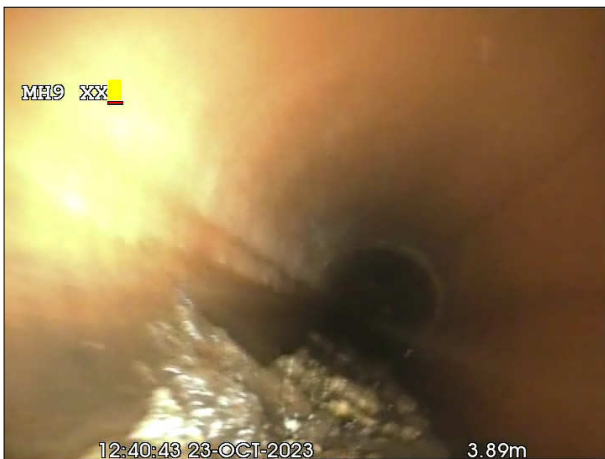


Photo: 138_8a, 00:00:00
3.9m, Debris silt, 5 % cross-sectional area loss, Start

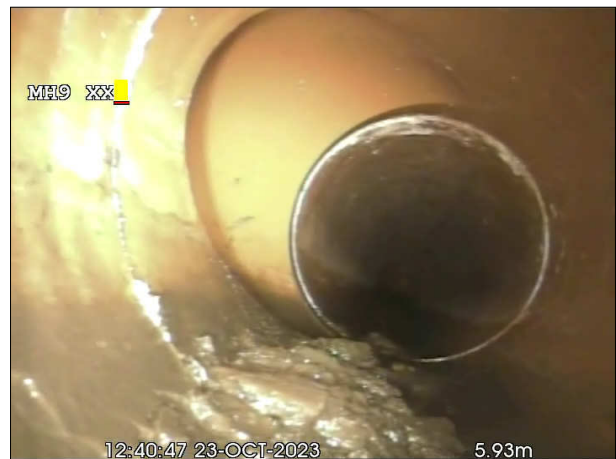


Photo: 139_9a, 00:00:00
6.2m, Junction at 09 o'clock, dia 150 mm

Inspection photos

Place: Cornbrook Road	Road: Cornbrook Road	Date: 26/10/2023	section number: 20	PLR: MH9 X X
---------------------------------	--------------------------------	----------------------------	------------------------------	------------------------

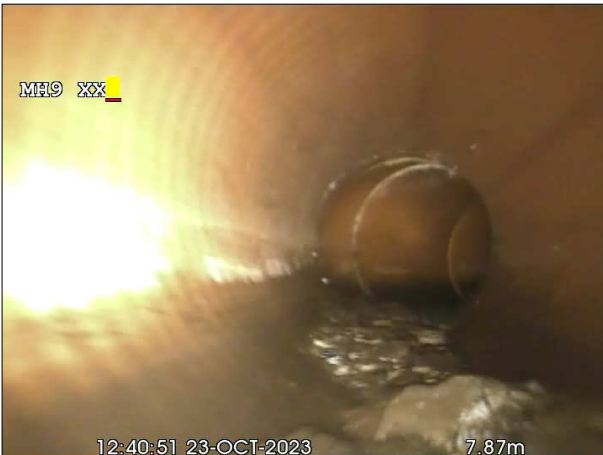


Photo: 141_11a, 00:00:00
7.9m, Debris silt, 5 % cross-sectional area loss, Start

Inspection report

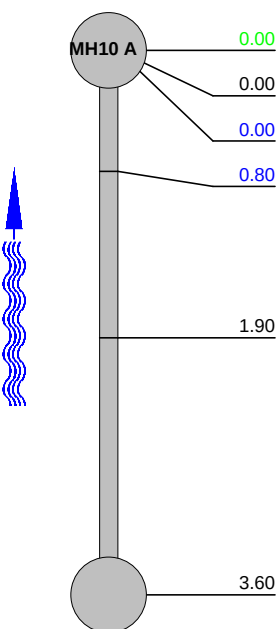
Date: 26/10/2023	Job N°: 61807	Weather: Dry	Operator: TH	section number: 21	PLR: X
Present:	Vehicle:	Camera: Solo Pro	Preset:	Cleaned: No	Grade:

Road: Cornbrook Road	Division:	start MH: MH10 A
Place: Cornbrook Road	District:	end MH:
Location:	Tape No.:	Total length: 3.6 m

Purpose:	Shape/Size: Circular dia 150 mm
Use: Surface water	Material: Polyvinyl chloride Pipe length:
Catchment:	Lining:
	Category:

Comment:

Location details:

1:50	position	code	observation	counter	photo	grade
	0.00	MH	Manhole Remark: MH10 A	00:00:00		(Constr) 0
	0.00	ST	Start of Survey	00:00:00		(Misc) 0
	0.00	WL	Water level, 0 % height/diameter	00:00:00		(Serv) 0
	0.80	LU	Line of Sewer deviates up	00:00:00		(Serv) 0
	1.90	GP	General Condition photograph	00:00:00	149_5a	(Misc) 0
	3.60	FH	Finish Survey, Remark: Gully reached.	00:00:00		(Misc) 0

Structural Defects

Constructional Features

Service Defects

Miscellaneous Features

Inspection photos

Place: Cornbrook Road	Road: Cornbrook Road	Date: 26/10/2023	section number: 21	PLR: X
---------------------------------	--------------------------------	----------------------------	------------------------------	------------------



Photo: 149_5a, 00:00:00
1.9m, General Condition photograph

Inspection report

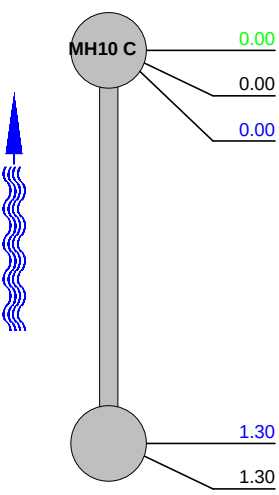
Date: 26/10/2023	Job N°: 61807	Weather: Dry	Operator: TH	section number: 22	PLR: X
Present:	Vehicle:	Camera: Solo Pro	Preset:	Cleaned: No	Grade:

Road: Cornbrook Road	Division:	start MH: MH10 C
Place: Cornbrook Road	District:	end MH:
Location:	Tape No.:	Total length: 1.3 m

Purpose:	Shape/Size: Circular dia 150 mm
Use: Surface water	Material: Vitrified clay Pipe length:
Catchment:	Lining:
	Category:

Comment:

Location details:

1:25	position	code	observation	counter	photo	grade
		MH	Manhole Remark: MH10 C	00:00:00		(Constr) 0
		ST	Start of Survey	00:00:00		(Misc) 0
		WL	Water level, 0 % height/diameter	00:00:00		(Serv) 0
		LU	Line of Sewer deviates up	00:00:00		(Serv) 0
		FH	Finish Survey, Remark: Rest bend reached.	00:00:00		(Misc) 0

Structural Defects

Constructional Features

Service Defects

Miscellaneous Features

Inspection report

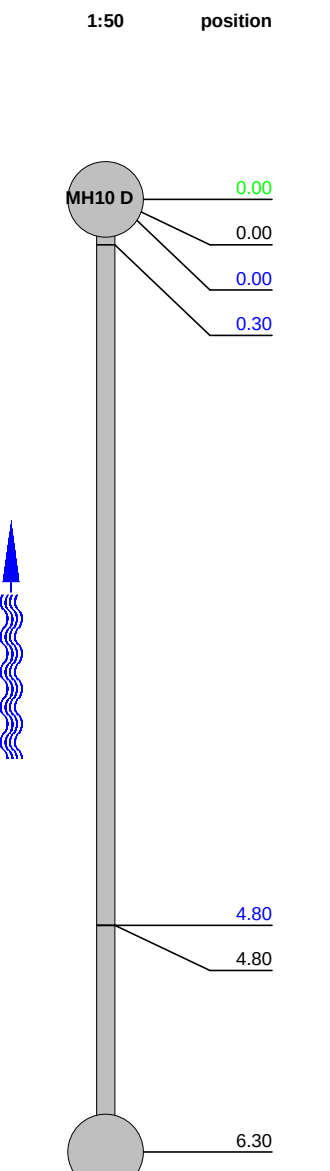
Date: 26/10/2023	Job N°: 61807	Weather: Dry	Operator: TH	section number: 23	PLR: X
Present:	Vehicle:	Camera: Solo Pro	Preset:	Cleaned: No	Grade:

Road:	Cornbrook Road	Division:	start MH:	MH10 D
Place:	Cornbrook Road	District:	end MH:	
Location:		Tape No.:	Total length:	6.3 m

Purpose:		Shape/Size:	Circular dia 150 mm
Use:	Surface water	Material:	Vitrified clay Pipe length:
Catchment:		Lining:	
		Category:	

Comment:

Location details:

1:50	position	code	observation	counter	photo	grade
	0.00	MH	Manhole Remark: MH10 D	00:00:00		(Constr) 0
	0.00	ST	Start of Survey	00:00:00		(Misc) 0
	0.00	WL	Water level, 0 % height/diameter	00:00:00		(Serv) 0
	0.30	LR	Line of Sewer deviates right	00:00:00		(Serv) 0
	4.80	LL	Line of Sewer deviates left	00:00:00		(Serv) 0
	4.80	GP	General Condition photograph	00:00:00	161_6a	(Misc) 0
	6.30	FH	Finish Survey, Remark: Gully reached	00:00:00		(Misc) 0

Structural Defects	Constructional Features
Service Defects	Miscellaneous Features

Inspection photos

Place: Cornbrook Road	Road: Cornbrook Road	Date: 26/10/2023	section number: 23	PLR: X
---------------------------------	--------------------------------	----------------------------	------------------------------	------------------



Photo: 161_6a, 00:00:00
4.8m, General Condition photograph

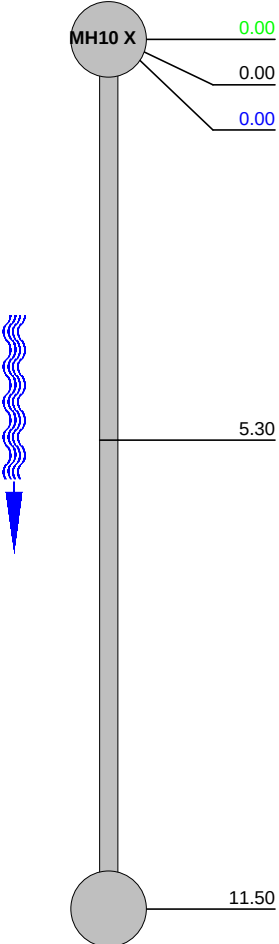
Inspection report

Date: 26/10/2023	Job N°: 61807	Weather: Dry	Operator: TH	section number: 24	PLR: MH10 X X
Present:	Vehicle:	Camera: Solo Pro	Preset:	Cleaned: No	Grade:

Road: Cornbrook Road	Division:	start MH: MH10 X
Place: Cornbrook Road	District:	end MH:
Location:	Tape No.:	Total length: 11.5 m

Purpose:	Shape/Size: Circular dia 300 mm
Use: Surface water	Material: Vitrified clay Pipe length:
Catchment:	Lining:
	Category:

Comment:
Location details:

1:100	position	code	observation	counter	photo	grade
		MH	Manhole Remark: MH10 X	00:00:00		(Constr) 0
		ST	Start of Survey	00:00:00		(Misc) 0
		WL	Water level, 0 % height/diameter	00:00:00		(Serv) 0
		GP	General Condition photograph	00:00:00	166_4a	(Misc) 0
		FH	Finish Survey, Remark: Point reached from previous survey of MH1 B	00:00:00		(Misc) 0

Structural Defects	Constructional Features
Service Defects	Miscellaneous Features

Inspection photos

Place: Cornbrook Road	Road: Cornbrook Road	Date: 26/10/2023	section number: 24	PLR: MH10 X X
---------------------------------	--------------------------------	----------------------------	------------------------------	-------------------------



Photo: 166_4a, 00:00:00
5.3m, General Condition photograph

Inspection report

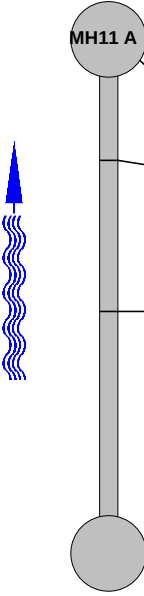
Date: 26/10/2023	Job N°: 61807	Weather: Dry	Operator: TH	section number: 25	PLR: X
Present:	Vehicle:	Camera: Solo Pro	Preset:	Cleaned: No	Grade:

Road: Cornbrook Road	Division:	start MH: MH11 A
Place: Cornbrook Road	District:	end MH:
Location:	Tape No.:	Total length: 3.4 m

Purpose:	Shape/Size: Circular dia 150 mm
Use: Surface water	Material: Polyvinyl chloride Pipe length:
Catchment:	Lining:
	Category:

Comment:

Location details:

1:50	position	code	observation	counter	photo	grade
	0.00	MH	Manhole Remark: MH11 A	00:00:00		(Constr) 0
	0.00	ST	Start of Survey	00:00:00		(Misc) 0
	0.00	WL	Water level, 0 % height/diameter	00:00:00		(Serv) 0
	0.80	LU	Line of Sewer deviates up	00:00:00		(Serv) 0
	1.80	GP	General Condition photograph	00:00:00	173_5a	(Misc) 0

Structural Defects

Constructional Features

Service Defects

Miscellaneous Features

Inspection photos

Place: Cornbrook Road	Road: Cornbrook Road	Date: 26/10/2023	section number: 25	PLR: X
---------------------------------	--------------------------------	----------------------------	------------------------------	------------------



Photo: 173_5a, 00:00:00
1.8m, General Condition photograph

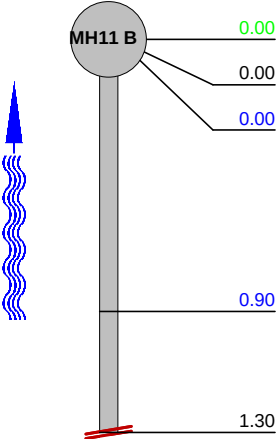
Inspection report

Date: 26/10/2023	Job N°: 61807	Weather: Dry	Operator: TH	section number: 26	PLR: X
Present:	Vehicle:	Camera: Solo Pro	Preset:	Cleaned: No	Grade:

Road: Cornbrook Road	Division:	start MH: MH11 B
Place: Cornbrook Road	District:	end MH:
Location:	Tape No.:	Total length: 1.3 m

Purpose:	Shape/Size: Circular dia 150 mm
Use: Surface water	Material: Polyvinyl chloride Pipe length:
Catchment:	Lining:
	Category:

Comment:
Location details:

1:25	position	code	observation	counter	photo	grade
	0.00	MH	Manhole Remark: MH11 B	00:00:00		(Constr) 0
	0.00	ST	Start of Survey	00:00:00		(Misc) 0
	0.00	WL	Water level, 0 % height/diameter	00:00:00		(Serv) 0
	0.90	LR	Line of Sewer deviates right	00:00:00		(Serv) 0
	1.30	SA	Survey abandoned, Remark: Unable to survey beyond deviation.	00:00:00		(Misc) 0

Structural Defects	Constructional Features
Service Defects	Miscellaneous Features

Inspection report

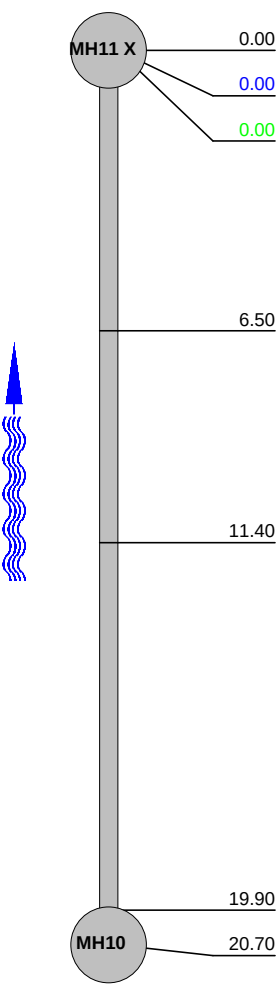
Date: 26/10/2023	Job N°: 61807	Weather: Dry	Operator: TH	section number: 27	PLR: X
Present:	Vehicle:	Camera: Solo Pro	Preset:	Cleaned: No	Grade:

Road: Cornbrook Road	Division:	start MH: MH11 X
Place: Cornbrook Road	District:	end MH: MH10
Location:	Tape No.:	Total length: 20.7 m

Purpose:	Shape/Size: Circular dia 150 mm
Use: Surface water	Material: Polyvinyl chloride Pipe length:
Catchment:	Lining:
	Category:

Comment:

Location details:

1:175	position	code	observation	counter	photo	grade
	0.00	ST	Start of Survey	00:00:00		(Misc) 0
	0.00	WL	Water level, 0 % height/diameter	00:00:00		(Serv) 0
	0.00	MH	Manhole Remark: MH11 X	00:00:00		(Constr) 0
	6.50	GP	General Condition photograph	00:00:00	27_-9503a	(Misc) 0
	11.40	GP	General Condition photograph	00:00:00	27_-9502a	(Misc) 0
	19.90	GP	General Condition photograph	00:00:00	27_-9501a	(Misc) 0
	20.70	FH	Finish Survey, Remark: MH10 reached.	00:00:00		(Misc) 0

Structural Defects

Constructional Features

Service Defects

Miscellaneous Features

Inspection photos

Place: Cornbrook Road	Road: Cornbrook Road	Date: 26/10/2023	section number: 27	PLR: X
---------------------------------	--------------------------------	----------------------------	------------------------------	------------------



Photo: 27_-9503a, 00:00:00
6.5m, General Condition photograph



Photo: 27_-9502a, 00:00:00
11.4m, General Condition photograph



Photo: 27_-9501a, 00:00:00
19.9m, General Condition photograph

Date:
26/10/2023

Job N°
61807

Weather:
Dry

Operator:
TH

section number:
28

PLR: _____

Present:

Vehicle:

Camera:
Solo Pro

Preset:

Cleaned:
No

Grade:

Road: Cornbrook Road

Place: **Cornbrook Road**

Location:

Division:

District:

Tape No.:

start MH: MH12 A

end MH:

Total length: **9.2 m**

Purpose:

Use: **Surface water**

Shape/Size:

Material: **Concrete** Pipe length:

Lining:

Category:

Comment:

Location details:

1:75	position	code	observation	counter	photo	grade
	0.00	MH	Manhole Remark: MH12 A	00:00:00		(Constr) 0
	0.00	ST	Start of Survey	00:00:00		(Misc) 0
	0.00	WL	Water level, 0 % height/diameter	00:00:00		(Serv) 0
	0.50	JN	Junction at 09 o'clock, dia 150 mm	00:00:00	189_4a, b	(Constr) 0
	7.20	WL	Water level, 20 % height/diameter	00:00:00		(Serv) 0
	7.80	S1	CU Camera Underwater, Start, Remark: Loss of vision.	00:00:00		(Misc) 0
	9.20	F1	CU Camera Underwater, Finish, Remark: Loss of vision.	00:00:00		(Misc) 0
	9.20	FH	Finish Survey, Remark: MH reached.	00:00:00		(Misc) 0

Structural Defects

Constructional Features

Service Defects

Miscellaneous Features

Inspection photos

Place: Cornbrook Road	Road: Cornbrook Road	Date: 26/10/2023	section number: 28	PLR: X
---------------------------------	--------------------------------	----------------------------	------------------------------	------------------



Photo: 189_4a, 00:00:00
0.5m, Junction at 09 o'clock, dia 150 mm

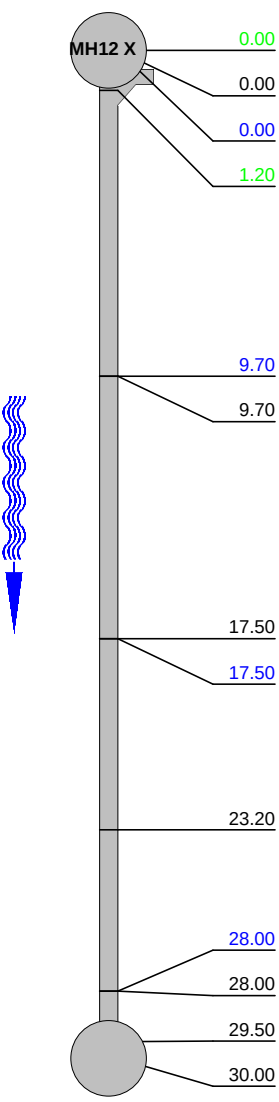


Photo: 189_4b, 00:00:00
0.5m, Junction at 09 o'clock, dia 150 mm

Inspection report

Date: 26/10/2023	Job N°: 61807	Weather: Dry	Operator: TH	section number: 29	PLR: MH12 X X
Present:	Vehicle:	Camera: Solo Pro	Preset:	Cleaned: No	Grade:

Road: Cornbrook Road	Division:	start MH: MH12 X
Place: Cornbrook Road	District:	end MH:
Location:	Tape No.:	Total length: 30 m
Purpose:	Shape/Size: Egg shaped dia 300 mm	
Use: Surface water	Material: Concrete	Pipe length:
Catchment:	Lining:	
	Category:	
Comment:		
Location details:		

1:225	position	code	observation	counter	photo	grade
	0.00	MH	Manhole Remark: MH12 X	00:00:00		(Constr) 0
	0.00	ST	Start of Survey	00:00:00		(Misc) 0
	0.00	WL	Water level, 0 % height/diameter	00:00:00		(Serv) 0
	1.20	JN	Junction at 09 o'clock, dia 150 mm	00:00:00	197_4a	(Constr) 0
	9.70	WL	Water level, 20 % height/diameter	00:00:00		(Serv) 0
	9.70	S1 CU	Camera Underwater, Start, Remark: Loss of vision.	00:00:00		(Misc) 0
	17.50	F1 CU	Camera Underwater, Finish, Remark: Loss of vision.	00:00:00		(Misc) 0
	17.50	WL	Water level, 5 % height/diameter	00:00:00		(Serv) 0
	23.20	GP	General Condition photograph	00:00:00	202_9a	(Misc) 0
	28.00	WL	Water level, 30 % height/diameter	00:00:00		(Serv) 0
	28.00	S1 CU	Camera Underwater, Start, Remark: Loss of vision.	00:00:00		(Misc) 0
	29.50	F1 CU	Camera Underwater, Finish, Remark: Loss of vision.	00:00:00		(Misc) 0
	30.00	FH	Finish Survey, Remark: Unable to survey beyond this this point due restricted leverage.	00:00:00		(Misc) 0
Structural Defects			Constructional Features			
Service Defects			Miscellaneous Features			

Inspection photos

Place: Cornbrook Road	Road: Cornbrook Road	Date: 26/10/2023	section number: 29	PLR: MH12 X X
---------------------------------	--------------------------------	----------------------------	------------------------------	-------------------------



Photo: 197_4a, 00:00:00
 1.2m, Junction at 09 o'clock, dia 150 mm



Photo: 202_9a, 00:00:00
 23.2m, General Condition photograph

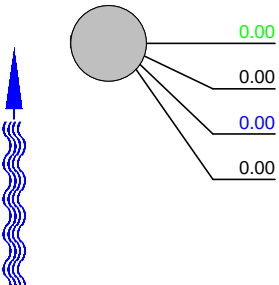
Inspection report

Date: 26/10/2023	Job N°: 61807	Weather: Dry	Operator: TH	section number: 30	PLR: X
Present:	Vehicle:	Camera: Solo Pro	Preset:	Cleaned: No	Grade:

Road: Cornbrook Road	Division:	start MH: MH13 A
Place: Cornbrook Road	District:	end MH:
Location:	Tape No.:	Total length: 0 m

Purpose:	Shape/Size: Egg shaped dia 150 mm
Use: Surface water	Material: Vitrified clay Pipe length:
Catchment:	Lining:
	Category:

Comment:
Location details:

1:25	position	code	observation	counter	photo	grade
	0.00	MH	Manhole Remark: MH13 A	00:00:00		(Constr) 0
	0.00	ST	Start of Survey	00:00:00		(Misc) 0
	0.00	WL	Water level, 0 % height/diameter	00:00:00		(Serv) 0
	0.00	FH	Finish Survey, Remark: Gully reached.			(Misc) 0

Structural Defects	Constructional Features
Service Defects	Miscellaneous Features

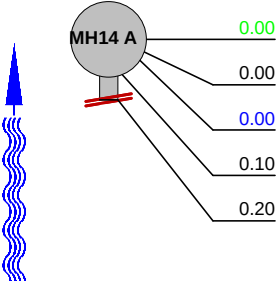
Inspection report

Date: 26/10/2023	Job N°: 61807	Weather: Dry	Operator: TH	section number: 31	PLR: X
Present:	Vehicle:	Camera: Solo Pro	Preset:	Cleaned: No	Grade:

Road: Cornbrook Road	Division:	start MH: MH14 A
Place: Cornbrook Road	District:	end MH:
Location:	Tape No.:	Total length: 0.2 m

Purpose:	Shape/Size: Egg shaped dia 300 mm
Use: Surface water	Material: Concrete Pipe length:
Catchment:	Lining:
	Category:

Comment:
Location details:

1:25	position	code	observation	counter	photo	grade
	0.00	MH	Manhole Remark: MH14 A	00:00:00		(Constr) 0
	0.00	ST	Start of Survey	00:00:00		(Misc) 0
	0.00	WL	Water level, 0 % height/diameter	00:00:00		(Serv) 0
	0.10	GO	General Observation, Remark: Sewer reappear	00:00:00	214_4a	(Misc) 0
	0.20	SA	Survey abandoned, Remark: Unable to survey beyond repair.	00:00:00		(Misc) 0

Structural Defects	Constructional Features
Service Defects	Miscellaneous Features

Inspection photos

Place: Cornbrook Road	Road: Cornbrook Road	Date: 26/10/2023	section number: 31	PLR: X
---------------------------------	--------------------------------	----------------------------	------------------------------	------------------



Photo: 214_4a, 00:00:00
0.1m, General Observation, Remark: Sewer reappear

Inspection report

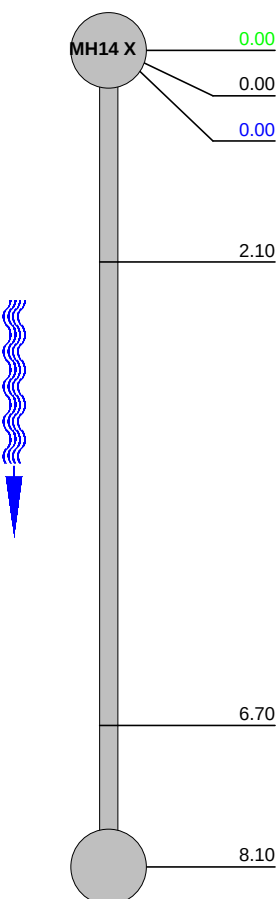
Date: 26/10/2023	Job N°: 61807	Weather: Dry	Operator: TH	section number: 32	PLR: MH14 X X
Present:	Vehicle:	Camera: Solo Pro	Preset:	Cleaned: No	Grade:

Road: Cornbrook Road	Division:	start MH: MH14 X
Place: Cornbrook Road	District:	end MH:
Location:	Tape No.:	Total length: 8.1 m

Purpose:	Shape/Size: Egg shaped dia 300 mm
Use: Surface water	Material: Concrete Pipe length:
Catchment:	Lining:
	Category:

Comment:

Location details:

1:75	position	code	observation	counter	photo	grade
	0.00	MH	Manhole Remark: MH14 X	00:00:00		(Constr) 0
	0.00	ST	Start of Survey	00:00:00		(Misc) 0
	0.00	WL	Water level, 0 % height/diameter	00:00:00		(Serv) 0
	2.10	GP	General Condition photograph	00:00:00	219_4a	(Misc) 0
	6.70	GP	General Condition photograph	00:00:00	220_5a	(Misc) 0
	8.10	FH	Finish Survey, Remark: Drops into sewer line.	00:00:00		(Misc) 0

Structural Defects

Constructional Features

Service Defects

Miscellaneous Features

Inspection photos

Place: Cornbrook Road	Road: Cornbrook Road	Date: 26/10/2023	section number: 32	PLR: MH14 X X
---------------------------------	--------------------------------	----------------------------	------------------------------	-------------------------



Photo: 219_4a, 00:00:00
2.1m, General Condition photograph



Photo: 220_5a, 00:00:00
6.7m, General Condition photograph

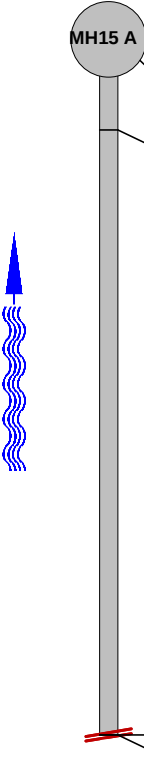
Inspection report

Date: 26/10/2023	Job N°: 61807	Weather: Dry	Operator: TH	section number: 33	PLR: X
Present:	Vehicle:	Camera: Solo Pro	Preset:	Cleaned: No	Grade:

Road: Cornbrook Road	Division:	start MH: MH15 A
Place: Cornbrook Road	District:	end MH:
Location:	Tape No.:	Total length: 2.3 m

Purpose:	Shape/Size: Egg shaped dia 150 mm
Use: Surface water	Material: Polyvinyl chloride Pipe length:
Catchment:	Lining:
	Category:

Comment:
Location details:

1:25	position	code	observation	counter	photo	grade
	0.00	MH	Manhole Remark: MH15 A	00:00:00		(Constr) 0
	0.00	ST	Start of Survey	00:00:00		(Misc) 0
	0.00	WL	Water level, 0 % height/diameter	00:00:00		(Serv) 0
	0.30	S1 DES	Debris silt, 10 % cross-sectional area loss, Start	00:00:00	225_4a	(Serv) 1
	2.30	F1 DES	Debris silt, 10 % cross-sectional area loss, Finish	00:00:00		(Serv) 1
	2.30	SA	Survey abandoned, Remark: Unable to survey beyond blockage.	00:00:00		(Misc) 0

Structural Defects	Constructional Features
Service Defects	Miscellaneous Features

Inspection photos

Place: Cornbrook Road	Road: Cornbrook Road	Date: 26/10/2023	section number: 33	PLR: X
---------------------------------	--------------------------------	----------------------------	------------------------------	------------------

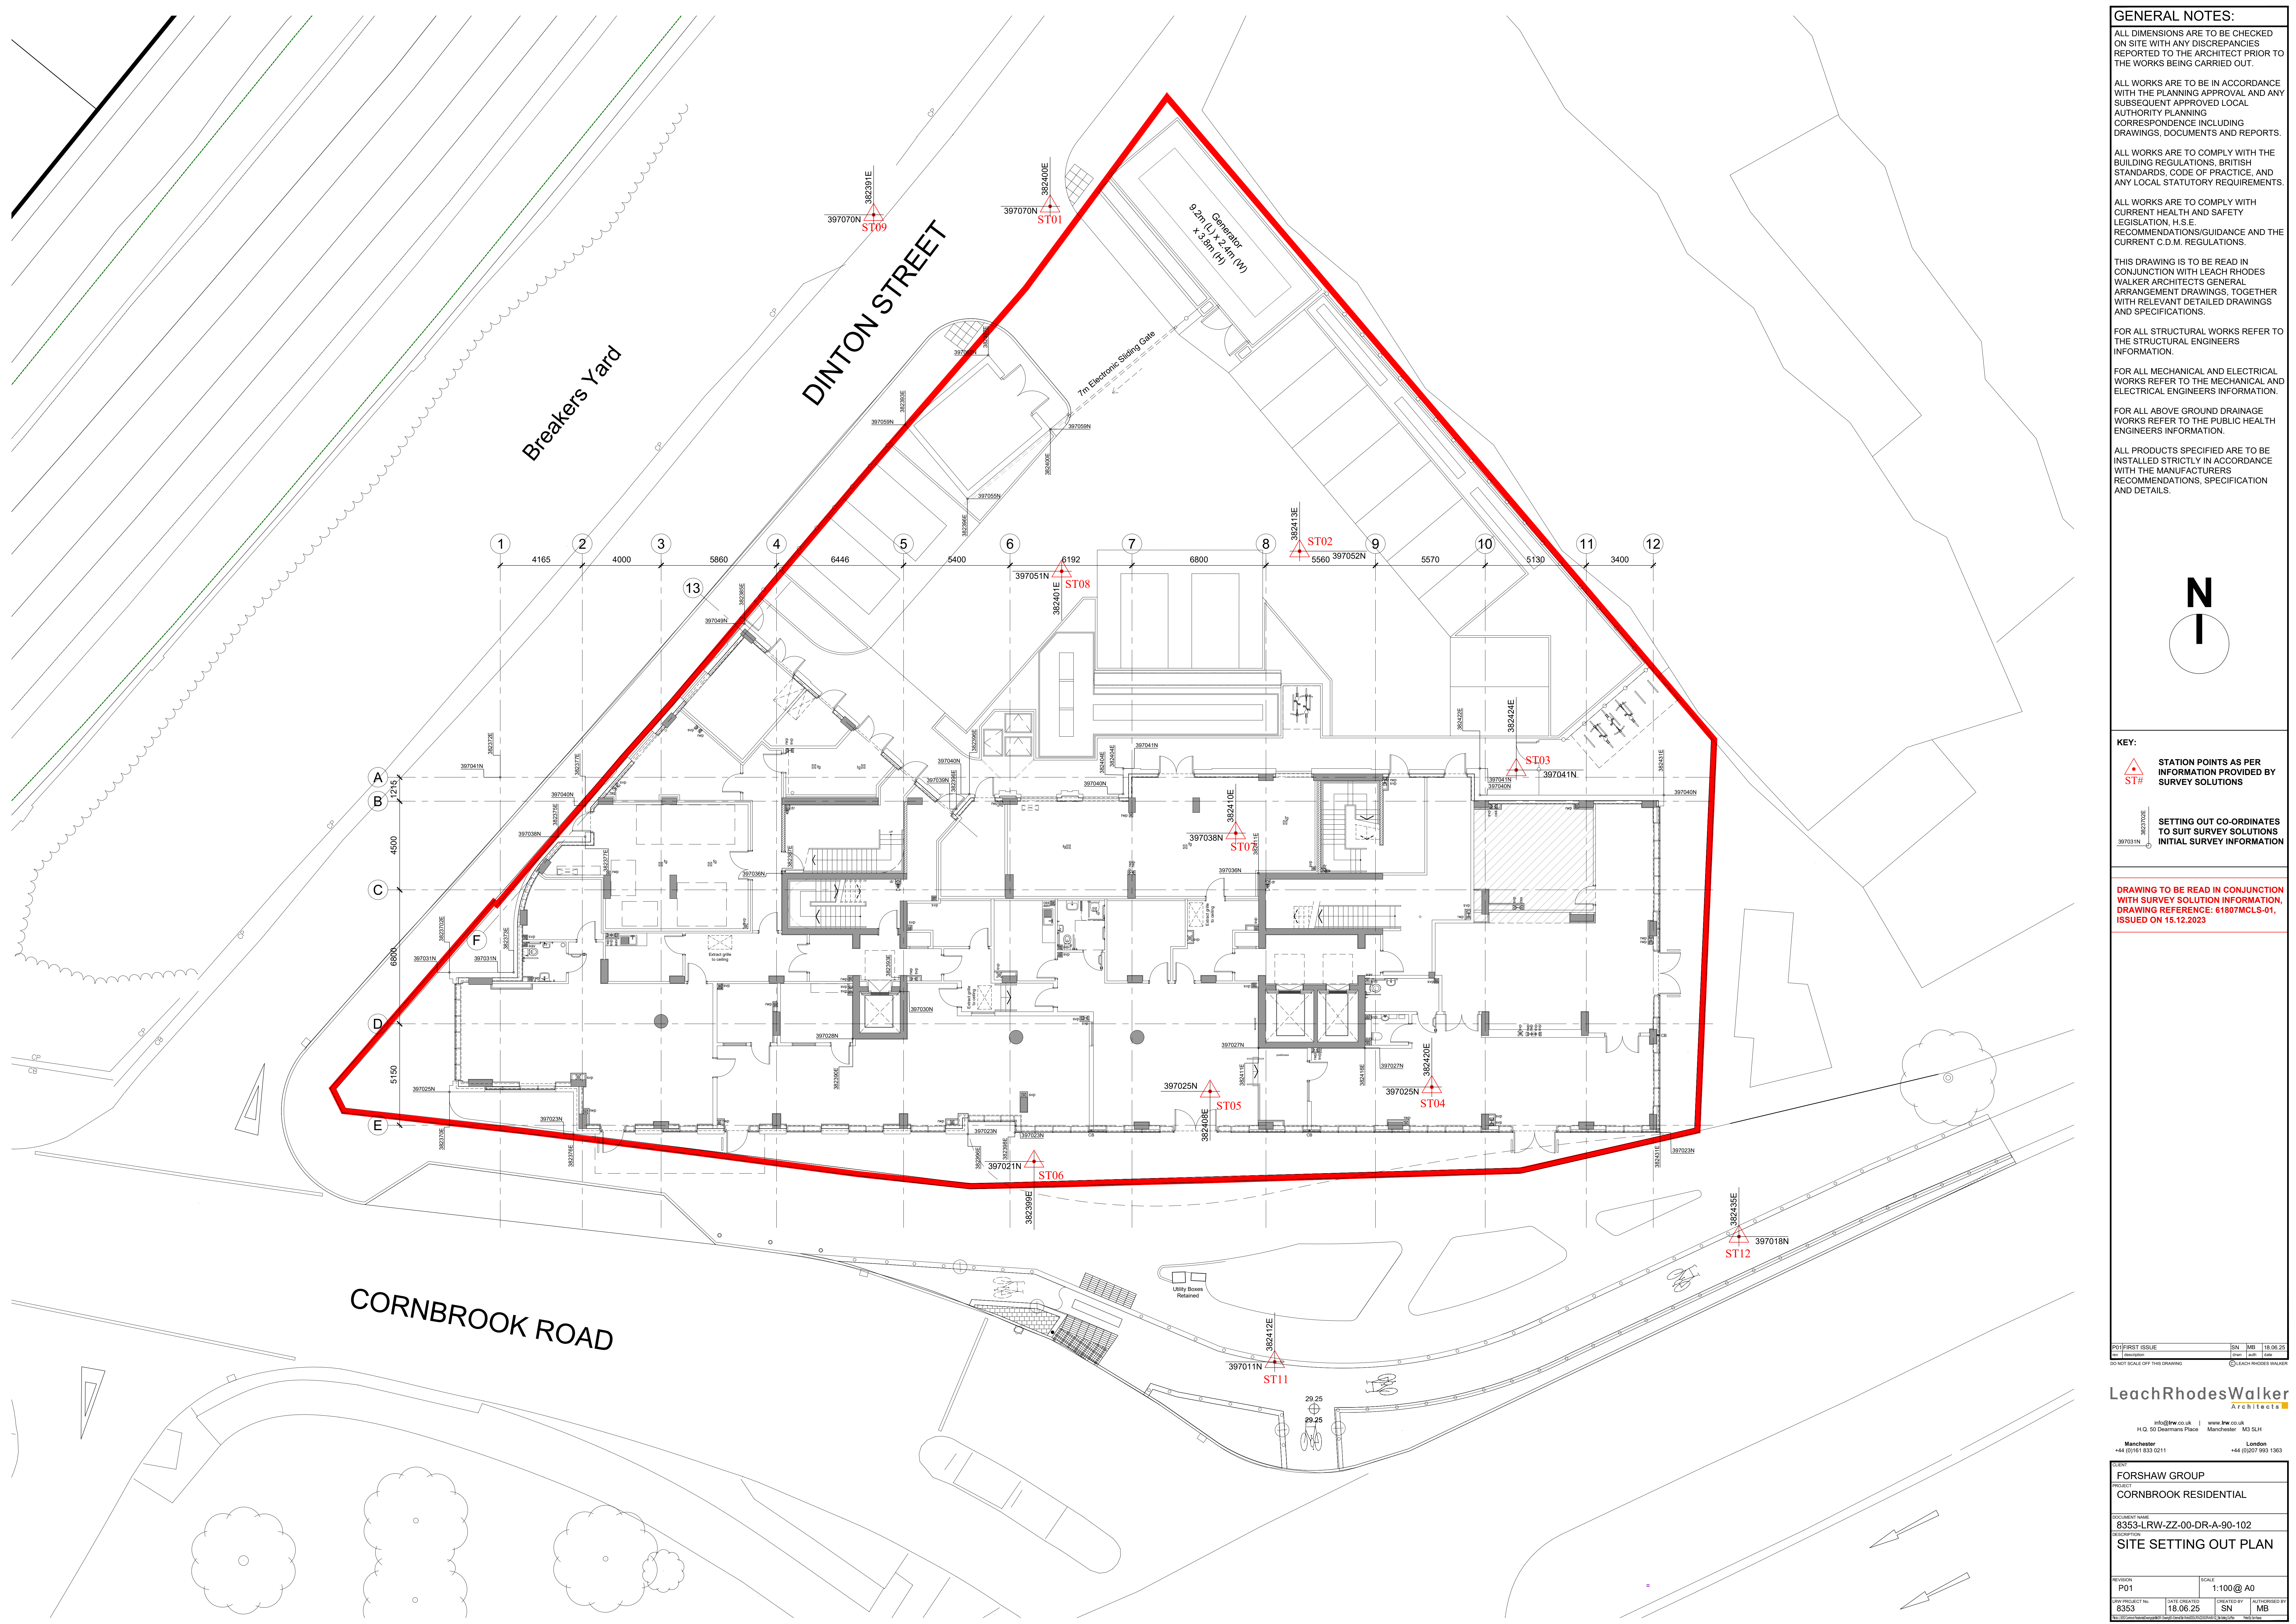


Photo: 225_4a, 00:00:00

0.3m, Debris silt, 10 % cross-sectional area loss, Start

APPENDIX D

PROPOSED DEVELOPMENT PLANS



GENERAL NOTES:

ALL DIMENSIONS ARE TO BE CHECKED ON SITE WITH ANY DISCREPANCIES REPORTED TO THE ARCHITECT PRIOR TO THE WORKS BEING CARRIED OUT.

ALL WORKS ARE TO BE IN ACCORDANCE WITH THE PLANNING APPROVAL AND ANY SUBSEQUENT APPROVED LOCAL AUTHORITY PLANNING CORRESPONDENCE INCLUDING DRAWINGS, DOCUMENTS AND REPORTS.

ALL WORKS ARE TO COMPLY WITH THE BUILDING REGULATIONS, BRITISH STANDARDS, CODE OF PRACTICE, AND ANY LOCAL STATUTORY REQUIREMENTS.

ALL WORKS ARE TO COMPLY WITH CURRENT HEALTH AND SAFETY LEGISLATION, H.S.E. RECOMMENDATIONS/GUIDANCE AND THE CURRENT C.D.M. REGULATIONS.

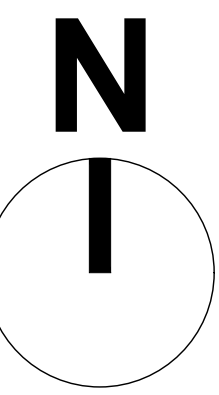
THIS DRAWING IS TO BE READ IN CONJUNCTION WITH LEACH RHODES WALKER ARCHITECTS GENERAL ARRANGEMENT DRAWINGS, TOGETHER WITH RELEVANT DETAILED DRAWINGS AND SPECIFICATIONS.

FOR ALL STRUCTURAL WORKS REFER TO THE STRUCTURAL ENGINEERS INFORMATION.

FOR ALL MECHANICAL AND ELECTRICAL WORKS REFER TO THE MECHANICAL AND ELECTRICAL ENGINEERS INFORMATION.

FOR ALL ABOVE GROUND DRAINAGE WORKS REFER TO THE PUBLIC HEALTH ENGINEERS INFORMATION.

ALL PRODUCTS SPECIFIED ARE TO BE INSTALLED STRICTLY IN ACCORDANCE WITH THE MANUFACTURERS RECOMMENDATIONS, SPECIFICATION AND DETAILS.



KEY:

ST# STATION POINTS AS PER INFORMATION PROVIDED BY SURVEY SOLUTIONS

397031N 397031E 397031N 397031E SETTING OUT CO-ORDINATES TO SUIT SURVEY SOLUTIONS INITIAL SURVEY INFORMATION

DRAWING TO BE READ IN CONJUNCTION WITH SURVEY SOLUTION INFORMATION, DRAWING REFERENCE: 61807MCLS-01, ISSUED ON 15.12.2023

P01	FIRST ISSUE	SN	MB	18.06.25
1	18.06.25	18.06.25	18.06.25	18.06.25

LeachRhodesWalker Architects

info@lrw.co.uk | www.lrw.co.uk
H.Q. 50 Deans Place Manchester M3 3LH
Manchester +44 (0)161 833 0211 London +44 (0)20 795 1365

FORSHAW GROUP
CORNbrook RESIDENTIAL

8353-LRW-ZZ-00-DR-A-90-102
SITE SETTING OUT PLAN

REVISION	SCALE
P01	1:100 @ A0
SN	MB
18.06.25	18.06.25

APPENDIX E
EXISTING DRAINED AREAS PLAN



NOTES:

1. THIS DRAWING IS INTENDED TO INDICATE THE EXISTING DRAINED AREAS FROM THE CORNBROOK SITE. IT IS BASED UPON A REVIEW OF THE TOPOGRAPHICAL SURVEY AND AERIAL IMAGES OF THE SITE.

KEY	
	PLANNING BOUNDARY
	SITE BOUNDARY TOTAL AREA: 2254 m2 (0.23 ha)
	SOFT LANDSCAPED AREAS AREA: 969.34 m2 (0.097 ha)
	HARD PAVED AREAS AREA: 1287.51 m2 (0.130ha)

P02	UPDATED FOR LATEST ARCHITECT PLANS	19.01.24	JB	PC
P01	FIRST ISSUE	15.12.23	SA	PC
Rev:	Description:	Date:	By:	Chkd:



Renaissance Associates Ltd
Carvers Warehouse
77 Dale Street
Manchester
M1 2HG

Project:

**CORNBROOK RESIDENTIAL,
MANCHESTER**

Drawing Title:

**EXISTING DRAINED AREAS
PLAN**

Status:

PLANNING

Size:	Date:	Drawn by:	Designed by:	Checked by:
A1	DEC 23	SA	SA	PC
Scale:	1:125	Project No:	2306-18	

Project	Originator	Volume	Level	Type	Role	Number	Revision:
CBR-REN-00-FN-DR-C-00050							P02

APPENDIX F

GREENFIELD RUN-OFF RATES

Renaissance Assoc.		Page 1
Carvers Warehouse 77 Dale Street Manchester M1 2HG	Cornbrook Greenfield Run -Off	
Date 15/12/2023 10:36 File	Designed by JB Checked by PC	
Innovyze	Source Control 2020.1.3	
<u>ICP SUDS Mean Annual Flood</u> Input Return Period (years) 2 SAAR (mm) 872 Urban 0.750 Area (ha) 0.225 Soil 0.450 Region Number Region 10 Results 1/s QBAR Rural 1.3 QBAR Urban 3.2 Q2 years 3.3 Q1 year 2.8 Q30 years 4.6 Q100 years 5.0		
©1982-2020 Innovyze		

APPENDIX G
UNITED UTILITIES CORRESPONDENCE

From: seweradoptions@uuplc.co.uk
Sent: 06 October 2023 13:36
To: Henry Wilkinson
Subject: RE: PDE CA28. Cornbrook Residential - 04740820

Good afternoon Henry

Pre Development Enquiry for: Cornbrook Road, M15 4YG UU Reference Number : 04740820

We have carried out an assessment of your application which is based on the information provided. This pre-development advice on your drainage strategy will be valid for 12 months. Your drainage strategy will need to be reviewed by other competent authorities as part of the planning process, and we advise that you carry out the necessary site investigations to confirm the viability of your proposals.

If your investigations require access to our public sewer network, we ask that you contact our network engineers with a request for an access certificate via our main contact telephone number 0345 6723 723 or refer to the link below:

<https://www.unitedutilities.com/builders-developers/working-near-our-assets/>

Foul Water

Foul flow from this site will be allowed to drain into the public foul water/combined sewer system.

Our preferred point of discharge would be to the 300 x 400mm diameter public combined sewer within Dinton Street located to the south of your proposed development at an unrestricted rate.

In accordance with our infrastructure plans we may ask you to change your point of connection. Therefore please contact us when you are ready to formalise your drainage proposals, we would suggest before you submit for Full Planning.

Please be advised both proposed points of discharge are combined sewers, UU would not object to the same sewer being used for both connection points

Surface Water

All surface water flow from the proposed development should drain in-line with the drainage hierarchy, as outlined in Paragraph 80, (Reference ID: 7-080-20150323), of the National Planning Practice Guidance. We also recommend you prioritise the use of multi-functional sustainable drainage systems for the management of surface water in accordance with national planning policy.

Generally, the aim should be to discharge surface run off as high up the following hierarchy of drainage options as reasonably practicable.

This is outlined as follows, in order of priority:

1. **into the ground (infiltration);**
2. **to a surface waterbody;**
3. **to a surface water sewer or highway drain;**
4. **to a combined sewer.**

For guidance, The [North West SuDS Pro-Forma](#) provides information on the appropriate evidence required at each stage of the hierarchy, to demonstrate how each level has been discounted.

The Lead Local Flood Authority has responsibility for all surface water drainage concerns and their input to your proposal is critical. You should also consider whether it is necessary to discuss your proposal with the Environment Agency, or Internal Drainage Board (if operating in your area).

The Local Planning Authority are the determining authority for any application for planning permission and the appropriate authority for determining cost viability of a proposed drainage scheme, such assessments are outside of the jurisdiction of United Utilities.

Infiltration

Surface water runoff generated from this development should discharge to the ground via infiltration system where feasible.

A detailed evidence based feasibility assessment must be carried out in line with Chapter 25 of the CIRIA SuDS Manual 2015 to determine whether infiltration is a suitable method of surface water disposal.

Particular attention must be paid to Ground Water Source Protection Zones to ensure that the risk of pollution to these valuable resources is not compromised. Details can be obtained from the government website:

<https://www.gov.uk/guidance/groundwater-source-protection-zones-spzs#find-groundwater-spzs>

If your site is in a Groundwater Source Protection Zone, you should have regard to the Environment Agency's approach to Groundwater Protection. Information on this is available via the link below:

<https://www.gov.uk/government/publications/groundwater-protection-position-statements>

Please note that such a location could have implications for the principle of your development and the need for additional mitigating measures to protect the groundwater environment and public water supply in the detailed design of your site.

Highway Drainage

If an evidence based assessment has been carried out and confirms that infiltration is not feasible, we recommend that you investigate the possibility of draining surface water to the highway drain where this ultimately discharges to a watercourse, by contacting the relevant Highway Authority.

Public Sewer

In accordance with the hierarchy of drainage options within the National Planning Practice Guidance, both discharge to ground via infiltration and discharge to a waterbody should be discounted prior to consideration of discharging surface water to the public sewer system. Evidence should be provided to demonstrate how these have been discounted, as outlined in the North West SuDS pro-forma.

Once evidence is provided as outlined above, United Utilities will consider a connection to the 375 x 510mm diameter public combined sewer within Dinton Street located to the north of your proposed development at a pass forward flow to be agreed by the Lead Local Flood Authority. United Utilities request that any agreed rate does not exceed 5 l/s.

As a Water Company, we have no obligation to accept highway drainage into our public sewer network. However, should your proposals include runoff from highways, we would request that consideration is given to SuDS components that deliver source control are incorporated within the design of the scheme to reduce the volume and frequency of discharges of these flows to the public sewer.

Please be advised both proposed points of discharge are combined sewers, UU would not object to the same sewer being used for both connection points

Levels

For low-lying sites, (where the ground level of the site or the level of a basement is below the ground level at the point where the drainage connects to the public sewer), care should be taken to ensure that the property is not at increased risk of flooding. If these circumstances exist, we recommend that you contact us to discuss further. It could affect the detailed design of your site and result in the need to incorporate appropriate mitigating measures in your drainage scheme.

Land drainage / Overland flows / track drainage

United Utilities have no obligation, and furthermore we do not accept land drainage, overland flows or track drainage into the public sewerage network under any circumstances

Existing Wastewater Assets Crossing the Site

We have reviewed our records and can confirm that there does not appear to be any charted public sewers located within the boundary of proposed development. However, due to the accuracy of the records and the public sewer transfer legislation in 2011, not all public sewers are shown on our records so we would ask that you proceed with caution and carry out your own site investigation works. If any uncharted sewers are identified while carrying out your works we would ask that you contact United Utilities at the earliest opportunity so that we can offer guidance and update our records

Existing Water Assets Crossing the Site

It is the developer responsibility to identify utilities on-site. Where clean water assets are shown on our records, we recommend that you contact our Water Pre-Development Team, via the following email address:

DeveloperServicesWater@uuplc.co.uk. Further information for this service can be found on our website via the link below:

<https://www.unitedutilities.com/builders-developers/larger-developments/pre-development/water-pre-dev/>

Connection Application

Although we may discuss and agree discharge points and rates in principle, please be aware that you will have to apply for a formal sewer connection. This is so that we can assess the method of construction, Health & Safety requirements and to ultimately inspect the connection when it is made. Details of the application process and the form itself can be obtained from our website by following the link below:

<https://www.unitedutilities.com/builders-developers/wastewater-services/sewer-connections/sewer-connection/>

We recommend that the detailed design should confirm the locations of all utilities in the area and ensure that any proposed drainage solution considers routing and clash checks where required.

If we can be of any further assistance please don't hesitate to contact us further.

Kind Regards



Lewis Barr

Assistant Developer Engineer
Developer Services & Metering
Customer Services
07827286541
unitedutilities.com

If you have received a great service today why not tell us?

Visit: unitedutilities.com/wow

----- Original Message -----

From: seweradoptions@uuplc.co.uk [seweradoptions@uuplc.co.uk]

Sent: 06/10/2023 09:24

To: [REDACTED]

Subject: PDE CA28. Cornbrook Residential - 04740820

Good Morning,

PRE DEVELOPMENT APPLICATION AT Cornbrook Residential: – UU Ref 04740820

Please accept this email as receipt of your application received on 05/10/2023 for the above development. This has now been logged on our system and the job reference is 04740820 we would ask that you quote this reference in all future correspondence.

I have reviewed your application (and attachments) and can confirm this is suitable to be passed to Ashleigh for technical assessment. You will receive their response within 8 working days.


Kind regards,



Katie Houghton

Customer Advisor Advanced
Developer Services & Metering
Customer Services

Tel: 0345 072 6067 (option 4)
unitedutilities.com

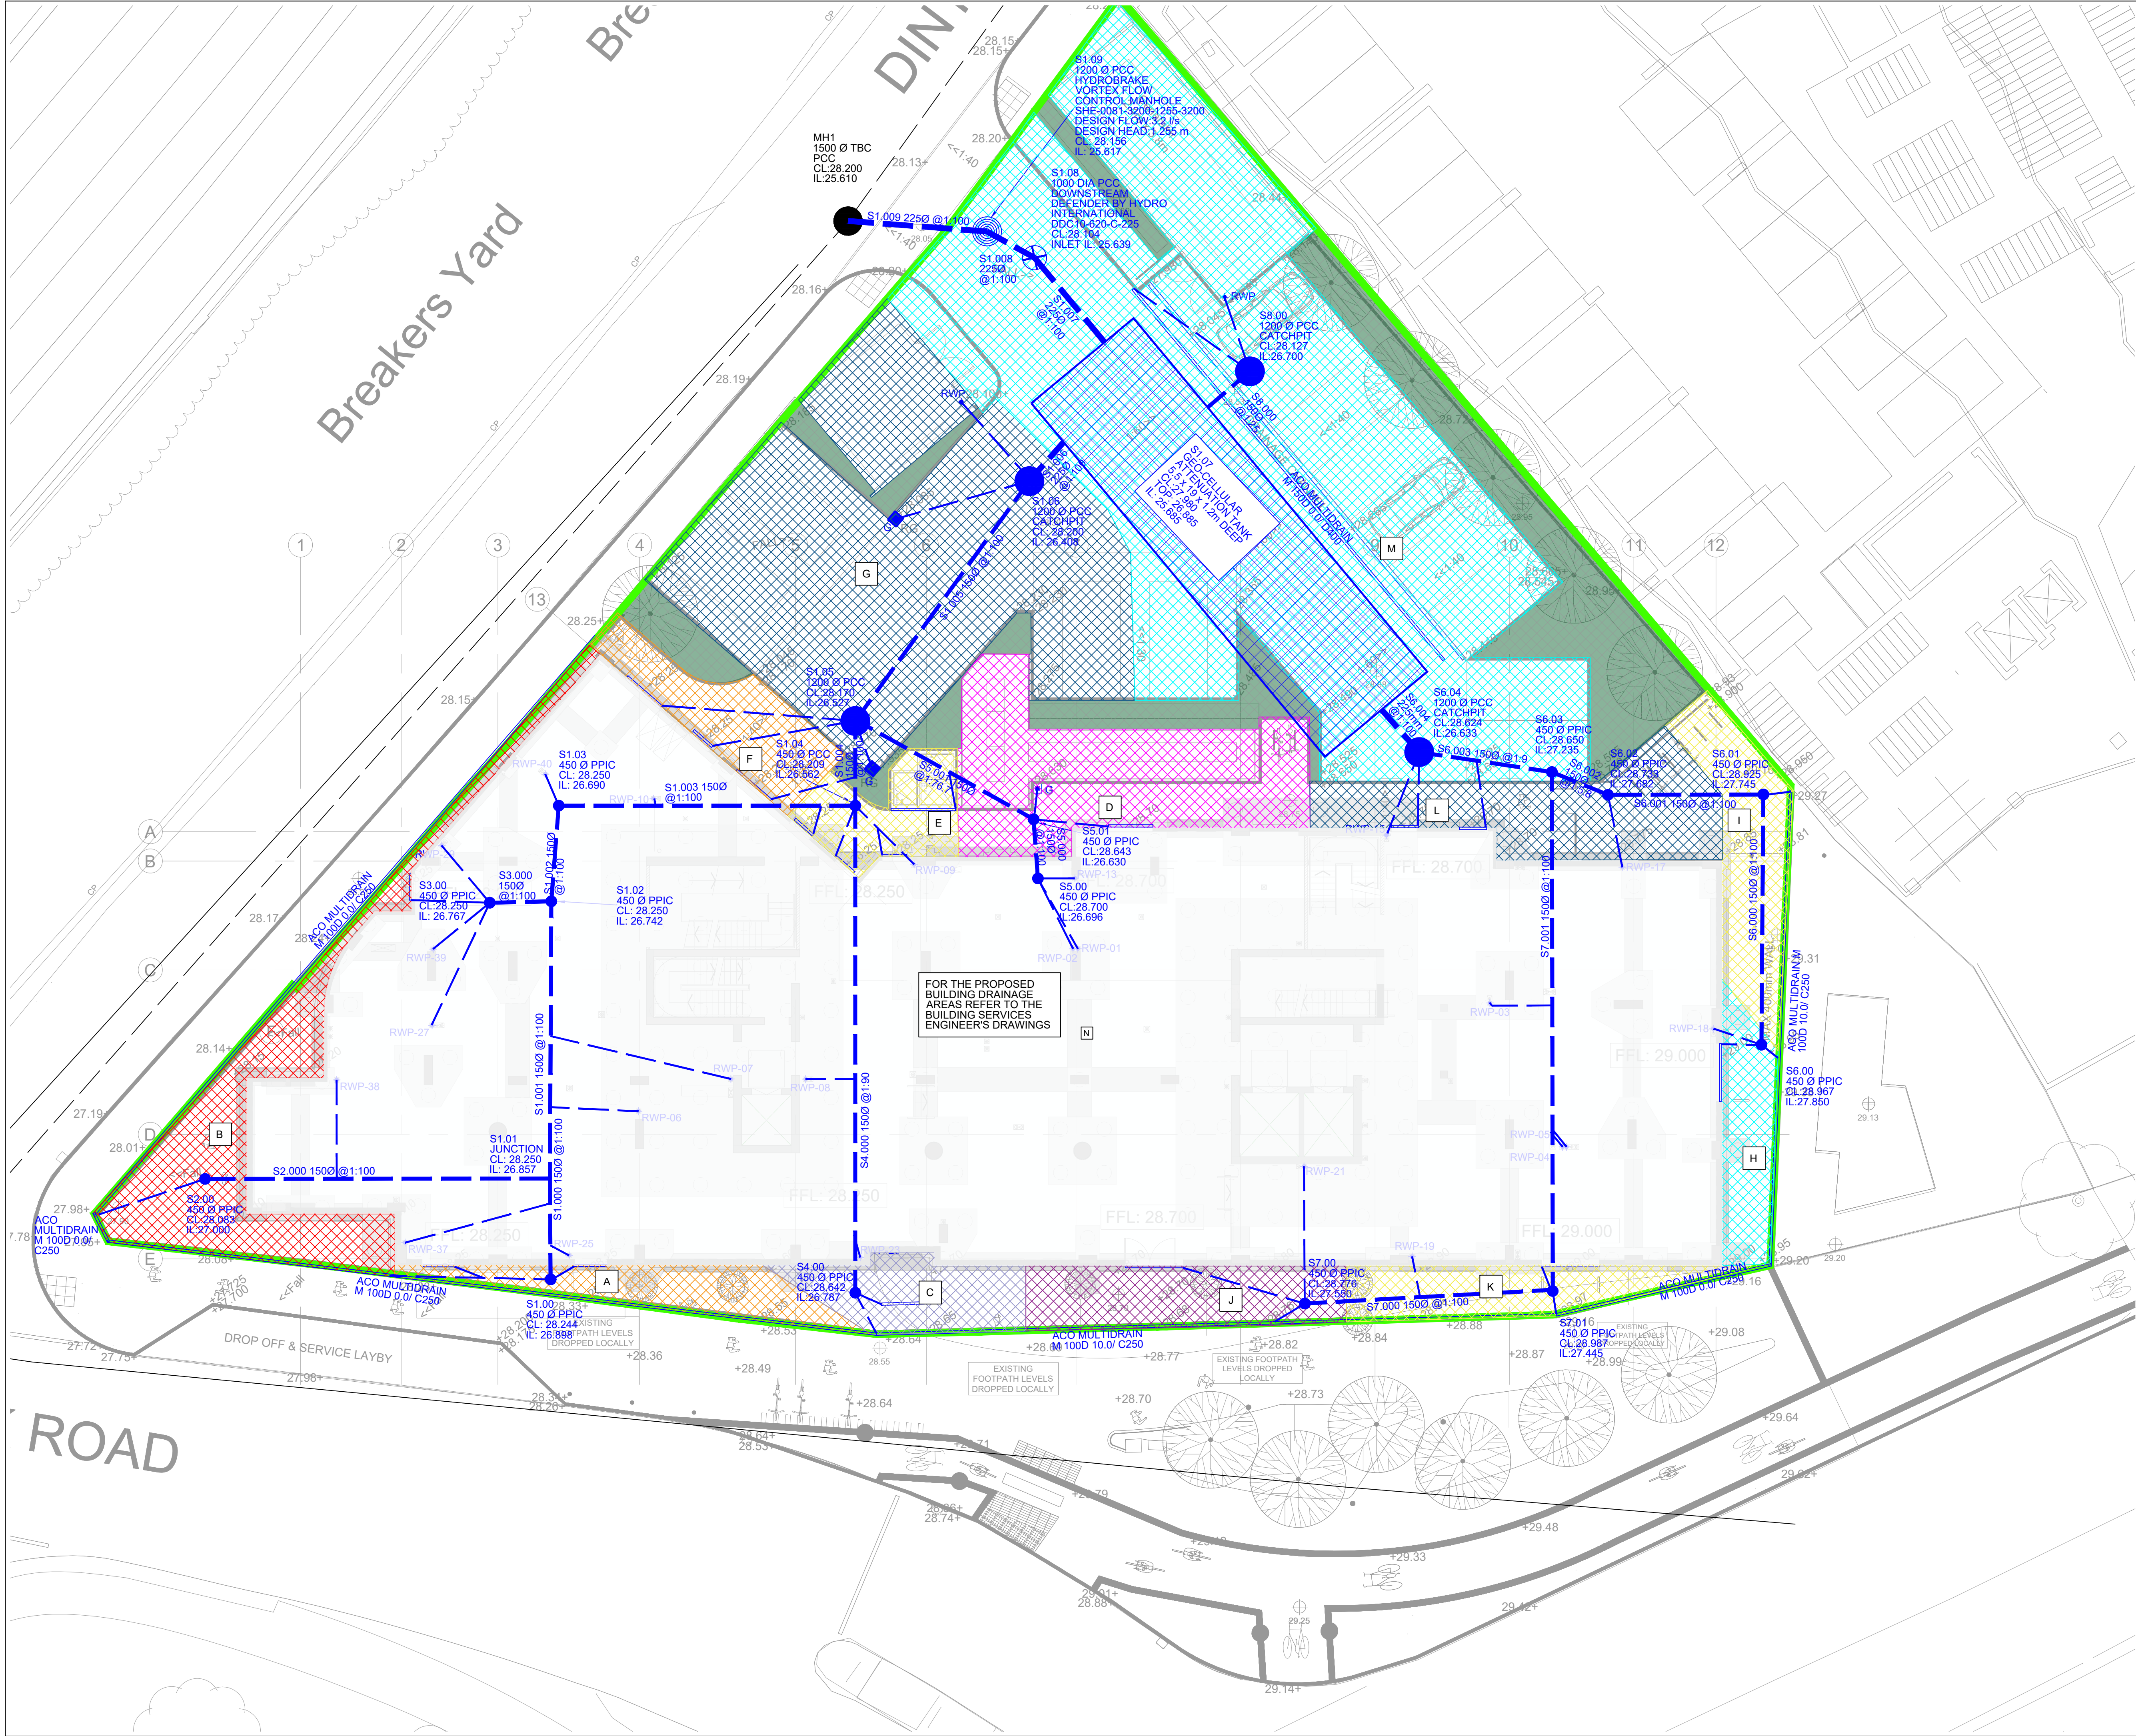


The information contained in this e-mail is intended only for the individual to whom it is addressed. It may contain legally privileged or confidential information or otherwise be exempt from disclosure. If you have received this Message in error or there are any problems, please notify the sender immediately and delete the message from your computer. You must not use, disclose, copy or alter this message for any unauthorised purpose. Neither United Utilities Group PLC nor any of its subsidiaries will be liable for any direct, special, indirect or consequential damages as a result of any virus being passed on, or arising from the alteration of the contents of this message by a third party.

United Utilities Group PLC, Haweswater House, Lingley Mere
Business Park, Lingley Green Avenue, Great Sankey,
Warrington, WA5 3LP
Registered in England and Wales. Registered No 6559020

www.unitedutilities.com
www.unitedutilities.com/subsidiaries

APPENDIX H
PROPOSED DRAINED AREAS PLAN



NOTES:
1. THIS DRAWING SHOULD BE READ IN CONJUNCTION WITH:
- EXISTING IMPERMEABLE AREA PLAN
- PROPOSED BELOW GROUND DRAINAGE DRAWING
- MICRODRAINAGE MODEL AND CALCULATION OUTPUTS

EXTERNAL WORKS SETTING OUT
FOR PROPOSED CHANNEL DRAINS AND GULLY LOCATIONS, REFER TO LANDSCAPE ARCHITECT DRAWINGS.

PROPOSED IMPERMEABLE AREAS			
MH REFERENCE	HATCH	AREA (Ha)	COMMENTS
S1.00	[Hatch A]	0.003	
S2.00	[Hatch B]	0.007	
S4.00	[Hatch C]	0.003	
S5.01	[Hatch D]	0.007	
S1.04	[Hatch E]	0.002	
S1.05	[Hatch F]	0.003	
S1.06	[Hatch G]	0.021	
S6.00	[Hatch H]	0.002	
S6.01	[Hatch I]	0.004	
S7.00	[Hatch J]	0.003	
S7.01	[Hatch K]	0.003	
S6.04	[Hatch L]	0.005	
S8.00	[Hatch M]	0.040	
THE BUILDING	[Hatch N]	0.106	
TOTAL		0.209	

FOR THE PROPOSED BUILDING DRAINAGE AREAS REFER TO THE BUILDING SERVICES ENGINEER'S DRAWINGS

C01

GATEWAY SUBMISSION

24.07.25

SA

AS

Rev:

Description:

Date:

By:

Chkd:

Renaissance Associates Ltd
Carvers Warehouse
77 Dale Street
Manchester
M1 2HG

Project:

CORNBROOK RESIDENTIAL MANCHESTER

Drawing Title:

PROPOSED DRAINED AREAS PLAN

Status:

STAGE 4 GATEWAY 2 ISSUE

Size:

A1

Date:

JUL 25

Drawn by:

SA

Designed by:

SA

Checked by:

AS

Scale:

1:125

Project No:

2306-18

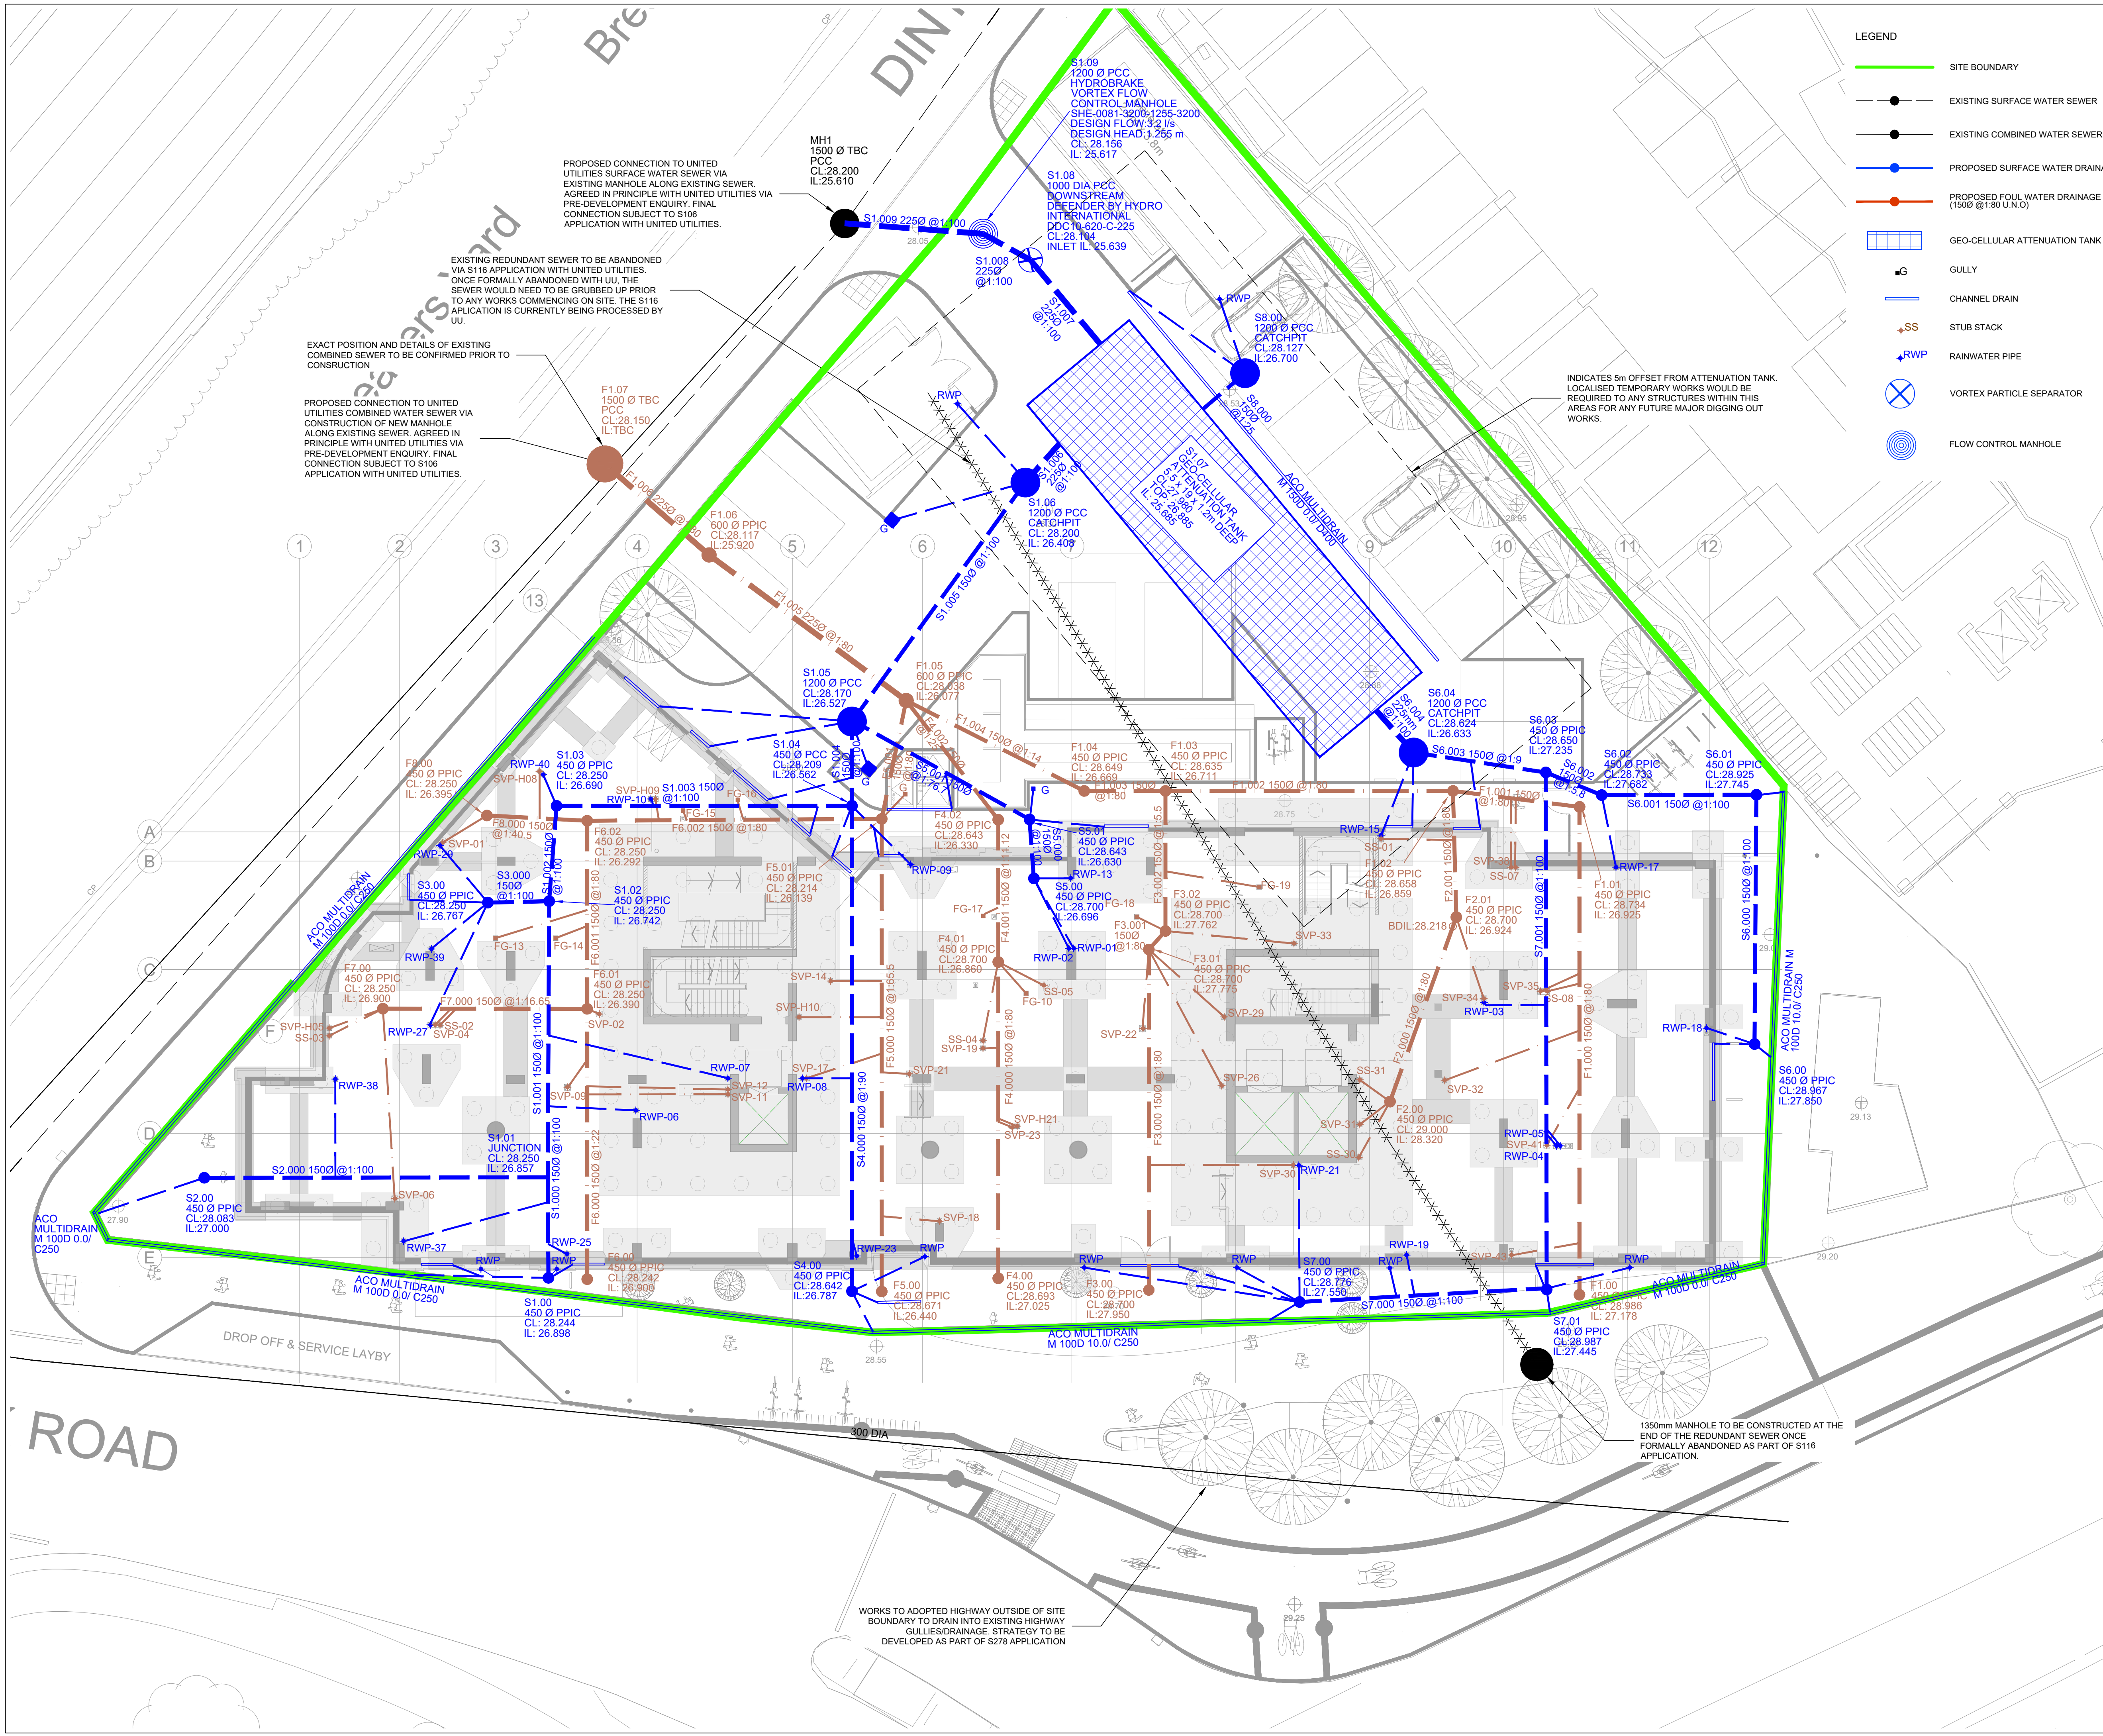
Project - Originator - Volume - Level - Type - Role - Number:

CBR-REN-ZZ-FN-DR-C-00060

C01

APPENDIX I

BELOW GROUND DRAINAGE PLAN



- LEGEND
- SITE BOUNDARY
 - EXISTING SURFACE WATER SEWER
 - EXISTING COMBINED WATER SEWER
 - PROPOSED SURFACE WATER DRAINAGE
 - PROPOSED FOUL WATER DRAINAGE (1500 @ 1.80 U.N.O)
 - GEO-CELLULAR ATTENUATION TANK
 - GULLY
 - CHANNEL DRAIN
 - STUB STACK
 - RAINWATER PIPE
 - VORTEX PARTICLE SEPARATOR
 - FLOW CONTROL MANHOLE

- NOTES:
- THIS DRAWING IS TO BE READ IN CONJUNCTION WITH ALL RENAISSANCE, ARCHITECTS, LANDSCAPE ARCHITECTS AND BUILDING SERVICES ENGINEERS DRAWINGS.
 - THIS DRAWING IS TO BE READ IN CONJUNCTION WITH THE BELOW GROUND DRAINAGE DETAILS SHOWN ON DRAWING SERIES C-03100 TO C-03103.
 - FOR ALL ABOVE GROUND DRAINAGE AND ASSOCIATED PUMPS REFER TO BUILDING SERVICES AND ARCHITECT'S DRAWINGS.
 - ALL BELOW GROUND DRAINAGE WORKS TO BE IN ACCORDANCE WITH RELEVANT BUILDING REGULATIONS AND SEWER SECTOR GUIDANCE APPENDIX C: DESIGN AND CONSTRUCTION GUIDANCE. IF DISCREPANCIES ARE NOTED BETWEEN SSG AND DRAWINGS THESE SHOULD BE BROUGHT TO THE ATTENTION OF RENAISSANCE FOR REVIEW.
 - RWPs, SVPs, SSs and FLOOR GULLEYS ARE TO HAVE RODDABLE ACCESS POINTS ABOVE GROUND FLOOR TO BUILDING SERVICES DETAILS.
 - THE CONTRACTOR IS TO UNDERTAKE A FULL CCTV SURVEY AT COMPLETION OF THE PROJECT TO DEMONSTRATE THAT THE DRAINAGE IS CLEAN. ANY DEFECTS ARE TO BE CORRECTED BY THE CONTRACTOR PRIOR TO HANDOVER OF THE SYSTEM TO THE CLIENT.
 - THE CONTRACTOR IS TO KEEP A RECORD SET OF THE AS INSTALLED DRAINAGE ON SITE AND PROVIDE THIS TO RENAISSANCE UPON COMPLETION OF THE WORKS TO ALLOW FOR PRODUCTION OF A FINAL CONSTRUCTION ISSUE DRAWING.
 - DURING THE WORKS ALTERATIONS TO THE DRAINAGE LAYOUT ARE TO BE MARKED UP BY THE CONTRACTOR AND AGREED WITH RENAISSANCE IN WRITING.
 - THE CHAMBER SIZE OF PCC MANHOLES WITH MORE THAN ONE CONNECTION IN THEM MAY NEED TO BE INCREASED AN INCREMENT TO ACCOMMODATE THE CONNECTIONS AND BENDS.
 - MANHOLE COVERS ARE TO BE IN ACCORDANCE WITH BS EN 124 FOR THE RATING INDICATED IN THE MANHOLE SCHEDULE. THE CONTRACTOR IS TO SUBMIT DETAILS FOR THE PROPOSED MANHOLE COVERS TO THE ENGINEER AND LANDSCAPE ARCHITECT FOR REVIEW PRIOR TO INSTALLATION.
 - ALL INTERNAL COVERS TO BE RECESSED AND TRIPLE SEALED
 - COVER SLABS MUST CARRY THE BSI KITEMARK, WHERE THE CLEAR OPENING OF THE KITEMARKED PRODUCT IS DIFFERENT TO THAT OF THE COVER AND FRAME, A LOAD BEARING REDUCING SLAB SHOULD BE FITTED ABOVE THE COVER SLAB TO BRING THE SIZE DOWN TO REQUIRED SIZE.
 - ALL SEWERS TO BE BSI KITEMARK (CERTIFIED TO WIS 4-35-01)
 - ALL CONCRETE PIPES TO BE TO ES EN 1916 CLASS 120 (54kN/m).
 - BEDDING AND BACKFILL MATERIAL TO CONFORM TO THE REQUIREMENTS OF THE WATER INDUSTRY SPECIFICATION 4-08092 (TABLE A2).
 - IF PLASTIC PIPES ARE TO BE USED THEN THE FOLLOWING MUST APPLY:
 - A. BSI KITEMARK (CERTIFIED TO BS EN 13476-1 AND WIS 4-35-01)
 - B. PIPES LESS THAN OR EQUAL TO 500mm DIA
 - C. BEDDING AND BACKFILL MATERIAL TO CONFORM TO THE REQUIREMENTS OF THE WATER INDUSTRY SPECIFICATION 4-08092 (TABLE A2)
 - THE MINIMUM CRUSHING STRENGTH FOR CLAY PIPES SHOULD BE AS FOLLOWS: 100mm DIA. 40kN/m, 150mm DIA. 40kN/m, 225mm DIA. 45kN/m AND 300mm DIA. 72kN/m.
 - THE MINIMUM CRUSHING STRENGTH FOR CONCRETE PIPES SHOULD BE - (CLASS 120 TO EN 1916/BS5911-1:2002). PLASTIC PIPES SHOULD CONFORM TO WIS 4-35-01 AND BS EN13476.
 - SULPHATE RESISTANT CEMENT (C20-DC3) AND PRECAST CONCRETE PRODUCTS MUST BE USED OR A LABORATORY REPORT PROVIDING THAT SUCH PRECAUTIONS ARE NOT NECESSARY.
 - SEWER PIPES TO BE LAID IN MAXIMUM 3 METER LENGTHS UNLESS THERE IS A SPECIFIC OPERATIONAL NEED TO LAY LONGER PIPES, AND THIS IS AGREED BY THE CONTRACTOR WITH THE PIPE MANUFACTURER.
 - ALL FOUL AND SURFACE WATER BELOW GROUND SYSTEMS ARE TO BE VENTED WITHIN THE ABOVE GROUND DRAINAGE TO THE BUILDING SERVICES ENGINEERS DETAILS.

EXTERNAL WORKS SETTING OUT FOR PROPOSED CHANNEL DRAINS AND GULLY LOCATIONS, REFER TO LANDSCAPE ARCHITECT DRAWINGS.

C03	UPDATED TO DISCHARGE PLANNING CONDITION	06.02.26	HW	AS
C02	UPDATED TO SUIT RWPs LOCATIONS	31.07.25	SA	AS
C01	GATEWAY SUBMISSION	24.07.25	SA	AS
Rev:	Description:	Date:	By:	Chkd:



Project: CORNBROOK RESIDENTIAL MANCHESTER

Drawing Title: **BELOW GROUND DRAINAGE GENERAL ARRANGEMENT**

Status: **STAGE 4 GATEWAY 2 ISSUE**

Size:	Date:	Drawn by:	Designed by:	Checked by:
A1	JUL 25	SA	SA	AS
Scale:	1:125	Project No:	2306-18	
Project - Originator - Volume - Level - Type - Role - Number: Revision:				

CBR-REN-ZZ-FN-DR-C-01100 C03

APPENDIX J

NETWORK DRAINAGE CALCULATIONS

Project:	Date: 13/05/2025		
	Designed by:	Checked by:	Approved By:
	HenryWilkinson		
Report Details: Type: Inflow Summary Storm Phase: Surface Water		Company Address:	



Inflow Label	Connected To	Flow (L/s)	Runoff Method	Area (ha)	Percentage Impervious (%)	Urban Creep (%)	Adjusted Percentage Impervious (%)	Area Analysed (ha)
RWP01 - 79.8m2	S5.00		Time of Concentration	0.008	100	0	100	0.008
RWP02 - 79.8m2	S5.00		Time of Concentration	0.008	100	0	100	0.008
RWP03 - 79.8m2	S7.01		Time of Concentration	0.008	100	0	100	0.008
RWP04 - 79.8m2	S7.01		Time of Concentration	0.008	100	0	100	0.008
RWP05 - 79.8m2	S7.01		Time of Concentration	0.008	100	0	100	0.008
RWP06 - 62.3m2	S1.01		Time of Concentration	0.006	100	0	100	0.006
RWP07 - 62.3m2	S1.01		Time of Concentration	0.006	100	0	100	0.006
RWP08 - 62.3m2	S4.00		Time of Concentration	0.006	100	0	100	0.006
RWP09 - 86.5m2	S1.04		Time of Concentration	0.009	100	0	100	0.009
RWP10 - 85.9m2	S1.03		Time of Concentration	0.009	100	0	100	0.009
RWP17 - 15.8m2	S6.02		Time of Concentration	0.002	100	0	100	0.002
RWP18 - 15.8m2	S6.00		Time of Concentration	0.002	100	0	100	0.002
RWP19 - 31.6m2	S7.00		Time of Concentration	0.003	100	0	100	0.003
RWP21 - 31.6m2	S7.00		Time of Concentration	0.003	100	0	100	0.003
RWP23- 40m2	S4.00		Time of Concentration	0.004	100	0	100	0.004
RWP25 - 48.4m2	S1.00		Time of Concentration	0.005	100	0	100	0.005
RWP27 - 31.6m2	S3.00		Time of Concentration	0.003	100	0	100	0.003
RWP29 - 8.4m2	S3.00		Time of Concentration	0.001	100	0	100	0.001
RWP37 - 8.4m2	S1.00		Time of Concentration	0.001	100	0	100	0.001
RWP38 - 8.4m2	S2.00		Time of Concentration	0.001	100	0	100	0.001
RWP39 - 8.4m2	S3.00		Time of Concentration	0.001	100	0	100	0.001
RWP40 - 37.5m2	S1.03		Time of Concentration	0.004	100	0	100	0.004
S1.00-26m2	S1.00		Time of Concentration	0.003	100	0	100	0.003
S1.04 23 m2	S1.04		Time of Concentration	0.002	100	0	100	0.002
S1.05-29m2	S1.05		Time of Concentration	0.003	100	0	100	0.003
S1.06-206m2	S1.06		Time of Concentration	0.021	100	0	100	0.021
S2.00-65m2	S2.00		Time of Concentration	0.007	100	0	100	0.007
S4.00-25m2	S4.00		Time of Concentration	0.003	100	0	100	0.003
S5.01-741m2	S5.01		Time of Concentration	0.007	100	0	100	0.007
S6.00 - 22m2	S6.00		Time of Concentration	0.002	100	0	100	0.002
S6.01- 35m2	S6.01		Time of Concentration	0.004	100	0	100	0.004
S6.04 50m2	S6.04		Time of Concentration	0.005	100	0	100	0.005
S6.04-430m2	S8.00		Time of Concentration	0.040	100	0	100	0.040

Project:			Date:					
			13/05/2025					
Designed by:		Checked by:		Approved By:				
HenryWilkinson								
Report Details:			Company Address:					
Type: Inflow Summary								
Storm Phase: Surface Water								

S7.00 - 34m2	S7.00		Time of Concentration	0.003	100	0	100	0.003
S7.01 -28m2	S7.01		Time of Concentration	0.003	100	0	100	0.003
TOTAL		0.0		0.209				0.209

Project:	Date: 13/05/2025			
	Designed by:	Checked by:	Approved By:	
Report Details:			Company Address:	
Type: Network Design Criteria Storm Phase: Surface Water				

Flow Options

Peak Flow Calculation	(UK) Modified Rational Method
Min. Time of Entry (mins)	5
Max. Travel Time (mins)	30

Pipe Options

Lock Slope Options	None
Design Options	Minimise Excavation
Design Level	Level Soffits
Min. Cover Depth (m)	1.000
Min. Slope (1:X)	500.00
Max. Slope (1:X)	40.00
Min. Velocity (m/s)	1.0
Max. Velocity (m/s)	3.0
Use Flow Restriction	☐
Reduce Channel Depths	☐

Pipe Size Library

Pipe Size Library

Add. Increment (mm)	150
Max. Diameter (mm)	600

Diameter (mm)	Min. Slope (1:X)	Max. Slope (1:X)
150	150.00	0.00
225	150.00	0.00
300	200.00	0.00
450	200.00	0.00

Project:	Date: 13/05/2025		
	Designed by: HenryWilkinson	Checked by:	Approved By:
Report Details: Type: Network Design Criteria Storm Phase: Surface Water		Company Address:	



Manhole Options

Apply Offset	☐
--------------	--------------------------

Manhole Size Library

Manhole Lib HW

Diameter / Width

Connection (mm)	Diameter / Length (m)	Width (m)
150	0.450	0.000
225	0.600	0.000
375	1.200	0.000
450	1.350	0.000
700	1.500	0.000
900	1.800	0.000

Additional Sizing

Connection (mm)	900
Diameter / Length (m)	0.900
Width (m)	0.000

Depth

Depth (m)	Diameter / Length (m)	Width (m)
0.000	0.450	0.000
3.000	1.200	0.000

Access

Depth (m)	Ladder Protrusion (mm)
0.000	130
3.000	230

Benching Requirements

Landing Width (mm)	500
Benching Width (mm)	225

Project:	Date: 13/05/2025			
	Designed by: HenryWilkinson	Checked by:	Approved By:	
Report Details: Type: Outfall Details Storm Phase: Surface Water	Company Address:			

Outfalls

Outfall	Outfall Type	Gated	Fixed Surcharged Level (m)	Level Curve
S1.10	Free Discharge			

Project:	Date: 13/05/2025			
	Designed by:	Checked by:	Approved By:	
Report Title: Rainfall Analysis Criteria	Company Address:			

Runoff Type	Dynamic
Output Interval (mins)	5
Time Step	Default
Urban Creep	Apply Global Value
Urban Creep Global Value (%)	0
Junction Flood Risk Margin (mm)	300
Perform No Discharge Analysis	☐

Rainfall	
Cornbtook FSR	Type: FSR

Region	England And Wales
M5-60 (mm)	18.0
Ratio R	0.367
Summer	☒
Winter	☒

Return Period

Return Period (years)	Increase Rainfall (%)
2.0	0.000
30.0	40.000
100.0	45.000

Storm Durations

Duration (mins)	Run Time (mins)
15	1440
30	1440
60	1440
120	1440
180	1440
240	2880
360	1440
480	2880
600	2880
720	2880
960	2880
1440	2880

Project:	Date: 13/05/2025		
	Designed by: HenryWilkinson	Checked by:	Approved By:
Report Details: Type: Inflows Summary Storm Phase: Surface Water	Company Address:		



Cornbtook FSR: 2 years: Increase Rainfall (%): +0: Critical Storm Per Item: Rank By: Max. Inflow

Inflow	Storm Event	Inflow Area (ha)	Max. Inflow (L/s)	Total Inflow Volume (m³)
S2.00-65m2	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	0.01	1.4	0.609
S1.00-26m2	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	0.00	0.6	0.258
S7.01 - 28m2	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	0.00	0.6	0.258
S1.05-29m2	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	0.00	0.6	0.258
S6.04-430m2	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	0.04	8.1	3.493
RWP25 - 48.4m2	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	0.01	1.0	0.435
RWP37 - 8.4m2	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	0.00	0.2	0.084
RWP38 - 8.4m2	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	0.00	0.2	0.084
RWP06 - 62.3m2	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	0.01	1.2	0.525
RWP07 - 62.3m2	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	0.01	1.2	0.525
RWP39 - 8.4m2	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	0.00	0.2	0.084
RWP27 - 31.6m2	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	0.00	0.6	0.258
RWP29 - 8.4m2	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	0.00	0.2	0.084
RWP40 - 37.5m2	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	0.00	0.8	0.351
RWP10 - 85.9m2	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	0.01	1.8	0.783

Project:	Date: 13/05/2025		
	Designed by: HenryWilkinson	Checked by:	Approved By:
Report Details: Type: Inflows Summary Storm Phase: Surface Water	Company Address:		



RWP23-40m2	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	0.00	0.8	0.351
RWP08 - 62.3m2	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	0.01	1.2	0.525
S4.00-25m2	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	0.00	0.6	0.258
RWP09 - 86.5m2	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	0.01	1.8	0.783
RWP01 - 79.8m2	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	0.01	1.6	0.699
RWP02 - 79.8m2	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	0.01	1.6	0.699
S5.01-741m2	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	0.01	1.4	0.609
S1.06-206m2	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	0.02	4.2	1.832
RWP21 - 31.6m2	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	0.00	0.6	0.258
RWP19 - 31.6m2	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	0.00	0.6	0.258
S7.00 - 34m2	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	0.00	0.6	0.258
RWP03 - 79.8m2	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	0.01	1.6	0.699
RWP04 - 79.8m2	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	0.01	1.6	0.699
RWP05 - 79.8m2	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	0.01	1.6	0.699
RWP18 - 15.8m2	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	0.00	0.4	0.174
S6.00 - 22m2	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	0.00	0.4	0.174
S6.01-35m2	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	0.00	0.8	0.351

Project:	Date: 13/05/2025		
	Designed by: HenryWilkinson	Checked by:	Approved By:
Report Details: Type: Inflows Summary Storm Phase: Surface Water		Company Address:	



RWP17 - 15.8m2	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	0.00	0.4	0.174
S1.04 23 m2	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	0.00	0.4	0.174
S6.04 50m2	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	0.01	1.0	0.435

Project:	Date: 13/05/2025		
	Designed by: HenryWilkinson	Checked by:	Approved By:
Report Details: Type: Inflows Summary Storm Phase: Surface Water	Company Address:		



Cornbtook FSR: 30 years: Increase Rainfall (%): +40: Critical Storm Per Item: Rank By: Max. Inflow

Inflow	Storm Event	Inflow Area (ha)	Max. Inflow (L/s)	Total Inflow Volume (m³)
S2.00-65m2	Cornbtook FSR: 30 years: +40 %: 15 mins: Summer	0.01	3.7	1.619
S1.00-26m2	Cornbtook FSR: 30 years: +40 %: 15 mins: Summer	0.00	1.6	0.696
S7.01 - 28m2	Cornbtook FSR: 30 years: +40 %: 15 mins: Summer	0.00	1.6	0.696
S1.05-29m2	Cornbtook FSR: 30 years: +40 %: 15 mins: Summer	0.00	1.6	0.696
S6.04-430m2	Cornbtook FSR: 30 years: +40 %: 15 mins: Summer	0.04	21.3	9.246
RWP25 - 48.4m2	Cornbtook FSR: 30 years: +40 %: 15 mins: Summer	0.01	2.7	1.155
RWP37 - 8.4m2	Cornbtook FSR: 30 years: +40 %: 15 mins: Summer	0.00	0.5	0.231
RWP38 - 8.4m2	Cornbtook FSR: 30 years: +40 %: 15 mins: Summer	0.00	0.5	0.231
RWP06 - 62.3m2	Cornbtook FSR: 30 years: +40 %: 15 mins: Summer	0.01	3.2	1.386
RWP07 - 62.3m2	Cornbtook FSR: 30 years: +40 %: 15 mins: Summer	0.01	3.2	1.386
RWP39 - 8.4m2	Cornbtook FSR: 30 years: +40 %: 15 mins: Summer	0.00	0.5	0.231
RWP27 - 31.6m2	Cornbtook FSR: 30 years: +40 %: 15 mins: Summer	0.00	1.6	0.696

Project:	Date: 13/05/2025		
	Designed by: HenryWilkinson	Checked by:	Approved By:
Report Details: Type: Inflows Summary Storm Phase: Surface Water	Company Address:		



RWP29 - 8.4m2	Cornbtook FSR: 30 years: +40 %: 15 mins: Summer	0.00	0.5	0.231
RWP40 - 37.5m2	Cornbtook FSR: 30 years: +40 %: 15 mins: Summer	0.00	2.1	0.921
RWP10 - 85.9m2	Cornbtook FSR: 30 years: +40 %: 15 mins: Summer	0.01	4.8	2.081
RWP23- 40m2	Cornbtook FSR: 30 years: +40 %: 15 mins: Summer	0.00	2.1	0.921
RWP08 - 62.3m2	Cornbtook FSR: 30 years: +40 %: 15 mins: Summer	0.01	3.2	1.386
S4.00- 25m2	Cornbtook FSR: 30 years: +40 %: 15 mins: Summer	0.00	1.6	0.696
RWP09 - 86.5m2	Cornbtook FSR: 30 years: +40 %: 15 mins: Summer	0.01	4.8	2.081
RWP01 - 79.8m2	Cornbtook FSR: 30 years: +40 %: 15 mins: Summer	0.01	4.3	1.850
RWP02 - 79.8m2	Cornbtook FSR: 30 years: +40 %: 15 mins: Summer	0.01	4.3	1.850
S5.01- 741m2	Cornbtook FSR: 30 years: +40 %: 15 mins: Summer	0.01	3.7	1.619
S1.06- 206m2	Cornbtook FSR: 30 years: +40 %: 15 mins: Summer	0.02	11.2	4.855
RWP21 - 31.6m2	Cornbtook FSR: 30 years: +40 %: 15 mins: Summer	0.00	1.6	0.696
RWP19 - 31.6m2	Cornbtook FSR: 30 years: +40 %: 15 mins: Summer	0.00	1.6	0.696
S7.00 - 34m2	Cornbtook FSR: 30 years: +40 %: 15 mins: Summer	0.00	1.6	0.696

Project:	Date: 13/05/2025		
	Designed by: HenryWilkinson	Checked by:	Approved By:
Report Details: Type: Inflows Summary Storm Phase: Surface Water		Company Address:	



RWP03 - 79.8m2	Cornbtook FSR: 30 years: +40 %: 15 mins: Summer	0.01	4.3	1.850
RWP04 - 79.8m2	Cornbtook FSR: 30 years: +40 %: 15 mins: Summer	0.01	4.3	1.850
RWP05 - 79.8m2	Cornbtook FSR: 30 years: +40 %: 15 mins: Summer	0.01	4.3	1.850
RWP18 - 15.8m2	Cornbtook FSR: 30 years: +40 %: 15 mins: Summer	0.00	1.1	0.465
S6.00 - 22m2	Cornbtook FSR: 30 years: +40 %: 15 mins: Summer	0.00	1.1	0.465
S6.01- 35m2	Cornbtook FSR: 30 years: +40 %: 15 mins: Summer	0.00	2.1	0.921
RWP17 - 15.8m2	Cornbtook FSR: 30 years: +40 %: 15 mins: Summer	0.00	1.1	0.465
S1.04 23 m2	Cornbtook FSR: 30 years: +40 %: 15 mins: Summer	0.00	1.1	0.465
S6.04 50m2	Cornbtook FSR: 30 years: +40 %: 15 mins: Summer	0.01	2.7	1.155

Project:	Date: 13/05/2025		
	Designed by: HenryWilkinson	Checked by:	Approved By:
Report Details: Type: Inflows Summary Storm Phase: Surface Water	Company Address:		



Cornbtook FSR: 100 years: Increase Rainfall (%): +45: Critical Storm Per Item: Rank By: Max. Inflow

Inflow	Storm Event	Inflow Area (ha)	Max. Inflow (L/s)	Total Inflow Volume (m³)
S2.00-65m2	Cornbtook FSR: 100 years: +45 %: 15 mins: Summer	0.01	5.0	2.165
S1.00-26m2	Cornbtook FSR: 100 years: +45 %: 15 mins: Summer	0.00	2.1	0.930
S7.01 - 28m2	Cornbtook FSR: 100 years: +45 %: 15 mins: Summer	0.00	2.1	0.930
S1.05-29m2	Cornbtook FSR: 100 years: +45 %: 15 mins: Summer	0.00	2.1	0.930
S6.04-430m2	Cornbtook FSR: 100 years: +45 %: 15 mins: Summer	0.04	28.5	12.365
RWP25 - 48.4m2	Cornbtook FSR: 100 years: +45 %: 15 mins: Summer	0.01	3.6	1.545
RWP37 - 8.4m2	Cornbtook FSR: 100 years: +45 %: 15 mins: Summer	0.00	0.7	0.309
RWP38 - 8.4m2	Cornbtook FSR: 100 years: +45 %: 15 mins: Summer	0.00	0.7	0.309
RWP06 - 62.3m2	Cornbtook FSR: 100 years: +45 %: 15 mins: Summer	0.01	4.3	1.853
RWP07 - 62.3m2	Cornbtook FSR: 100 years: +45 %: 15 mins: Summer	0.01	4.3	1.853
RWP39 - 8.4m2	Cornbtook FSR: 100 years: +45 %: 15 mins: Summer	0.00	0.7	0.309
RWP27 - 31.6m2	Cornbtook FSR: 100 years: +45 %: 15 mins: Summer	0.00	2.1	0.930

Project:	Date: 13/05/2025		
	Designed by: HenryWilkinson	Checked by:	Approved By:
Report Details: Type: Inflows Summary Storm Phase: Surface Water	Company Address:		



RWP29 - 8.4m2	Cornbtook FSR: 100 years: +45 %: 15 mins: Summer	0.00	0.7	0.309
RWP40 - 37.5m2	Cornbtook FSR: 100 years: +45 %: 15 mins: Summer	0.00	2.9	1.236
RWP10 - 85.9m2	Cornbtook FSR: 100 years: +45 %: 15 mins: Summer	0.01	6.4	2.783
RWP23- 40m2	Cornbtook FSR: 100 years: +45 %: 15 mins: Summer	0.00	2.9	1.236
RWP08 - 62.3m2	Cornbtook FSR: 100 years: +45 %: 15 mins: Summer	0.01	4.3	1.853
S4.00- 25m2	Cornbtook FSR: 100 years: +45 %: 15 mins: Summer	0.00	2.1	0.930
RWP09 - 86.5m2	Cornbtook FSR: 100 years: +45 %: 15 mins: Summer	0.01	6.4	2.783
RWP01 - 79.8m2	Cornbtook FSR: 100 years: +45 %: 15 mins: Summer	0.01	5.7	2.474
RWP02 - 79.8m2	Cornbtook FSR: 100 years: +45 %: 15 mins: Summer	0.01	5.7	2.474
S5.01- 741m2	Cornbtook FSR: 100 years: +45 %: 15 mins: Summer	0.01	5.0	2.165
S1.06- 206m2	Cornbtook FSR: 100 years: +45 %: 15 mins: Summer	0.02	15.0	6.493
RWP21 - 31.6m2	Cornbtook FSR: 100 years: +45 %: 15 mins: Summer	0.00	2.1	0.930
RWP19 - 31.6m2	Cornbtook FSR: 100 years: +45 %: 15 mins: Summer	0.00	2.1	0.930
S7.00 - 34m2	Cornbtook FSR: 100 years: +45 %: 15 mins: Summer	0.00	2.1	0.930

Project:	Date: 13/05/2025		
	Designed by: HenryWilkinson	Checked by:	Approved By:
Report Details: Type: Inflows Summary Storm Phase: Surface Water		Company Address:	



RWP03 - 79.8m2	Cornbtook FSR: 100 years: +45 %: 15 mins: Summer	0.01	5.7	2.474
RWP04 - 79.8m2	Cornbtook FSR: 100 years: +45 %: 15 mins: Summer	0.01	5.7	2.474
RWP05 - 79.8m2	Cornbtook FSR: 100 years: +45 %: 15 mins: Summer	0.01	5.7	2.474
RWP18 - 15.8m2	Cornbtook FSR: 100 years: +45 %: 15 mins: Summer	0.00	1.4	0.621
S6.00 - 22m2	Cornbtook FSR: 100 years: +45 %: 15 mins: Summer	0.00	1.4	0.621
S6.01- 35m2	Cornbtook FSR: 100 years: +45 %: 15 mins: Summer	0.00	2.9	1.236
RWP17 - 15.8m2	Cornbtook FSR: 100 years: +45 %: 15 mins: Summer	0.00	1.4	0.621
S1.04 23 m2	Cornbtook FSR: 100 years: +45 %: 15 mins: Summer	0.00	1.4	0.621
S6.04 50m2	Cornbtook FSR: 100 years: +45 %: 15 mins: Summer	0.01	3.6	1.545

Project:	Date: 13/05/2025		
	Designed by: HenryWilkinson	Checked by:	Approved By:
Report Details: Type: Junctions Summary Storm Phase: Surface Water	Company Address:		





Cornbtook FSR: 2 years: Increase Rainfall (%): +0: Critical Storm Per Item: Rank By: Max. Outflow

Junction	Storm Event	Cover Level (m)	Invert Level (m)	Max. Level (m)	Max. Depth (m)	Max. Inflow (L/s)	Max. Resident Volume (m³)	Max. Flooded Volume (m³)	Max. Outflow (L/s)	Total Discharge Volume (m³)	Status
S1.00	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	28.244	26.898	26.930	0.032	1.8	0.005	0.000	1.8	0.776	OK
S1.02	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	28.250	26.742	26.809	0.068	6.4	0.011	0.000	6.2	2.943	OK
S1.03	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	28.250	26.690	26.764	0.074	8.8	0.012	0.000	8.6	4.075	OK
S1.04	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	28.209	26.562	26.688	0.125	13.4	0.020	0.000	12.4	6.162	OK
S1.05	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	28.170	26.527	26.656	0.129	17.5	0.146	0.000	16.5	8.422	OK
S1.06	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	28.200	26.408	26.523	0.115	20.8	0.131	0.000	20.3	10.253	OK
S3.00	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	28.250	26.767	26.811	0.044	1.0	0.007	0.000	0.9	0.426	OK
S4.00	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	28.476	26.787	26.823	0.036	2.6	0.006	0.000	2.5	1.133	OK
S5.00	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	28.700	26.696	26.734	0.038	3.2	0.006	0.000	3.1	1.397	OK
S5.01	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	28.643	26.630	26.676	0.047	4.6	0.007	0.000	4.5	2.005	OK
S6.00	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	28.967	27.850	27.871	0.021	0.8	0.003	0.000	0.8	0.347	OK
S6.01	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	28.925	27.746	27.778	0.032	1.6	0.005	0.000	1.5	0.698	OK
S6.02	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	28.733	27.682	27.699	0.017	1.9	0.003	0.000	1.9	0.871	OK
S6.03	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	28.650	27.236	27.274	0.039	8.8	0.006	0.000	8.7	3.997	OK
S6.04	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	28.612	26.633	26.707	0.074	9.7	0.084	0.000	9.4	4.430	OK
S1.01	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer		26.857	26.918	0.061	5.7			5.5	2.518	OK
S2.00	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	28.083	27.000	27.030	0.030	1.6	0.005	0.000	1.6	0.692	OK
S1.08	Cornbtook FSR: 2 years: +0 %: 60 mins: Summer	28.104	25.639	25.905	0.266	3.5	0.209	0.000	3.2	30.208	Surcharged
S1.09 HYDROBR AKE	Cornbtook FSR: 2 years: +0 %: 120 mins: Summer	28.156	25.617	25.916	0.299	3.2	0.428	0.000	3.1	37.573	Surcharged
S1.10	Cornbtook FSR: 2 years: +0 %: 120 mins: Summer	28.200	25.559	25.596	0.037	3.1	0.000	0.000	3.1	37.572	OK

Project:		Date: 13/05/2025			
		Designed by: HenryWilkinson	Checked by:	Approved By:	
Report Details: Type: Junctions Summary Storm Phase: Surface Water		Company Address:			

S7.00	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	28.77 6	27.55 0	27.581	0.031	1.8	0.005	0.000	1.7	0.773	OK
S7.01	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	28.98 7	27.44 6	27.517	0.071	7.2	0.011	0.000	6.9	3.127	OK
S8.00	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	28.12 7	26.70 0	26.756	0.056	8.1	0.064	0.000	7.9	3.492	OK

Project:	Date: 13/05/2025		
	Designed by: HenryWilkinson	Checked by:	Approved By:
Report Details: Type: Junctions Summary Storm Phase: Surface Water	Company Address:		



Cornbtook FSR: 30 years: Increase Rainfall (%): +40: Critical Storm Per Item: Rank By: Max. Outflow

Junction	Storm Event	Cover Level (m)	Invert Level (m)	Max. Level (m)	Max. Depth (m)	Max. Inflow (L/s)	Max. Resident Volume (m³)	Max. Flooded Volume (m³)	Max. Outflow (L/s)	Total Discharge Volume (m³)	Status
S1.00	Cornbtook FSR: 30 years: +40 %: 30 mins: Summer	28.244	26.898	27.156	0.258	3.2	0.041	0.000	3.1	2.741	Surcharged
S1.02	Cornbtook FSR: 30 years: +40 %: 15 mins: Summer	28.250	26.742	27.143	0.401	10.5	0.064	0.000	12.1	7.875	Surcharged
S1.03	Cornbtook FSR: 30 years: +40 %: 15 mins: Summer	28.250	26.690	27.114	0.424	13.7	0.067	0.000	15.2	10.853	Surcharged
S1.04	Cornbtook FSR: 30 years: +40 %: 15 mins: Summer	28.209	26.562	27.008	0.445	22.1	0.071	0.000	21.3	16.390	Surcharged
S1.05	Cornbtook FSR: 30 years: +40 %: 30 mins: Summer	28.170	26.527	26.944	0.417	29.2	0.471	0.000	28.8	29.596	Surcharged
S1.06	Cornbtook FSR: 30 years: +40 %: 15 mins: Summer	28.200	26.408	26.582	0.174	39.1	0.197	0.000	38.7	27.254	OK
S3.00	Cornbtook FSR: 30 years: +40 %: 15 mins: Summer	28.250	26.767	27.144	0.377	2.7	0.060	0.000	2.2	1.178	Surcharged
S4.00	Cornbtook FSR: 30 years: +40 %: 15 mins: Summer	28.476	26.787	27.025	0.238	6.9	0.038	0.000	4.6	2.994	Surcharged
S5.00	Cornbtook FSR: 30 years: +40 %: 15 mins: Summer	28.700	26.696	26.964	0.268	8.5	0.043	0.000	6.5	3.700	Surcharged
S5.01	Cornbtook FSR: 30 years: +40 %: 15 mins: Summer	28.643	26.630	26.956	0.327	10.2	0.052	0.000	8.2	5.319	Surcharged
S6.00	Cornbtook FSR: 30 years: +40 %: 15 mins: Summer	28.967	27.850	27.885	0.035	2.1	0.006	0.000	2.1	0.929	OK
S6.01	Cornbtook FSR: 30 years: +40 %: 15 mins: Summer	28.925	27.746	27.798	0.052	4.2	0.008	0.000	4.1	1.849	OK
S6.02	Cornbtook FSR: 30 years: +40 %: 15 mins: Summer	28.733	27.682	27.709	0.027	5.2	0.004	0.000	5.1	2.313	OK
S6.03	Cornbtook FSR: 30 years: +40 %: 15 mins: Summer	28.650	27.236	27.304	0.068	23.3	0.011	0.000	23.0	10.645	OK
S6.04	Cornbtook FSR: 30 years: +40 %: 15 mins: Summer	28.612	26.633	26.763	0.130	25.7	0.147	0.000	25.3	11.798	OK
S1.01	Cornbtook FSR: 30 years: +40 %: 30 mins: Winter		26.857	27.109	0.252	9.5			9.2	8.852	Surcharged
S2.00	Cornbtook FSR: 30 years: +40 %: 30 mins: Summer	28.083	27.000	27.157	0.157	2.8	0.025	0.000	2.8	2.435	Surcharged
S1.08	Cornbtook FSR: 30 years: +40 %: 15 mins: Summer	28.104	25.639	26.127	0.488	5.1	0.383	0.000	4.2	48.211	Surcharged
S1.09 HYDROBR AKE	Cornbtook FSR: 30 years: +40 %: 15 mins: Summer	28.156	25.617	26.127	0.510	4.2	0.730	0.000	3.1	48.207	Surcharged
S1.10	Cornbtook FSR: 30 years: +40 %: 360 mins: Winter	28.200	25.559	25.596	0.037	3.1	0.000	0.000	3.1	132.618	OK

Project:		Date: 13/05/2025			
		Designed by: HenryWilkinson	Checked by:	Approved By:	
Report Details: Type: Junctions Summary Storm Phase: Surface Water		Company Address:			

S7.00	Cornbtook FSR: 30 years: +40 %: 15 mins: Summer	28.77 6	27.55 0	27.602	0.052	4.8	0.008	0.000	4.7	2.087	OK
S7.01	Cornbtook FSR: 30 years: +40 %: 15 mins: Summer	28.98 7	27.44 6	27.587	0.141	19.1	0.022	0.000	18.1	8.333	OK
S8.00	Cornbtook FSR: 30 years: +40 %: 15 mins: Summer	28.12 7	26.70 0	26.806	0.106	21.3	0.120	0.000	21.0	9.244	OK

Project:	Date: 13/05/2025		
	Designed by: HenryWilkinson	Checked by:	Approved By:
Report Details: Type: Junctions Summary Storm Phase: Surface Water	Company Address:		





Cornbtook FSR: 100 years: Increase Rainfall (%): +45: Critical Storm Per Item: Rank By: Max. Outflow

Junction	Storm Event	Cover Level (m)	Invert Level (m)	Max. Level (m)	Max. Depth (m)	Max. Inflow (L/s)	Max. Resident Volume (m³)	Max. Flooded Volume (m³)	Max. Outflow (L/s)	Total Discharge Volume (m³)	Status
S1.00	Cornbtook FSR: 100 years: +45 %: 15 mins: Summer	28.244	26.898	27.500	0.602	6.4	0.096	0.000	3.3	2.782	Surcharged
S1.02	Cornbtook FSR: 100 years: +45 %: 15 mins: Summer	28.250	26.742	27.454	0.713	12.8	0.113	0.000	14.6	10.532	Surcharged
S1.03	Cornbtook FSR: 100 years: +45 %: 15 mins: Summer	28.250	26.690	27.415	0.725	16.6	0.115	0.000	18.5	14.517	Surcharged
S1.04	Cornbtook FSR: 100 years: +45 %: 15 mins: Summer	28.209	26.562	27.263	0.700	26.2	0.111	0.000	26.2	21.924	Surcharged
S1.05	Cornbtook FSR: 100 years: +45 %: 15 mins: Summer	28.170	26.527	27.141	0.614	35.6	0.695	0.000	35.8	29.966	Surcharged
S1.06	Cornbtook FSR: 100 years: +45 %: 15 mins: Summer	28.200	26.408	26.614	0.206	47.8	0.233	0.000	46.9	36.453	OK
S3.00	Cornbtook FSR: 100 years: +45 %: 30 mins: Winter	28.250	26.767	27.349	0.582	2.2	0.092	0.000	2.7	2.076	Surcharged
S4.00	Cornbtook FSR: 100 years: +45 %: 15 mins: Summer	28.476	26.787	27.273	0.486	9.3	0.077	0.000	6.0	4.010	Surcharged
S5.00	Cornbtook FSR: 100 years: +45 %: 15 mins: Summer	28.700	26.696	27.161	0.465	11.4	0.074	0.000	8.4	4.948	Surcharged
S5.01	Cornbtook FSR: 100 years: +45 %: 15 mins: Summer	28.643	26.630	27.158	0.528	13.4	0.084	0.000	10.4	7.112	Surcharged
S6.00	Cornbtook FSR: 100 years: +45 %: 15 mins: Summer	28.967	27.850	27.890	0.040	2.9	0.006	0.000	2.8	1.241	OK
S6.01	Cornbtook FSR: 100 years: +45 %: 15 mins: Summer	28.925	27.746	27.807	0.061	5.6	0.010	0.000	5.5	2.476	OK
S6.02	Cornbtook FSR: 100 years: +45 %: 15 mins: Summer	28.733	27.682	27.713	0.031	7.0	0.005	0.000	6.9	3.096	OK
S6.03	Cornbtook FSR: 100 years: +45 %: 15 mins: Summer	28.650	27.236	27.314	0.078	28.0	0.012	0.000	27.7	14.234	OK
S6.04	Cornbtook FSR: 100 years: +45 %: 15 mins: Summer	28.612	26.633	26.780	0.147	31.2	0.166	0.000	30.7	15.777	OK
S1.01	Cornbtook FSR: 100 years: +45 %: 30 mins: Summer		26.857	27.453	0.596	11.5			10.4	11.965	Surcharged
S2.00	Cornbtook FSR: 100 years: +45 %: 15 mins: Summer	28.083	27.000	27.503	0.503	5.7	0.080	0.000	3.1	2.473	Surcharged
S1.08	Cornbtook FSR: 100 years: +45 %: 15 mins: Summer	28.104	25.639	26.282	0.643	5.7	0.505	0.000	4.5	64.501	Surcharged
S1.09 HYDROBR AKE	Cornbtook FSR: 100 years: +45 %: 240 mins: Winter	28.156	25.617	26.876	1.259	3.7	1.802	0.000	3.2	162.766	Surcharged
S1.10	Cornbtook FSR: 100 years: +45 %: 240 mins: Winter	28.200	25.559	25.597	0.038	3.2	0.000	0.000	3.2	162.766	OK

Project:		Date: 13/05/2025			
		Designed by: HenryWilkinson	Checked by:	Approved By:	
Report Details: Type: Junctions Summary Storm Phase: Surface Water		Company Address:			

S7.00	Cornbtook FSR: 100 years: +45 %: 15 mins: Winter	28.77 6	27.55 0	27.674	0.124	6.0	0.020	0.000	4.6	2.779	OK
S7.01	Cornbtook FSR: 100 years: +45 %: 15 mins: Summer	28.98 7	27.44 6	27.704	0.257	22.9	0.041	0.000	21.1	11.141	Surcharged
S8.00	Cornbtook FSR: 100 years: +45 %: 15 mins: Summer	28.12 7	26.70 0	26.836	0.136	28.5	0.154	0.000	28.0	12.364	OK

Project:	Date: 13/05/2025		
	Designed by: HenryWilkinson	Checked by:	Approved By:
Report Details: Type: Stormwater Controls Summary Storm Phase: Surface Water	Company Address:		





Cornbtook FSR: 2 years: Increase Rainfall (%): +0: Critical Storm Per Item: Rank
By: Max. Resident Volume

Stormwater Control	Storm Event	Max. US Level (m)	Max. DS Level (m)	Max. US Depth (m)	Max. DS Depth (m)	Max. Inflow (L/s)	Max. Resident Volume (m³)	Max. Flooded Volume (m³)	Total Lost Volume (m³)	Max. Outflow (L/s)	Total Discharge Volume (m³)	Half Drain Down Time (mins)	Percentage Available (%)
S1.07 - TANK	Cornbtook FSR: 2 years: +0 %: 120 mins: Summer	25.917	25.917	0.232	0.232	17.9	23.023	0.000	0.000	3.3	37.578		80.850

Project:	Date: 13/05/2025			
	Designed by:	Checked by:	Approved By:	
	HenryWilkinson			
Report Details: Type: Stormwater Controls Summary Storm Phase: Surface Water		Company Address:		

Status
OK

Project:	Date: 13/05/2025		
	Designed by: HenryWilkinson	Checked by:	Approved By:
Report Details: Type: Stormwater Controls Summary Storm Phase: Surface Water	Company Address:		





Cornbtook FSR: 30 years: Increase Rainfall (%): +40: Critical Storm Per Item:
Rank By: Max. Resident Volume

Stormwater Control	Storm Event	Max. US Level (m)	Max. DS Level (m)	Max. US Depth (m)	Max. DS Depth (m)	Max. Inflow (L/s)	Max. Resident Volume (m³)	Max. Flooded Volume (m³)	Total Lost Volume (m³)	Max. Outflow (L/s)	Total Discharge Volume (m³)	Half Drain Down Time (mins)	Percentage Available (%)
S1.07 - TANK	Cornbtook FSR: 30 years: +40 %: 240 mins: Winter	26.524	26.524	0.839	0.839	20.9	83.306	0.000	0.000	3.6	119.951	155	30.708

Project:	Date: 13/05/2025			
	Designed by: HenryWilkinson	Checked by:	Approved By:	
Report Details:	Company Address:			
Type: Stormwater Controls Summary Storm Phase: Surface Water				

Status
OK

Project:	Date: 13/05/2025		
	Designed by: HenryWilkinson	Checked by:	Approved By:
Report Details: Type: Stormwater Controls Summary Storm Phase: Surface Water	Company Address:		





Cornbtook FSR: 100 years: Increase Rainfall (%): +45: Critical Storm Per Item:
Rank By: Max. Resident Volume

Stormwater Control	Storm Event	Max. US Level (m)	Max. DS Level (m)	Max. US Depth (m)	Max. DS Depth (m)	Max. Inflow (L/s)	Max. Resident Volume (m³)	Max. Flooded Volume (m³)	Total Lost Volume (m³)	Max. Outflow (L/s)	Total Discharge Volume (m³)	Half Drain Down Time (mins)	Percentage Available (%)
S1.07 - TANK	Cornbtook FSR: 100 years: +45 %: 240 mins: Winter	26.877	26.877	1.192	1.192	28.4	118.330	0.000	0.000	3.7	162.763	370	1.576

Project:	Date: 13/05/2025			
	Designed by: HenryWilkinson	Checked by:	Approved By:	
	Report Details: Type: Stormwater Controls Summary Storm Phase: Surface Water			
Company Address:				

Status
OK

Project:	Date: 13/05/2025		
	Designed by: HenryWilkinson	Checked by:	Approved By:
Report Details: Type: Connections Summary Storm Phase: Surface Water	Company Address:		





Cornbtook FSR: 2 years: Increase Rainfall (%): +0: Critical Storm Per Item: Rank By: Max. Flow

Connection	Storm Event	Connection Type	From	To	Upstream Cover Level (m)	Max. US Water Level (m)	Max. Flow Depth (m)	Discharge Volume (m³)	Max. Velocity (m/s)	Flow / Capacity	Max. Flow (L/s)	Status
S1.003	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	Pipe	S1.03	S1.04	28.250	26.764	0.099	4.075	0.7	0.49	8.6	OK
S1.004	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	Pipe	S1.04	S1.05	28.209	26.688	0.127	6.162	0.8	0.7	12.4	OK
S1.005	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	Pipe	S1.05	S1.06	28.170	26.656	0.122	8.422	1.1	0.93	16.5	OK
S3.000	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	Pipe	S3.00	S1.02	28.250	26.811	0.056	0.426	0.2	0.05	0.9	OK
S4.000	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	Pipe	S4.00	S1.04	28.476	26.823	0.080	1.133	0.3	0.14	2.5	OK
S5.000	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	Pipe	S5.00	S5.01	28.700	26.734	0.042	1.397	0.8	0.11	3.1	OK
S5.001	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	Pipe	S5.01	S1.05	28.643	26.676	0.088	2.005	0.4	0.22	4.5	OK
S6.000	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	Pipe	S6.00	S6.01	28.967	27.871	0.027	0.347	0.4	0.04	0.8	OK
S6.001	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	Pipe	S6.01	S6.02	28.925	27.778	0.024	0.698	0.8	0.09	1.5	OK
S6.002	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	Pipe	S6.02	S6.03	28.733	27.699	0.028	0.871	0.9	0.03	1.9	OK
S6.003	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	Pipe	S6.03	S6.04	28.650	27.274	0.056	3.997	1.4	0.15	8.7	OK
S1.006	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	Pipe	S1.06	S1.07 - TANK	28.200	26.523	0.107	10.253	1.1	0.39	20.3	OK
S6.004	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	Pipe	S6.04	S1.07 - TANK	28.612	26.707	0.069	4.430	0.9	0.18	9.4	OK
S1.000	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	Pipe	S1.00	S1.01	28.244	26.930	0.046	0.776	0.4	0.1	1.8	OK

Project:				Date: 13/05/2025							
				Designed by: HenryWilkinson	Checked by:	Approved By:					
Report Details: Type: Connections Summary Storm Phase: Surface Water				Company Address:							

S1.001	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	Pipe	S1.01	S1.02	28.250	26.918	0.064	2.518	0.8	0.31	5.5	OK
S2.000	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	Pipe	S2.00	S1.01	28.083	27.030	0.045	0.692	0.3	0.09	1.6	OK
S1.008	Cornbtook FSR: 2 years: +0 %: 60 mins: Summer	Pipe	S1.08	S1.09 HYDRO BRAKE	28.104	25.905	0.225	30.208	0.4	0.06	3.2	Surch arged
S1.009	Cornbtook FSR: 2 years: +0 %: 120 mins: Summer	Pipe	S1.09 HYDRO BRAKE	S1.10	28.156	25.916	0.038	37.572	0.7	0.06	3.1	Surch arged
S1.007	Cornbtook FSR: 2 years: +0 %: 30 mins: Summer	Pipe	S1.07 - TANK	S1.08	27.980	25.878	0.216	23.884	0.4	0.07	3.5	OK
S7.000	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	Pipe	S7.00	S7.01	28.776	27.581	0.051	0.773	0.3	0.1	1.7	OK
S7.001	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	Pipe	S7.01	S6.03	28.987	27.517	0.055	3.127	1.2	0.39	6.9	OK
1.002	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	Pipe	S1.02	S1.03	28.250	26.809	0.064	2.943	0.9	0.35	6.2	OK
8.000	Cornbtook FSR: 2 years: +0 %: 15 mins: Summer	Pipe	S8.00	S1.07 - TANK	28.127	26.756	0.052	3.492	1.5	0.22	7.9	OK

Project:	Date: 13/05/2025		
	Designed by: HenryWilkinson	Checked by:	Approved By:
Report Details: Type: Connections Summary Storm Phase: Surface Water	Company Address:		





Cornbtook FSR: 30 years: Increase Rainfall (%): +40: Critical Storm Per Item: Rank By: Max. Flow

Connection	Storm Event	Connection Type	From	To	Upstream Cover Level (m)	Max. US Water Level (m)	Max. Flow Depth (m)	Discharge Volume (m³)	Max. Velocity (m/s)	Flow / Capacity	Max. Flow (L/s)	Status
S1.003	Cornbtook FSR: 30 years: +40 %: 15 mins: Summer	Pipe	S1.03	S1.04	28.250	27.114	0.150	10.853	0.9	0.86	15.2	Surcharged
S1.004	Cornbtook FSR: 30 years: +40 %: 15 mins: Summer	Pipe	S1.04	S1.05	28.209	27.008	0.150	16.390	1.2	1.2	21.3	Surcharged
S1.005	Cornbtook FSR: 30 years: +40 %: 30 mins: Summer	Pipe	S1.05	S1.06	28.170	26.944	0.150	29.596	1.6	1.62	28.8	Surcharged
S3.000	Cornbtook FSR: 30 years: +40 %: 15 mins: Summer	Pipe	S3.00	S1.02	28.250	27.144	0.150	1.157	0.1	0.12	2.2	Surcharged
S4.000	Cornbtook FSR: 30 years: +40 %: 15 mins: Summer	Pipe	S4.00	S1.04	28.476	27.025	0.150	2.994	0.3	0.25	4.6	Surcharged
S5.000	Cornbtook FSR: 30 years: +40 %: 15 mins: Summer	Pipe	S5.00	S5.01	28.700	26.964	0.150	3.700	0.7	0.23	6.5	Surcharged
S5.001	Cornbtook FSR: 30 years: +40 %: 15 mins: Summer	Pipe	S5.01	S1.05	28.643	26.956	0.150	5.319	0.5	0.4	8.2	Surcharged
S6.000	Cornbtook FSR: 30 years: +40 %: 15 mins: Summer	Pipe	S6.00	S6.01	28.967	27.885	0.044	0.929	0.5	0.12	2.1	OK
S6.001	Cornbtook FSR: 30 years: +40 %: 15 mins: Summer	Pipe	S6.01	S6.02	28.925	27.798	0.039	1.849	1.1	0.23	4.1	OK
S6.002	Cornbtook FSR: 30 years: +40 %: 15 mins: Summer	Pipe	S6.02	S6.03	28.733	27.709	0.047	2.313	1.1	0.07	5.1	OK
S6.003	Cornbtook FSR: 30 years: +40 %: 15 mins: Summer	Pipe	S6.03	S6.04	28.650	27.304	0.099	10.645	1.9	0.39	23.0	OK

Project:				Date: 13/05/2025							
				Designed by: HenryWilkinson		Checked by:					
Report Details: Type: Connections Summary Storm Phase: Surface Water				Company Address:							

S1.006	Cornbtook FSR: 30 years: +40 %: 15 mins: Summer	Pipe	S1.06	S1.07 - TANK	28.200	26.582	0.159	27.254	1.3	0.74	38.7	OK
S6.004	Cornbtook FSR: 30 years: +40 %: 15 mins: Summer	Pipe	S6.04	S1.07 - TANK	28.612	26.763	0.120	11.798	1.2	0.49	25.3	OK
S1.000	Cornbtook FSR: 30 years: +40 %: 30 mins: Summer	Pipe	S1.00	S1.01	28.244	27.156	0.150	2.741	0.4	0.17	3.1	Surch arged
S1.001	Cornbtook FSR: 30 years: +40 %: 30 mins: Winter	Pipe	S1.01	S1.02	28.250	27.109	0.150	8.852	0.7	0.52	9.2	Surch arged
S2.000	Cornbtook FSR: 30 years: +40 %: 30 mins: Summer	Pipe	S2.00	S1.01	28.083	27.157	0.150	2.435	0.4	0.16	2.8	Surch arged
S1.008	Cornbtook FSR: 30 years: +40 %: 15 mins: Summer	Pipe	S1.08	S1.09 HYDRO BRAKE	28.104	26.127	0.225	48.211	0.7	0.08	4.2	Surch arged
S1.009	Cornbtook FSR: 30 years: +40 %: 360 mins: Winter	Pipe	S1.09 HYDRO BRAKE	S1.10	28.156	26.494	0.038	132.618	0.7	0.06	3.1	Surch arged
S1.007	Cornbtook FSR: 30 years: +40 %: 15 mins: Summer	Pipe	S1.07 - TANK	S1.08	27.980	26.127	0.225	48.213	0.5	0.1	5.1	Surch arged
S7.000	Cornbtook FSR: 30 years: +40 %: 15 mins: Summer	Pipe	S7.00	S7.01	28.776	27.602	0.096	2.087	0.4	0.27	4.7	OK
S7.001	Cornbtook FSR: 30 years: +40 %: 15 mins: Summer	Pipe	S7.01	S6.03	28.987	27.587	0.104	8.333	1.4	1.02	18.1	OK
1.002	Cornbtook FSR: 30 years: +40 %: 15 mins: Summer	Pipe	S1.02	S1.03	28.250	27.143	0.150	7.854	0.7	0.68	12.1	Surch arged
8.000	Cornbtook FSR: 30 years: +40 %: 15 mins: Summer	Pipe	S8.00	S1.07 - TANK	28.127	26.806	0.094	9.244	1.8	0.59	21.0	OK

Project:	Date: 13/05/2025		
	Designed by: HenryWilkinson	Checked by:	Approved By:
Report Details: Type: Connections Summary Storm Phase: Surface Water	Company Address:		



Cornbtook FSR: 100 years: Increase Rainfall (%): +45: Critical Storm Per Item: Rank By: Max. Flow

Connection	Storm Event	Connection Type	From	To	Upstream Cover Level (m)	Max. US Water Level (m)	Max. Flow Depth (m)	Discharge Volume (m³)	Max. Velocity (m/s)	Flow / Capacity	Max. Flow (L/s)	Status
S1.003	Cornbtook FSR: 100 years: +45 %: 15 mins: Summer	Pipe	S1.03	S1.04	28.250	27.415	0.150	14.517	1.0	1.04	18.5	Surcharged
S1.004	Cornbtook FSR: 100 years: +45 %: 15 mins: Summer	Pipe	S1.04	S1.05	28.209	27.263	0.150	21.924	1.5	1.48	26.2	Surcharged
S1.005	Cornbtook FSR: 100 years: +45 %: 15 mins: Summer	Pipe	S1.05	S1.06	28.170	27.141	0.150	29.966	2.0	2.02	35.8	Surcharged
S3.000	Cornbtook FSR: 100 years: +45 %: 30 mins: Winter	Pipe	S3.00	S1.02	28.250	27.349	0.150	2.069	0.2	0.15	2.7	Surcharged
S4.000	Cornbtook FSR: 100 years: +45 %: 15 mins: Summer	Pipe	S4.00	S1.04	28.476	27.273	0.150	4.010	0.3	0.32	6.0	Surcharged
S5.000	Cornbtook FSR: 100 years: +45 %: 15 mins: Summer	Pipe	S5.00	S5.01	28.700	27.161	0.150	4.948	0.7	0.3	8.4	Surcharged
S5.001	Cornbtook FSR: 100 years: +45 %: 15 mins: Summer	Pipe	S5.01	S1.05	28.643	27.158	0.150	7.112	0.6	0.51	10.4	Surcharged
S6.000	Cornbtook FSR: 100 years: +45 %: 15 mins: Summer	Pipe	S6.00	S6.01	28.967	27.890	0.051	1.241	0.5	0.16	2.8	OK
S6.001	Cornbtook FSR: 100 years: +45 %: 15 mins: Summer	Pipe	S6.01	S6.02	28.925	27.807	0.046	2.476	1.2	0.31	5.5	OK
S6.002	Cornbtook FSR: 100 years: +45 %: 15 mins: Summer	Pipe	S6.02	S6.03	28.733	27.713	0.054	3.096	1.2	0.09	6.9	OK
S6.003	Cornbtook FSR: 100 years: +45 %: 15 mins: Summer	Pipe	S6.03	S6.04	28.650	27.314	0.113	14.234	1.9	0.46	27.7	OK

Project:				Date: 13/05/2025							
				Designed by: HenryWilkinson		Checked by:					
Report Details: Type: Connections Summary Storm Phase: Surface Water				Company Address:							

S1.006	Cornbtook FSR: 100 years: +45 %: 15 mins: Summer	Pipe	S1.06	S1.07 - TANK	28.200	26.614	0.187	36.453	1.3	0.9	46.9	OK
S6.004	Cornbtook FSR: 100 years: +45 %: 15 mins: Summer	Pipe	S6.04	S1.07 - TANK	28.612	26.780	0.135	15.777	1.2	0.59	30.7	OK
S1.000	Cornbtook FSR: 100 years: +45 %: 15 mins: Summer	Pipe	S1.00	S1.01	28.244	27.500	0.150	2.782	0.4	0.19	3.3	Surch arged
S1.001	Cornbtook FSR: 100 years: +45 %: 30 mins: Summer	Pipe	S1.01	S1.02	28.250	27.453	0.150	11.965	0.7	0.59	10.4	Surch arged
S2.000	Cornbtook FSR: 100 years: +45 %: 15 mins: Summer	Pipe	S2.00	S1.01	28.083	27.503	0.150	2.473	0.3	0.18	3.1	Surch arged
S1.008	Cornbtook FSR: 100 years: +45 %: 15 mins: Summer	Pipe	S1.08	S1.09 HYDRO BRAKE	28.104	26.282	0.225	64.501	0.6	0.09	4.5	Surch arged
S1.009	Cornbtook FSR: 100 years: +45 %: 240 mins: Winter	Pipe	S1.09 HYDRO BRAKE	S1.10	28.156	26.876	0.039	162.766	0.7	0.06	3.2	Surch arged
S1.007	Cornbtook FSR: 100 years: +45 %: 15 mins: Summer	Pipe	S1.07 - TANK	S1.08	27.980	26.282	0.225	64.503	0.6	0.11	5.7	Surch arged
S7.000	Cornbtook FSR: 100 years: +45 %: 15 mins: Winter	Pipe	S7.00	S7.01	28.776	27.674	0.150	2.779	0.3	0.26	4.6	OK
S7.001	Cornbtook FSR: 100 years: +45 %: 15 mins: Summer	Pipe	S7.01	S6.03	28.987	27.704	0.150	11.141	1.2	1.19	21.1	Surch arged
1.002	Cornbtook FSR: 100 years: +45 %: 15 mins: Summer	Pipe	S1.02	S1.03	28.250	27.454	0.150	10.501	0.8	0.82	14.6	Surch arged
8.000	Cornbtook FSR: 100 years: +45 %: 15 mins: Summer	Pipe	S8.00	S1.07 - TANK	28.127	26.836	0.118	12.364	1.9	0.78	28.0	OK

APPENDIX K
NORTHWEST SUDS PRO-FORMA

NORTH WEST SuDS PRO-FORMA

This pro-forma is a requirement for any planning application for major development¹.

It supports applicants in summarising and confirming how surface water from a development will be managed sustainably under current and future conditions.

Your sustainable drainage system should be designed in accordance with [CIRIA The SuDS Manual C753](#) and any necessary adoption standards.

HOW TO COMPLETE

Blue Box	Instruction/ Question
Orange Box	Evidence Required
White Box	To be completed by Developer / Consultant

1. Complete ALL white boxes
2. Submit this pro-forma to the Local Planning Authority, along with:
 - Sustainable Drainage Strategy
 - Site Specific Flood Risk Assessment (if required)
 - Minimum supporting evidence, as indicated in orange boxes of this pro-forma.

GUIDANCE TO SUPPORT YOU

The pro-forma should be completed in conjunction with ‘Completing your SuDS Pro Forma Guide.’

The pro-forma can be completed using freely available tools such as [Tools for Sustainable Drainage Systems](#) or appropriate industry standard surface water management design software.

¹ as defined in Section 2 of [Statutory Instrument 2015 No. 595](#) or on sites in Critical Drainage Areas.

SECTION 1. APPLICATION & DEVELOPMENT DETAILS

Planning Application Reference <i>(if available)</i>		
State type of planning application <i>i.e. Pre-application, Outline, Full, Hybrid, Reserved Matters*</i> *Information only required if drainage is to be considered as part of reserved matters application		FULL PLANNING
Developer(s) Name:		FORSHAW GROUP
Consultant(s) Name:		RENAISSANCE ASSOCIATES LTD
Development Address <i>(including postcode)</i>		Land off Cornbrook Road M15 4YG
Development Grid Reference <i>(Eastings/Northings)</i>		382421, 397060
Total Development Site Area (Ha)		0.225
Drained Area (Ha)* of Development		0.225
Please indicate the flood zone that your development is in. Tick all that apply. <i>Based on the Environment Agency Flood Map for Planning and the relevant Local Authority Strategic Flood Risk Assessment (to identify Flood Zones 3a/3b).</i>		Flood Zone 1 ☒ Flood Zone 2 ☐ Flood Zone 3a ☐ Flood Zone 3b ☐
What is the surface water risk of the site? Tick all that apply. <i>Based on the Environment Agency Surface Water Flood Map.</i>		High ☐ Medium ☐ Low ☒
Have you submitted a Site Specific Flood Risk Assessment (FRA)? <i>See separate guidance notes for clarification on when a FRA is required</i>		Yes ☒ No ☐
Have you submitted a Sustainable Drainage Strategy?		Yes ☒ No ☐
Does your drainage proposal provide multi-functional benefits via SuDS?		Yes ☐ No ☒
Expected Lifetime of Development <i>(years)</i> <i>Refer to Planning Practice Guidance "Flood Risk and Coastal Change" Paragraph 026</i>		100 YEARS
Development Type:		State Proposed Number of Units
Greenfield Site Site is wholly undeveloped, and a new drainage system will be installed		☒ 1
Previously Developed/ Brownfield Site - Site is already developed, and the <u>entirety</u> of the existing surface water drainage system will be used to serve the new development (evidence must be provided to prove existing surface water drainage system is reusable); <u>OR</u> - Where records of the previously developed system are not available so that the hydraulic characteristics of the system cannot be determined or where the drainage system is not in reasonable working order i.e. broken, blocked or no longer operational for other reasons.		☐
Please list any relevant document and or drawing numbers (including revision reference) to support your answers to Section 1.		CBR-REN-XX-XX-RP-C-00001 CBR-REN-XX-XX-RP-C-00002

SECTION 2: IMPERMEABLE AREA AND EXISTING DRAINAGE

	Existing (E)	Proposed (P)	Change (P – E)
State Impermeable Area (Ha)	0.130	0.225	0.095
Evidence Required: Plans showing development layout of site with existing and proposed impermeable areas.			

Are there existing sewers, watercourses, water bodies, highway drains, soakaways or filter drains on the site?	Yes ☒ No ☐ Don't Know ☐
Evidence Required: Plan(s) showing existing layout to include all: • Watercourses, open and culverted • Water bodies – ponds, swales etc. • Sewers, including manholes • Highway drains, include manholes, gullies etc. • Infiltration features - soakaways, filter drains etc.	☒

Drainage Design <i>Outline planning applications should be able to demonstrate that a suitable drainage system is achievable.</i> <i>All other type of planning application should provide full details or reference to previous planning application where drainage details have been submitted or approved.</i>		
Select which design approach you are taking to manage water quantity (refer to Section 3.3 SuDS Manual)		
Approach 1 – Volume control / Long Term Storage (Technical Standards S2/3, S4/5) <i>The attenuated runoff volume for the 1 in 100 year 6 hour event (plus climate change allowance) is limited to the greenfield runoff volume for the 1 in 100 year 6 hour event, with any additional runoff volume utilising long term storage and either infiltrated or released at 2 l/s/ha</i> <i>The discharge rate for the critical duration 1 in 1 year event is restricted to the 1 in 1 year greenfield runoff rate</i> <i>The discharge rate for the critical duration 1 in 100 year event (plus climate change allowance) is restricted to the 1 in 100 year greenfield runoff rate</i>	☐	
Approach 2 – Qbar (Technical Standards S6) <i>Justification has been provided that the provision of volume control/long term storage is not appropriate and an attenuation only approach is proposed. All events up to the critical duration 1 in 100 year event (plus climate change allowance) are limited to Qbar (1 in 2 year greenfield rate) or 2 l/s/ha, whichever is greater.</i>	☒	
Evidence Required: Plans showing: - Existing flow routes and flood risks - Modified flow routes - Contributing and impermeable areas - Current (if any) and proposed ‘source control’ and ‘management train’ locations of sustainable drainage components (C753 Chapter 7) - Details of drainage ownership - Details of exceedance routes (Technical Standards S9) - Topographic survey - Locations and number of existing and proposed discharge points		☒

Note consideration should be given to manage surface water from both impermeable and permeable surfaces (including gardens and verges) likely to enter the drainage system.

Please list any relevant document and or drawing numbers (including revision reference) to support your answers to Section 2.

CBR-REN-XX-XX-RP-C-00001
CBR-REN-XX-XX-RP-C-00002

SECTION 3: PEAK RUNOFF RATES – TECHNICAL STANDARDS S2, S3 AND S6 (UNLESS S1 APPLIES)

Rainfall Event	Existing Rate (l/s)	Greenfield Rate (l/s)	Proposed Rate (l/s) <i>Previously developed sites - In line with S3 should be equivalent to Greenfield runoff rates – discuss with LLFA if this is not achievable pre-application</i>
Qbar (Approach 2)	31.97	3.2	3.2
1 in 1 Year Event (Approach 1)			
1 in 30 Year Event			
1 in 100 Year Event* (Approach 1)			
* Total discharge at the 1 in 100 year rate should be restricted to the greenfield runoff volume for the 1 in 100 Year 6 hour event with additional volumes (long-term storage volume) released at a rate no greater than 2 l/s/ha where infiltration is not possible. The climate change allowance should only be applied to the proposed rate and not the existing or greenfield rate.			
Evidence Required: Methodology used to calculate peak runoff rate clearly stated and justified. Impermeable areas plan, supported by topographical survey confirming positive drainage. Hydraulic calculations and details of software used.			☒ ☒ ☒

State the hydraulic method used in your calculations
(Refer to Table 24.1 of The SuDS Manual)

FEH ReFH2 - Microdrainage

Please list any relevant document and or drawing numbers (including revision reference) to support your answers to Section 3.

CBR-REN-XX-XX-RP-C-00001
CBR-REN-XX-XX-RP-C-00002

SECTION 4: DISCHARGE VOLUME – TECHNICAL STANDARDS S4, S5 AND S6 (UNLESS S1 APPLIES)

Rainfall Event	Existing Volume (m ³)	Greenfield Volume (m ³)	Proposed Volume (m ³)
1 in 100 Year 6 Hour Event <i>(Approach 1)</i>			
Does the below statement apply to your development proposal? Long term storage is not achievable on this site and, in accordance with S6 of the Non Statutory Technical Standards for SuDS, the surface water discharge rates for events up to and including the 1 in 100 year critical event are limited to Qbar (Approach 2)			Yes ☒ No ☐
Evidence Required: Approach to managing the quantity of surface water leaving the site clearly stated and justified Methodology used to calculate discharge volume clearly stated and justified. Hydraulic calculations and details of software used.			☒ ☒ ☒

Please list any relevant document and or drawing numbers (including revision reference) to support your answers to Section 4.	CBR-REN-XX-XX-RP-C-00001 CBR-REN-XX-XX-RP-C-00002
--	--

SECTION 5: STORAGE – TECHNICAL STANDARDS S7 AND S8

State climate change allowance used (%)	1 in 30 YEAR: 40% 1 in 100 YEAR: 45%
State housing density (houses per ha)	N/A
State urban creep allowance used (%)	0% - NOT SUITABLE DUE TO TYPE OF DEVELOPMENT
Evidence Required: State / used in appropriate industry standard surface water management design software.	☒

State storage volume required (m³) (excluding non-void spaces) <i>Must include an allowance for climate change and urban creep</i>	125.4
Have you incorporated interception into your design? <i>(Refer to Chapter 24 of The SuDS Manual C753)</i> <i>Where possible, infiltration or other techniques are to be used to try and achieve zero discharge to receiving waters for rainfall depths up to 5mm.</i>	Yes ☐ No ☒
Evidence Required: Drainage plans showing location of attenuation and all flow control devices and supporting calculations.	☒

Summarise how storage will be provided for 1 in 30 year event on site. <i>Storage must be designed to ensure that at no flooding occurs onsite in a 1 in 30 year event except in designed areas and no flooding occurs offsite in a 1 in 100 year (plus climate change allowance) event.</i>	ALL ATTENUATION IT TO BE PROVIDED BELOW GROUND IN A GEO-CELLULAR ATTENUATION TANK
Summarise how storage will be provided for 1 in 100 year (plus climate change) event on site. <i>Where storage above the 1 in 30 year rainfall event is provided in designated areas designed to accommodate excess surface water volumes, plans showing storage locations and surface water depths and supported by calculations used in appropriate industry standard surface water management design software. It is important to run a range of duration events to ensure the worst case condition is found for each drainage element on the site</i>	AS ABOVE
Evidence Required: Plans showing size and location of storage and supporting calculations. Where there is controlled flooding, extents and depths must be indicated.	☒

Please list any relevant document and or drawing numbers (including revision reference) to support your answers to Section 5.	CBR-REN-XX-XX-RP-C-00001 CBR-REN-XX-XX-RP-C-00002
--	--

SECTION 6: WATER QUALITY PROTECTION

Contaminated surface water run-off can have negative impacts on the quality of receiving water bodies. The potential level of contamination will influence final the design of an appropriate treatment train as part of your sustainable drainage system.

Is the proposal site known to be or potentially contaminated?	Yes ☐	No ☒
If the site is contaminated, it should be demonstrated that the sustainable drainage system will not increase the risk of pollution to controlled waters through the mobilisation of contaminants and/or creation of new pollution pathways.		

Confirm the Pollution Hazard Level of the proposed development - Tick <u>ALL</u> that apply Refer to Pollution Hazard Indices for different Land Use Classifications in Table 26.2 of The SuDS Manual C753 for further guidance.		
Pollution Hazard Level Tick <u>ALL</u> that apply	Surface water run-off from the proposed development will drain from:	
VERY LOW	☐	Residential roofs
LOW	☒	- Other roofs (typically commercial/industrial roofs) - Individual property driveways, residential car parks, low traffic roads (e.g. cul de sacs, home-zones and general access roads) - Non-residential car parking with infrequent change (e.g. schools, offices) i.e. < 300 traffic movements/day
MEDIUM	☐	- Commercial yard and delivery areas - Non-residential car parking with frequent change (e.g. hospitals, retail) - All roads except low traffic roads and trunk roads/motorways²
HIGH	☐	- Sites with heavy pollution (e.g. haulage yards, lorry parks, highly frequented lorry approaches to industrial estates, waste sites) - Sites where chemicals and fuels (other than domestic fuel oil) are to be delivered, handled, stored, used or manufactured - Industrial sites - Trunk roads and motorways¹

If the development's Pollution Hazard Level is 'Very Low' or 'Low', has the sustainable drainage design been risk assessed and appropriate mitigation measures included?	Yes ☒	No ☐
If the proposed development has a very low or low polluting potential, you should design your sustainable drainage system to include an appropriate treatment train in accordance with The SuDS Manual (C753).		

If the development's Pollution Hazard Level is 'Medium' or 'High', is the application supported by a detailed water quality risk assessment?	Yes ☐	No ☐
- If the proposed development has a high polluting potential, a detailed risk assessment <u>will</u> be required to identify an appropriate SuDS treatment train and ensure compliance with Paragraph 170 of the National Planning Policy Framework. - If the proposed development has a medium polluting potential, a detailed risk assessment <u>may</u> be required depending on the nature, scale and location of the development.		

Has pre-application advice on water quality been obtained from the Environment Agency?	Yes ☐	No ☒
If YES, provide details:		

² Motorways and trunk roads should follow the guidance and risk assessment process set out in Highways Agency (2009).

Please list any relevant document and or drawing numbers (including revision reference) to support your answers to Section 6.

SECTION 7: DETAILS OF YOUR SUSTAINABLE DRAINAGE SYSTEM

a) Function of your Sustainable Drainage System

Do your proposals store rainwater for later use (as a resource)?	Yes ☐ No ☒
Evidence Required: Please provide a brief sentence in the adjacent white box to describe how this function has been achieved.	

Do your proposals promote source control to manage rainfall close to where it falls? (e.g. promoting natural losses through soakage, infiltration and evapotranspiration)	Yes ☐ No ☒
Evidence Required: Please provide a brief sentence in the adjacent white box to describe how this function has been achieved.	

Please list any relevant document and or drawing numbers (including revision reference) to support your answers to Section 7a.	CBR-REN-XX-XX-RP-C-00001 CBR-REN-XX-XX-RP-C-00002
--	--

b) Hierarchy of Drainage Options – Planning Practice Guidance

The proposed method of discharge are set out within order of priority. Generally, the aim should be to discharge surface run off as high up the following hierarchy of drainage options as reasonably practicable.

Proposed method of surface water discharge		Is this proposed?	
Hierarchy Level 1: Into the ground (via infiltration)		Yes ☐ No ☒	
If YES - Evidence Required		If NO – Evidence Required Tick ALL that apply	
☐	A. Completed Infiltration Checklist from The SuDS Manual (C753) Appendix B <i>An editable version of this form is available on SusDrain website.</i>	☒	A. Site investigation to demonstrate that the ground is not free draining. Test results to be provided in accordance with: - The methodology within BRE 365 (2016), OR - Falling head permeability tests BS EN ISO 22282-2: 2012
☐	B. British Geological Survey (BGS) Infiltration SuDS Map	☐	B. NOTE: where an applicant is unable to access a site to undertake testing, e.g. where unable to access a site for an outline application, they can submit a SuDS GeoReport or similar.
☐	C. Infiltration testing to BRE 365 (2016) or falling head permeability tests to BS EN ISO 22282-2: 2012 (optional for outline)	☒	C. Evidence to confirm that infiltration to ground would result in a risk of deterioration to ground water quality.
☐	'Plan B' sustainable drainage plan and statement of approach with an alternative discharge method, in case infiltration proposals are proven not feasible upon	☒	D. Geotechnical advice from a competent person* which determines that infiltration of water to ground would pose an unacceptable risk of geohazards to the site and/or local area.

	further site specific ground investigation e.g. to consider seasonal variations to groundwater.		<i>*Note: Competent person may include a Chartered Engineer, Chartered Geologists, Registered Ground Engineering Professionals (RoGEP).</i>
--	---	--	---

Proposed method of surface water discharge		Is this proposed?	
Hierarchy Level 2: To a surface water body <i>(select type)</i> NOTE: Consent from LLFA or Permit from Environment Agency may be required – refer to guidance		Yes ☒ No ☐ N/A ☒	
		☐ Main river ☐ Ordinary watercourse	☐ Canal ☐ Other water body
If YES - Evidence Required		If NO – Evidence Required Tick ALL that apply	
☐ Surface water body / watercourse survey and report	☐ Plan showing nearby watercourses and waterbodies AND ☒ Statement providing justification in your Sustainable Drainage Strategy <i>Note: Where discharge of any element in the hierarchy is discounted, an applicant should provide justification. If the reasoning for discounting a discharge of surface water to watercourse relates to issues associated with third party land or the securing of any other required consent, it may be necessary for the applicant to provide evidence to the local planning authority to support their proposed approach.</i>		

Proposed method of surface water discharge		Is this proposed?	
Hierarchy Level 3: To a surface water sewer or highway drain <i>(select type)</i>		Yes ☒ No ☐ N/A ☐	
		☒ Surface water sewer	☐ Highway drain
If YES - Evidence Required		If NO – Evidence Required Tick ALL that apply	
☐ Written correspondence from Water and Sewerage Company/ Highway Authority regarding proposed connection.	☒ Plan showing nearby sewers and highway drains AND ☒ Statement providing justification in your Sustainable Drainage Strategy		

Proposed method of surface water discharge		Is this proposed?	
Hierarchy Level 4: To combined sewer		Yes ☐ No ☒ N/A ☒	
If YES - Evidence Required		If NO – Evidence Required	
☐ Written correspondence from Water and Sewerage Company	N/A		

Please list any relevant document and or drawing numbers (including revision reference) to support your answers to Section 7b.	CBR-REN-XX-XX-RP-C-00001 CBR-REN-XX-XX-RP-C-00002
--	--

c) Proposed SuDS Component Types

	Tick ALL that apply				
Within property boundary	☐ Rainwater harvesting	☐ Green/ blue roofs	☐ Pervious pavements [Type: A ☐ B ☐ C ☐	☐ Soakaway	☐ Bio retention systems

	Tick ALL that apply				
Within development site boundary (not property)	☐ Infiltration system [Type: ☐ Surface level ☐ Below ground]		☐ Filter strips	☐ Filter drains	☐ Swales
	☐ Bio retention system	☐ Detention basins	☐ Ponds and wetlands	☒ Attenuation tanks/ Oversized pipes	☐ Other (state below)
	If 'Other' please state:				

Off site (not within the boundary of the proposed development)	Please state:
--	---------------

I confirm that the above selected components have been designed in accordance with The SuDS Manual (C753).	I confirm ☒
I confirm that the management of flows resulting from rainfall in excess of a 1 in 100 year plus climate change rainfall event, and their exceedance route(s), has been fully considered in order to minimise the risks to people, property (new and existing) and infrastructure.	I confirm ☒

Please list any relevant document and or drawing numbers (including revision reference) to support your answers to Section 7c.	CBR-REN-XX-XX-RP-C-00001 CBR-REN-XX-XX-RP-C-00002
--	--

The applicant is responsible to ensure that ALL components selected in Section 7 can be maintained for the design life of the development. This information is required so the Local Planning Authority can ensure the maintenance and management of the sustainable drainage system. The Local Planning Authority will discuss how this will be secured (e.g. via planning condition or planning obligation).

[illegible]

		Information Provided?
Maintenance Schedule		Yes ☒ No ☐
Evidence Required: A copy of the maintenance schedule including: Proactive and preventative maintenance Detailing regular, occasional and remedial maintenance activities including recommendations for inspection and monitoring. This should include recommended frequencies, advice on plant/ machinery required and an explanation of the objectives for the maintenance proposed and potential implications of not meeting them. Reactive and corrective maintenance (e.g. product repair and replacement). Including advice on excavations, or similar works, in locations that could affect the SuDS components/ adjacent structures.		☒

		Information Provided?
Maintenance and Management Arrangements		Yes ☒ No ☐
Evidence Required: Evidence of formal agreement with the party responsible for undertaking maintenance. Please select any of the adopting bodies that you will be offering your sustainable drainage components for adoption. Tick all that apply. ☐ Water and Sewerage Company <i>Section 104 agreement (Water Industry Act 1991)</i> ☐ Highway Authority <i>Section 278/38 agreement (Highways Act 1980)</i> ☐ Local Authority Public Open Space <i>[Refer to Local Authority Policy]</i> Please select the arrangement(s) for all non-adopted sustainable drainage components. Tick all that apply. ☒ Management Company ☐ Property Owner <i>(for SuDS components within property boundary only)</i> ☐ Other (please state) 		☐

Please list any relevant document and or drawing numbers (including revision reference) to support your answers to Section 8.

CBR-REN-XX-XX-RP-C-00001
CBR-REN-XX-XX-RP-C-00002

DECLARATION AND SUBMISSION

This pro-forma has been completed using evidence from information which has been submitted with the planning application.

The information submitted in the Sustainable Drainage Strategy and site-specific Flood Risk Assessment (FRA), where submitted, is proportionate to the site conditions, flood risks and magnitude of development and I agree that this information can be used as evidence to this sustainable drainage approach.

Submitter Details			
Completed by	JOE BULLOUGH		
Signed off by	PATRICK CLAYTON	Accreditation(s) and/or Qualification(s) of Signatory	CEng MIStructE
Date (dd/mm/yyyy)	15.12.2023	Company	RENAISSANCE ASSOCIATES LTD

Client Details			
Name	-	Company	FORSHAW GROUP

APPENDIX L

OVERLAND FLOW ROUTES PLAN

APPENDIX M

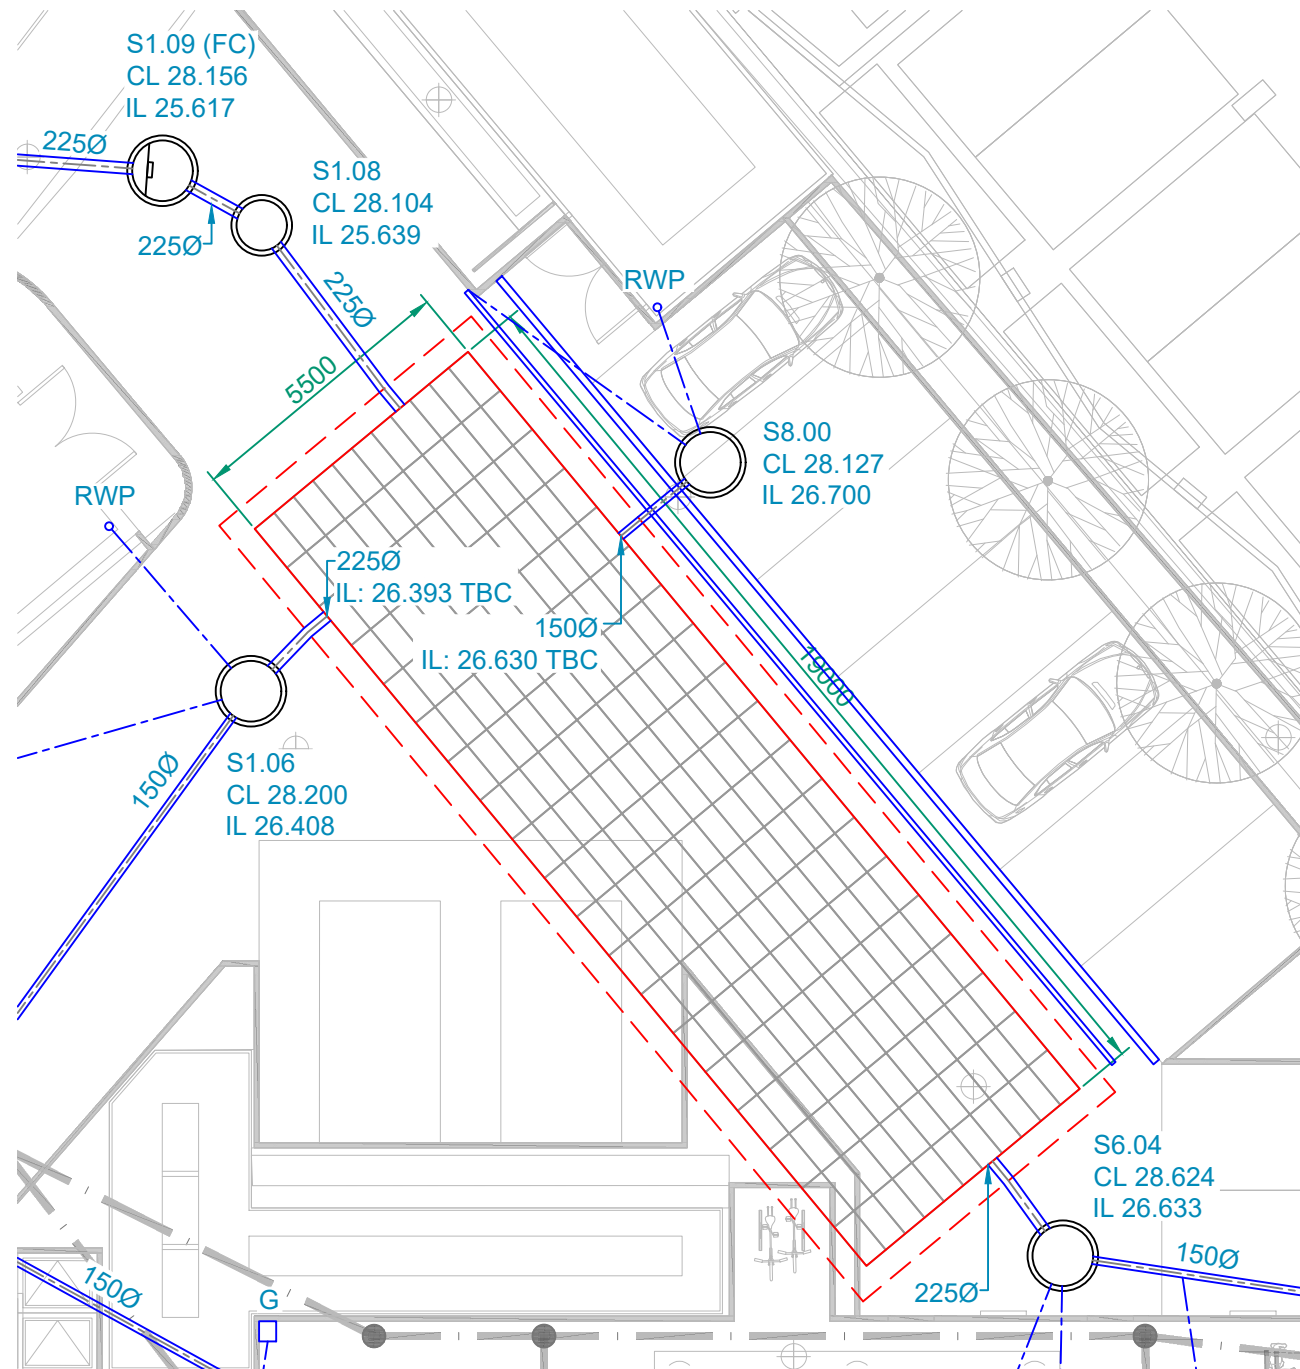
FLOW CONTROL AND TANK DETAILS

NOTES

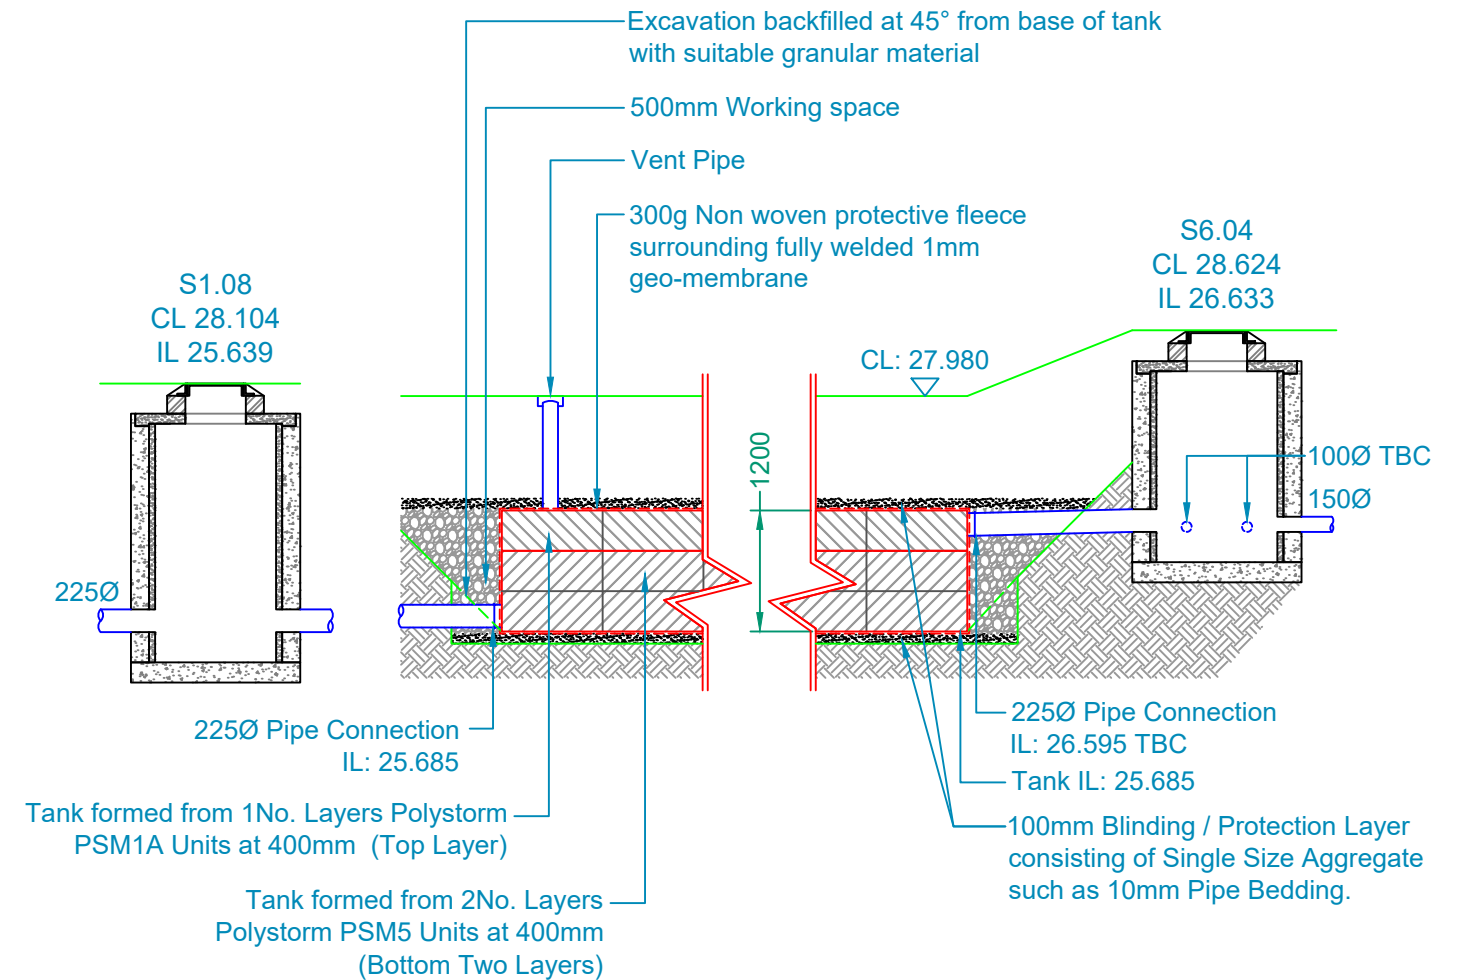
1. Proposed Hydro WMS layout.
2. All dimensions are in millimetres, all elevations in metres unless otherwise stated.
3. All temporary and enabling works by others.
4. All dimensions of fabricated items are nominal and may vary within manufacturing tolerances.

19.0 x 5.5 x 1.2m deep
 Total Vol = 125.40m³
 Net Vol ≈ 119.13m³
 At 95% min Void Ratio
 209 PSM1A units (Top Layer)
 418 PSM5 units (Layer)

Extents of excavation to be an additional 500mm around the perimeter of the tank



Proposed Plan
 (Scale 1:150)



Proposed Section
 (Scale 1:75)

AquaBrake Flow Control



Project :- Conrbrook

Technical Information :-

AquaBrake Type : 82mm Orifice - TYPE3

Head = 1.225mH / Flow = 3.20 l/s

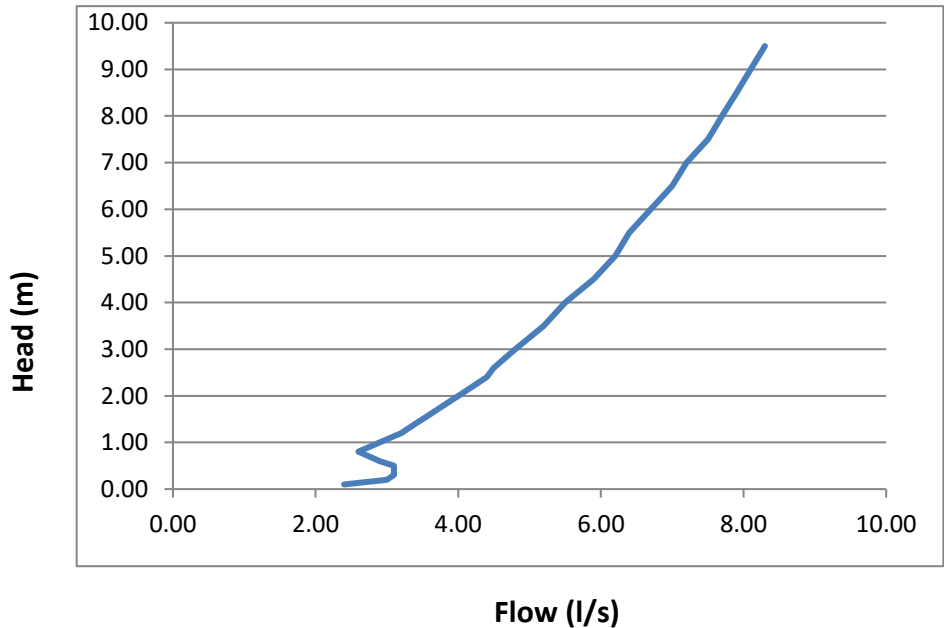
Primary Design Point (A)

Control Points	Head (m)	Flow (l/s)
Wash-Flo (B)	0.400	24.00
Hit-Flo ©	0.800	21.20

Wash-Flo (B)
The point at which the vortex begins to initiate and have a throttling effect. This point on the AquaBrake curve is usually much nearer to the maximum design flow (Design Point) than other vortex flow controls leading to more water passing through the unit during the earlier stages of a storm, thus reducing the amount of water that needs to be stored upstream.

Hit-Flo (C)
The point at which the vortex has initiated and at which the curve begins to return back to follow the orifice curve and reach the same design point or desired head / flow condition.

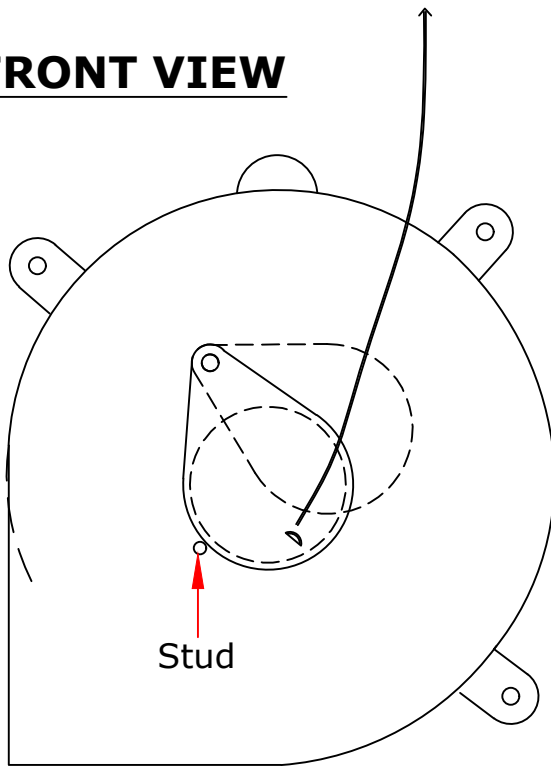
Head / Flow characteristic



Flow (l/s)	Head (m)
2.40	0.10
3.00	0.20
3.10	0.30
3.10	0.40
3.10	0.50
2.90	0.60
2.60	0.80
2.90	1.00
3.20	1.20
3.40	1.40
3.60	1.60
3.80	1.80
4.00	2.00
4.20	2.20
4.40	2.40
4.50	2.60
4.80	3.00
5.20	3.50
5.50	4.00
5.90	4.50
6.20	5.00
6.40	5.50
6.70	6.00
7.00	6.50
7.20	7.00
7.50	7.50
7.70	8.00
7.90	8.50
8.10	9.00
8.30	9.50

ROYLE HOUSE,
COWM TOP LN,
ROCHDALE
OL11 2PU
TEL: 01706 374416

FRONT VIEW



Stainless Steel
Straps

Sleeve Dia (O.D) - 100 mm

90 mm

150 mm

TOP VIEW

6 mm Ø Wire
Lifting Lug

490 mm

3 Nos. Stainless steel
straps with 10 mm hole
- welded

Sleeve

82 mm

Outlet

3 mm

NOTES:

1. Quantity - 1
2. Outlet - 82 mm
3. All welds continuous,
unless otherwise noted

SECTION VIEW

KEYTEC
INSTALLATION SERVICES

ROYLE HOUSE,
COWM TOP LN,
ROCHDALE
OL11 2PU
TEL: 01706 374416
FAX 01706 376785

FLUIDIC-AMP AQUABRAKE
STAINLESS STEEL STRAP
ATTACHMENT FABRICATION
DRAWING

DATE
23/07/2025

DRAWN
KZ

NAME:

SCALE
N.T.S.

CHECKED
FA

JOB No.

REVISION No.

HEAD 1.225m
DISCHARGE 3.20 l/sec
(TYPE 3)