

LEVEL MONITORING

for Subsidence Management Services

3 Winstar Avenue, MANCHESTER, M20 2YG

Client:	Subsidence Management Services
Client Contact:	John Morrison
Claim Number:	500392020
Client Reference:	IFS-LBG-SUB-22-0102241
Policy Holder:	Mr Kevin Stout
Report Date:	28 September 2023
Our Ref:	M19269


Level Monitoring Readings

The following table shows the reading levels of the various Level Monitoring Station points.

Date	1	2	3	4	5	6	7	8
15/09/2022	10.3967	10.6514	10.4337	10.6034	10.3812	10.3724	10.3672	10.3793
29/11/2022	10.3963	10.6519	10.4337	10.6036	10.3804	10.3724	10.3675	10.3790
08/02/2023	10.3961	10.6522	10.4326	10.6016	10.3798	10.3715	10.3663	10.3782
26/04/2023	10.3941	10.6525	10.4315	10.6003	10.3797	10.3708	10.3652	10.3794
19/07/2023	10.3959	10.6531	10.4328	10.6016	10.3803	10.3710	10.3656	10.3784
23/09/2023	10.3970	10.6510	10.4339	10.6030	10.3800	10.3716	10.3667	10.3772



Level Monitoring Difference Graphs

The following graphs display the progressive movement that each Level Monitoring Station recorded at each separate site visit date to give an overall look at how much the property is moving.

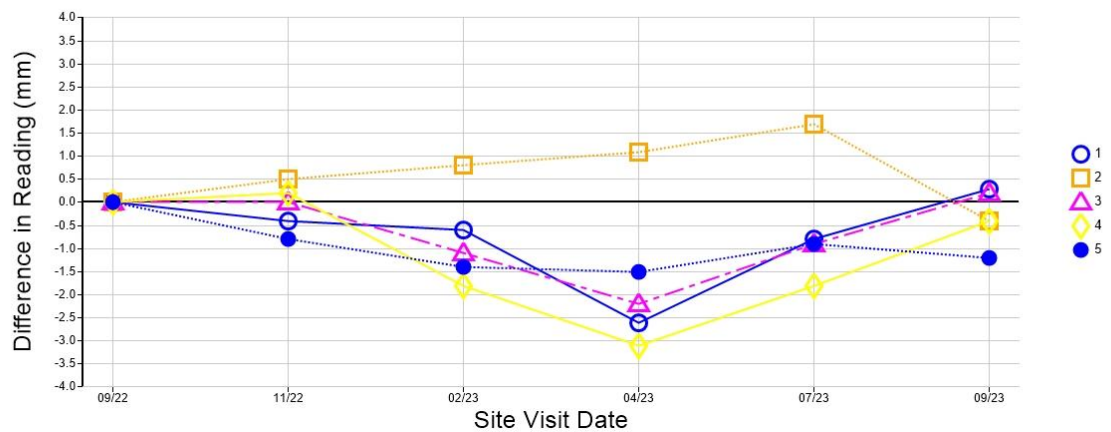

Level Monitoring Displacement Map

The following image shows an isometric representation of the movement of the property, based on the Level Monitoring Stations that were installed.

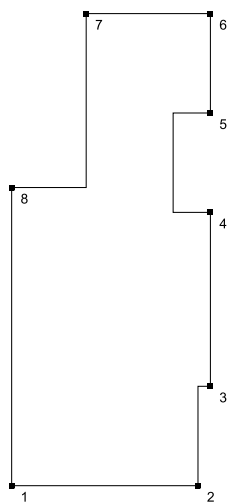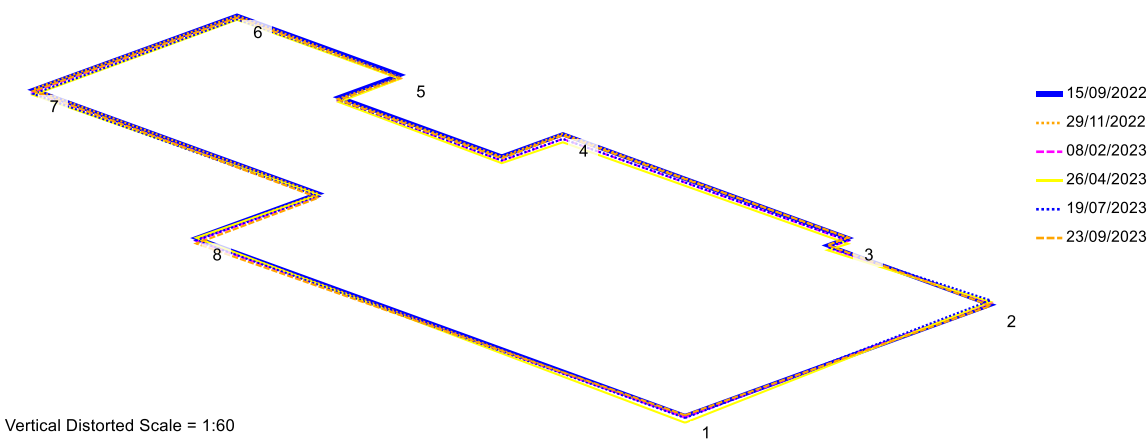

FRONT

Site Visit Notes

TBM located in drain at front of property. No secondary TBM located. If this is not suitable, please advise if a deep datum is required. Relative Survey.