C.J LYON & SONS LTD
BENTLEY NURSERIES, BENTLEY LANE
Tel. 01257 462986
nicola@cjlyon.co.uk

Project

Project Name:	W.P.I. CIVIL ENGINEERING LTD - MOUNT ROAD GORTON
Project Date:	14/07/2025
Inspection Standard:	MSCC5 Sewers & Drainage GB (SRM5 Scoring)

C.J LYON & SONS LTD
BENTLEY NURSERIES, BENTLEY LANE
Tel. 01257 462986
nicola@cjlyon.co.uk

Table of Contents

Project Name	Project Number	Project Date
W.P.I. CIVIL ENGINEERING LTD - MOUNT ROAD GORTON		14/07/2025

Project Information P-1
Section Item 1: F1 > C1 (F1X) 1
Section Item 2: F2 > F1 (F2X) 2
Section Item 3: F3 > F2 (F3X) 3
Section Item 4: F4 > F2 (F4X) 4
Section Item 5: F8 > F7 (F8X) 5
Section Item 6: F9 > F8 (F9X) 6
Section Item 7: F10 > F9 (F10X) 7
Section Item 8: F11 > F10 (F11X) 8
Section Item 9: F16 > F11 (F16X) 9
Section Item 10: F12 > F11 (F12X) 10
Section Item 11: F13 > F12 (F13X) 11
Section Item 12: F14 > F13 (F14X) 12
Section Item 13: F15 > F13 (F15X) 13
Section Item 14: F17 > F9 (F17X) 14
Section Item 15: F18 > F17 (F18X) 15
Section Item 16: F19 > F18 (F19X) 16
Section Item 17: F20 > F19 (F20X) 17
Section Item 18: F22 > F17 (F22X) 18
Section Item 19: S5 > S4 (S5X) 19
Section Item 20: S14 > S5 (S14X) 20
Section Item 21: S6 > S5 (S6X) 21
Section Item 22: S13 > S6 (S13X) 22
Section Item 23: S7 > S6 (S7X) 23
Section Item 24: S8 > S7 (S8X) 24
Section Item 25: S9 > S8 (S9X) 25
Section Item 26: S12 > S9 (S12X) 26
Section Item 27: S10 > S9 (S10X) 27
Section Item 28: S11 > S10 (S11X) 28

C.J LYON & SONS LTD
BENTLEY NURSERIES, BENTLEY LANE
Tel. 01257 462986
nicola@cjlyon.co.uk

Table of Contents

Project Name	Project Number	Project Date
W.P.I. CIVIL ENGINEERING LTD - MOUNT ROAD GORTON		14/07/2025

Section Item 29: S21 > S14 (S21X) 29
Section Item 30: S15 > S14 (S15X) 30
Section Item 31: S16 > S15 (S16X) 31
Section Item 32: S17 > S16 (S17X) 32
Section Item 33: S18 > S17 (S18X) 33
Section Item 34: S19 > S18 (S19X) 34
Section Item 35: S20 > S18 (S20X) 35
Section Item 36: S26 > S21 (S26X) 36
Section Item 37: S22 > S21 (S22X) 37
Section Item 38: S23 > S22 (S23X) 38
Section Item 39: S24 > S23 (S24X) 39
Section Item 40: S25 > S22 (S25X) 40
Section Item 41: S27 > S26 (S27X) 41
Section Item 42: S30 > S29 (S30X) 42
Section Item 43: S31 > S30 (S31X) 43
Section Item 44: S32 > S31 (S32X) 44
Section Item 45: S33 > S32 (S33X) 45
Section Item 46: S37 > S33 (S37X) 46
Section Item 47: S34 > S33 (S34X) 47
Section Item 48: S35 > S34 (S35X) 48
Section Item 49: S36 > S35 (S36X) 49
Section Item 50: F5 > F5A (F5X) 50
Section Item 51: F5A > C2 (F5AX) 51
Section Item 52: F6 > F5 (F6X) 52
Section Item 53: F7 > F6 (F7X) 54
Section Item 54: F21 > F18 (F21X) 55
Section Item 55: F24 > F6 (F24X) 57
Section Item 56: S2 > S1 (S2X) 58
Section Item 57: S3 > S2 (S3X) 59

C.J LYON & SONS LTD
BENTLEY NURSERIES, BENTLEY LANE
Tel. 01257 462986
nicola@cjlyon.co.uk

Table of Contents

Project Name	Project Number	Project Date
W.P.I. CIVIL ENGINEERING LTD - MOUNT ROAD GORTON		14/07/2025

Section Item 58: S4 > S3 (S4X) 60

C.J LYON & SONS LTD
BENTLEY NURSERIES, BENTLEY LANE
Tel. 01257 462986
nicola@cjlyon.co.uk

Project Information

Project Name	Project Number	Project Date
W.P.I. CIVIL ENGINEERING LTD - MOUNT ROAD GORTON		14/07/2025

Client

Company: W.P.I. CIVIL ENGINEERING LTD
Street: KING STREET TRADING ESTATE
Town or City: MIDDLEWICH
County: CHESHIRE
Post Code: CW10 9LF

Site

Company: W.P.I. CIVIL ENGINEERING LTD
Street: MOUNT ROAD
Town or City: GORTON

Contractor

Company: C.J LYON & SONS LTD
Contact: NICOLA CREAMER
Street: BENTLEY NURSERIES
Town or City: BENTLEY LANE
County: MAWDESLEY
Post Code: L40 3SN
Phone: 01257 462986
Email: nicola@cjlyon.co.uk

C.J LYON & SONS LTD
BENTLEY NURSERIES, BENTLEY LANE
Tel. 01257 462986
nicola@cjlyon.co.uk

Section Inspection - 12/09/2025 - F1X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
1	1	12/09/25	14:49	Not Specified	No Rain Or Snow	Yes	F1X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
M. Glover	Not Specified	Crawler Unit	Not Specified	Public Sewer	Not Specified

Town or Village:	Gorton	**Inspection Direction:**	Downstream	**Upstream Node:**	F1
Road:	Mount Road	**Inspected Length:**	8.60 m	**Upstream Pipe Depth:**	2.312 m
Location:	Road	**Total Length:**	8.60 m	**Downstream Node:**	C1
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	2.525 m

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: None
Recommendations:

Scale: 1:75

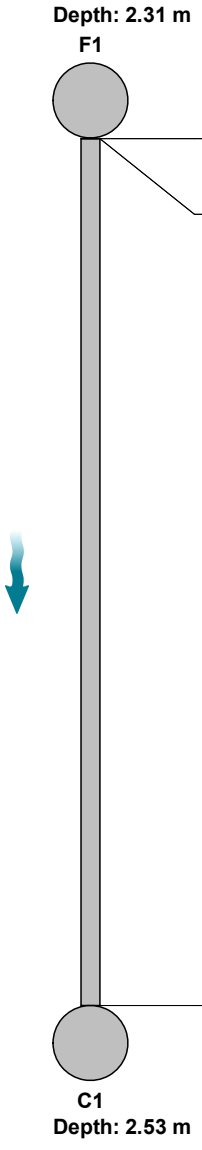

Position [m]	Code	Observation	MPEG	Photo	Grade
0.00	MH	Start node, manhole, reference: F1	00:00:00		
0.00	WL	Water level, 5% of the vertical dimension			
8.60	MHF	Finish node, manhole, reference: C1	00:01:21		

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

C.J LYON & SONS LTD
BENTLEY NURSERIES, BENTLEY LANE
Tel. 01257 462986
nicola@cjlyon.co.uk

Section Inspection - 11/07/2025 - F2X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
2	1	11/07/25	15:14	Not Specified	No Rain Or Snow	Yes	F2X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
M. Glover	Not Specified	Crawler Unit	Not Specified	Public Sewer	Not Specified

Town or Village:	Gorton	**Inspection Direction:**	Downstream	**Upstream Node:**	F2
Road:	Mount Road	**Inspected Length:**	51.30 m	**Upstream Pipe Depth:**	2.272 m
Location:	Road	**Total Length:**	51.30 m	**Downstream Node:**	F1
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	2.312 m

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: None
Recommendations:

Scale: 1:445

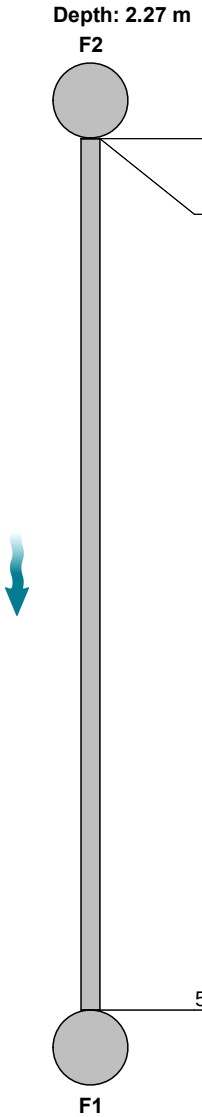

Position [m]	Code	Observation	MPEG	Photo	Grade
0.00	MH	Start node, manhole, reference: F2	00:00:00		
0.00	WL	Water level, 5% of the vertical dimension			
51.30	MHF	Finish node, manhole, reference: F1	00:00:00		

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

C.J LYON & SONS LTD
BENTLEY NURSERIES, BENTLEY LANE
Tel. 01257 462986
nicola@cjlyon.co.uk

Section Inspection - 11/07/2025 - F3X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
3	1	11/07/25	15:15	Not Specified	No Rain Or Snow	Yes	F3X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
M. Glover	Not Specified	Crawler Unit	Not Specified	Public Sewer	Not Specified

Town or Village:	Gorton	**Inspection Direction:**	Downstream	**Upstream Node:**	F3
Road:	Mount Road	**Inspected Length:**	52.50 m	**Upstream Pipe Depth:**	1.300 m
Location:	Road	**Total Length:**	52.50 m	**Downstream Node:**	F2
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	2.272 m

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: None
Recommendations:

Scale: 1:455

Position [m]	Code	Observation	MPEG	Photo	Grade
		Depth: 1.30 m			
		F3			
0.00	MH	Start node, manhole, reference: F3	00:00:00		
0.00	WL	Water level, 5% of the vertical dimension			
52.50	MHF	Finish node, manhole, reference: F2	00:00:00		
		F2			
		Depth: 2.27 m			

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

C.J LYON & SONS LTD
BENTLEY NURSERIES, BENTLEY LANE
Tel. 01257 462986
nicola@cjlyon.co.uk

Section Inspection - 11/07/2025 - F4X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
4	1	11/07/25	15:16	Not Specified	No Rain Or Snow	Yes	F4X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
M. Glover	Not Specified	Crawler Unit	Not Specified	Public Sewer	Not Specified

Town or Village:	Gorton	**Inspection Direction:**	Downstream	**Upstream Node:**	F4
Road:	Mount Road	**Inspected Length:**	30.00 m	**Upstream Pipe Depth:**	1.500 m
Location:	Road	**Total Length:**	30.00 m	**Downstream Node:**	F2
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	2.272 m

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: None
Recommendations:

Scale: 1:260

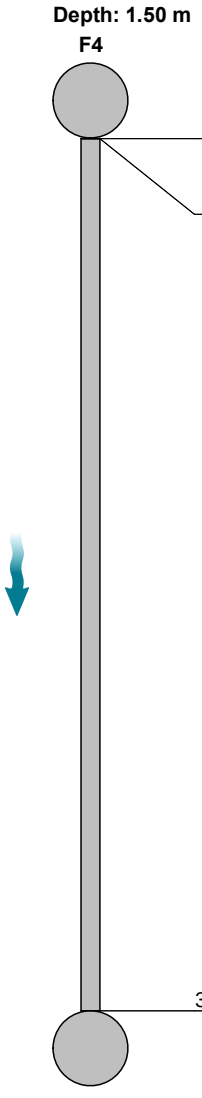

Position [m]	Code	Observation	MPEG	Photo	Grade
0.00	MH	Start node, manhole, reference: F4	00:00:00		
0.00	WL	Water level, 5% of the vertical dimension			
30.00	MHF	Finish node, manhole, reference: F2	00:00:00		

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

C.J LYON & SONS LTD
BENTLEY NURSERIES, BENTLEY LANE
Tel. 01257 462986
nicola@cjlyon.co.uk

Section Inspection - 12/09/2025 - F8X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
5	1	12/09/25	14:52	Not Specified	No Rain Or Snow	Yes	F8X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
M. Glover	Not Specified	Crawler Unit	Not Specified	Public Sewer	Not Specified

Town or Village:	Gorton	**Inspection Direction:**	Downstream	**Upstream Node:**	F8
Road:	Mount Road	**Inspected Length:**	46.70 m	**Upstream Pipe Depth:**	4.033 m
Location:	Road	**Total Length:**	46.70 m	**Downstream Node:**	F7
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	3.796 m

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: None
Recommendations:

Scale: 1:405

Depth: 4.03 m
F8



Position [m]	Code	Observation	MPEG	Photo	Grade
0.00	MH	Start node, manhole, reference: F8	00:00:00		
0.00	WL	Water level, 5% of the vertical dimension			
46.70	MHF	Finish node, manhole, reference: F7	00:00:00		

F7
Depth: 3.80 m

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

C.J LYON & SONS LTD
BENTLEY NURSERIES, BENTLEY LANE
Tel. 01257 462986
nicola@cjlyon.co.uk

Section Inspection - 12/09/2025 - F9X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
6	1	12/09/25	14:53	Not Specified	No Rain Or Snow	Yes	F9X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
M. Glover	Not Specified	Crawler Unit	Not Specified	Public Sewer	Not Specified

Town or Village:	Gorton	**Inspection Direction:**	Downstream	**Upstream Node:**	F9
Road:	Mount Road	**Inspected Length:**	13.60 m	**Upstream Pipe Depth:**	4.075 m
Location:	Road	**Total Length:**	13.60 m	**Downstream Node:**	F8
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	4.033 m

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: None
Recommendations:

Scale: 1:118

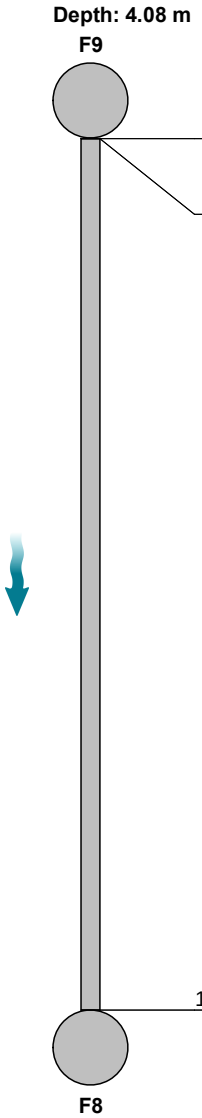

Position [m]	Code	Observation	MPEG	Photo	Grade
0.00	MH	Start node, manhole, reference: F9	00:00:00		
0.00	WL	Water level, 5% of the vertical dimension			
13.60	MHF	Finish node, manhole, reference: F8	00:00:00		

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

C.J LYON & SONS LTD
BENTLEY NURSERIES, BENTLEY LANE
Tel. 01257 462986
nicola@cjlyon.co.uk

Section Inspection - 12/09/2025 - F10X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
7	1	12/09/25	14:54	Not Specified	No Rain Or Snow	Yes	F10X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
M. Glover	Not Specified	Crawler Unit	Not Specified	Public Sewer	Not Specified

Town or Village:	Gorton	**Inspection Direction:**	Downstream	**Upstream Node:**	F10
Road:	Mount Road	**Inspected Length:**	54.50 m	**Upstream Pipe Depth:**	3.573 m
Location:	Road	**Total Length:**	54.90 m	**Downstream Node:**	F9
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	4.075 m

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: None
Recommendations:

Scale: 1:476

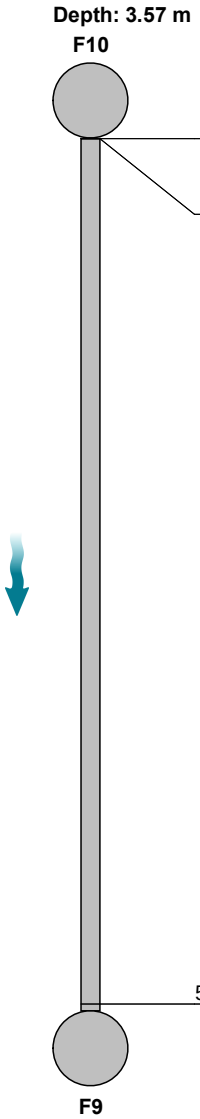

Position [m]	Code	Observation	MPEG	Photo	Grade
0.00	MH	Start node, manhole, reference: F10	00:00:00		
0.00	WL	Water level, 5% of the vertical dimension			
54.50	MHF	Finish node, manhole, reference: F9	00:00:00		

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

C.J LYON & SONS LTD
BENTLEY NURSERIES, BENTLEY LANE
Tel. 01257 462986
nicola@cjlyon.co.uk

Section Inspection - 12/09/2025 - F11X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
8	1	12/09/25	14:55	Not Specified	No Rain Or Snow	Yes	F11X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
M. Glover	Not Specified	Crawler Unit	Not Specified	Public Sewer	Not Specified

Town or Village:	Gorton	**Inspection Direction:**	Downstream	**Upstream Node:**	F11
Road:	Mount Road	**Inspected Length:**	48.80 m	**Upstream Pipe Depth:**	3.573 m
Location:	Road	**Total Length:**	48.80 m	**Downstream Node:**	F10
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	3.716 m

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: None
Recommendations:

Scale: 1:423

Depth: 3.57 m
F11



Position [m]	Code	Observation	MPEG	Photo	Grade
0.00	MH	Start node, manhole, reference: F11	00:00:00		
0.00	WL	Water level, 5% of the vertical dimension			
2.00	WL	Water level, 10% of the vertical dimension	00:00:18		
3.20	WL	Water level, 5% of the vertical dimension	00:00:27		
7.40	WL	Water level, 10% of the vertical dimension	00:01:02		
9.20	WL	Water level, 5% of the vertical dimension	00:01:17		
20.00	WL	Water level, 10% of the vertical dimension	00:02:48		
20.80	WL	Water level, 5% of the vertical dimension	00:02:56		
22.40	WL	Water level, 10% of the vertical dimension	00:03:08		
24.40	WL	Water level, 5% of the vertical dimension	00:03:24		
48.80	MHF	Finish node, manhole, reference: F10	00:00:00		

F10
Depth: 3.72 m

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

C.J LYON & SONS LTD
BENTLEY NURSERIES, BENTLEY LANE
Tel. 01257 462986
nicola@cjlyon.co.uk

Section Inspection - 12/09/2025 - F16X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
9	1	12/09/25	14:45	Not Specified	No Rain Or Snow	Yes	F16X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
M. Glover	Not Specified	Crawler Unit	Not Specified	Public Sewer	Not Specified

Town or Village:	Gorton	**Inspection Direction:**	Upstream	**Upstream Node:**	F16
Road:	Mount Road	**Inspected Length:**	33.00 m	**Upstream Pipe Depth:**	2.858 m
Location:	Road	**Total Length:**	33.00 m	**Downstream Node:**	F11
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	3.573 m

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: None
Recommendations:

Scale: 1:286

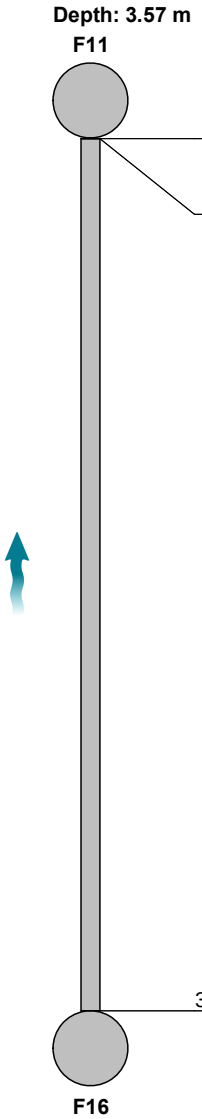

Position [m]	Code	Observation	MPEG	Photo	Grade
0.00	MH	Start node, manhole, reference: F11	00:00:00		
0.00	WL	Water level, 5% of the vertical dimension			
33.00	MHF	Finish node, manhole, reference: F16	00:00:00		

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

C.J LYON & SONS LTD
BENTLEY NURSERIES, BENTLEY LANE
Tel. 01257 462986
nicola@cjlyon.co.uk

Section Inspection - 12/09/2025 - F12X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
10	1	12/09/25	14:56	Not Specified	No Rain Or Snow	Yes	F12X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
M. Glover	Not Specified	Crawler Unit	Not Specified	Public Sewer	Not Specified

Town or Village:	Gorton	**Inspection Direction:**	Downstream	**Upstream Node:**	F12
Road:	Mount Road	**Inspected Length:**	39.70 m	**Upstream Pipe Depth:**	2.901 m
Location:	Road	**Total Length:**	39.70 m	**Downstream Node:**	F11
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	3.573 m

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: None
Recommendations:

Scale: 1:344

Depth: 2.90 m
F12



Position [m]	Code	Observation	MPEG	Photo	Grade
0.00	MH	Start node, manhole, reference: F12	00:00:00		
0.00	WL	Water level, 5% of the vertical dimension			
39.70	MHF	Finish node, manhole, reference: F11	00:05:46		

F11
Depth: 3.57 m

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

C.J LYON & SONS LTD
BENTLEY NURSERIES, BENTLEY LANE
Tel. 01257 462986
nicola@cjlyon.co.uk

Section Inspection - 12/09/2025 - F13X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
11	1	12/09/25	14:44	Not Specified	No Rain Or Snow	Yes	F13X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
M. Glover	Not Specified	Crawler Unit	Not Specified	Public Sewer	Not Specified

Town or Village:	Gorton	**Inspection Direction:**	Downstream	**Upstream Node:**	F13
Road:	Mount Road	**Inspected Length:**	41.50 m	**Upstream Pipe Depth:**	2.680 m
Location:	Road	**Total Length:**	41.50 m	**Downstream Node:**	F12
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	2.901 m

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: None
Recommendations:

Scale: 1:360

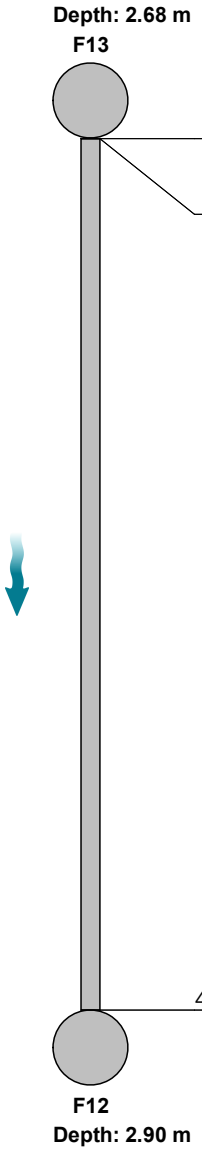

Position [m]	Code	Observation	MPEG	Photo	Grade
0.00	MH	Start node, manhole, reference: F13	00:00:00		
0.00	WL	Water level, 5% of the vertical dimension			
41.50	MHF	Finish node, manhole, reference: F12	00:00:00		

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

C.J LYON & SONS LTD
BENTLEY NURSERIES, BENTLEY LANE
Tel. 01257 462986
nicola@cjlyon.co.uk

Section Inspection - 11/07/2025 - F14X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
12	1	11/07/25	15:24	Not Specified	No Rain Or Snow	Yes	F14X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
M. Glover	Not Specified	Crawler Unit	Not Specified	Public Sewer	Not Specified

Town or Village:	Gorton	**Inspection Direction:**	Downstream	**Upstream Node:**	F14
Road:	Mount Road	**Inspected Length:**	31.80 m	**Upstream Pipe Depth:**	1.460 m
Location:	Road	**Total Length:**	31.80 m	**Downstream Node:**	F13
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	2.680 m

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: None
Recommendations:

Scale: 1:276

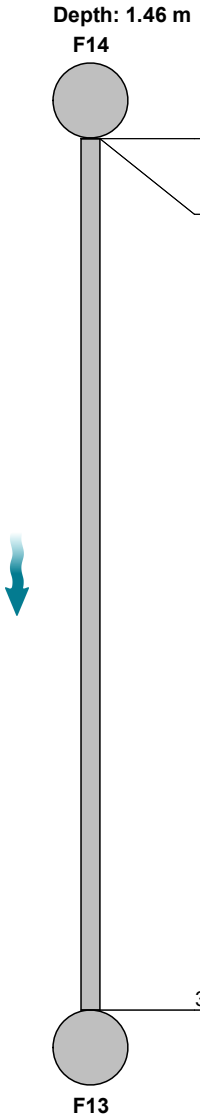

Position [m]	Code	Observation	MPEG	Photo	Grade
0.00	MH	Start node, manhole, reference: F14	00:00:00		
0.00	WL	Water level, 5% of the vertical dimension			
31.80	MHF	Finish node, manhole, reference: F13: Dropshaft	00:04:54		

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

C.J LYON & SONS LTD
BENTLEY NURSERIES, BENTLEY LANE
Tel. 01257 462986
nicola@cjlyon.co.uk

Section Inspection - 11/07/2025 - F15X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
13	1	11/07/25	15:25	Not Specified	No Rain Or Snow	Yes	F15X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
M. Glover	Not Specified	Crawler Unit	Not Specified	Public Sewer	Not Specified

Town or Village:	Gorton	**Inspection Direction:**	Downstream	**Upstream Node:**	F15
Road:	Mount Road	**Inspected Length:**	28.60 m	**Upstream Pipe Depth:**	2.620 m
Location:	Road	**Total Length:**	28.60 m	**Downstream Node:**	F13
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	2.680 m

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: None
Recommendations:

Scale: 1:248

Position [m]	Code	Observation	MPEG	Photo	Grade
		Depth: 2.62 m **F15**			
0.00	MH	Start node, manhole, reference: F15	00:00:00		
0.00	WL	Water level, 5% of the vertical dimension			
28.60	MHF	Finish node, manhole, reference: F13	00:00:00		
		F13 **Depth: 2.68 m**			

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

C.J LYON & SONS LTD
BENTLEY NURSERIES, BENTLEY LANE
Tel. 01257 462986
nicola@cjlyon.co.uk

Section Inspection - 11/07/2025 - F17X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
14	1	11/07/25	15:26	Not Specified	No Rain Or Snow	Yes	F17X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
M. Glover	Not Specified	Crawler Unit	Not Specified	Public Sewer	Not Specified

Town or Village:	Gorton	**Inspection Direction:**	Downstream	**Upstream Node:**	F17
Road:	Mount Road	**Inspected Length:**	58.00 m	**Upstream Pipe Depth:**	2.737 m
Location:	Road	**Total Length:**	58.00 m	**Downstream Node:**	F9
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	4.075 m

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: None
Recommendations:

Scale: 1:503

Position [m]	Code	Observation	MPEG	Photo	Grade
		Depth: 2.74 m			
		F17			
0.00	MH	Start node, manhole, reference: F17	00:00:00		
0.00	WL	Water level, 5% of the vertical dimension			
58.00	MHF	Finish node, manhole, reference: F9: Dropshaft	00:08:20		
		F9			
		Depth: 4.08 m			

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

C.J LYON & SONS LTD
BENTLEY NURSERIES, BENTLEY LANE
Tel. 01257 462986
nicola@cjlyon.co.uk

Section Inspection - 11/07/2025 - F18X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
15	1	11/07/25	15:28	Not Specified	No Rain Or Snow	Yes	F18X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
M. Glover	Not Specified	Crawler Unit	Not Specified	Public Sewer	Not Specified

Town or Village:	Gorton	**Inspection Direction:**	Downstream	**Upstream Node:**	F18
Road:	Mount Road	**Inspected Length:**	27.30 m	**Upstream Pipe Depth:**	2.655 m
Location:	Road	**Total Length:**	27.30 m	**Downstream Node:**	F17
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	2.737 m

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: None
Recommendations:

Scale: 1:237

Position [m]	Code	Observation	MPEG	Photo	Grade
		Depth: 2.66 m			
		F18			
0.00	MH	Start node, manhole, reference: F18	00:00:00		
0.00	WL	Water level, 5% of the vertical dimension			
27.30	MHF	Finish node, manhole, reference: F17	00:03:47		
		F17			
		Depth: 2.74 m			

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

C.J LYON & SONS LTD
BENTLEY NURSERIES, BENTLEY LANE
Tel. 01257 462986
nicola@cjlyon.co.uk

Section Inspection - 11/07/2025 - F19X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
16	1	11/07/25	15:29	Not Specified	No Rain Or Snow	Yes	F19X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
M. Glover	Not Specified	Crawler Unit	Not Specified	Public Sewer	Not Specified

Town or Village:	Gorton	**Inspection Direction:**	Downstream	**Upstream Node:**	F19
Road:	Mount Road	**Inspected Length:**	31.10 m	**Upstream Pipe Depth:**	2.480 m
Location:	Road	**Total Length:**	31.10 m	**Downstream Node:**	F18
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	2.655 m

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: None
Recommendations:

Scale: 1:270

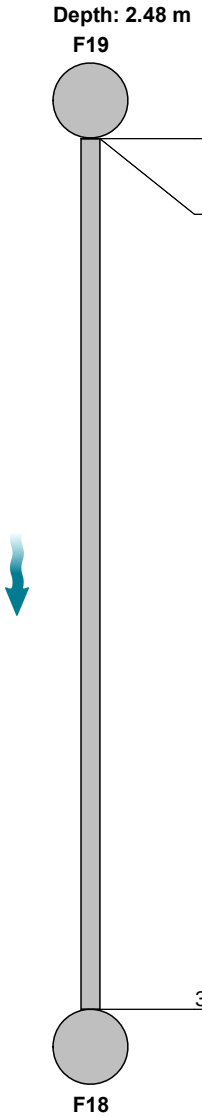

Position [m]	Code	Observation	MPEG	Photo	Grade
0.00	MH	Start node, manhole, reference: F19	00:00:00		
0.00	WL	Water level, 5% of the vertical dimension			
31.10	MHF	Finish node, manhole, reference: F18	00:04:17		

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

C.J LYON & SONS LTD
BENTLEY NURSERIES, BENTLEY LANE
Tel. 01257 462986
nicola@cjlyon.co.uk

Section Inspection - 11/07/2025 - F20X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
17	1	11/07/25	15:30	Not Specified	No Rain Or Snow	Yes	F20X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
M. Glover	Not Specified	Crawler Unit	Not Specified	Public Sewer	Not Specified

Town or Village:	Gorton	**Inspection Direction:**	Upstream	**Upstream Node:**	F20
Road:	Mount Road	**Inspected Length:**	21.40 m	**Upstream Pipe Depth:**	2.369 m
Location:	Road	**Total Length:**	21.40 m	**Downstream Node:**	F19
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	2.480 m

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: None
Recommendations:

Scale: 1:186



Position [m]	Code	Observation	MPEG	Photo	Grade
Depth: 2.48 m					
F19					
0.00	MH	Start node, manhole, reference: F19	00:00:00		
0.00	WL	Water level, 5% of the vertical dimension			
21.40	MHF	Finish node, manhole, reference: F20	00:03:07		
F20					
Depth: 2.37 m					

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

C.J LYON & SONS LTD
BENTLEY NURSERIES, BENTLEY LANE
Tel. 01257 462986
nicola@cjlyon.co.uk

Section Inspection - 11/07/2025 - F22X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
18	1	11/07/25	15:30	Not Specified	No Rain Or Snow	Yes	F22X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
M. Glover	Not Specified	Crawler Unit	Not Specified	Public Sewer	Not Specified

Town or Village:	Gorton	**Inspection Direction:**	Downstream	**Upstream Node:**	F22
Road:	Mount Road	**Inspected Length:**	19.50 m	**Upstream Pipe Depth:**	2.024 m
Location:	Road	**Total Length:**	19.50 m	**Downstream Node:**	F17
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	2.737 m

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: None
Recommendations:

Scale: 1:169

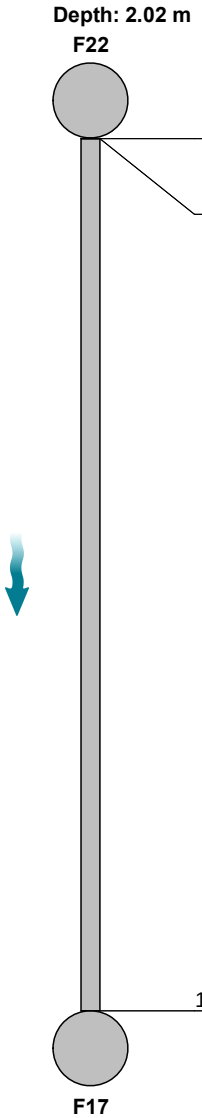

Position [m]	Code	Observation	MPEG	Photo	Grade
0.00	MH	Start node, manhole, reference: F22	00:00:00		
0.00	WL	Water level, 5% of the vertical dimension			
19.50	MHF	Finish node, manhole, reference: F17	00:00:00		

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

C.J LYON & SONS LTD
BENTLEY NURSERIES, BENTLEY LANE
Tel. 01257 462986
nicola@cjlyon.co.uk

Section Inspection - 14/07/2025 - S5X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
19	1	14/07/25	8:04	Not Specified	No Rain Or Snow	Yes	S5X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
M. Glover	Not Specified	Crawler Unit	Not Specified	Public Sewer	Not Specified

Town or Village:	Gorton	**Inspection Direction:**	Downstream	**Upstream Node:**	S5
Road:	Mount Road	**Inspected Length:**	34.80 m	**Upstream Pipe Depth:**	2.278 m
Location:	Road	**Total Length:**	34.80 m	**Downstream Node:**	S4
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	2.420 m

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	1,050 mm
Flow Control:	No flow control	**Material:**	Concrete
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: None
Recommendations:

Scale: 1:302

Position [m]	Code	Observation	MPEG	Photo	Grade
		Depth: 2.28 m			
		S5			
0.00	MH	Start node, manhole, reference: S5	00:00:00		
0.00	WL	Water level, 5% of the vertical dimension			
34.80	MHF	Finish node, manhole, reference: S4	00:02:24		
		S4			
		Depth: 2.42 m			

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

C.J LYON & SONS LTD
BENTLEY NURSERIES, BENTLEY LANE
Tel. 01257 462986
nicola@cjlyon.co.uk

Section Inspection - 14/07/2025 - S14X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
20	1	14/07/25	8:05	Not Specified	No Rain Or Snow	Yes	S14X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
M. Glover	Not Specified	Crawler Unit	Not Specified	Public Sewer	Not Specified

Town or Village:	Gorton	**Inspection Direction:**	Upstream	**Upstream Node:**	S14
Road:	Mount Road	**Inspected Length:**	57.80 m	**Upstream Pipe Depth:**	2.814 m
Location:	Road	**Total Length:**	57.80 m	**Downstream Node:**	S5
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	2.278 m

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	1,050 mm
Flow Control:	No flow control	**Material:**	Concrete
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining
Comments:	None		
Recommendations:			

Scale: 1:501



Position [m]	Code	Observation	MPEG	Photo	Grade
0.00	MH	Start node, manhole, reference: S5	00:00:00		
0.00	WL	Water level, 5% of the vertical dimension			
12.40	CN	Connection other than junction at 11 o'clock, 150mm dia	00:01:03		
17.90	CN	Connection other than junction at 11 o'clock, 150mm dia	00:01:58		
17.90	CN	Connection other than junction at 1 o'clock, 150mm dia	00:02:02		
50.00	CN	Connection other than junction at 11 o'clock, 150mm dia	00:05:45		
50.00	CN	Connection other than junction at 1 o'clock, 150mm dia	00:05:47		
57.80	MHF	Finish node, manhole, reference: S14	00:06:53		

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

C.J LYON & SONS LTD
BENTLEY NURSERIES, BENTLEY LANE
Tel. 01257 462986
nicola@cjlyon.co.uk

Section Inspection - 14/07/2025 - S6X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
21	1	14/07/25	8:06	Not Specified	No Rain Or Snow	Yes	S6X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
M. Glover	Not Specified	Crawler Unit	Not Specified	Public Sewer	Not Specified

Town or Village:	Gorton	**Inspection Direction:**	Downstream	**Upstream Node:**	S6
Road:	Mount Road	**Inspected Length:**	81.30 m	**Upstream Pipe Depth:**	2.613 m
Location:	Road	**Total Length:**	81.30 m	**Downstream Node:**	S5
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	2.278 m

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	1,050 mm
Flow Control:	No flow control	**Material:**	Concrete
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: None
Recommendations:

Scale: 1:704

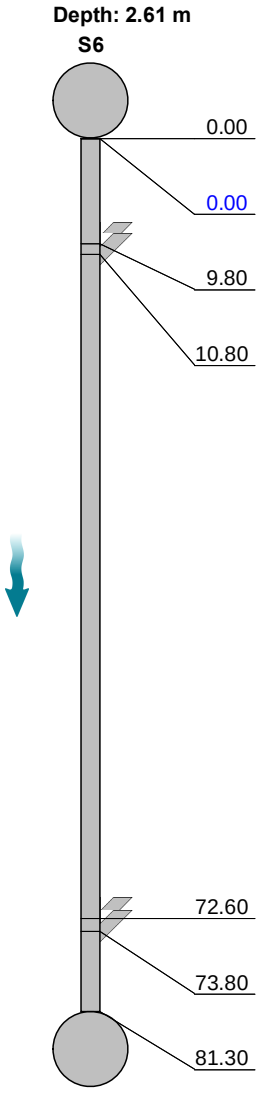

Position [m]	Code	Observation	MPEG	Photo	Grade
0.00	MH	Start node, manhole, reference: S6	00:00:00		
0.00	WL	Water level, 5% of the vertical dimension			
9.80	CN	Connection other than junction at 11 o'clock, 150mm dia	00:00:58		
10.80	CN	Connection other than junction at 11 o'clock, 150mm dia	00:01:06		
72.60	CN	Connection other than junction at 11 o'clock, 150mm dia	00:05:03		
73.80	CN	Connection other than junction at 11 o'clock, 150mm dia	00:05:15		
81.30	MHF	Finish node, manhole, reference: S5	00:00:00		

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

C.J LYON & SONS LTD
BENTLEY NURSERIES, BENTLEY LANE
Tel. 01257 462986
nicola@cjlyon.co.uk

Section Inspection - 14/07/2025 - S13X


Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
22	1	14/07/25	8:06	Not Specified	No Rain Or Snow	Yes	S13X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
M. Glover	Not Specified	Crawler Unit	Not Specified	Public Sewer	Not Specified

Town or Village:	Gorton	**Inspection Direction:**	Upstream	**Upstream Node:**	S13
Road:	Mount Road	**Inspected Length:**	26.20 m	**Upstream Pipe Depth:**	2.766 m
Location:	Road	**Total Length:**	26.20 m	**Downstream Node:**	S6
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	2.613 m

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	1,050 mm
Flow Control:	No flow control	**Material:**	Concrete
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining
Comments:	None		
Recommendations:			

Scale: 1:227

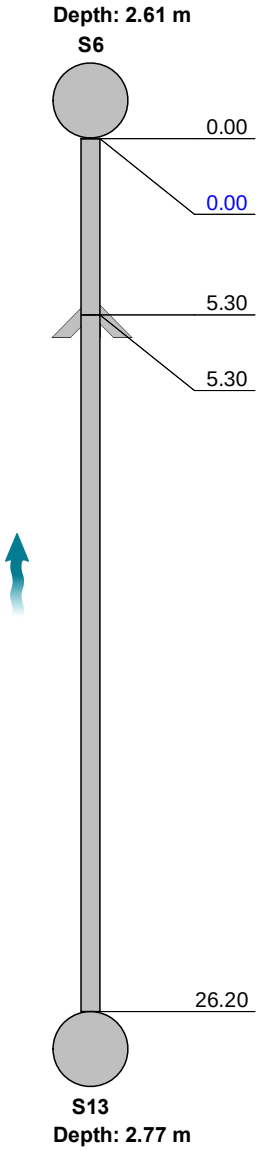

Position [m]	Code	Observation	MPEG	Photo	Grade
0.00	MH	Start node, manhole, reference: S6	00:00:00		
0.00	WL	Water level, 5% of the vertical dimension			
5.30	CN	Connection other than junction at 11 o'clock, 150mm dia	00:00:25		
5.30	CN	Connection other than junction at 1 o'clock, 150mm dia	00:00:29		
26.20	MHF	Finish node, manhole, reference: S13	00:00:00		

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

C.J LYON & SONS LTD
BENTLEY NURSERIES, BENTLEY LANE
Tel. 01257 462986
nicola@cjlyon.co.uk

Section Inspection - 14/07/2025 - S7X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
23	1	14/07/25	8:07	Not Specified	No Rain Or Snow	Yes	S7X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
M. Glover	Not Specified	Crawler Unit	Not Specified	Public Sewer	Not Specified

Town or Village:	Gorton	**Inspection Direction:**	Downstream	**Upstream Node:**	S7
Road:	Mount Road	**Inspected Length:**	86.80 m	**Upstream Pipe Depth:**	2.782 m
Location:	Road	**Total Length:**	86.80 m	**Downstream Node:**	S6
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	2.613 m

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	1,050 mm
Flow Control:	No flow control	**Material:**	Concrete
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: None
Recommendations:

Scale: 1:752

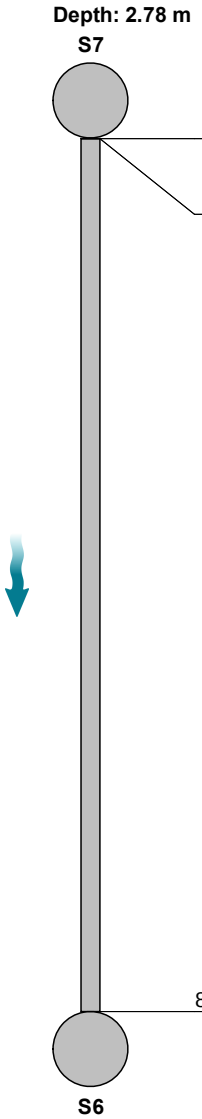

Position [m]	Code	Observation	MPEG	Photo	Grade
0.00	MH	Start node, manhole, reference: S7	00:00:00		
0.00	WL	Water level, 5% of the vertical dimension			
86.80	MHF	Finish node, manhole, reference: S6	00:06:02		

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

C.J LYON & SONS LTD
BENTLEY NURSERIES, BENTLEY LANE
Tel. 01257 462986
nicola@cjlyon.co.uk

Section Inspection - 14/07/2025 - S8X


Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
24	1	14/07/25	8:07	Not Specified	No Rain Or Snow	Yes	S8X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
M. Glover	Not Specified	Crawler Unit	Not Specified	Public Sewer	Not Specified

Town or Village:	Gorton	**Inspection Direction:**	Upstream	**Upstream Node:**	S8
Road:	Mount Road	**Inspected Length:**	56.10 m	**Upstream Pipe Depth:**	3.239 m
Location:	Road	**Total Length:**	56.10 m	**Downstream Node:**	S7
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	2.782 m

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	1,050 mm
Flow Control:	No flow control	**Material:**	Concrete
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining
Comments:	None		
Recommendations:			

Scale: 1:486

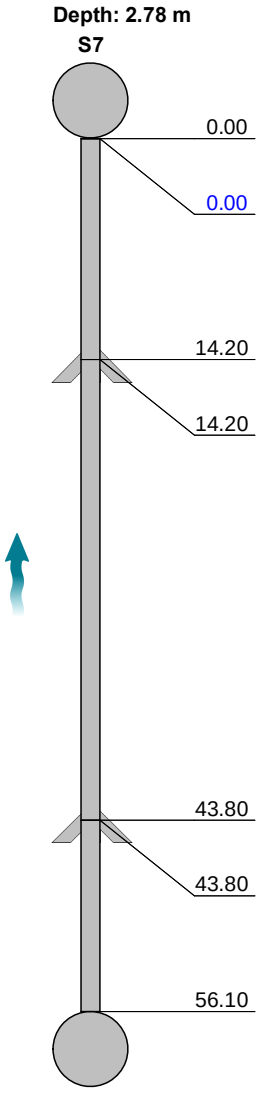

Position [m]	Code	Observation	MPEG	Photo	Grade
0.00	MH	Start node, manhole, reference: S8	00:00:00		
0.00	WL	Water level, 5% of the vertical dimension			
14.20	CN	Connection other than junction at 1 o'clock, 150mm dia	00:01:00		
14.20	CN	Connection other than junction at 11 o'clock, 150mm dia	00:01:02		
43.80	CN	Connection other than junction at 11 o'clock, 150mm dia	00:02:59		
43.80	CN	Connection other than junction at 1 o'clock, 150mm dia	00:03:06		
56.10	MHF	Finish node, manhole, reference: S7	00:03:54		

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

C.J LYON & SONS LTD
BENTLEY NURSERIES, BENTLEY LANE
Tel. 01257 462986
nicola@cjlyon.co.uk

Section Inspection - 14/07/2025 - S9X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
25	1	14/07/25	8:08	Not Specified	No Rain Or Snow	Yes	S9X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
M. Glover	Not Specified	Crawler Unit	Not Specified	Public Sewer	Not Specified

Town or Village:	Gorton	**Inspection Direction:**	Downstream	**Upstream Node:**	S9
Road:	Mount Road	**Inspected Length:**	48.70 m	**Upstream Pipe Depth:**	3.614 m
Location:	Road	**Total Length:**	48.70 m	**Downstream Node:**	S8
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	3.239 m

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	1,050 mm
Flow Control:	No flow control	**Material:**	Concrete
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: None
Recommendations:

Scale: 1:422

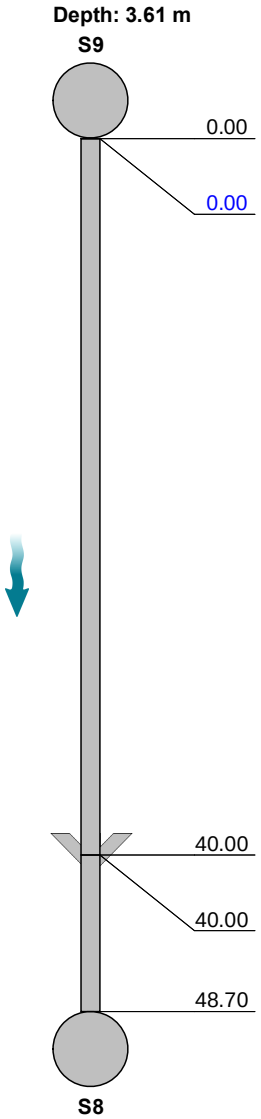

Position [m]	Code	Observation	MPEG	Photo	Grade
0.00	MH	Start node, manhole, reference: S9	00:00:00		
0.00	WL	Water level, 5% of the vertical dimension			
40.00	CN	Connection other than junction at 11 o'clock, 150mm dia	00:02:45		
40.00	CN	Connection other than junction at 1 o'clock, 150mm dia	00:02:52		
48.70	MHF	Finish node, manhole, reference: S8	00:00:00		

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

C.J LYON & SONS LTD
BENTLEY NURSERIES, BENTLEY LANE
Tel. 01257 462986
nicola@cjlyon.co.uk

Section Inspection - 14/07/2025 - S12X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
26	1	14/07/25	8:08	Not Specified	No Rain Or Snow	Yes	S12X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
M. Glover	Not Specified	Crawler Unit	Not Specified	Public Sewer	Not Specified

Town or Village:	Gorton	**Inspection Direction:**	Upstream	**Upstream Node:**	S12
Road:	Mount Road	**Inspected Length:**	42.10 m	**Upstream Pipe Depth:**	2.717 m
Location:	Road	**Total Length:**	42.10 m	**Downstream Node:**	S9
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	3.614 m

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	1,050 mm
Flow Control:	No flow control	**Material:**	Concrete
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: None
Recommendations:

Scale: 1:365

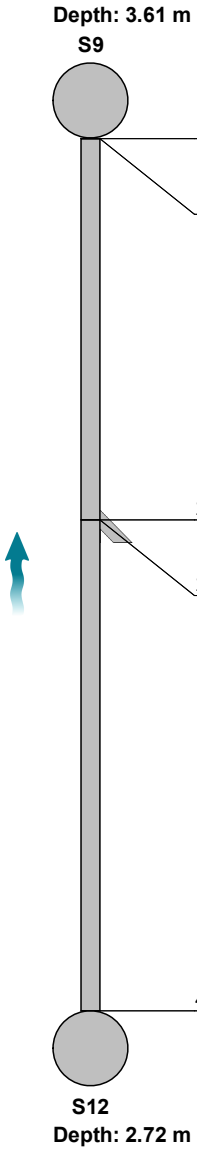

Position [m]	Code	Observation	MPEG	Photo	Grade
0.00	MH	Start node, manhole, reference: S9	00:00:00		
0.00	WL	Water level, 5% of the vertical dimension			
18.40	CN	Connection other than junction at 11 o'clock, 150mm dia	00:01:25		
18.40	CN	Connection other than junction at 11 o'clock, 150mm dia	00:01:30		
42.10	MHF	Finish node, manhole, reference: S12	00:02:58		

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

C.J LYON & SONS LTD
BENTLEY NURSERIES, BENTLEY LANE
Tel. 01257 462986
nicola@cjlyon.co.uk

Section Inspection - 14/07/2025 - S10X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
27	1	14/07/25	8:09	Not Specified	No Rain Or Snow	Yes	S10X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
M. Glover	Not Specified	Crawler Unit	Not Specified	Public Sewer	Not Specified

Town or Village:	Gorton	**Inspection Direction:**	Downstream	**Upstream Node:**	S10
Road:	Mount Road	**Inspected Length:**	34.20 m	**Upstream Pipe Depth:**	3.086 m
Location:	Road	**Total Length:**	34.20 m	**Downstream Node:**	S9
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	3.614 m

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	1,050 mm
Flow Control:	No flow control	**Material:**	Concrete
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: None
Recommendations:

Scale: 1:297

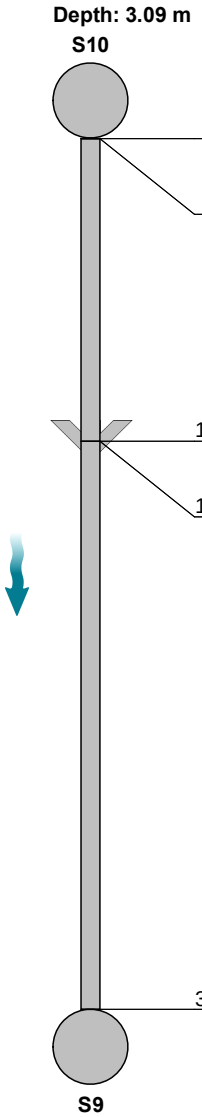

Position [m]	Code	Observation	MPEG	Photo	Grade
0.00	MH	Start node, manhole, reference: S10	00:00:00		
0.00	WL	Water level, 5% of the vertical dimension			
11.90	CN	Connection other than junction at 11 o'clock, 150mm dia	00:01:14		
11.90	CN	Connection other than junction at 1 o'clock, 150mm dia	00:01:23		
34.20	MHF	Finish node, manhole, reference: S9	00:02:52		

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

C.J LYON & SONS LTD
BENTLEY NURSERIES, BENTLEY LANE
Tel. 01257 462986
nicola@cjlyon.co.uk

Section Inspection - 14/07/2025 - S11X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
28	1	14/07/25	8:09	Not Specified	No Rain Or Snow	Yes	S11X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
M. Glover	Not Specified	Crawler Unit	Not Specified	Public Sewer	Not Specified

Town or Village:	Gorton	**Inspection Direction:**	Upstream	**Upstream Node:**	S11
Road:	Mount Road	**Inspected Length:**	23.20 m	**Upstream Pipe Depth:**	2.741 m
Location:	Road	**Total Length:**	23.20 m	**Downstream Node:**	S10
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	3.084 m

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	1,050 mm
Flow Control:	No flow control	**Material:**	Concrete
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: None
Recommendations:

Scale: 1:201



Position [m]	Code	Observation	MPEG	Photo	Grade
0.00	MH	Start node, manhole, reference: S10	00:00:00		
0.00	WL	Water level, 5% of the vertical dimension			
8.00	CN	Connection other than junction at 11 o'clock, 150mm dia	00:00:41		
8.00	CN	Connection other than junction at 1 o'clock, 150mm dia	00:00:45		
20.60	CN	Connection other than junction at 1 o'clock, 150mm dia	00:01:46		
23.20	MHF	Finish node, manhole, reference: S11	00:00:00		

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

C.J LYON & SONS LTD
BENTLEY NURSERIES, BENTLEY LANE
Tel. 01257 462986
nicola@cjlyon.co.uk

Section Inspection - 14/07/2025 - S21X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
29	1	14/07/25	8:10	Not Specified	No Rain Or Snow	Yes	S21X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
M. Glover	Not Specified	Crawler Unit	Not Specified	Public Sewer	Not Specified

Town or Village:	Gorton	**Inspection Direction:**	Upstream	**Upstream Node:**	S21
Road:	Mount Road	**Inspected Length:**	57.10 m	**Upstream Pipe Depth:**	
Location:	Road	**Total Length:**	57.10 m	**Downstream Node:**	S14
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	2.814 m

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	1,050 mm
Flow Control:	No flow control	**Material:**	Concrete
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: None
Recommendations:

Scale: 1:495

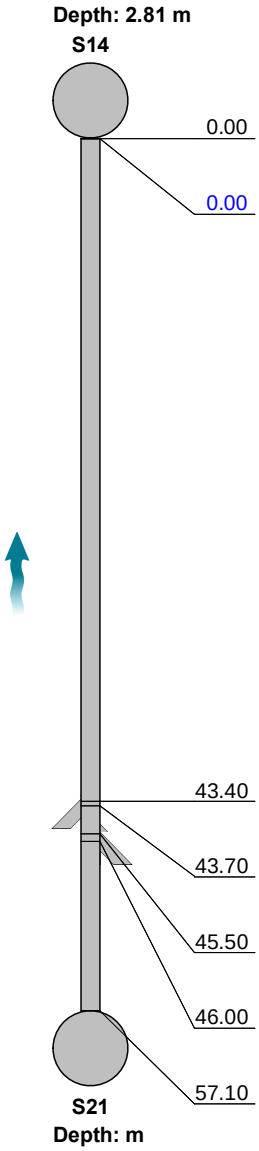

Position [m]	Code	Observation	MPEG	Photo	Grade
0.00	MH	Start node, manhole, reference: S14	00:00:00		
0.00	WL	Water level, 5% of the vertical dimension			
43.40	CN	Connection other than junction at 1 o'clock, 150mm dia	00:02:51		
43.70	CN	Connection other than junction at 1 o'clock, 150mm dia	00:02:55		
45.50	CN	Connection other than junction at 11 o'clock, 150mm dia	00:03:06		
46.00	CN	Connection other than junction at 11 o'clock, 150mm dia	00:03:08		
57.10	MHF	Finish node, manhole, reference: S21	00:00:00		

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

C.J LYON & SONS LTD
BENTLEY NURSERIES, BENTLEY LANE
Tel. 01257 462986
nicola@cjlyon.co.uk

Section Inspection - 14/07/2025 - S15X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
30	1	14/07/25	8:10	Not Specified	No Rain Or Snow	Yes	S15X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
M. Glover	Not Specified	Crawler Unit	Not Specified	Public Sewer	Not Specified

Town or Village:	Gorton	**Inspection Direction:**	Downstream	**Upstream Node:**	S15
Road:	Mount Road	**Inspected Length:**	47.10 m	**Upstream Pipe Depth:**	2.561 m
Location:	Road	**Total Length:**	47.10 m	**Downstream Node:**	S14
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	2.814 m

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	1,050 mm
Flow Control:	No flow control	**Material:**	Concrete
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: None
Recommendations:

Scale: 1:408

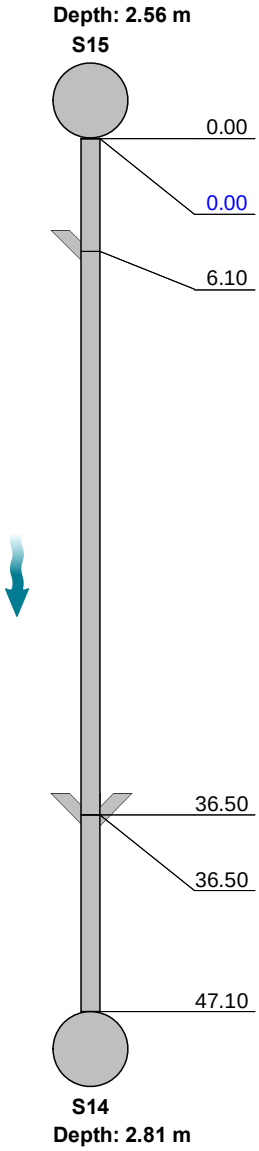

Position [m]	Code	Observation	MPEG	Photo	Grade
0.00	MH	Start node, manhole, reference: S15	00:00:00		
0.00	WL	Water level, 5% of the vertical dimension			
6.10	CN	Connection other than junction at 1 o'clock, 150mm dia	00:00:29		
36.50	CN	Connection other than junction at 11 o'clock, 150mm dia	00:02:31		
36.50	CN	Connection other than junction at 1 o'clock, 150mm dia	00:02:34		
47.10	MHF	Finish node, manhole, reference: S14	00:00:00		

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

C.J LYON & SONS LTD
BENTLEY NURSERIES, BENTLEY LANE
Tel. 01257 462986
nicola@cjlyon.co.uk

Section Inspection - 14/07/2025 - S16X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
31	1	14/07/25	8:11	Not Specified	No Rain Or Snow	Yes	S16X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
M. Glover	Not Specified	Crawler Unit	Not Specified	Public Sewer	Not Specified

Town or Village:	Gorton	**Inspection Direction:**	Downstream	**Upstream Node:**	S16
Road:	Mount Road	**Inspected Length:**	57.30 m	**Upstream Pipe Depth:**	2.407 m
Location:	Road	**Total Length:**	57.30 m	**Downstream Node:**	S15
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	2.561 m

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	1,050 mm
Flow Control:	No flow control	**Material:**	Concrete
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: None
Recommendations:

Scale: 1:497

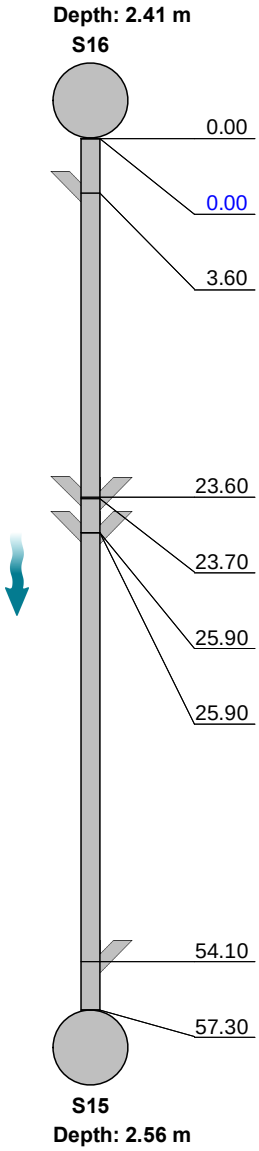

Position [m]	Code	Observation	MPEG	Photo	Grade
0.00	MH	Start node, manhole, reference: S16	00:00:00		
0.00	WL	Water level, 5% of the vertical dimension			
3.60	CN	Connection other than junction at 1 o'clock, 150mm dia	00:00:20		
23.60	CN	Connection other than junction at 1 o'clock, 150mm dia	00:01:39		
23.70	CN	Connection other than junction at 11 o'clock, 150mm dia	00:01:44		
25.90	CN	Connection other than junction at 11 o'clock, 150mm dia	00:01:57		
25.90	CN	Connection other than junction at 1 o'clock, 150mm dia	00:01:59		
54.10	CN	Connection other than junction at 11 o'clock, 150mm dia	00:03:48		
57.30	MHF	Finish node, manhole, reference: S15	00:00:00		

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

C.J LYON & SONS LTD
BENTLEY NURSERIES, BENTLEY LANE
Tel. 01257 462986
nicola@cjlyon.co.uk

Section Inspection - 14/07/2025 - S17X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
32	1	14/07/25	8:11	Not Specified	No Rain Or Snow	Yes	S17X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
M. Glover	Not Specified	Crawler Unit	Not Specified	Public Sewer	Not Specified

Town or Village:	Gorton	**Inspection Direction:**	Downstream	**Upstream Node:**	S17
Road:	Mount Road	**Inspected Length:**	20.20 m	**Upstream Pipe Depth:**	2.492 m
Location:	Road	**Total Length:**	20.20 m	**Downstream Node:**	S16
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	2.407 m

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	1,050 mm
Flow Control:	No flow control	**Material:**	Concrete
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: None
Recommendations:

Scale: 1:175



Position [m]	Code	Observation	MPEG	Photo	Grade
0.00	MH	Start node, manhole, reference: S17	00:00:00		
0.00	WL	Water level, 5% of the vertical dimension			
9.70	CN	Connection other than junction at 11 o'clock, 150mm dia	00:00:49		
9.70	CN	Connection other than junction at 1 o'clock, 150mm dia	00:00:51		
20.20	MHF	Finish node, manhole, reference: S16	00:00:00		

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

C.J LYON & SONS LTD
BENTLEY NURSERIES, BENTLEY LANE
Tel. 01257 462986
nicola@cjlyon.co.uk

Section Inspection - 14/07/2025 - S18X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
33	1	14/07/25	8:12	Not Specified	No Rain Or Snow	Yes	S18X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
M. Glover	Not Specified	Crawler Unit	Not Specified	Public Sewer	Not Specified

Town or Village:	Gorton	**Inspection Direction:**	Downstream	**Upstream Node:**	S18
Road:	Mount Road	**Inspected Length:**	61.80 m	**Upstream Pipe Depth:**	2.214 m
Location:	Road	**Total Length:**	61.80 m	**Downstream Node:**	S17
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	2.492 m

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	1,050 mm
Flow Control:	No flow control	**Material:**	Concrete
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: None
Recommendations:

Scale: 1:536

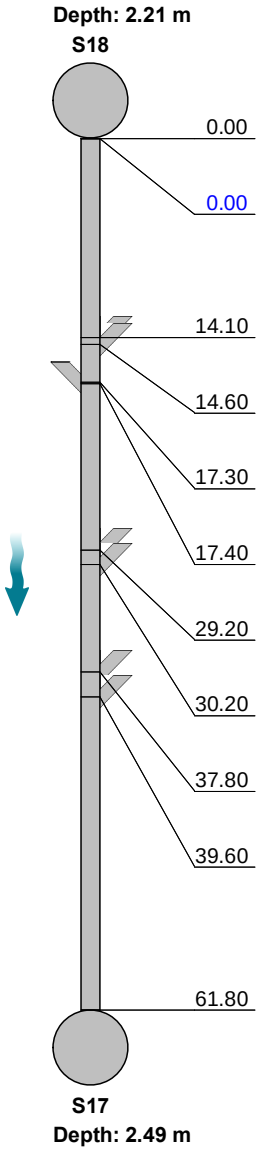

Position [m]	Code	Observation	MPEG	Photo	Grade
0.00	MH	Start node, manhole, reference: S18	00:00:00		
0.00	WL	Water level, 5% of the vertical dimension			
14.10	CN	Connection other than junction at 11 o'clock, 150mm dia	00:01:05		
14.60	CN	Connection other than junction at 11 o'clock, 150mm dia	00:01:10		
17.30	CN	Connection other than junction at 1 o'clock, 150mm dia	00:01:23		
17.40	CN	Connection other than junction at 1 o'clock, 150mm dia	00:01:26		
29.20	CN	Connection other than junction at 11 o'clock, 150mm dia	00:02:11		
30.20	CN	Connection other than junction at 11 o'clock, 150mm dia	00:02:18		
37.80	CN	Connection other than junction at 11 o'clock, 150mm dia	00:02:51		
39.60	CN	Connection other than junction at 11 o'clock, 150mm dia	00:03:00		
61.80	MHF	Finish node, manhole, reference: S17	00:00:00		

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

C.J LYON & SONS LTD
BENTLEY NURSERIES, BENTLEY LANE
Tel. 01257 462986
nicola@cjlyon.co.uk

Section Inspection - 14/07/2025 - S19X


Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
34	1	14/07/25	8:12	Not Specified	No Rain Or Snow	Yes	S19X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
M. Glover	Not Specified	Crawler Unit	Not Specified	Public Sewer	Not Specified

Town or Village:	Gorton	**Inspection Direction:**	Upstream	**Upstream Node:**	S19
Road:	Mount Road	**Inspected Length:**	48.80 m	**Upstream Pipe Depth:**	2.333 m
Location:	Road	**Total Length:**	48.80 m	**Downstream Node:**	S18
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	2.214 m

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	1,050 mm
Flow Control:	No flow control	**Material:**	Concrete
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining
Comments:	None		
Recommendations:			

Scale: 1:423

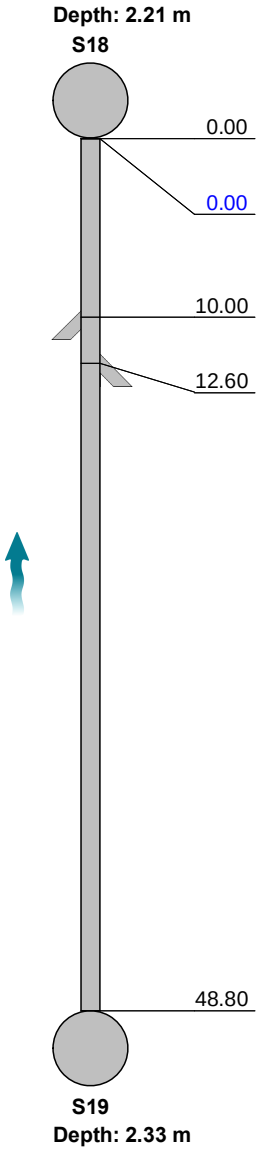

Position [m]	Code	Observation	MPEG	Photo	Grade
0.00	MH	Start node, manhole, reference: S18	00:00:00		
0.00	WL	Water level, 5% of the vertical dimension			
10.00	CN	Connection other than junction at 1 o'clock, 150mm dia	00:01:28		
12.60	CN	Connection other than junction at 11 o'clock, 150mm dia	00:01:43		
48.80	MHF	Finish node, manhole, reference: S19	00:04:10		

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

C.J LYON & SONS LTD
BENTLEY NURSERIES, BENTLEY LANE
Tel. 01257 462986
nicola@cjlyon.co.uk

Section Inspection - 14/07/2025 - S20X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
35	1	14/07/25	8:12	Not Specified	No Rain Or Snow	Yes	S20X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
M. Glover	Not Specified	Crawler Unit	Not Specified	Public Sewer	Not Specified

Town or Village:	Gorton	**Inspection Direction:**	Upstream	**Upstream Node:**	S20
Road:	Mount Road	**Inspected Length:**	28.90 m	**Upstream Pipe Depth:**	2.632 m
Location:	Road	**Total Length:**	28.90 m	**Downstream Node:**	S18
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	2.214 m

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	1,050 mm
Flow Control:	No flow control	**Material:**	Concrete
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining
Comments:	None		
Recommendations:			

Scale: 1:251

Depth: 2.21 m
S18

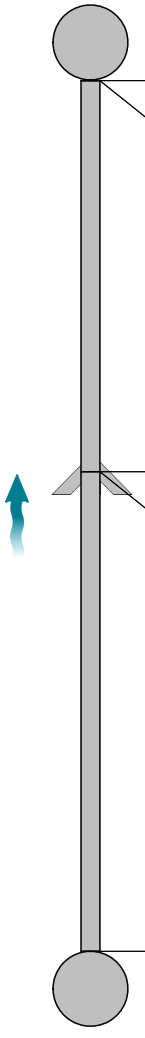

S20
Depth: 2.63 m

Position [m]	Code	Observation	MPEG	Photo	Grade
0.00	MH	Start node, manhole, reference: S18	00:00:00		
0.00	WL	Water level, 5% of the vertical dimension			
13.00	CN	Connection other than junction at 11 o'clock, 150mm dia	00:01:00		
13.00	CN	Connection other than junction at 1 o'clock, 150mm dia	00:01:05		
28.90	MHF	Finish node, manhole, reference: S20	00:00:00		

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

C.J LYON & SONS LTD
BENTLEY NURSERIES, BENTLEY LANE
Tel. 01257 462986
nicola@cjlyon.co.uk

Section Inspection - 14/07/2025 - S26X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
36	1	14/07/25	8:13	Not Specified	No Rain Or Snow	Yes	S26X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
M. Glover	Not Specified	Crawler Unit	Not Specified	Public Sewer	Not Specified

Town or Village:	Gorton	**Inspection Direction:**	Upstream	**Upstream Node:**	S26
Road:	Mount Road	**Inspected Length:**	38.00 m	**Upstream Pipe Depth:**	2.611 m
Location:	Road	**Total Length:**	38.00 m	**Downstream Node:**	S21
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	1,050 mm
Flow Control:	No flow control	**Material:**	Concrete
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: None
Recommendations:

Scale: 1:330

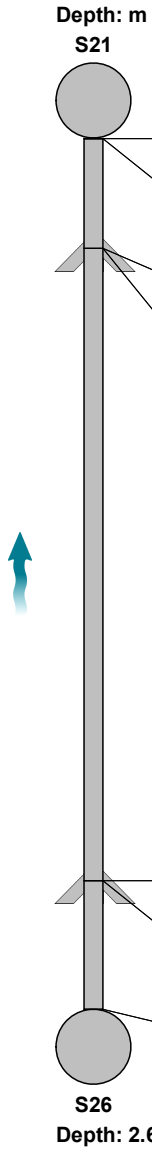

Position [m]	Code	Observation	MPEG	Photo	Grade
0.00	MH	Start node, manhole, reference: S21	00:00:00		
0.00	WL	Water level, 5% of the vertical dimension			
4.80	CN	Connection other than junction at 11 o'clock, 150mm dia	00:00:23		
4.80	CN	Connection other than junction at 1 o'clock, 150mm dia	00:00:23		
32.40	CN	Connection other than junction at 1 o'clock, 150mm dia	00:02:07		
32.40	CN	Connection other than junction at 11 o'clock, 150mm dia	00:02:09		
38.00	MHF	Finish node, manhole, reference: S26	00:00:00		

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

C.J LYON & SONS LTD
BENTLEY NURSERIES, BENTLEY LANE
Tel. 01257 462986
nicola@cjlyon.co.uk

Section Inspection - 14/07/2025 - S22X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
37	1	14/07/25	8:13	Not Specified	No Rain Or Snow	Yes	S22X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
M. Glover	Not Specified	Crawler Unit	Not Specified	Public Sewer	Not Specified

Town or Village:	Gorton	**Inspection Direction:**	Downstream	**Upstream Node:**	S22
Road:	Mount Road	**Inspected Length:**	56.70 m	**Upstream Pipe Depth:**	2.760 m
Location:	Road	**Total Length:**	56.70 m	**Downstream Node:**	S21
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	1,050 mm
Flow Control:	No flow control	**Material:**	Concrete
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: None
Recommendations:

Scale: 1:491

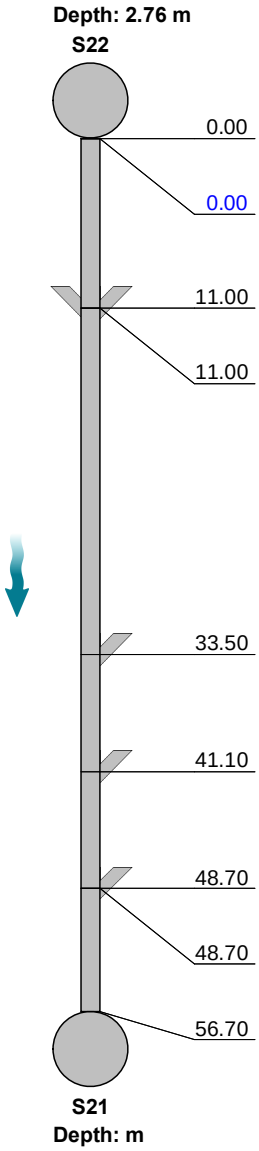

Position [m]	Code	Observation	MPEG	Photo	Grade
0.00	MH	Start node, manhole, reference: S22	00:00:00		
0.00	WL	Water level, 5% of the vertical dimension			
11.00	CN	Connection other than junction at 11 o'clock, 150mm dia	00:00:44		
11.00	CN	Connection other than junction at 1 o'clock, 150mm dia	00:00:44		
33.50	CN	Connection other than junction at 11 o'clock, 150mm dia	00:02:51		
41.10	CN	Connection other than junction at 11 o'clock, 150mm dia	00:03:33		
48.70	CN	Connection other than junction at 11 o'clock, 150mm dia	00:04:09		
48.70	CN	Connection other than junction at 11 o'clock, 150mm dia	00:04:12		
56.70	MHF	Finish node, manhole, reference: S21	00:00:00		

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

C.J LYON & SONS LTD
BENTLEY NURSERIES, BENTLEY LANE
Tel. 01257 462986
nicola@cjlyon.co.uk

Section Inspection - 14/07/2025 - S23X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
38	1	14/07/25	8:14	Not Specified	No Rain Or Snow	Yes	S23X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
M. Glover	Not Specified	Crawler Unit	Not Specified	Public Sewer	Not Specified

Town or Village:	Gorton	**Inspection Direction:**	Upstream	**Upstream Node:**	S23
Road:	Mount Road	**Inspected Length:**	25.70 m	**Upstream Pipe Depth:**	2.862 m
Location:	Road	**Total Length:**	25.70 m	**Downstream Node:**	S22
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	2.760 m

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	1,050 mm
Flow Control:	No flow control	**Material:**	Concrete
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: None
Recommendations:

Scale: 1:223



Position [m]	Code	Observation	MPEG	Photo	Grade
0.00	MH	Start node, manhole, reference: S22	00:00:00		
0.00	WL	Water level, 5% of the vertical dimension			
20.30	CN	Connection other than junction at 11 o'clock, 150mm dia	00:01:27		
20.30	CN	Connection other than junction at 11 o'clock, 150mm dia	00:01:29		
25.70	MHF	Finish node, manhole, reference: S23	00:00:00		

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

C.J LYON & SONS LTD
BENTLEY NURSERIES, BENTLEY LANE
Tel. 01257 462986
nicola@cjlyon.co.uk

Section Inspection - 14/07/2025 - S24X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
39	1	14/07/25	8:14	Not Specified	No Rain Or Snow	Yes	S24X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
M. Glover	Not Specified	Crawler Unit	Not Specified	Public Sewer	Not Specified

Town or Village:	Gorton	**Inspection Direction:**	Downstream	**Upstream Node:**	S24
Road:	Mount Road	**Inspected Length:**	25.60 m	**Upstream Pipe Depth:**	2.970 m
Location:	Road	**Total Length:**	25.60 m	**Downstream Node:**	S23
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	2.862 m

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	1,050 mm
Flow Control:	No flow control	**Material:**	Concrete
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: None
Recommendations:

Scale: 1:222

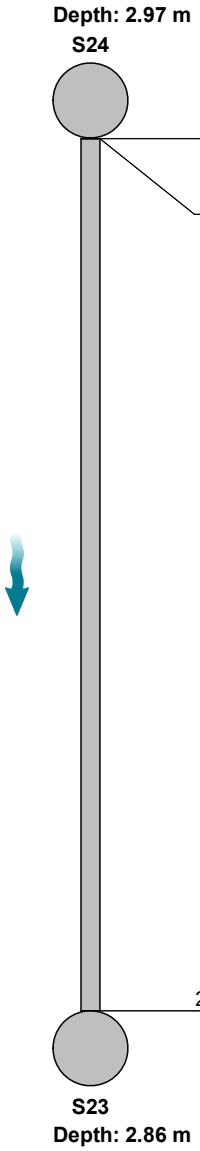

Position [m]	Code	Observation	MPEG	Photo	Grade
0.00	MH	Start node, manhole, reference: S24	00:00:00		
0.00	WL	Water level, 5% of the vertical dimension			
25.60	MHF	Finish node, manhole, reference: S23	00:00:00		

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

C.J LYON & SONS LTD
BENTLEY NURSERIES, BENTLEY LANE
Tel. 01257 462986
nicola@cjlyon.co.uk

Section Inspection - 14/07/2025 - S25X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
40	1	14/07/25	8:14	Not Specified	No Rain Or Snow	Yes	S25X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
M. Glover	Not Specified	Crawler Unit	Not Specified	Public Sewer	Not Specified

Town or Village:	Gorton	**Inspection Direction:**	Downstream	**Upstream Node:**	S25
Road:	Mount Road	**Inspected Length:**	23.40 m	**Upstream Pipe Depth:**	2.961 m
Location:	Road	**Total Length:**	23.40 m	**Downstream Node:**	S22
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	2.760 m

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	1,050 mm
Flow Control:	No flow control	**Material:**	Concrete
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: None
Recommendations:

Scale: 1:203

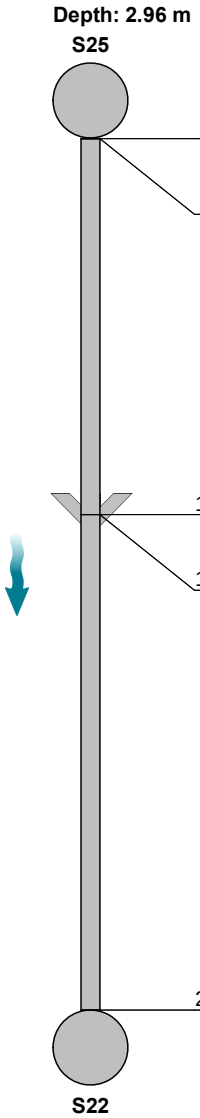

Position [m]	Code	Observation	MPEG	Photo	Grade
0.00	MH	Start node, manhole, reference: S25	00:00:00		
0.00	WL	Water level, 5% of the vertical dimension			
10.10	CN	Connection other than junction at 11 o'clock, 150mm dia	00:00:46		
10.10	CN	Connection other than junction at 1 o'clock, 150mm dia	00:00:50		
23.40	MHF	Finish node, manhole, reference: S22	00:01:41		

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

C.J LYON & SONS LTD
BENTLEY NURSERIES, BENTLEY LANE
Tel. 01257 462986
nicola@cjlyon.co.uk

Section Inspection - 14/07/2025 - S27X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
41	1	14/07/25	8:15	Not Specified	No Rain Or Snow	Yes	S27X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
M. Glover	Not Specified	Crawler Unit	Not Specified	Public Sewer	Not Specified

Town or Village:	Gorton	**Inspection Direction:**	Upstream	**Upstream Node:**	S27
Road:	Mount Road	**Inspected Length:**	26.00 m	**Upstream Pipe Depth:**	2.457 m
Location:	Road	**Total Length:**	26.00 m	**Downstream Node:**	S26
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	2.611 m

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	1,050 mm
Flow Control:	No flow control	**Material:**	Concrete
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: None
Recommendations:

Scale: 1:226

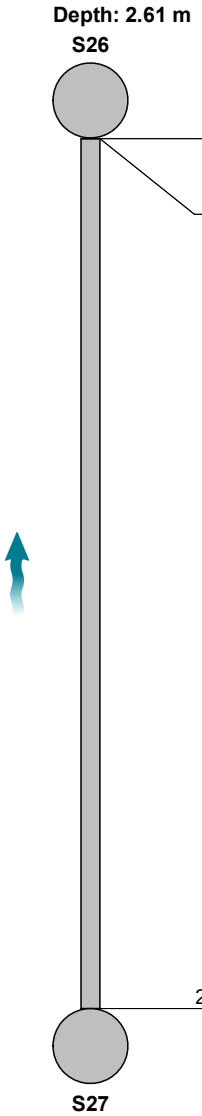

Position [m]	Code	Observation	MPEG	Photo	Grade
0.00	MH	Start node, manhole, reference: S26	00:00:00		
0.00	WL	Water level, 5% of the vertical dimension			
26.00	MHF	Finish node, manhole, reference: S27	00:00:00		

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

C.J LYON & SONS LTD
BENTLEY NURSERIES, BENTLEY LANE
Tel. 01257 462986
nicola@cjlyon.co.uk

Section Inspection - 12/09/2025 - S30X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
42	1	12/09/25	14:48	Not Specified	No Rain Or Snow	Yes	S30X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
M. Glover	Not Specified	Crawler Unit	Not Specified	Public Sewer	Not Specified

Town or Village:	Gorton	**Inspection Direction:**	Upstream	**Upstream Node:**	S30
Road:	Mount Road	**Inspected Length:**	7.80 m	**Upstream Pipe Depth:**	3.091 m
Location:	Road	**Total Length:**	10.00 m	**Downstream Node:**	S29
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	3.318 m

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	225 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: None
Recommendations:

Scale: 1:87

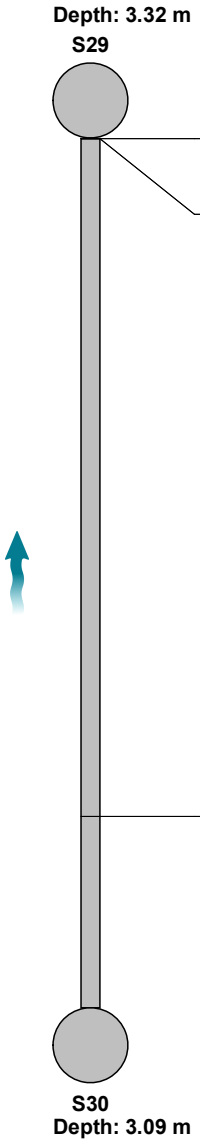

Position [m]	Code	Observation	MPEG	Photo	Grade
0.00	MH	Start node, manhole, reference: S29	00:00:00		
0.00	WL	Water level, 5% of the vertical dimension			
7.80	MHF	Finish node, manhole, reference: S30	00:01:29		

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

C.J LYON & SONS LTD
BENTLEY NURSERIES, BENTLEY LANE
Tel. 01257 462986
nicola@cjlyon.co.uk

Section Inspection - 14/07/2025 - S31X


Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
43	1	14/07/25	8:15	Not Specified	No Rain Or Snow	Yes	S31X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
M. Glover	Not Specified	Crawler Unit	Not Specified	Public Sewer	Not Specified

Town or Village:	Gorton	**Inspection Direction:**	Upstream	**Upstream Node:**	S31
Road:	Mount Road	**Inspected Length:**	9.10 m	**Upstream Pipe Depth:**	3.056 m
Location:	Road	**Total Length:**	9.10 m	**Downstream Node:**	S30
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	3.091 m

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	1,050 mm
Flow Control:	No flow control	**Material:**	Concrete
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining
Comments:	None		
Recommendations:			

Scale: 1:79

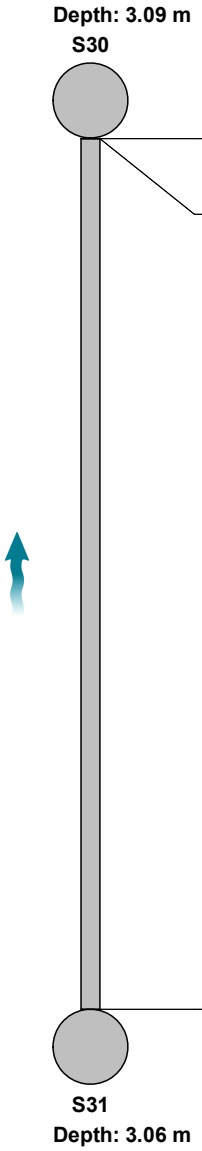

Position [m]	Code	Observation	MPEG	Photo	Grade
0.00	MH	Start node, manhole, reference: S30	00:00:00		
0.00	WL	Water level, 5% of the vertical dimension			
9.10	MHF	Finish node, manhole, reference: S31	00:00:00		

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

C.J LYON & SONS LTD
BENTLEY NURSERIES, BENTLEY LANE
Tel. 01257 462986
nicola@cjlyon.co.uk

Section Inspection - 14/07/2025 - S32X


Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
44	1	14/07/25	8:16	Not Specified	No Rain Or Snow	Yes	S32X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
M. Glover	Not Specified	Crawler Unit	Not Specified	Public Sewer	Not Specified

Town or Village:	Gorton	**Inspection Direction:**	Upstream	**Upstream Node:**	S32
Road:	Mount Road	**Inspected Length:**	54.10 m	**Upstream Pipe Depth:**	2.381 m
Location:	Road	**Total Length:**	54.10 m	**Downstream Node:**	S31
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	3.056 m

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	1,050 mm
Flow Control:	No flow control	**Material:**	Concrete
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining
Comments:	None		
Recommendations:			

Scale: 1:469

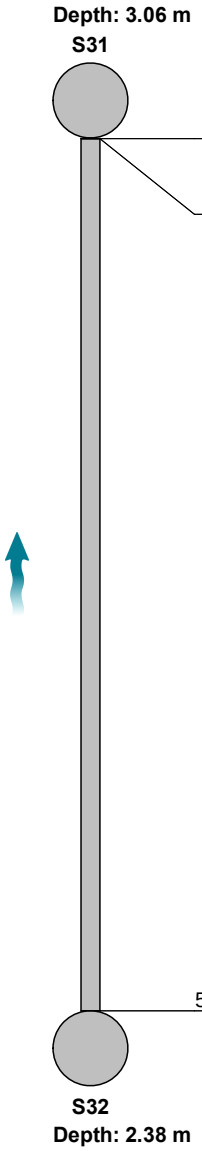

Position [m]	Code	Observation	MPEG	Photo	Grade
0.00	MH	Start node, manhole, reference: S31	00:00:00		
0.00	WL	Water level, 5% of the vertical dimension			
54.10	MHF	Finish node, manhole, reference: S32	00:00:00		

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

C.J LYON & SONS LTD
BENTLEY NURSERIES, BENTLEY LANE
Tel. 01257 462986
nicola@cjlyon.co.uk

Section Inspection - 14/07/2025 - S33X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
45	1	14/07/25	8:16	Not Specified	No Rain Or Snow	Yes	S33X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
M. Glover	Not Specified	Crawler Unit	Not Specified	Public Sewer	Not Specified

Town or Village:	Gorton	**Inspection Direction:**	Downstream	**Upstream Node:**	S33
Road:	Mount Road	**Inspected Length:**	56.60 m	**Upstream Pipe Depth:**	3.155 m
Location:	Road	**Total Length:**	56.60 m	**Downstream Node:**	S32
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	2.381 m

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	1,050 mm
Flow Control:	No flow control	**Material:**	Concrete
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: None
Recommendations:

Scale: 1:491

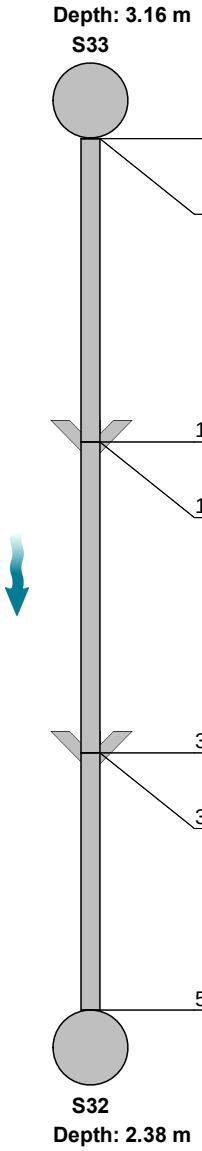

Position [m]	Code	Observation	MPEG	Photo	Grade
0.00	MH	Start node, manhole, reference: S33	00:00:00		
0.00	WL	Water level, 5% of the vertical dimension			
19.70	CN	Connection other than junction at 1 o'clock, 150mm dia	00:01:28		
19.70	CN	Connection other than junction at 11 o'clock, 150mm dia	00:01:36		
39.90	CN	Connection other than junction at 10 o'clock, 150mm dia	00:03:00		
39.90	CN	Connection other than junction at 1 o'clock, 150mm dia	00:03:08		
56.60	MHF	Finish node, manhole, reference: S32	00:04:18		

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

C.J LYON & SONS LTD
BENTLEY NURSERIES, BENTLEY LANE
Tel. 01257 462986
nicola@cjlyon.co.uk

Section Inspection - 14/07/2025 - S37X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
46	1	14/07/25	8:17	Not Specified	No Rain Or Snow	Yes	S37X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
M. Glover	Not Specified	Crawler Unit	Not Specified	Public Sewer	Not Specified

Town or Village:	Gorton	**Inspection Direction:**	Upstream	**Upstream Node:**	S37
Road:	Mount Road	**Inspected Length:**	44.50 m	**Upstream Pipe Depth:**	
Location:	Road	**Total Length:**	44.50 m	**Downstream Node:**	S33
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	3.155 m

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	1,050 mm
Flow Control:	No flow control	**Material:**	Concrete
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: None
Recommendations:

Scale: 1:386

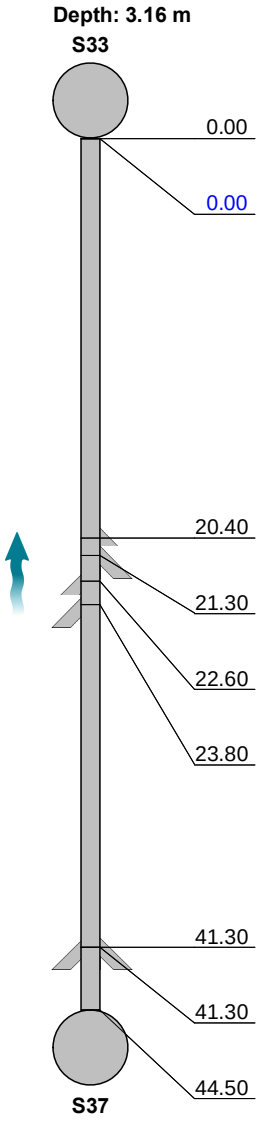

Position [m]	Code	Observation	MPEG	Photo	Grade
0.00	MH	Start node, manhole, reference: S33	00:00:00		
0.00	WL	Water level, 5% of the vertical dimension			
20.40	CN	Connection other than junction at 11 o'clock, 150mm dia	00:01:52		
21.30	CN	Connection other than junction at 11 o'clock, 150mm dia	00:02:01		
22.60	CN	Connection other than junction at 1 o'clock, 150mm dia	00:02:20		
23.80	CN	Connection other than junction at 1 o'clock, 150mm dia	00:02:27		
41.30	CN	Connection other than junction at 1 o'clock, 150mm dia	00:03:42		
41.30	CN	Connection other than junction at 11 o'clock, 150mm dia	00:03:54		
44.50	MHF	Finish node, manhole, reference: S37	00:04:12		

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

C.J LYON & SONS LTD
BENTLEY NURSERIES, BENTLEY LANE
Tel. 01257 462986
nicola@cjlyon.co.uk

Section Inspection - 14/07/2025 - S34X


Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
47	1	14/07/25	8:17	Not Specified	No Rain Or Snow	Yes	S34X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
M. Glover	Not Specified	Crawler Unit	Not Specified	Public Sewer	Not Specified

Town or Village:	Gorton	**Inspection Direction:**	Downstream	**Upstream Node:**	S34
Road:	Mount Road	**Inspected Length:**	19.00 m	**Upstream Pipe Depth:**	3.263 m
Location:	Road	**Total Length:**	19.00 m	**Downstream Node:**	S33
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	3.155 m

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	1,050 mm
Flow Control:	No flow control	**Material:**	Concrete
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining
Comments:	None		
Recommendations:			

Scale: 1:165

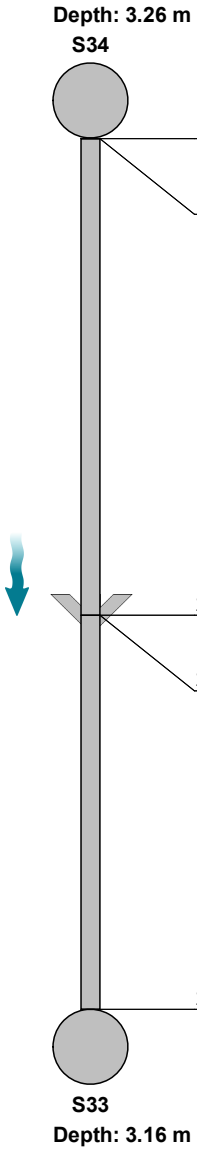

Position [m]	Code	Observation	MPEG	Photo	Grade
0.00	MH	Start node, manhole, reference: S34	00:00:00		
0.00	WL	Water level, 5% of the vertical dimension			
10.40	CN	Connection other than junction at 2 o'clock, 150mm dia	00:00:54		
10.40	CN	Connection other than junction at 10 o'clock, 150mm dia	00:00:59		
19.00	MHF	Finish node, manhole, reference: S33	00:00:00		

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

C.J LYON & SONS LTD
BENTLEY NURSERIES, BENTLEY LANE
Tel. 01257 462986
nicola@cjlyon.co.uk

Section Inspection - 14/07/2025 - S35X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
48	1	14/07/25	14:09	Not Specified	No Rain Or Snow	Yes	S35X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
M. Glover	Not Specified	Crawler Unit	Not Specified	Public Sewer	Not Specified

Town or Village:	Gorton	**Inspection Direction:**	Downstream	**Upstream Node:**	S35
Road:	Mount Road	**Inspected Length:**	45.60 m	**Upstream Pipe Depth:**	3.693 m
Location:	Road	**Total Length:**	45.60 m	**Downstream Node:**	S34
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	3.263 m

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	1,050 mm
Flow Control:	No flow control	**Material:**	Concrete
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: None
Recommendations:

Scale: 1:395

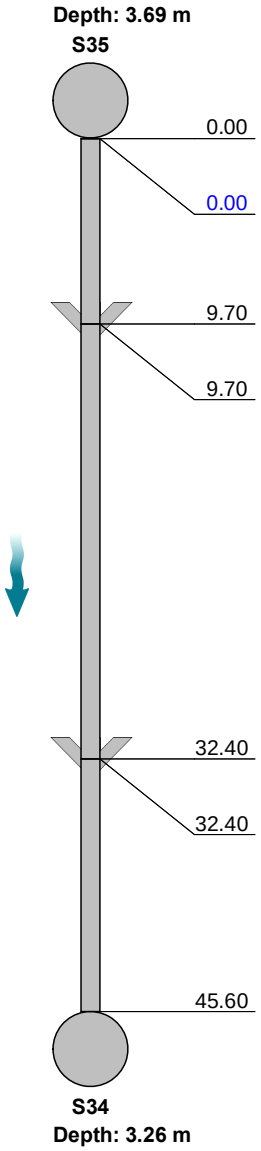

Position [m]	Code	Observation	MPEG	Photo	Grade
0.00	MH	Start node, manhole, reference: S35	00:00:00		
0.00	WL	Water level, 5% of the vertical dimension			
9.70	CN	Connection other than junction at 1 o'clock, 150mm dia	00:00:58		
9.70	CN	Connection other than junction at 11 o'clock, 150mm dia	00:01:08		
32.40	CN	Connection other than junction at 1 o'clock, 150mm dia	00:02:32		
32.40	CN	Connection other than junction at 11 o'clock, 150mm dia	00:02:41		
45.60	MHF	Finish node, manhole, reference: S34	00:00:00		

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

C.J LYON & SONS LTD
BENTLEY NURSERIES, BENTLEY LANE
Tel. 01257 462986
nicola@cjlyon.co.uk

Section Inspection - 14/07/2025 - S36X


Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
49	1	14/07/25	14:09	Not Specified	No Rain Or Snow	Yes	S36X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
M. Glover	Not Specified	Crawler Unit	Not Specified	Public Sewer	Not Specified

Town or Village:	Gorton	**Inspection Direction:**	Upstream	**Upstream Node:**	S36
Road:	Mount Road	**Inspected Length:**	49.50 m	**Upstream Pipe Depth:**	3.832 m
Location:	Road	**Total Length:**	49.50 m	**Downstream Node:**	S35
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	3.693 m

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	1,050 mm
Flow Control:	No flow control	**Material:**	Concrete
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining
Comments:	None		
Recommendations:			

Scale: 1:429

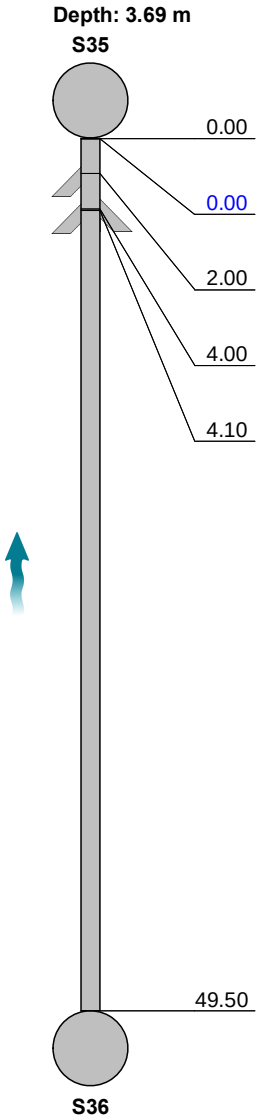

Position [m]	Code	Observation	MPEG	Photo	Grade
0.00	MH	Start node, manhole, reference: S35	00:00:00		
0.00	WL	Water level, 5% of the vertical dimension			
2.00	CN	Connection other than junction at 1 o'clock, 150mm dia	00:00:12		
4.00	CN	Connection other than junction at 11 o'clock, 150mm dia	00:00:28		
4.10	CN	Connection other than junction at 1 o'clock, 150mm dia	00:00:41		
49.50	MHF	Finish node, manhole, reference: S36	00:00:00		

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

C.J LYON & SONS LTD
BENTLEY NURSERIES, BENTLEY LANE
Tel. 01257 462986
nicola@cjlyon.co.uk

Section Inspection - 12/09/2025 - F5X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
50	1	12/09/25	14:49	Not Specified	No Rain Or Snow	Yes	F5X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
M. Glover	Not Specified	Crawler Unit	Not Specified	Public Sewer	Not Specified

Town or Village:	Gorton	**Inspection Direction:**	Downstream	**Upstream Node:**	F5
Road:	Mount Road	**Inspected Length:**	10.60 m	**Upstream Pipe Depth:**	
Location:	Road	**Total Length:**	10.60 m	**Downstream Node:**	F5A
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: None
Recommendations:

Scale: 1:92

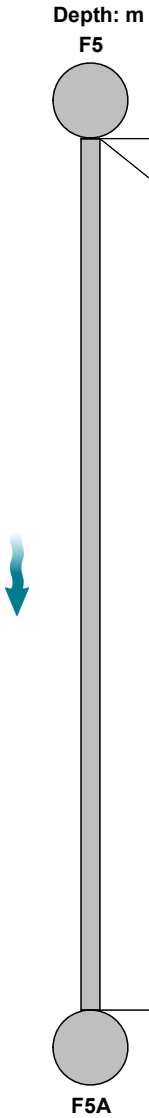

Position [m]	Code	Observation	MPEG	Photo	Grade
0.00	MH	Start node, manhole, reference: F5	00:00:00		
0.00	WL	Water level, 5% of the vertical dimension			
10.60	MHF	Finish node, manhole, reference: F5A	00:00:00		

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

C.J LYON & SONS LTD
BENTLEY NURSERIES, BENTLEY LANE
Tel. 01257 462986
nicola@cjlyon.co.uk

Section Inspection - 12/09/2025 - F5AX

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
51	1	12/09/25	14:49	Not Specified	No Rain Or Snow	Yes	F5AX

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
M. Glover	Not Specified	Crawler Unit	Not Specified	Public Sewer	Not Specified

Town or Village:	Gorton	**Inspection Direction:**	Downstream	**Upstream Node:**	F5A
Road:	Mount Road	**Inspected Length:**	1.40 m	**Upstream Pipe Depth:**	
Location:	Road	**Total Length:**	1.40 m	**Downstream Node:**	C2
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: None
Recommendations:

Scale: 1:50



Position [m]	Code	Observation	MPEG	Photo	Grade
0.00	MH	Start node, manhole, reference: F5A	00:00:00		
0.00	WL	Water level, 5% of the vertical dimension			
1.40	MHF	Finish node, manhole, reference: C2	00:00:18		

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

C.J LYON & SONS LTD
BENTLEY NURSERIES, BENTLEY LANE
Tel. 01257 462986
nicola@cjlyon.co.uk

Section Inspection - 12/09/2025 - F6X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
52	1	12/09/25	14:50	Not Specified	No Rain Or Snow	Yes	F6X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
M. Glover	Not Specified	Crawler Unit	Not Specified	Public Sewer	Not Specified

Town or Village:	Gorton	**Inspection Direction:**	Downstream	**Upstream Node:**	F6
Road:	Mount Road	**Inspected Length:**	50.60 m	**Upstream Pipe Depth:**	3.850 m
Location:	Road	**Total Length:**	50.60 m	**Downstream Node:**	F5
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: None
Recommendations:

Scale: 1:439

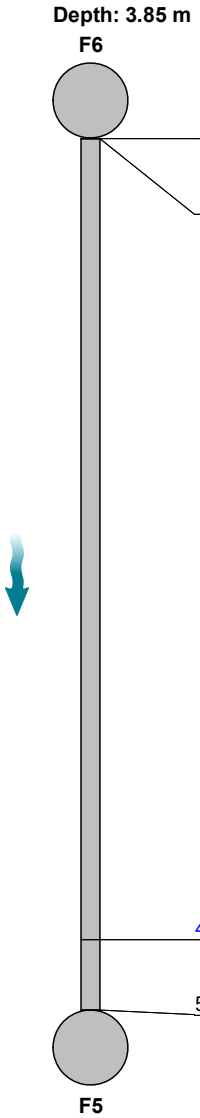

Position [m]	Code	Observation	MPEG	Photo	Grade
0.00	MH	Start node, manhole, reference: F6	00:00:00		
0.00	WL	Water level, 5% of the vertical dimension			
46.50	GP	General photograph taken at this point: Poorly coupled joint	00:06:36	1	
50.60	MHF	Finish node, manhole, reference: F5	00:00:00		

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

C.J LYON & SONS LTD
BENTLEY NURSERIES, BENTLEY LANE
Tel. 01257 462986
nicola@cjlyon.co.uk

Section Pictures - 12/09/2025 - F6X

Item No.	Inspection Direction	PLR	Client`s Job Ref	Contractor`s Job Ref
52	Downstream	F6X		



1, 00:06:36, 46.50 m
General photograph taken at this point, Poorly coupled joint

C.J LYON & SONS LTD
BENTLEY NURSERIES, BENTLEY LANE
Tel. 01257 462986
nicola@cjlyon.co.uk

Section Inspection - 12/09/2025 - F7X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
53	1	12/09/25	14:51	Not Specified	No Rain Or Snow	Yes	F7X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
M. Glover	Not Specified	Crawler Unit	Not Specified	Public Sewer	Not Specified

Town or Village:	Gorton	**Inspection Direction:**	Downstream	**Upstream Node:**	F7
Road:	Mount Road	**Inspected Length:**	29.00 m	**Upstream Pipe Depth:**	
Location:	Road	**Total Length:**	29.00 m	**Downstream Node:**	F6
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	3.850 m

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: None
Recommendations:

Scale: 1:252

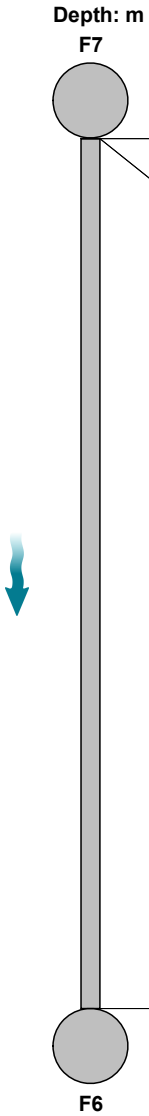

Position [m]	Code	Observation	MPEG	Photo	Grade
0.00	MH	Start node, manhole, reference: F7	00:00:00		
0.00	WL	Water level, 5% of the vertical dimension			
29.00	MHF	Finish node, manhole, reference: F6	00:00:00		

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

C.J LYON & SONS LTD
BENTLEY NURSERIES, BENTLEY LANE
Tel. 01257 462986
nicola@cjlyon.co.uk

Section Inspection - 12/09/2025 - F21X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
54	1	12/09/25	14:46	Not Specified	No Rain Or Snow	Yes	F21X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
M. Glover	Not Specified	Crawler Unit	Not Specified	Public Sewer	Not Specified

Town or Village:	Gorton	**Inspection Direction:**	Downstream	**Upstream Node:**	F21
Road:	Mount Road	**Inspected Length:**	30.30 m	**Upstream Pipe Depth:**	
Location:	Road	**Total Length:**	30.30 m	**Downstream Node:**	F18
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: Joint has not been pushed together flush into coupling at 29m
Recommendations:

Scale: 1:263



Position [m]	Code	Observation	MPEG	Photo	Grade
Depth: m F21					
0.00	MH	Start node, manhole, reference: F21	00:00:00		
0.00	WL	Water level, 5% of the vertical dimension			
29.00	OJ	Open joint, 5mm displacement, 1 - 1.5 x pipe wall thickness: Joint has not been pushed together flush into coupling	00:04:29	1	1
30.30	MHF	Finish node, manhole, reference: F18	00:04:42		
F18 Depth: m					

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
1	1.0	0.0	1.0	1.0	0	0.0	0.0	0.0	1.0

C.J LYON & SONS LTD
BENTLEY NURSERIES, BENTLEY LANE
Tel. 01257 462986
nicola@cjlyon.co.uk

Section Pictures - 12/09/2025 - F21X

Item No.	Inspection Direction	PLR	Client`s Job Ref	Contractor`s Job Ref
54	Downstream	F21X		



1, 00:04:29, 29.00 m
Open joint, 5mm displacement, 1 - 1.5 x pipe wall thickness,
Joint has not been pushed together flush into coupling

C.J LYON & SONS LTD
BENTLEY NURSERIES, BENTLEY LANE
Tel. 01257 462986
nicola@cjlyon.co.uk

Section Inspection - 12/09/2025 - F24X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
55	1	12/09/25	14:46	Not Specified	No Rain Or Snow	Yes	F24X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
M. Glover	Not Specified	Crawler Unit	Not Specified	Public Sewer	Not Specified

Town or Village:	Gorton	**Inspection Direction:**	Downstream	**Upstream Node:**	F24
Road:	Mount Road	**Inspected Length:**	28.60 m	**Upstream Pipe Depth:**	
Location:	Road	**Total Length:**	28.60 m	**Downstream Node:**	F6
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	3.850 m

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: None
Recommendations:

Scale: 1:248

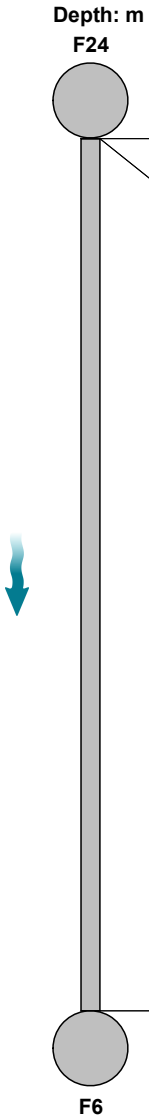

Position [m]	Code	Observation	MPEG	Photo	Grade
0.00	MH	Start node, manhole, reference: F24	00:00:00		
0.00	WL	Water level, 5% of the vertical dimension			
28.60	MHF	Finish node, manhole, reference: F6: Dropshaft	00:00:00		

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

C.J LYON & SONS LTD
BENTLEY NURSERIES, BENTLEY LANE
Tel. 01257 462986
nicola@cjlyon.co.uk

Section Inspection - 12/09/2025 - S2X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
56	1	12/09/25	14:46	Not Specified	No Rain Or Snow	Yes	S2X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
M. Glover	Not Specified	Crawler Unit	Not Specified	Public Sewer	Not Specified

Town or Village:	Gorton	**Inspection Direction:**	Downstream	**Upstream Node:**	S2
Road:	Mount Road	**Inspected Length:**	14.10 m	**Upstream Pipe Depth:**	
Location:	Road	**Total Length:**	14.10 m	**Downstream Node:**	S1
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	375 mm
Flow Control:	No flow control	**Material:**	Concrete
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: None
Recommendations:

Scale: 1:123	Position [m]	Code	Observation	MPEG	Photo	Grade
Depth: m S2						
	0.00	MH	Start node, manhole, reference: S2	00:00:00		
	0.00	WL	Water level, 5% of the vertical dimension			
	14.10	MHF	Finish node, manhole, reference: S1	00:00:42		
S1 Depth: m						

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

C.J LYON & SONS LTD
BENTLEY NURSERIES, BENTLEY LANE
Tel. 01257 462986
nicola@cjlyon.co.uk

Section Inspection - 12/09/2025 - S3X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
57	1	12/09/25	14:47	Not Specified	No Rain Or Snow	Yes	S3X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
M. Glover	Not Specified	Crawler Unit	Not Specified	Public Sewer	Not Specified

Town or Village:	Gorton	**Inspection Direction:**	Upstream	**Upstream Node:**	S3
Road:	Mount Road	**Inspected Length:**	59.50 m	**Upstream Pipe Depth:**	
Location:	Road	**Total Length:**	59.50 m	**Downstream Node:**	S2
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	375 mm
Flow Control:	No flow control	**Material:**	Concrete
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: None
Recommendations:

Scale: 1:516



Position [m]	Code	Observation	MPEG	Photo	Grade
0.00	MH	Start node, manhole, reference: S2	00:00:00		
0.00	WL	Water level, 5% of the vertical dimension			
59.50	MHF	Finish node, manhole, reference: S3	00:00:00		

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

C.J LYON & SONS LTD
BENTLEY NURSERIES, BENTLEY LANE
Tel. 01257 462986
nicola@cjlyon.co.uk

Section Inspection - 12/09/2025 - S4X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
58	1	12/09/25	14:48	Not Specified	No Rain Or Snow	Yes	S4X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
M. Glover	Not Specified	Crawler Unit	Not Specified	Public Sewer	Not Specified

Town or Village:	Gorton	**Inspection Direction:**	Upstream	**Upstream Node:**	S4
Road:	Mount Road	**Inspected Length:**	54.20 m	**Upstream Pipe Depth:**	
Location:	Road	**Total Length:**	54.20 m	**Downstream Node:**	S3
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	375 mm
Flow Control:	No flow control	**Material:**	Concrete
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: None
Recommendations:

Scale: 1:470



Position [m]	Code	Observation	MPEG	Photo	Grade
0.00	MH	Start node, manhole, reference: S3	00:00:00		
0.00	WL	Water level, 5% of the vertical dimension			
53.20	CN	Connection other than junction at 11 o'clock, 150mm dia	00:04:23		
54.20	MHF	Finish node, manhole, reference: S4	00:00:00		

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0