SDS Ltd
DRAINAGE SPECIALIST

CCTV Inspection Report

View via iTouch Live

Your full report, including the video is only a click away download or view online now.

87 ROCHDALE ROAD M4 4HY

30/07/2025

Job Number: 87 ROCHDALE ROAD M4 4HY 30/07/2025

Sewer Drainage Specialist Ltd

12 Urmston Lane, Stretford, Greater Manchester, M32 9BQ

Project Information

Sewer Drainage Specialist Ltd
112 Urmston Lane
Stretford
Greater Manchester
M32 9BQ

Job Number	Surveyed by (Operator)	Base Unit	Date
87 ROCHDALE ROAD M4 4HY 30/07/2025	**JOE**	**45J5KGGBCM**	**30/07/2025**

Client Details:

CRANGY CONSTRUCTION

Site Details:

87 ROCHDALE ROAD M4 4HY

Contractor Details:

Sewer Drainage Specialist Ltd
112 Urmston Lane
Stretford
Greater Manchester
M32 9BQ

Purpose of Survey:

Job Number	Surveyed by (Operator)	Base Unit	Date
87 ROCHDALE ROAD M4 4HY 30/07/2025	**JOE**	**45J5KGGBCM**	**30/07/2025**

Report Contents

Page 1 Cover Page

Page 2 Job Overview

Page 3 Contents Page

Page 4 Job Summary

Page 5 Survey Run Sheet(Survey 1 - CW01 to TJ01)

Page 7 Defect Summary

Page 9 Grade Defect Descriptions

View via iTouch Live

Sewer Drainage Specialist Ltd
112 Urmston Lane
Stretford
Greater Manchester
M32 9BQ

Report Summary

Job Number	Surveyed by (Operator)	Base Unit	Date
87 ROCHDALE ROAD M4 4HY 30/07/2025	**JOE**	**45J5KGGBCM**	**30/07/2025**

Job Information

Total Distance Surveyed: **11.28 meters**
Engineer: **JOE**
Number of Surveys: **1**
Number of Surveys grade 4 or above: **0**

Section 1 Overview (30/07/2025)

Manholes: **CW01 to TJ01**
Pipe Length: **11.28 metres**
Structural Grade: **0**
Service Grade: **0**
Material: **VC**
Pipe Size: **300mm**
Use: **Combined**

Sewer Drainage Specialist Ltd
112 Urmston Lane
Stretford
Greater Manchester
M32 9BQ

CCTV Inspection Report

Surveyed by (Operator)	Job Number	Pipe Length Reference(PLR)	Date	Pre Cleaned
JOE	**87 ROCHDALE ROAD M4 4HY 30/07/2025**	**CW01 X**	**30/07/2025**	**Not Cleaned**
Weather	Customer Present	Service Grade/Structural Grade	Base Unit	Section Number
1 - Dry		**0/0**	**45J5KGGBCM**	**1**

Road **87 ROCHDALE ROAD M4 4HY**
Place
Location

Division
District
Location Details

Purpose
Duty **Combined**
Catchment

Shape/Size **300mm**
Material **VC**
Category

Start Node **CW01**
End Node **TJ01**
Total length **11.28 metres**

Scale **1:0.59**
Direction **Downstream**

View via iTouch Live | Download

Start Node Ref:CW01 | I/L : metres


Position	Code	Description	Photo	Type/Grade
0.00	MH	Start node type, manhole, reference CW01	12733402	Comment / 0
0.00	WL	Water level 0% height/diameter	12733403	Comment / 0
11.28	BRF	Finish node type, major connection without manhole, reference TJ01	12733409	Comment / 0

End Node Ref:TJ01 | I/L : metres


Sewer Drainage Specialist Ltd
112 Urmston Lane
Stretford
Greater Manchester
M32 9BQ

CCTV Inspection Photos

Job Number	Surveyed by (Operator)	Base Unit	Date
87 ROCHDALE ROAD M4 4HY 30/07/2025	**JOE**	**45J5KGGBCM**	**30/07/2025**

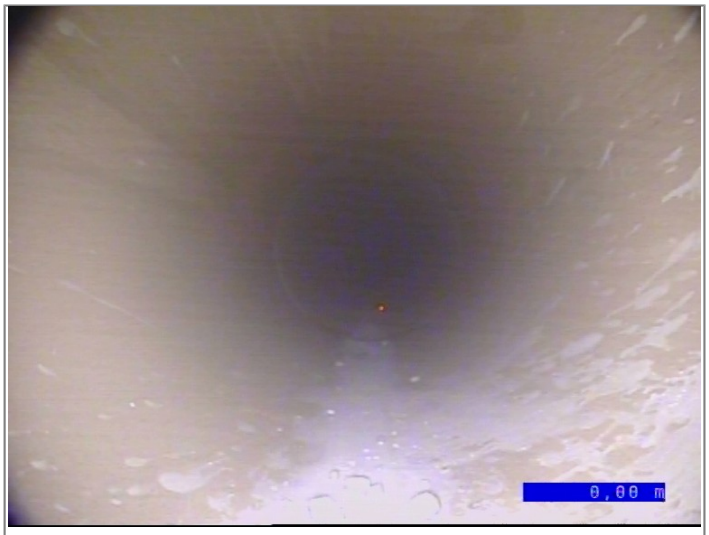

Start node type, manhole, reference CW01

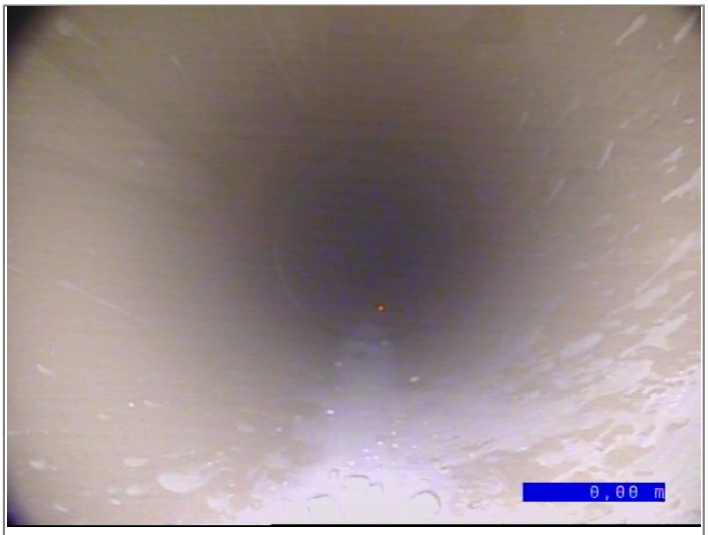

Water level 0% height/diameter



Finish node type, major connection without manhole, reference TJ01

Sewer Drainage Specialist Ltd
112 Urmston Lane
Stretford
Greater Manchester
M32 9BQ

Structural Defects (SRM 4)

Job Number	Surveyed by (Operator)	Base Unit	Date
87 ROCHDALE ROAD M4 4HY 30/07/2025	**JOE**	**45J5KGGBCM**	**30/07/2025**

No.	PLR	Dir.	Use	Shape/Size	Date	Mat.	Total Length	Inspection Length	Cat.	Peak Score	Grade	Mean Score	Total Score
1	CW01 X	D	C	300	30/07/2025	VC	11.28 metres	11.28		0	1	0	0

Sewer Drainage Specialist Ltd
112 Urmston Lane
Stretford
Greater Manchester
M32 9BQ

Service Defects (SRM 4)

Job Number	Surveyed by (Operator)	Base Unit	Date
87 ROCHDALE ROAD M4 4HY 30/07/2025	**JOE**	**45J5KGGBCM**	**30/07/2025**

No.	PLR	Dir.	Use	Shape/Size	Date	Mat.	Total Length	Inspection Length	Cat.	Peak Score	Grade	Mean Score	Total Score
1	CW01 X	D	C	300	30/07/2025	VC	11.28 metres	11.28		0	1	0	0

Sewer Drainage Specialist Ltd
112 Urmston Lane
Stretford
Greater Manchester
M32 9BQ

Defect Grade Descriptions

Job Number	Surveyed by (Operator)	Base Unit	Date
87 ROCHDALE ROAD M4 4HY 30/07/2025	**JOE**	**45J5KGGBCM**	**30/07/2025**

1: Occurences without damage. For example, laterals, joints,etc.

NO DEFECTS WERE DETECTED.

2: Constructional deficiencies or occurences with insignificant influence to tightness, hydraulic or static pressure or pipe: Eg. wide joints, badly torched intakes, minor deformation of plastic pipes, minor erosions etc.

REHABILITATION CAN BE SCHEDULED LONG-TERM.

3: Constructional deficiencies diminishing static, hydraulic and tightness: Eg. untorched intakes, cracks, minor drainage obstructions such as calcite build ups, protruding laterals, minor damages to pipe wall, individual root penetrations, corroded pipe walls etc.

REHABILITATION IS NECESSARY MEDIUM-TERM WITHIN 3 TO 5 YEARS.

4: Constructional damages with insufficent static safety, hydraulic or tightness: Eg. axial/radial pipe bursts, pipe deformations, visually noticeable infiltration/exfiltration, cavities, in pipe-wall, severe protruding, laterals severe root penetrations, severe corrosion of pipe wall etc.

REHABILITATION PROCEDURE IS URGENT AND HAS TO BE COMPLETED WITHIN 1 TO 2 YEARS. NECESSITY FOR EMERGENCY OPERATIONS HAS TO BE EXAMINED.

5: Pipe is already or will shortly be impermeable: Eg. collapsed pipe, deeply rooted pipe or other drainage obstructions. Pipe loses water or danger of backwater in basements etc.

REHABILITATION IS URGENT AND SHORT-TERM. IN ORDER TO PREVENT FURTHER DAMAGE, NECESSARY TEMPORARY SPOT REPAIR HAS TO BE CONDUCTED ON EMERGENCY LEVEL.

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Project Information

Project Name	Project Number	Project Date
87 ROCHDALE ROAD.wcx		3/15/2025

Client

Company: HEYROD CONSTRUCTION LTD
Street: ALBION WORKS, CLOWES STREET,
Town or City: CHADDERTON, OLDHAM
Post Code: OL9 7LY
Phone: 0161 683 4294

Site

Company: McGOFF CONSTRUCTION LTD
Department: DOWNTOWN VICTORIA NORTH
Street: 87 ROCHDALE ROAD
Town or City: MANCHESTER
Post Code: M4 4HY

Contractor

Company: WAYNE FOR DRAINS LTD
Contact: WAYNE MARTIN
Department: OPERATIONS
Street: 3 WILLOW GROVE
Town or City: BOROUGHBRIDGE
County: NORTH YORKSHIRE
Post Code: YO51 9FX
Phone: 07877 456 160
Mobile: 07877 456 160
Email: waynefordrains@gmail.com

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
1	1	06/03/25	9:54	01	No Rain Or Snow	No	FW22X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1

Town or Village:	Manchester	**Inspection Direction:**	Upstream	**Upstream Node:**	FW22
Road:	Rochdale Road	**Inspected Length:**	1.57 m	**Upstream Pipe Depth:**	
Location:	Property or buildings	**Total Length:**	1.57 m	**Downstream Node:**	CW02
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Combined	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: BLOCK 3
Recommendations:

Scale: 1:50

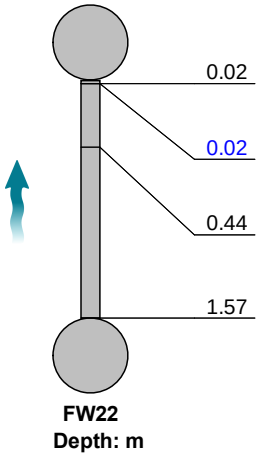

Position [m]	Code	Observation	Grade
0.02	MH	Start node, manhole, reference: CW02	
0.02	WL	Water level, 0% of the vertical dimension	
0.44	JN	Junction at 6 o'clock, 150mm dia	
1.57	MHF	Finish node, manhole, reference: FW22	


MH - 0.02


WL - 0.02


JN - 0.44


MHF - 1.57

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
2	2	06/03/25	10:02	01	No Rain Or Snow	No	FW21X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1

Town or Village:	Manchester	**Inspection Direction:**	Upstream	**Upstream Node:**	FW21
Road:	Rochdale Road	**Inspected Length:**	1.41 m	**Upstream Pipe Depth:**	
Location:	Property or buildings	**Total Length:**	1.41 m	**Downstream Node:**	FW22
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: BLOCK 3
Recommendations:

Scale: 1:50

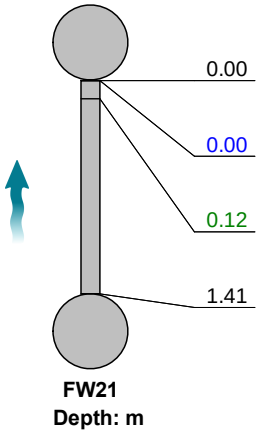

Position [m]	Code	Observation	Grade
0.00	MH	Start node, manhole, reference: FW22	
0.00	WL	Water level, 0% of the vertical dimension	
0.12	LL	Line deviates left	
1.41	MHF	Finish node, manhole, reference: FW21	


MH - 0.00


WL - 0.00


LL - 0.12


MHF - 1.41

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
3	3	06/03/25	10:08	01	No Rain Or Snow	No	FW20X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1

Town or Village:	Manchester	**Inspection Direction:**	Upstream	**Upstream Node:**	FW20
Road:	Rochdale Road	**Inspected Length:**	3.52 m	**Upstream Pipe Depth:**	
Location:	Property or buildings	**Total Length:**	3.52 m	**Downstream Node:**	FW21
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Combined	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: BLOCK 3
Recommendations:

Scale: 1:50

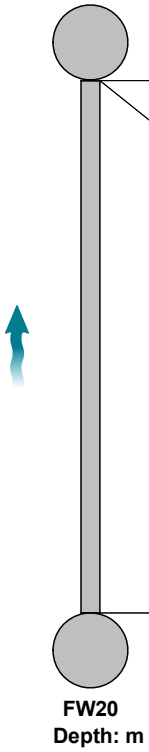

Position [m]	Code	Observation	Grade
0.00	MH	Start node, manhole, reference: FW21	
0.00	WL	Water level, 0% of the vertical dimension	
3.52	MHF	Finish node, manhole, reference: FW20	


MH - 0.00


WL - 0.00


MHF - 3.52

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
4	4	06/03/25	10:37	01	No Rain Or Snow	No	PU1X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1

Town or Village:	Manchester	**Inspection Direction:**	Downstream	**Upstream Node:**	PU1
Road:	Rochdale Road	**Inspected Length:**	3.33 m	**Upstream Pipe Depth:**	
Location:	Property or buildings	**Total Length:**	3.33 m	**Downstream Node:**	CARRIER
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: BLOCK 3
Recommendations:

Scale: 1:50

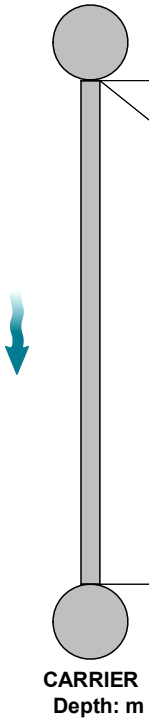

Position [m]	Code	Observation	Grade
0.00	OC	Start node, other special chamber, reference: PU1: POP UP	
0.00	LD	Line deviates down	
3.33	OCF	Finish node, other special chamber, reference: CARRIER: JUNCTION ONTO CARRIER	


OC - 0.00


LD - 0.00


OCF - 3.33

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
5	5	06/03/25	10:41	01	No Rain Or Snow	No	PU2X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1

Town or Village:	Manchester	**Inspection Direction:**	Downstream	**Upstream Node:**	PU2
Road:	Rochdale Road	**Inspected Length:**	4.08 m	**Upstream Pipe Depth:**	
Location:	Property or buildings	**Total Length:**	4.08 m	**Downstream Node:**	CARRIER
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments:
Recommendations:

Scale: 1:50



Position [m]	Code	Observation	Grade
0.00	OC	Start node, other special chamber, reference: PU2: POP UP	
0.00	LD	Line deviates down	
4.08	OCF	Finish node, other special chamber, reference: CARRIER: JUNCTION ONTO CARRIER	


OC - 0.00


LD - 0.00


OCF - 4.08

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
6	6	06/03/25	10:49	01	No Rain Or Snow	No	PU3X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1

Town or Village:	Manchester	**Inspection Direction:**	Downstream	**Upstream Node:**	PU3
Road:	Rochdale Road	**Inspected Length:**	4.74 m	**Upstream Pipe Depth:**	
Location:	Property or buildings	**Total Length:**	4.74 m	**Downstream Node:**	CARRIER
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: BLOCK 3
Recommendations:

Scale: 1:50

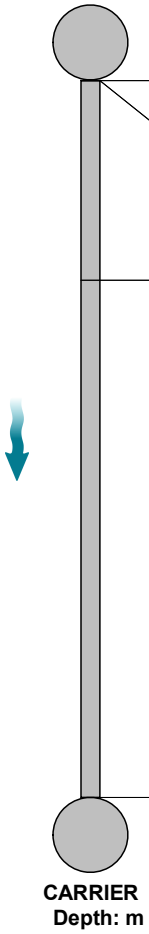

Position [m]	Code	Observation	Grade
0.00	OC	Start node, other special chamber, reference: PU3: POP UP	
0.00	LD	Line deviates down	
1.32	LL	Line deviates left	
4.74	OCF	Finish node, other special chamber, reference: CARRIER: JUNCTION ONTO CARRIER	


OC - 0.00


LD - 0.00


LL - 1.32


OCF - 4.74

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
7	7	06/03/25	10:53	01	No Rain Or Snow	No	PU4X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1

Town or Village:	Manchester	**Inspection Direction:**	Downstream	**Upstream Node:**	PU4
Road:	Rochdale Road	**Inspected Length:**	0.80 m	**Upstream Pipe Depth:**	
Location:	Property or buildings	**Total Length:**	0.80 m	**Downstream Node:**	CARRIER
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: BLOCK 3
Recommendations:

Scale: 1:50

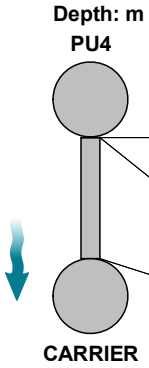

Position [m]	Code	Observation	Grade
0.00	OC	Start node, other special chamber, reference: PU4: POP UP	
0.00	LD	Line deviates down	
0.80	OCF	Finish node, other special chamber, reference: CARRIER: JUNCTION ONTO CARRIER	


OC - 0.00


LD - 0.00


OCF - 0.80

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
8	8	06/03/25	10:55	01	No Rain Or Snow	No	PU5X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1

Town or Village:	Manchester	**Inspection Direction:**	Downstream	**Upstream Node:**	PU5
Road:	Rochdale Road	**Inspected Length:**	4.46 m	**Upstream Pipe Depth:**	
Location:	Property or buildings	**Total Length:**	4.46 m	**Downstream Node:**	CARRIER
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: BLOCK 3
Recommendations:

Scale: 1:50

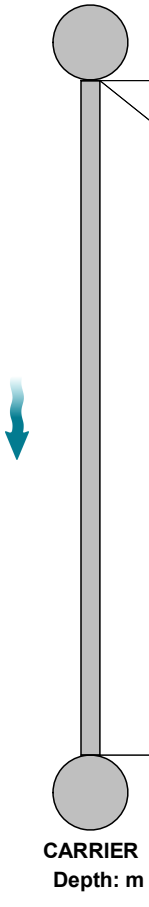

Position [m]	Code	Observation	Grade
0.00	OC	Start node, other special chamber, reference: PU5: POP UP	
0.00	LD	Line deviates down	
4.46	OCF	Finish node, other special chamber, reference: CARRIER: JUNCTION ONTO CARRIER	


OC - 0.00


LD - 0.00


OCF - 4.46

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
9	9	06/03/25	11:03	01	No Rain Or Snow	No	PU6X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1

Town or Village:	Manchester	**Inspection Direction:**	Downstream	**Upstream Node:**	PU6
Road:	Rochdale Road	**Inspected Length:**	2.84 m	**Upstream Pipe Depth:**	
Location:	Property or buildings	**Total Length:**	2.84 m	**Downstream Node:**	CARRIER
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	


Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: BLOCK 3
Recommendations:

Scale: 1:50	Position [m]	Code	Observation	Grade
Depth: m PU6				
	0.00	OC	Start node, other special chamber, reference: PU6: POP UP	
	0.00	LD	Line deviates down	
	1.51	LR	Line deviates right	
	2.84	OCF	Finish node, other special chamber, reference: CARRIER: JUNCTION ONTO CARRIER	
CARRIER				


OC - 0.00


LD - 0.00

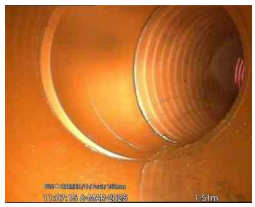
LR - 1.51


OCF - 2.84

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
10	10	06/03/25	11:10	01	No Rain Or Snow	No	PU7X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1

Town or Village:	Manchester	**Inspection Direction:**	Downstream	**Upstream Node:**	PU7
Road:	Rochdale Road	**Inspected Length:**	13.33 m	**Upstream Pipe Depth:**	
Location:	Property or buildings	**Total Length:**	13.33 m	**Downstream Node:**	FW22
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: BLOCK 3
Recommendations:

Scale: 1:116

Position [m]	Code	Observation	Grade
Depth: m PU7			
0.00	OC	Start node, other special chamber, reference: PU7: POP UP	
0.00	LD	Line deviates down	
1.33	LL	Line deviates left	
1.92	JN	Junction at 3 o'clock, 150mm dia	
4.45	JN	Junction at 9 o'clock, 150mm dia	
6.52	JN	Junction at 3 o'clock, 150mm dia	
10.41	JN	Junction at 3 o'clock, 150mm dia	
10.94	LL	Line deviates left	
13.10	JN	Junction at 6 o'clock, 150mm dia: BACKDROP	
13.33	OCF	Finish node, other special chamber, reference: FW22: MH JUST ROUND BEND	
FW22 Depth: m			


OC - 0.00


LD - 0.00


LL - 1.33


JN - 1.92


JN - 4.45

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection


Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
10	10	06/03/25	11:10	01	No Rain Or Snow	No	PU7X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1


JN - 6.52


JN - 10.41


LL - 10.94

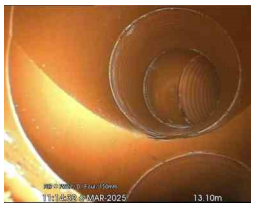
JN - 13.10


OCF - 13.33

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
11	11	06/03/25	11:18	01	No Rain Or Snow	No	PU9X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1

Town or Village:	Manchester	**Inspection Direction:**	Downstream	**Upstream Node:**	PU9
Road:	Rochdale Road	**Inspected Length:**	13.61 m	**Upstream Pipe Depth:**	
Location:	Property or buildings	**Total Length:**	13.61 m	**Downstream Node:**	FW21
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments:
Recommendations:

Scale: 1:118

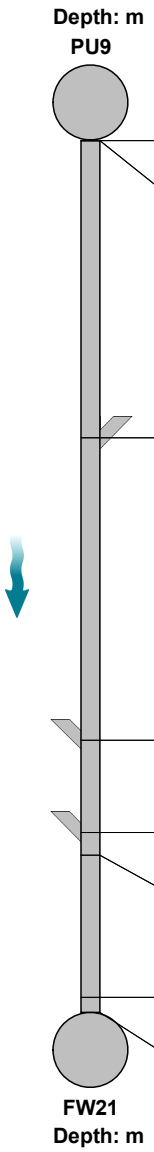

Position [m]	Code	Observation	Grade
0.00	OC	Start node, other special chamber, reference: PU9: POP UP	
0.00	LD	Line deviates down	
4.64	JN	Junction at 9 o'clock, 150mm dia	
9.36	JN	Junction at 3 o'clock, 150mm dia	
10.80	JN	Junction at 3 o'clock, 150mm dia	
11.16	LD	Line deviates down	
13.38	JN	Junction at 6 o'clock, 150mm dia: BACKDROP	
13.61	MHF	Finish node, manhole, reference: FW21: IN VIEW	


OC - 0.00


LD - 0.00


JN - 4.64


JN - 9.36


JN - 10.80

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
11	11	06/03/25	11:18	01	No Rain Or Snow	No	PU9X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1


LD - 11.16


JN - 13.38


MHF - 13.61

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
12	12	06/03/25	11:25	01	No Rain Or Snow	No	PU8X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1

Town or Village:	Manchester	**Inspection Direction:**	Downstream	**Upstream Node:**	PU8
Road:	Rochdale Road	**Inspected Length:**	1.29 m	**Upstream Pipe Depth:**	
Location:	Property or buildings	**Total Length:**	1.29 m	**Downstream Node:**	CARRIER
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: BLOCK 3
Recommendations:

Scale: 1:50



Position [m]	Code	Observation	Grade
0.00	OC	Start node, other special chamber, reference: PU8: POP UP	
0.00	LD	Line deviates down	
1.29	OCF	Finish node, other special chamber, reference: CARRIER: JUNCTION ONTO CARRIER	


OC - 0.00


LD - 0.00


OCF - 1.29

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
13	13	06/03/25	11:38	01	No Rain Or Snow	No	PU17X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1

Town or Village:	Manchester	**Inspection Direction:**	Downstream	**Upstream Node:**	PU17
Road:	Rochdale Road	**Inspected Length:**	1.26 m	**Upstream Pipe Depth:**	
Location:	Property or buildings	**Total Length:**	1.26 m	**Downstream Node:**	CARRIER
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: BLOCK 3
Recommendations:

Scale: 1:50	Position [m]	Code	Observation	Grade
Depth: m PU17				
	0.00	OC	Start node, other special chamber, reference: PU17: POP UP	
	0.00	LD	Line deviates down	
	0.38	LD	Line deviates down	
	1.26	OCF	Finish node, other special chamber, reference: CARRIER: JUNCTION ONTO CARRIER	
CARRIER Depth: m				


OC - 0.00


LD - 0.00


LD - 0.38


OCF - 1.26

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
14	14	06/03/25	11:42	01	No Rain Or Snow	No	PU15X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1

Town or Village:	Manchester	**Inspection Direction:**	Downstream	**Upstream Node:**	PU15
Road:	Rochdale Road	**Inspected Length:**	6.32 m	**Upstream Pipe Depth:**	
Location:	Property or buildings	**Total Length:**	6.32 m	**Downstream Node:**	CARRIER
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: BLOCK 3
Recommendations:

Scale: 1:55

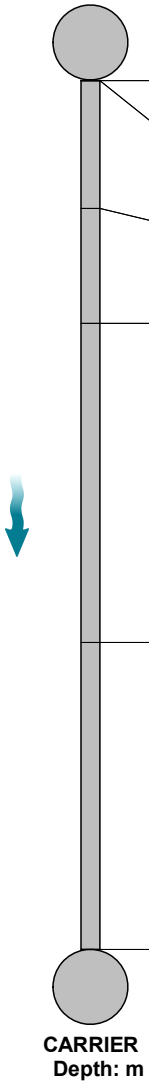

Position [m]	Code	Observation	Grade
0.00	OC	Start node, other special chamber, reference: PU15: POP UP	
0.00	LD	Line deviates down	
0.93	LL	Line deviates left	
1.77	LD	Line deviates down	
4.09	LL	Line deviates left	
6.32	OCF	Finish node, other special chamber, reference: CARRIER: JUNCTION ONTO CARRIER	


OC - 0.00


LD - 0.00


LL - 0.93


LD - 1.77


LL - 4.09

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
14	14	06/03/25	11:42	01	No Rain Or Snow	No	PU15X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1



OCF - 6.32

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
15	15	06/03/25	11:47	01	No Rain Or Snow	No	PU16X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1

Town or Village:	Manchester	**Inspection Direction:**	Downstream	**Upstream Node:**	PU16
Road:	Rochdale Road	**Inspected Length:**	4.53 m	**Upstream Pipe Depth:**	
Location:	Property or buildings	**Total Length:**	4.53 m	**Downstream Node:**	CARRIER
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: BLOCK 3
Recommendations:

Scale: 1:50



Position [m]	Code	Observation	Grade
0.00	OC	Start node, other special chamber, reference: PU16: POP UP	
0.00	LD	Line deviates down	
1.12	LR	Line deviates right	
4.14	LL	Line deviates left	
4.53	OCF	Finish node, other special chamber, reference: CARRIER: JUNCTION ONTO CARRIER	


OC - 0.00


LD - 0.00


LR - 1.12


LL - 4.14


OCF - 4.53

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
16	16	06/03/25	11:52	01	No Rain Or Snow	No	PU14X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1

Town or Village:	Manchester	**Inspection Direction:**	Downstream	**Upstream Node:**	PU14
Road:	Rochdale Road	**Inspected Length:**	5.93 m	**Upstream Pipe Depth:**	
Location:	Property or buildings	**Total Length:**	5.93 m	**Downstream Node:**	CARRIER
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: BLOCK 3
Recommendations:

Scale: 1:52



Position [m]	Code	Observation	Grade
0.00	OC	Start node, other special chamber, reference: PU14: POP UP	
0.00	LD	Line deviates down	
3.74	LD	Line deviates down	
4.05	LL	Line deviates left	
5.93	OCF	Finish node, other special chamber, reference: CARRIER: JUNCTION ONTO CARRIER	


OC - 0.00


LD - 0.00


LD - 3.74


LL - 4.05


OCF - 5.93

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
17	17	06/03/25	12:55	01	No Rain Or Snow	No	PU13X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1

Town or Village:	Manchester	**Inspection Direction:**	Downstream	**Upstream Node:**	PU13
Road:	Rochdale Road	**Inspected Length:**	8.48 m	**Upstream Pipe Depth:**	
Location:	Property or buildings	**Total Length:**	8.48 m	**Downstream Node:**	CARRIER
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: BLOCK 3
Recommendations:

Scale: 1:74

Position [m]	Code	Observation	Grade
Depth: m PU13			
0.00	OC	Start node, other special chamber, reference: PU13: POP UP	
0.00	LD	Line deviates down	
1.78	LL	Line deviates left	
5.93	JN	Junction at 3 o'clock, 150mm dia	
7.86	JN	Junction at 9 o'clock, 150mm dia	
8.48	OCF	Finish node, other special chamber, reference: CARRIER: JUNCTION ONTO CARRIER	
CARRIER Depth: m			


OC - 0.00


LD - 0.00


LL - 1.78


JN - 5.93


JN - 7.86

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
17	17	06/03/25	12:55	01	No Rain Or Snow	No	PU13X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1



OCF - 8.48

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection


Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
18	18	06/03/25	13:10	01	No Rain Or Snow	No	PU11X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1

Town or Village:	Manchester	**Inspection Direction:**	Downstream	**Upstream Node:**	PU11
Road:	Rochdale Road	**Inspected Length:**	16.32 m	**Upstream Pipe Depth:**	
Location:	Property or buildings	**Total Length:**	16.32 m	**Downstream Node:**	FW20
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining
Comments:	BLOCK 3		
Recommendations:			

Scale: 1:142

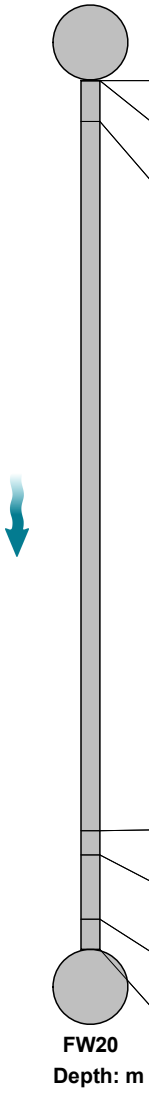


Position [m]	Code	Observation	Grade
0.00	OC	Start node, other special chamber, reference: PU11: POP UP	
0.00	LD	Line deviates down	
0.78	LL	Line deviates left	
14.10	LR	Line deviates right	
14.55	LD	Line deviates down	
15.76	LL	Line deviates left	
16.32	MHF	Finish node, manhole, reference: FW20	


OC - 0.00


LD - 0.00


LL - 0.78

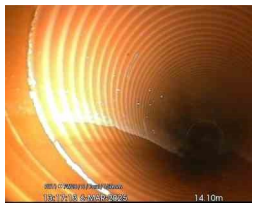
LR - 14.10


LD - 14.55

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
18	18	06/03/25	13:10	01	No Rain Or Snow	No	PU11X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1


LL - 15.76


MHF - 16.32

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
19	19	06/03/25	13:20	01	No Rain Or Snow	No	PU10X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1

Town or Village:	Manchester	**Inspection Direction:**	Downstream	**Upstream Node:**	PU10
Road:	Rochdale Road	**Inspected Length:**	12.04 m	**Upstream Pipe Depth:**	
Location:	Property or buildings	**Total Length:**	12.04 m	**Downstream Node:**	CARRIER
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: BLOCK 3
Recommendations:

Scale: 1:105

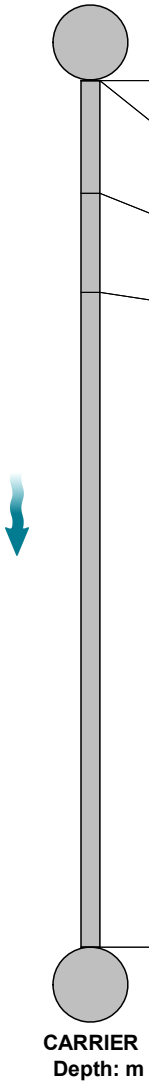

Position [m]	Code	Observation	Grade
0.00	OC	Start node, other special chamber, reference: PU10: POP UP	
0.00	LD	Line deviates down	
1.57	LR	Line deviates right	
2.95	WL	Water level, 10% of the vertical dimension	
12.04	OCF	Finish node, other special chamber, reference: CARRIER: JUNCTION ONTO CARRIER	


OC - 0.00


LD - 0.00


LR - 1.57


WL - 2.95


OCF - 12.04

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
20	20	06/03/25	14:47	01	No Rain Or Snow	No	FW19X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1

Town or Village:	Manchester	**Inspection Direction:**	Downstream	**Upstream Node:**	FW19
Road:	Rochdale Road	**Inspected Length:**	15.25 m	**Upstream Pipe Depth:**	
Location:	Property or buildings	**Total Length:**	15.25 m	**Downstream Node:**	FW18
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: BLOCK 1
Recommendations:

Scale: 1:133

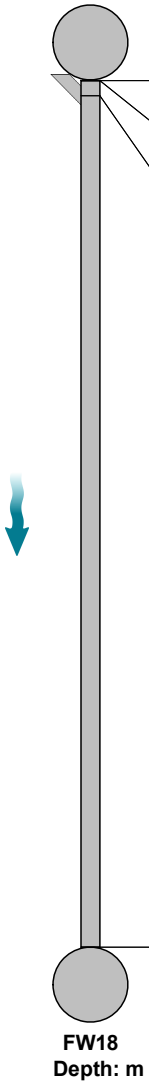

Position [m]	Code	Observation	Grade
0.00	MH	Start node, manhole, reference: FW19	
0.00	WL	Water level, 0% of the vertical dimension	
0.27	JN	Junction at 3 o'clock, 150mm dia	
15.25	MHF	Finish node, manhole, reference: FW18	


MH - 0.00


WL - 0.00


JN - 0.27


MHF - 15.25

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
21	21	06/03/25	14:51	01	No Rain Or Snow	No	FW18X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1

Town or Village:	Manchester	**Inspection Direction:**	Downstream	**Upstream Node:**	FW18
Road:	Rochdale Road	**Inspected Length:**	14.72 m	**Upstream Pipe Depth:**	
Location:	Property or buildings	**Total Length:**	14.72 m	**Downstream Node:**	FW17
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: BLOCK 1
Recommendations:

Scale: 1:128

Position [m]	Code	Observation	Grade
		Depth: m	
		FW18	
0.00	MH	Start node, manhole, reference: FW18	
0.00	WL	Water level, 0% of the vertical dimension	
12.73	JN	Junction at 3 o'clock, 150mm dia	
14.72	MHF	Finish node, manhole, reference: FW17	
		FW17	
		Depth: m	


MH - 0.00


WL - 0.00


JN - 12.73


MHF - 14.72

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
22	22	06/03/25	14:58	01	No Rain Or Snow	No	FW15X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1

Town or Village:	Manchester	**Inspection Direction:**	Upstream	**Upstream Node:**	FW15
Road:	Rochdale Road	**Inspected Length:**	29.57 m	**Upstream Pipe Depth:**	
Location:	Property or buildings	**Total Length:**	29.57 m	**Downstream Node:**	FW19
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: BLOCK 1
Recommendations:

Scale: 1:257

Position [m]	Code	Observation	Grade
		Depth: m **FW19**	
0.00	MH	Start node, manhole, reference: FW19	
0.00	WL	Water level, 0% of the vertical dimension	
9.89	JN	Junction at 10 o'clock, 150mm dia	
26.78	JN	Junction at 10 o'clock, 150mm dia	
29.57	ICF	Finish node, inspection chamber, reference: FW15	
		FW15 **Depth: m**	


MH - 0.00


WL - 0.00


JN - 9.89


JN - 26.78


ICF - 29.57

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
23	23	06/03/25	15:06	01	No Rain Or Snow	No	SW18AX

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1

Town or Village:	Manchester	**Inspection Direction:**	Downstream	**Upstream Node:**	SW18A
Road:	Rochdale Road	**Inspected Length:**	25.44 m	**Upstream Pipe Depth:**	
Location:	Property or buildings	**Total Length:**	25.44 m	**Downstream Node:**	SW18
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	225 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: BLOCK 1
Recommendations:

Scale: 1:221


Position [m]	Code	Observation	Grade
		Depth: m	
		SW18A	
0.00	IC	Start node, inspection chamber, reference: SW18A	
0.00	WL	Water level, 0% of the vertical dimension	
7.26	JN	Junction at 3 o'clock, 150mm dia	
7.67	JN	Junction at 1 o'clock, 150mm dia	
10.45	JN	Junction at 3 o'clock, 150mm dia	
21.30	JN	Junction at 10 o'clock, 150mm dia	
25.44	MHF	Finish node, manhole, reference: SW18	
		SW18	
		Depth: m	


IC - 0.00


WL - 0.00


JN - 7.26


JN - 7.67

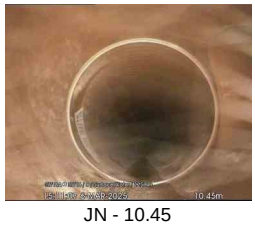
JN - 10.45

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
23	23	06/03/25	15:06	01	No Rain Or Snow	No	SW18AX

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1


JN - 21.30


MHF - 25.44

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
24	24	06/03/25	15:18	01	No Rain Or Snow	No	SW17X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1

Town or Village:	Manchester	**Inspection Direction:**	Upstream	**Upstream Node:**	SW17
Road:	Rochdale Road	**Inspected Length:**	5.99 m	**Upstream Pipe Depth:**	
Location:	Property or buildings	**Total Length:**	5.99 m	**Downstream Node:**	SW16
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	300 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: BLOCK 1
Recommendations:

Scale: 1:52

Position [m]	Code	Observation	Grade
Depth: m SW16			
0.04	MH	Start node, manhole, reference: SW16	
0.05	WL	Water level, 0% of the vertical dimension	
5.99	MHF	Finish node, manhole, reference: SW17	
SW17 Depth: m			


MH - 0.04


MHF - 5.99

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
25	25	06/03/25	15:20	01	No Rain Or Snow	No	SW18X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1

Town or Village:	Manchester	**Inspection Direction:**	Upstream	**Upstream Node:**	SW18
Road:	Rochdale Road	**Inspected Length:**	19.37 m	**Upstream Pipe Depth:**	
Location:	Property or buildings	**Total Length:**	19.37 m	**Downstream Node:**	SW17
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	300 mm
Flow Control:	No flow control	**Material:**	Vitrified clay
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: BLOCK 1
Recommendations:

Scale: 1:168

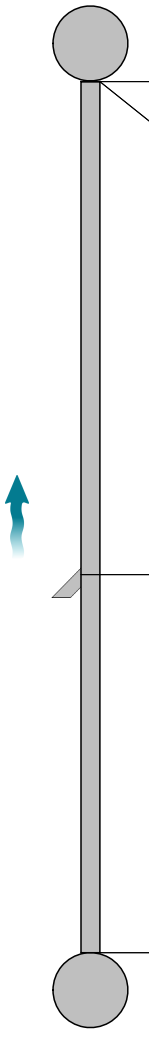

Position [m]	Code	Observation	Grade
0.00	MH	Start node, manhole, reference: SW17	
0.00	WL	Water level, 0% of the vertical dimension	
10.97	JN	Junction at 2 o'clock, 150mm dia	
19.37	MHF	Finish node, manhole, reference: SW18	


MH - 0.00


WL - 0.00


JN - 10.97


MHF - 19.37

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
26	26	07/03/25	9:07	01	No Rain Or Snow	No	PU27X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1

Town or Village:	Manchester	**Inspection Direction:**	Downstream	**Upstream Node:**	PU27
Road:	Rochdale Road	**Inspected Length:**	8.42 m	**Upstream Pipe Depth:**	
Location:	Property or buildings	**Total Length:**	8.42 m	**Downstream Node:**	CARRIER
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	


Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: BLOCK 4
Recommendations:

Scale: 1:73

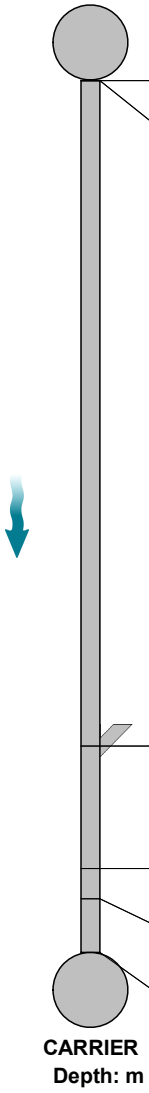

Position [m]	Code	Observation	Grade
0.00	OC	Start node, other special chamber, reference: PU27: POP UP	
0.00	LD	Line deviates down	
6.43	JN	Junction at 9 o'clock, 150mm dia	
7.61	LR	Line deviates right	
7.90	LD	Line deviates down	
8.42	OCF	Finish node, other special chamber, reference: CARRIER: JUNCTION ONTO CARRIER	

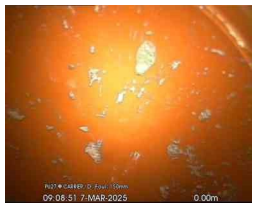
OC - 0.00


LD - 0.00


JN - 6.43


LR - 7.61


LD - 7.90

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
26	26	07/03/25	9:07	01	No Rain Or Snow	No	PU27X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1



OCF - 8.42

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
27	27	07/03/25	9:12	01	No Rain Or Snow	No	PU28X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1

Town or Village:	Manchester	**Inspection Direction:**	Downstream	**Upstream Node:**	PU28
Road:	Rochdale Road	**Inspected Length:**	3.56 m	**Upstream Pipe Depth:**	
Location:	Property or buildings	**Total Length:**	3.56 m	**Downstream Node:**	CARRIER
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: BLOCK 4
Recommendations:

Scale: 1:50

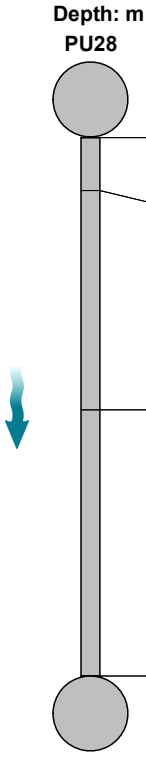

Position [m]	Code	Observation	Grade
0.00	OC	Start node, other special chamber, reference: PU28: POP UP	
0.35	LL	Line deviates left	
1.80	LR	Line deviates right	
3.56	OCF	Finish node, other special chamber, reference: CARRIER: JUNCTION ONTO CARRIER	


OC - 0.00


LL - 0.35


LR - 1.80


OCF - 3.56

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
28	28	07/03/25	9:17	01	No Rain Or Snow	No	PU29X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1


Town or Village:	Manchester	**Inspection Direction:**	Downstream	**Upstream Node:**	PU29
Road:	Rochdale Road	**Inspected Length:**	6.78 m	**Upstream Pipe Depth:**	
Location:	Property or buildings	**Total Length:**	6.78 m	**Downstream Node:**	CARRIER
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: BLOCK 4
Recommendations:

Scale: 1:59

Depth: m
PU29

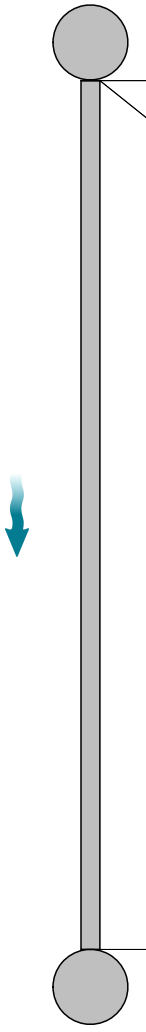


CARRIER
Depth: m

Position [m]	Code	Observation	Grade
0.00	OC	Start node, other special chamber, reference: PU29: POP UP	
0.00	LD	Line deviates down	
6.78	OCF	Finish node, other special chamber, reference: CARRIER: JUNCTION ONTO CARRIER	


OC - 0.00


LD - 0.00

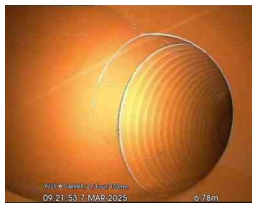
OCF - 6.78

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
29	29	07/03/25	9:23	01	No Rain Or Snow	No	PU30X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1

Town or Village:	Manchester	**Inspection Direction:**	Downstream	**Upstream Node:**	PU30
Road:	Rochdale Road	**Inspected Length:**	5.05 m	**Upstream Pipe Depth:**	
Location:	Property or buildings	**Total Length:**	5.05 m	**Downstream Node:**	CARRIER
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: BLOCK 4
Recommendations:

Scale: 1:50

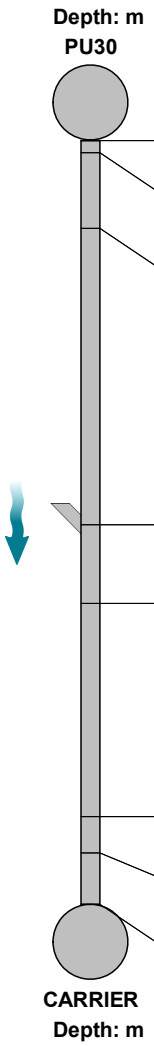

Position [m]	Code	Observation	Grade
0.00	OC	Start node, other special chamber, reference: PU30: POP UP	
0.08	LR	Line deviates right	
0.58	LL	Line deviates left	
2.54	JN	Junction at 3 o'clock, 150mm dia	
3.06	LD	Line deviates down	
4.47	LR	Line deviates right	
4.71	LD	Line deviates down	
5.05	OCF	Finish node, other special chamber, reference: CARRIER: JUNCTION ONTO CARRIER	


OC - 0.00


LR - 0.08


LL - 0.58


JN - 2.54


LD - 3.06

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
29	29	07/03/25	9:23	01	No Rain Or Snow	No	PU30X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1



LR - 4.47



LD - 4.71



OCF - 5.05

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
30	30	07/03/25	9:37	01	No Rain Or Snow	No	PU31X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1

Town or Village:	Manchester	**Inspection Direction:**	Downstream	**Upstream Node:**	PU31
Road:	Rochdale Road	**Inspected Length:**	9.03 m	**Upstream Pipe Depth:**	
Location:	Property or buildings	**Total Length:**	9.03 m	**Downstream Node:**	CARRIER
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: BLOCK 4
Recommendations:

Scale: 1:79



Position [m]	Code	Observation	Grade
0.00	OC	Start node, other special chamber, reference: PU31: POP UP	
0.00	LD	Line deviates down	
2.24	LD	Line deviates down	
6.48	JN	Junction at 3 o'clock, 150mm dia	
7.06	JN	Junction at 9 o'clock, 150mm dia	
8.53	LR	Line deviates right	
8.74	LD	Line deviates down	
9.03	OCF	Finish node, other special chamber, reference: CARRIER: JUNCTION ONTO CARRIER	


OC - 0.00


LD - 0.00


LD - 2.24


JN - 6.48


JN - 7.06

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
30	30	07/03/25	9:37	01	No Rain Or Snow	No	PU31X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1


LR - 8.53


LD - 8.74


OCF - 9.03

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
31	31	07/03/25	9:59	01	No Rain Or Snow	No	PU32X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1

Town or Village:	Manchester	**Inspection Direction:**	Downstream	**Upstream Node:**	PU32
Road:	Rochdale Road	**Inspected Length:**	3.41 m	**Upstream Pipe Depth:**	
Location:	Property or buildings	**Total Length:**	3.41 m	**Downstream Node:**	CARRIER
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: BLOCK 4
Recommendations:


Scale: 1:50

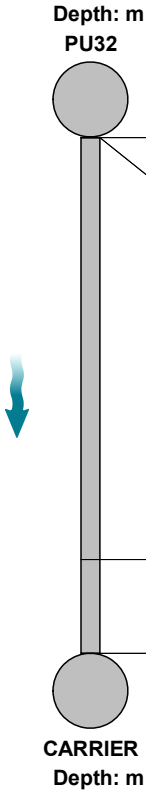


Position [m]	Code	Observation	Grade
0.00	OC	Start node, other special chamber, reference: PU32: POP UP	
0.00	LD	Line deviates down	
2.79	LR	Line deviates right	
3.41	OCF	Finish node, other special chamber, reference: CARRIER: JUNCTION ONTO CARRIER	


OC - 0.00


LD - 0.00

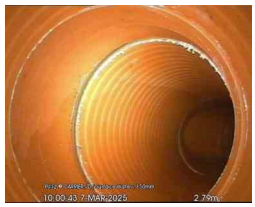
LR - 2.79

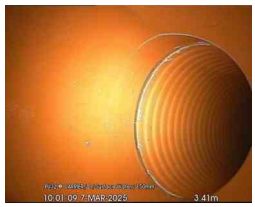
OCF - 3.41

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
32	32	07/03/25	10:05	01	No Rain Or Snow	No	PU33X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1

Town or Village:	Manchester	**Inspection Direction:**	Downstream	**Upstream Node:**	PU33
Road:	Rochdale Road	**Inspected Length:**	3.68 m	**Upstream Pipe Depth:**	
Location:	Property or buildings	**Total Length:**	3.68 m	**Downstream Node:**	CARRIER
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: BLOCK 4
Recommendations:

Scale: 1:50

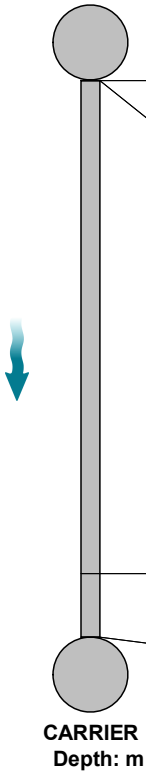

Position [m]	Code	Observation	Grade
0.00	OC	Start node, other special chamber, reference: PU33: POP UP	
0.00	LD	Line deviates down	
3.26	LR	Line deviates right	
3.68	OCF	Finish node, other special chamber, reference: CARRIER: JUNCTION ONTO CARRIER	


OC - 0.00


LD - 0.00


LR - 3.26


OCF - 3.68

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
33	33	07/03/25	10:12	01	No Rain Or Snow	No	PU34X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1

Town or Village:	Manchester	**Inspection Direction:**	Downstream	**Upstream Node:**	PU34
Road:	Rochdale Road	**Inspected Length:**	4.92 m	**Upstream Pipe Depth:**	
Location:	Property or buildings	**Total Length:**	4.92 m	**Downstream Node:**	CARRIER
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: BLOCK 4
Recommendations:

Scale: 1:50

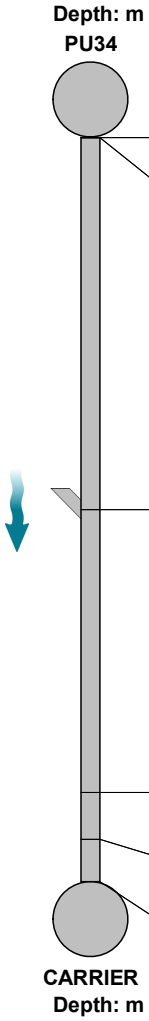

Position [m]	Code	Observation	Grade
0.00	OC	Start node, other special chamber, reference: PU34: POP UP	
0.00	LD	Line deviates down	
2.46	JN	Junction at 3 o'clock, 150mm dia	
4.33	LR	Line deviates right	
4.64	LD	Line deviates down	
4.92	OCF	Finish node, other special chamber, reference: CARRIER: JUNCTION ONTO CARRIER	


OC - 0.00


LD - 0.00


JN - 2.46


LR - 4.33


LD - 4.64

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
33	33	07/03/25	10:12	01	No Rain Or Snow	No	PU34X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1



OCF - 4.92

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
34	34	07/03/25	10:15	01	No Rain Or Snow	No	PU35X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1

Town or Village:	Manchester	**Inspection Direction:**	Downstream	**Upstream Node:**	PU35
Road:	Rochdale Road	**Inspected Length:**	8.05 m	**Upstream Pipe Depth:**	
Location:	Property or buildings	**Total Length:**	8.05 m	**Downstream Node:**	CARRIER
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: BLOCK 4
Recommendations:

Scale: 1:70

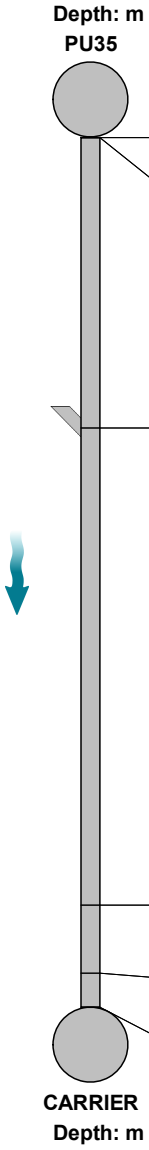

Position [m]	Code	Observation	Grade
0.00	OC	Start node, other special chamber, reference: PU35: POP UP	
0.00	LD	Line deviates down	
2.69	JN	Junction at 3 o'clock, 150mm dia	
7.11	LR	Line deviates right	
7.74	LD	Line deviates down	
8.05	OCF	Finish node, other special chamber, reference: CARRIER: JUNCTION ONTO CARRIER	


OC - 0.00


LD - 0.00


JN - 2.69


LR - 7.11


LD - 7.74

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
34	34	07/03/25	10:15	01	No Rain Or Snow	No	PU35X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1



OCF - 8.05

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
35	35	07/03/25	11:33	01	No Rain Or Snow	No	PU37X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1

Town or Village:	Manchester	**Inspection Direction:**	Downstream	**Upstream Node:**	PU37
Road:	Rochdale Road	**Inspected Length:**	5.75 m	**Upstream Pipe Depth:**	
Location:	Property or buildings	**Total Length:**	5.75 m	**Downstream Node:**	CARRIER
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: BLOCK 4
Recommendations:

Scale: 1:50

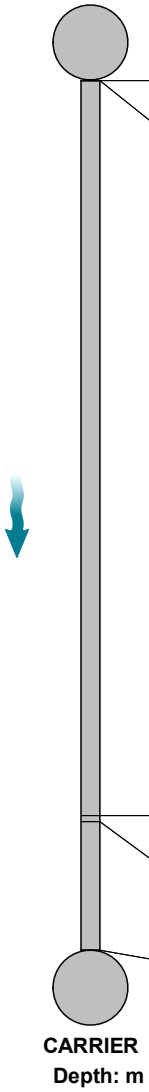

Position [m]	Code	Observation	Grade
0.00	OC	Start node, other special chamber, reference: PU37: POP UP	
0.00	LD	Line deviates down	
4.86	LL	Line deviates left	
4.90	LD	Line deviates down	
5.75	OCF	Finish node, other special chamber, reference: CARRIER: JUNCTION ONTO CARRIER	


OC - 0.00


LD - 0.00


LL - 4.86


LD - 4.90


OCF - 5.75

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
36	36	07/03/25	12:02	01	No Rain Or Snow	No	PU38X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1

Town or Village:	Manchester	**Inspection Direction:**	Downstream	**Upstream Node:**	PU38
Road:	Rochdale Road	**Inspected Length:**	1.45 m	**Upstream Pipe Depth:**	
Location:	Property or buildings	**Total Length:**	1.45 m	**Downstream Node:**	CARRIER
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: BLOCK 4
Recommendations:

Scale: 1:50



Position [m]	Code	Observation	Grade
0.02	OC	Start node, other special chamber, reference: PU38: POP UP	
0.02	LD	Line deviates down	
0.99	LL	Line deviates left	
1.07	LD	Line deviates down	
1.45	OCF	Finish node, other special chamber, reference: CARRIER: JUNCTION ONTO CARRIER	


OC - 0.02


LD - 0.02


LL - 0.99


LD - 1.07


OCF - 1.45

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
37	37	07/03/25	12:10	01	No Rain Or Snow	No	PU39X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1

Town or Village:	Manchester	**Inspection Direction:**	Downstream	**Upstream Node:**	PU39
Road:	Rochdale Road	**Inspected Length:**	2.17 m	**Upstream Pipe Depth:**	
Location:	Property or buildings	**Total Length:**	2.17 m	**Downstream Node:**	CARRIER
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: BLOCK 4
Recommendations:

Scale: 1:50 Position [m]	Code	Observation	Grade
Depth: m PU39			
0.00	OC	Start node, other special chamber, reference: PU39: POP UP	
0.00	LD	Line deviates down	
1.07	LL	Line deviates left	
1.84	LD	Line deviates down	
2.17	OCF	Finish node, other special chamber, reference: CARRIER: JUNCTION ONTO CARRIER	
CARRIER Depth: m			


OC - 0.00


LD - 0.00


LL - 1.07


LD - 1.84


OCF - 2.17

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
38	38	07/03/25	12:16	01	No Rain Or Snow	No	PU40X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1

Town or Village:	Manchester	**Inspection Direction:**	Downstream	**Upstream Node:**	PU40
Road:	Rochdale Road	**Inspected Length:**	2.15 m	**Upstream Pipe Depth:**	
Location:	Property or buildings	**Total Length:**	2.15 m	**Downstream Node:**	CARRIER
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: BLOCK 4
Recommendations:

Scale: 1:50

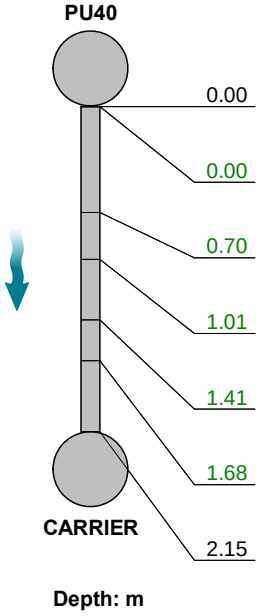

Position [m]	Code	Observation	Grade
0.00	OC	Start node, other special chamber, reference: PU40: POP UP	
0.00	LD	Line deviates down	
0.70	LL	Line deviates left	
1.01	LD	Line deviates down	
1.41	LL	Line deviates left	
1.68	LD	Line deviates down	
2.15	OCF	Finish node, other special chamber, reference: CARRIER: JUNCTION ONTO CARRIER	


OC - 0.00


LD - 0.00


LL - 0.70


LD - 1.01


LL - 1.41


LD - 1.68


OCF - 2.15

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
39	39	07/03/25	12:28	01	No Rain Or Snow	No	PU41X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1

Town or Village:	Manchester	**Inspection Direction:**	Downstream	**Upstream Node:**	PU41
Road:	Rochdale Road	**Inspected Length:**	2.52 m	**Upstream Pipe Depth:**	
Location:	Property or buildings	**Total Length:**	2.52 m	**Downstream Node:**	CARRIER
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: BLOCK 4
Recommendations:

Scale: 1:50

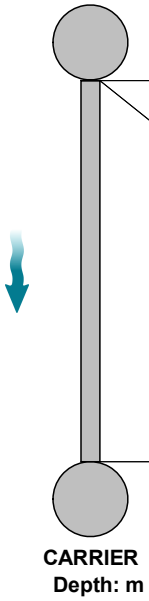

Position [m]	Code	Observation	Grade
0.00	OC	Start node, other special chamber, reference: PU41: POP UP	
0.00	LD	Line deviates down	
2.52	OCF	Finish node, other special chamber, reference: CARRIER: JUNCTION ONTO CARRIER	


OC - 0.00


LD - 0.00


OCF - 2.52

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
40	40	07/03/25	12:33	01	No Rain Or Snow	No	PU42X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1

Town or Village:	Manchester	**Inspection Direction:**	Downstream	**Upstream Node:**	PU42
Road:	Rochdale Road	**Inspected Length:**	1.95 m	**Upstream Pipe Depth:**	
Location:	Property or buildings	**Total Length:**	1.95 m	**Downstream Node:**	CARRIER
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: BLOCK 4
Recommendations:

Scale: 1:50

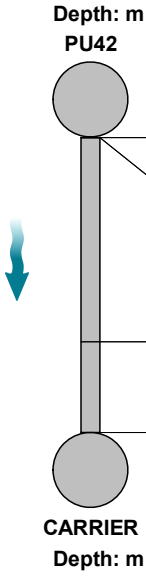

Position [m]	Code	Observation	Grade
0.00	OC	Start node, other special chamber, reference: PU42: POP UP	
0.00	LD	Line deviates down	
1.35	LD	Line deviates down	
1.95	OCF	Finish node, other special chamber, reference: CARRIER: JUNCTION ONTO CARRIER	


OC - 0.00


LD - 0.00


LD - 1.35


OCF - 1.95

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
41	41	07/03/25	12:41	01	No Rain Or Snow	No	PU43X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1

Town or Village:	Manchester	**Inspection Direction:**	Downstream	**Upstream Node:**	PU43
Road:	Rochdale Road	**Inspected Length:**	1.99 m	**Upstream Pipe Depth:**	
Location:	Property or buildings	**Total Length:**	1.99 m	**Downstream Node:**	CARRIER
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	


Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: BLOCK 4
Recommendations:

Scale: 1:50	Position [m]	Code	Observation	Grade
Depth: m PU43				
	0.00	OC	Start node, other special chamber, reference: PU43: POP UP	
	0.00	LD	Line deviates down	
	0.89	JN	Junction at 9 o'clock, 150mm dia	
	1.35	LD	Line deviates down	
	1.72	LL	Line deviates left	
	1.99	OCF	Finish node, other special chamber, reference: CARRIER: JUNCTION ONTO CARRIER	
CARRIER Depth: m				


OC - 0.00


LD - 0.00

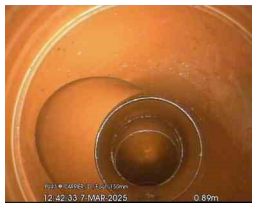
JN - 0.89


LD - 1.35


LL - 1.72


OCF - 1.99

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
42	42	07/03/25	12:44	01	No Rain Or Snow	No	PU44X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1

Town or Village:	Manchester	**Inspection Direction:**	Downstream	**Upstream Node:**	PU44
Road:	Rochdale Road	**Inspected Length:**	6.95 m	**Upstream Pipe Depth:**	
Location:	Property or buildings	**Total Length:**	6.95 m	**Downstream Node:**	CARRIER
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining


Comments: BLOCK 4
Recommendations:

Scale: 1:61



Position [m]	Code	Observation	Grade
0.00	OC	Start node, other special chamber, reference: PU44: POP UP	
1.28	LR	Line deviates right	
1.65	JN	Junction at 9 o'clock, 150mm dia	
4.34	LD	Line deviates down	
6.20	LL	Line deviates left	
6.30	LD	Line deviates down	
6.95	OCF	Finish node, other special chamber, reference: CARRIER: JUNCTION ONTO CARRIER	


OC - 0.00

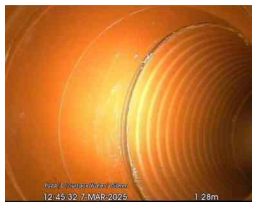
LR - 1.28


JN - 1.65


LD - 4.34


LL - 6.20

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
42	42	07/03/25	12:44	01	No Rain Or Snow	No	PU44X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1



LD - 6.30



OCF - 6.95

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
43	43	07/03/25	12:48	01	No Rain Or Snow	No	PU45X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1

Town or Village:	Manchester	**Inspection Direction:**	Downstream	**Upstream Node:**	PU45
Road:	Rochdale Road	**Inspected Length:**	0.99 m	**Upstream Pipe Depth:**	
Location:	Property or buildings	**Total Length:**	0.99 m	**Downstream Node:**	CARRIER
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: BLOCK 4
Recommendations:

Scale: 1:50

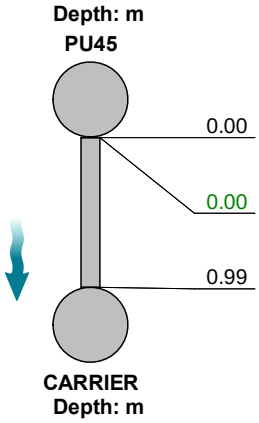

Position [m]	Code	Observation	Grade
0.00	OC	Start node, other special chamber, reference: PU45: POP UP	
0.00	LD	Line deviates down	
0.99	OCF	Finish node, other special chamber, reference: CARRIER: JUNCTION ONTO CARRIER	


OC - 0.00


LD - 0.00


OCF - 0.99

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
44	44	07/03/25	13:16	01	No Rain Or Snow	No	PU46X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1

Town or Village:	Manchester	**Inspection Direction:**	Downstream	**Upstream Node:**	PU46
Road:	Rochdale Road	**Inspected Length:**	3.20 m	**Upstream Pipe Depth:**	
Location:	Property or buildings	**Total Length:**	3.20 m	**Downstream Node:**	CARRIER
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: BLOCK 4
Recommendations:

Scale: 1:50

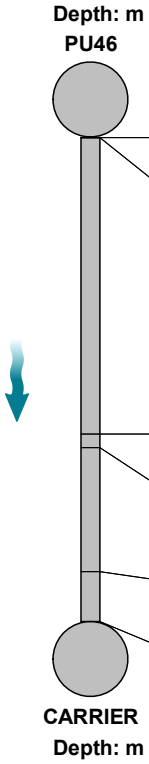


Position [m]	Code	Observation	Grade
0.00	OC	Start node, other special chamber, reference: PU46: POP UP	
0.00	LD	Line deviates down	
1.96	LR	Line deviates right	
2.05	LD	Line deviates down	
2.87	LD	Line deviates down	
3.20	OCF	Finish node, other special chamber, reference: CARRIER: JUNCTION ONTO CARRIER	


OC - 0.00


LD - 0.00


LR - 1.96


LD - 2.05

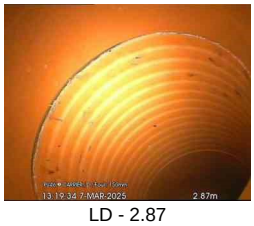
LD - 2.87


OCF - 3.20

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
45	45	07/03/25	13:22	01	No Rain Or Snow	No	PU47X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1

Town or Village:	Manchester	**Inspection Direction:**	Downstream	**Upstream Node:**	PU47
Road:	Rochdale Road	**Inspected Length:**	2.36 m	**Upstream Pipe Depth:**	
Location:	Property or buildings	**Total Length:**	2.36 m	**Downstream Node:**	CARRIER
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining


Comments: BLOCK 4
Recommendations:

Scale: 1:50


Depth: m
PU47

CARRIER
Depth: m

Position [m]	Code	Observation	Grade
0.00	OC	Start node, other special chamber, reference: PU47: POP UP	
0.00	LD	Line deviates down	
2.36	OCF	Finish node, other special chamber, reference: CARRIER: JUNCTION ONTO CARRIER	

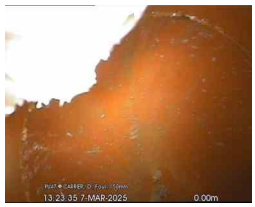
OC - 0.00


LD - 0.00

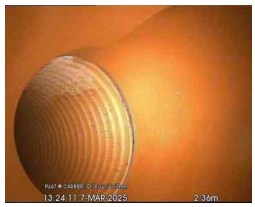
OCF - 2.36

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
46	46	07/03/25	13:25	01	No Rain Or Snow	No	PU48X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1

Town or Village:	Manchester	**Inspection Direction:**	Downstream	**Upstream Node:**	PU48
Road:	Rochdale Road	**Inspected Length:**	1.14 m	**Upstream Pipe Depth:**	
Location:	Property or buildings	**Total Length:**	1.14 m	**Downstream Node:**	CARRIER
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining


Comments: BLOCK 4
Recommendations:

Scale: 1:50

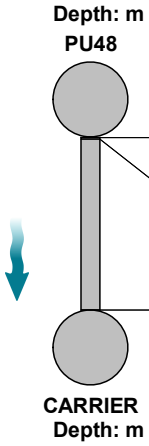

Position [m]	Code	Observation	Grade
0.00	OC	Start node, other special chamber, reference: PU48: POP UP	
0.01	LD	Line deviates down	
1.14	OCF	Finish node, other special chamber, reference: CARRIER: JUNTION ONTO CARRIER	


OC - 0.00

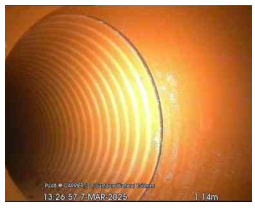
OCF - 1.14

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
47	47	07/03/25	13:27	01	No Rain Or Snow	No	PU49X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1

Town or Village:	Manchester	**Inspection Direction:**	Downstream	**Upstream Node:**	PU49
Road:	Rochdale Road	**Inspected Length:**	2.63 m	**Upstream Pipe Depth:**	
Location:	Property or buildings	**Total Length:**	2.63 m	**Downstream Node:**	CARRIER
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: BLOCK 4
Recommendations:

Scale: 1:50

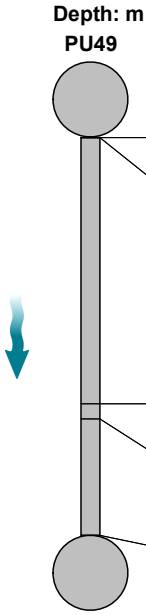


Position [m]	Code	Observation	Grade
0.00	OC	Start node, other special chamber, reference: PU49: POP UP	
0.00	LD	Line deviates down	
1.76	LL	Line deviates left	
1.86	LD	Line deviates down	
2.63	OCF	Finish node, other special chamber, reference: CARRIER: JUNCTION ONTO CARRIER	


OC - 0.00


LD - 0.00


LL - 1.76

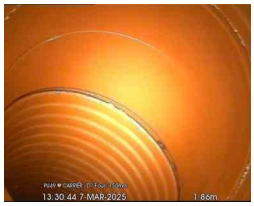
LD - 1.86


OCF - 2.63

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
48	48	07/03/25	13:33	01	No Rain Or Snow	No	PU50X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1

Town or Village:	Manchester	**Inspection Direction:**	Downstream	**Upstream Node:**	PU50
Road:	Rochdale Road	**Inspected Length:**	3.17 m	**Upstream Pipe Depth:**	
Location:	Property or buildings	**Total Length:**	3.17 m	**Downstream Node:**	FW16
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: BLOCK 4
Recommendations:

Scale: 1:50

Position [m]	Code	Observation	Grade
Depth: m PU50			
0.00	OC	Start node, other special chamber, reference: PU50: POP UP	
0.00	LD	Line deviates down	
0.73	LD	Line deviates down	
3.17	MHF	Finish node, manhole, reference: FW16	
FW16 Depth: m			


OC - 0.00


LD - 0.00


LD - 0.73


MHF - 3.17

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
49	49	07/03/25	14:14	01	No Rain Or Snow	Yes	FW17X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1

Town or Village:	Manchester	**Inspection Direction:**	Upstream	**Upstream Node:**	FW17
Road:	Rochdale Road	**Inspected Length:**	5.96 m	**Upstream Pipe Depth:**	
Location:	Property or buildings	**Total Length:**	5.96 m	**Downstream Node:**	FW16
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: BLOCK 4
Recommendations:

Scale: 1:52

Position [m]	Code	Observation	Grade
Depth: m FW16			
0.00	MH	Start node, manhole, reference: FW16	
0.00	WL	Water level, 0% of the vertical dimension	
5.96	MHF	Finish node, manhole, reference: FW17	
FW17 Depth: m			



MH - 0.00



WL - 0.00


MHF - 5.96

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
50	50	10/03/25	10:29	01	No Rain Or Snow	No	PU58X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1

Town or Village:	Manchester	**Inspection Direction:**	Downstream	**Upstream Node:**	PU58
Road:	Rochdale Road	**Inspected Length:**	6.01 m	**Upstream Pipe Depth:**	
Location:	Property or buildings	**Total Length:**	6.01 m	**Downstream Node:**	CARRIER
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: BLOCK 2
Recommendations:

Scale: 1:53

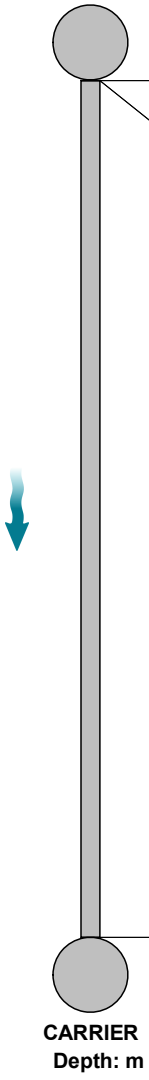

Position [m]	Code	Observation	Grade
0.00	OC	Start node, other special chamber, reference: PU58: POP UP	
0.00	LD	Line deviates down	
6.01	OCF	Finish node, other special chamber, reference: CARRIER: JUNCTION ONTO CARRIER	


OC - 0.00


LD - 0.00


OCF - 6.01

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
51	51	10/03/25	10:33	01	No Rain Or Snow	No	PU59X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1

Town or Village:	Manchester	**Inspection Direction:**	Downstream	**Upstream Node:**	PU59
Road:	Rochdale Road	**Inspected Length:**	1.28 m	**Upstream Pipe Depth:**	
Location:	Property or buildings	**Total Length:**	1.28 m	**Downstream Node:**	CARRIER
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: BLOCK 2
Recommendations:

Scale: 1:50

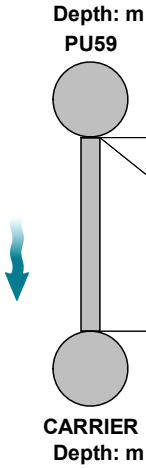

Position [m]	Code	Observation	Grade
0.00	OC	Start node, other special chamber, reference: PU59: POP UP	
0.00	LD	Line deviates down	
1.28	OCF	Finish node, other special chamber, reference: CARRIER: JUNCTION ONTO CARRIER	


OC - 0.00


LD - 0.00


OCF - 1.28

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
52	52	10/03/25	11:05	01	No Rain Or Snow	No	PU64X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1

Town or Village:	Manchester	**Inspection Direction:**	Downstream	**Upstream Node:**	PU64
Road:	Rochdale Road	**Inspected Length:**	6.21 m	**Upstream Pipe Depth:**	
Location:	Property or buildings	**Total Length:**	6.21 m	**Downstream Node:**	CARRIER
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: BLOCK 2
Recommendations:

Scale: 1:54

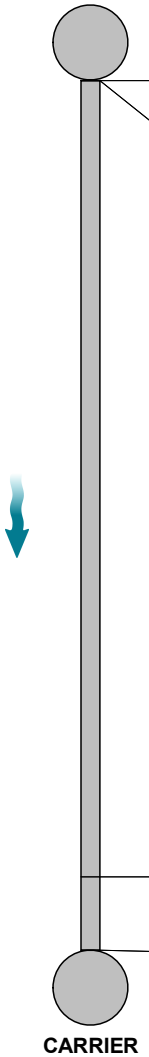

Position [m]	Code	Observation	Grade
0.00	OC	Start node, other special chamber, reference: PU64: POP UP	
0.00	LD	Line deviates down	
5.69	LL	Line deviates left	
6.21	OCF	Finish node, other special chamber, reference: CARRIER: JUNCTION ONTO CARRIER	


OC - 0.00


LD - 0.00


LL - 5.69


OCF - 6.21

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
53	53	10/03/25	11:27	01	No Rain Or Snow	No	PU63X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1

Town or Village:	Manchester	**Inspection Direction:**	Downstream	**Upstream Node:**	PU63
Road:	Rochdale Road	**Inspected Length:**	4.43 m	**Upstream Pipe Depth:**	
Location:	Property or buildings	**Total Length:**	4.43 m	**Downstream Node:**	CARRIER
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: BLOCK 2
Recommendations:

Scale: 1:50


Depth: m
PU63

CARRIER
Depth: m

Position [m]	Code	Observation	Grade
0.00	OC	Start node, other special chamber, reference: PU63: POP UP	
0.00	LD	Line deviates down	
4.43	OCF	Finish node, other special chamber, reference: CARRIER: JUNCTION ONTO CARRIER	


OC - 0.00


LD - 0.00

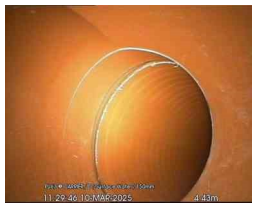
OCF - 4.43

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
54	54	10/03/25	11:30	01	No Rain Or Snow	No	PU61X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1

Town or Village:	Manchester	**Inspection Direction:**	Downstream	**Upstream Node:**	PU61
Road:	Rochdale Road	**Inspected Length:**	12.19 m	**Upstream Pipe Depth:**	
Location:	Property or buildings	**Total Length:**	12.19 m	**Downstream Node:**	CARRIER
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: BLOCK 2
Recommendations:

Scale: 1:106

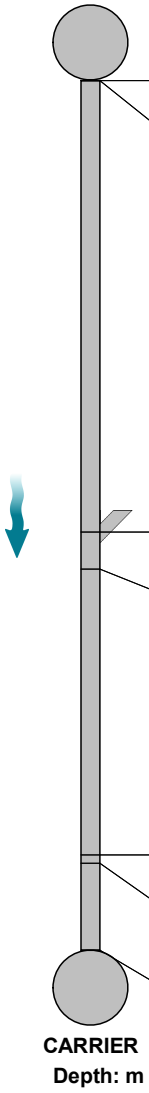

Position [m]	Code	Observation	Grade
0.00	OC	Start node, other special chamber, reference: PU61: POP UP	
0.00	LD	Line deviates down	
6.33	JN	Junction at 9 o'clock, 150mm dia	
6.85	LD	Line deviates down	
10.86	LL	Line deviates left	
10.98	LD	Line deviates down	
12.19	OCF	Finish node, other special chamber, reference: CARRIER: JUNCTION ONTO CARRIER	


OC - 0.00


LD - 0.00


JN - 6.33


LD - 6.85


LL - 10.86

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
54	54	10/03/25	11:30	01	No Rain Or Snow	No	PU61X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1



LD - 10.98



OCF - 12.19

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
55	55	10/03/25	11:36	01	No Rain Or Snow	No	PU65X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1

Town or Village:	Manchester	**Inspection Direction:**	Downstream	**Upstream Node:**	PU65
Road:	Rochdale Road	**Inspected Length:**	8.97 m	**Upstream Pipe Depth:**	
Location:	Property or buildings	**Total Length:**	8.97 m	**Downstream Node:**	SW12
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining


Comments: BLOCK 2
Recommendations:

Scale: 1:78

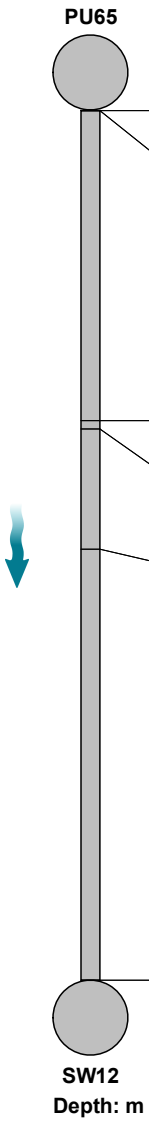


Position [m]	Code	Observation	Grade
0.00	OC	Start node, other special chamber, reference: PU65: POP UP	
0.00	LD	Line deviates down	
3.20	LL	Line deviates left	
3.29	LD	Line deviates down	
4.53	LR	Line deviates right	
8.97	OCF	Finish node, other special chamber, reference: SW12: NOT YET INSTALLED	


OC - 0.00

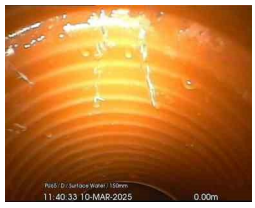
LD - 0.00


LL - 3.20


LD - 3.29

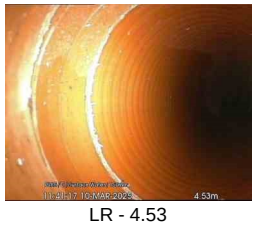
LR - 4.53

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
55	55	10/03/25	11:36	01	No Rain Or Snow	No	PU65X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1



OCF - 8.97

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
57	57	10/03/25	11:54	01	No Rain Or Snow	No	PU67X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1

Town or Village:	Manchester	**Inspection Direction:**	Downstream	**Upstream Node:**	PU67
Road:	Rochdale Road	**Inspected Length:**	10.25 m	**Upstream Pipe Depth:**	
Location:	Property or buildings	**Total Length:**	10.25 m	**Downstream Node:**	CARRIER
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: BLOCK 2
Recommendations:

Scale: 1:89

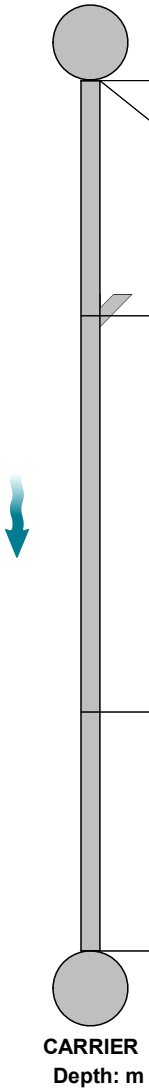

Position [m]	Code	Observation	Grade
0.00	OC	Start node, other special chamber, reference: PU67: POP UP	
0.00	LD	Line deviates down	
2.77	JN	Junction at 9 o'clock, 150mm dia	
7.44	LL	Line deviates left	
10.25	OCF	Finish node, other special chamber, reference: CARRIER: JUNCTION ONTO CARRIER	


OC - 0.00


LD - 0.00


JN - 2.77


LL - 7.44


OCF - 10.25

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
58	58	10/03/25	12:06	01	No Rain Or Snow	No	PU68X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1

Town or Village:	Manchester	**Inspection Direction:**	Downstream	**Upstream Node:**	PU68
Road:	Rochdale Road	**Inspected Length:**	0.83 m	**Upstream Pipe Depth:**	
Location:	Property or buildings	**Total Length:**	0.83 m	**Downstream Node:**	CARRIER
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: BLOCK 2
Recommendations:

Scale: 1:50

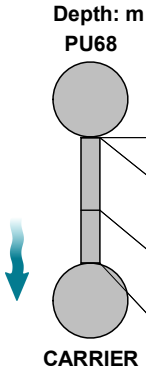

Position [m]	Code	Observation	Grade
0.00	OC	Start node, other special chamber, reference: PU68: POP UP	
0.00	LD	Line deviates down	
0.48	LL	Line deviates left	
0.83	OCF	Finish node, other special chamber, reference: CARRIER: JUNCTION ONTO CARRIER	


OC - 0.00


LD - 0.00


LL - 0.48


OCF - 0.83

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
59	59	10/03/25	12:08	01	No Rain Or Snow	No	PU69X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1

Town or Village:	Manchester	**Inspection Direction:**	Downstream	**Upstream Node:**	PU69
Road:	Rochdale Road	**Inspected Length:**	1.55 m	**Upstream Pipe Depth:**	
Location:	Property or buildings	**Total Length:**	1.55 m	**Downstream Node:**	CARRIER
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: BLOCK 2
Recommendations:

Scale: 1:50



Position [m]	Code	Observation	Grade
0.00	OC	Start node, other special chamber, reference: PU69: POP UP	
0.00	LD	Line deviates down	
1.55	OCF	Finish node, other special chamber, reference: CARRIER: JUNCTION ONTO CARRIER	


OC - 0.00


LD - 0.00


OCF - 1.55

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
60	60	10/03/25	13:18	01	No Rain Or Snow	No	PU70X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1

Town or Village:	Manchester	**Inspection Direction:**	Downstream	**Upstream Node:**	PU70
Road:	Rochdale Road	**Inspected Length:**	3.00 m	**Upstream Pipe Depth:**	
Location:	Property or buildings	**Total Length:**	3.00 m	**Downstream Node:**	CARRIER
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: BLOCK 2
Recommendations:


Scale: 1:50

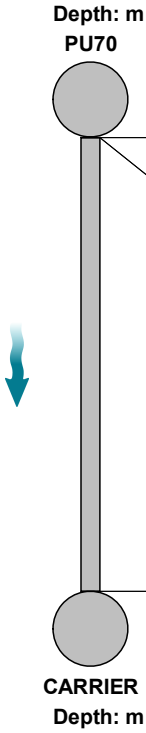

Position [m]	Code	Observation	Grade
0.00	OC	Start node, other special chamber, reference: PU70: POP UP	
0.00	LD	Line deviates down	
3.00	OCF	Finish node, other special chamber, reference: CARRIER: JUNCTION ONTO CARRIER	


OC - 0.00


LD - 0.00

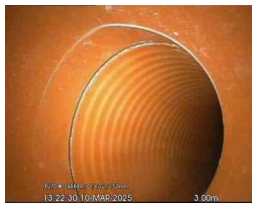
OCF - 3.00

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
61	61	10/03/25	13:33	01	No Rain Or Snow	No	FW11X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1

Town or Village:	Manchester	**Inspection Direction:**	Upstream	**Upstream Node:**	FW11
Road:	Rochdale Road	**Inspected Length:**	5.09 m	**Upstream Pipe Depth:**	
Location:	Property or buildings	**Total Length:**	5.09 m	**Downstream Node:**	FW6
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	225 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: BLOCK 2
Recommendations:

Scale: 1:50	Position [m]	Code	Observation	Grade
Depth: m FW6				
	0.00	MH	Start node, manhole, reference: FW6	
	0.00	WL	Water level, 0% of the vertical dimension	
	5.09	MHF	Finish node, manhole, reference: FW11	
FW11 Depth: m				


MH - 0.00


WL - 0.00


MHF - 5.09

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
62	62	10/03/25	13:36	01	No Rain Or Snow	No	FW10X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1

Town or Village:	Manchester	**Inspection Direction:**	Upstream	**Upstream Node:**	FW10
Road:	Rochdale Road	**Inspected Length:**	6.03 m	**Upstream Pipe Depth:**	
Location:	Property or buildings	**Total Length:**	6.03 m	**Downstream Node:**	FW6
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: BLOCK 2
Recommendations:

Scale: 1:53

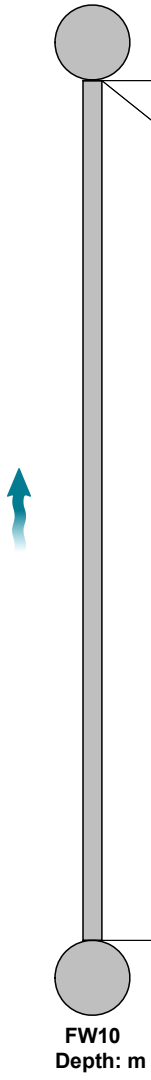

Position [m]	Code	Observation	Grade
0.00	MH	Start node, manhole, reference: FW6	
0.00	WL	Water level, 0% of the vertical dimension	
6.03	MHF	Finish node, manhole, reference: FW10	


MH - 0.00


WL - 0.00


MHF - 6.03

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
63	63	10/03/25	13:39	01	No Rain Or Snow	No	FW6X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1

Town or Village:	Manchester	**Inspection Direction:**	Downstream	**Upstream Node:**	FW6
Road:	Rochdale Road	**Inspected Length:**	10.62 m	**Upstream Pipe Depth:**	
Location:	Property or buildings	**Total Length:**	10.62 m	**Downstream Node:**	FW9
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	225 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: BLOCK 2
Recommendations:

Scale: 1:92

Position [m]	Code	Observation	Grade
Depth: m FW6			
0.00	MH	Start node, manhole, reference: FW6	
0.00	WL	Water level, 0% of the vertical dimension	
10.62	MHF	Finish node, manhole, reference: FW9	
FW9 Depth: m			


MH - 0.00


WL - 0.00


MHF - 10.62

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
64	64	10/03/25	13:42	01	No Rain Or Snow	No	FW9X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1

Town or Village:	Manchester	**Inspection Direction:**	Downstream	**Upstream Node:**	FW9
Road:	Rochdale Road	**Inspected Length:**	9.81 m	**Upstream Pipe Depth:**	
Location:	Property or buildings	**Total Length:**	9.81 m	**Downstream Node:**	FW5
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	225 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: BLOCK 2
Recommendations:

Scale: 1:85

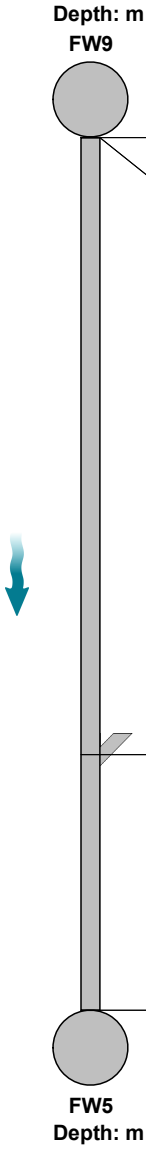

Position [m]	Code	Observation	Grade
0.00	MH	Start node, manhole, reference: FW9	
0.00	WL	Water level, 0% of the vertical dimension	
6.94	JN	Junction at 10 o'clock, 150mm dia	
9.81	MHF	Finish node, manhole, reference: FW5	


MH - 0.00


WL - 0.00


JN - 6.94


MHF - 9.81

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
65	65	10/03/25	13:48	01	No Rain Or Snow	No	PU66X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1

Town or Village:	Manchester	**Inspection Direction:**	Downstream	**Upstream Node:**	PU66
Road:	Rochdale Road	**Inspected Length:**	11.07 m	**Upstream Pipe Depth:**	
Location:	Property or buildings	**Total Length:**	11.07 m	**Downstream Node:**	FW10
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments: BLOCK 2
Recommendations:

Scale: 1:96

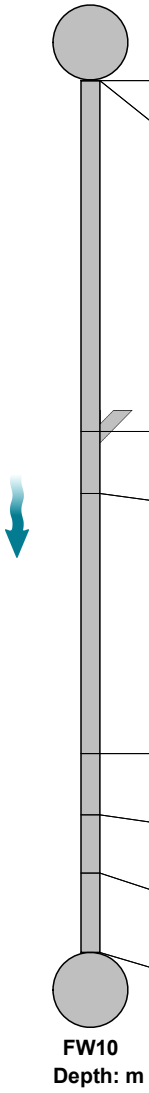

Position [m]	Code	Observation	Grade
0.00	OC	Start node, other special chamber, reference: PU66: POP UP	
0.00	LD	Line deviates down	
4.46	JN	Junction at 9 o'clock, 150mm dia	
5.25	LL	Line deviates left	
8.55	LD	Line deviates down	
9.33	JN	Junction at 6 o'clock, 150mm dia: BACKDROP	
10.07	LD	Line deviates down	
11.07	MHF	Finish node, manhole, reference: FW10: IN VIEW	


OC - 0.00


LD - 0.00


JN - 4.46


LL - 5.25


LD - 8.55

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
65	65	10/03/25	13:48	01	No Rain Or Snow	No	PU66X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1



JN - 9.33



LD - 10.07



MHF - 11.07

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com

Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
66	66	10/03/25	13:57	01	No Rain Or Snow	Yes	FW12X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1

Town or Village:	Manchester	**Inspection Direction:**	Upstream	**Upstream Node:**	FW12
Road:	Rochdale Road	**Inspected Length:**	27.78 m	**Upstream Pipe Depth:**	
Location:	Property or buildings	**Total Length:**	27.78 m	**Downstream Node:**	FW16
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:	Gravity drain/sewer	**Dia/Height:**	150 mm
Flow Control:	No flow control	**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:	Post completion condition survey	**Lining Material:**	No Lining

Comments:
Recommendations:

Scale: 1:241

Position [m]	Code	Observation	Grade
Depth: m FW16			
0.00	MH	Start node, manhole, reference: FW16	
0.00	WL	Water level, 0% of the vertical dimension	
3.94	JN	Junction at 11 o'clock, 150mm dia	
5.82	JN	Junction at 1 o'clock, 150mm dia	
10.98	JN	Junction at 11 o'clock, 150mm dia	
11.81	JN	Junction at 1 o'clock, 150mm dia	
14.05	JN	Junction at 10 o'clock, 150mm dia	
15.69	JN	Junction at 2 o'clock, 150mm dia	
21.13	JN	Junction at 1 o'clock, 150mm dia	
22.11	JN	Junction at 1 o'clock, 150mm dia	
22.51	JN	Junction at 11 o'clock, 150mm dia	
27.78	MHF	Finish node, manhole, reference: FW12	
FW12 Depth: m			


MH - 0.00


WL - 0.00


JN - 3.94


JN - 5.82


JN - 10.98

WAYNE FOR DRAINS LTD
3 WILLOW GROVE, BOROUGHBRIDGE
Tel. 07877 456 160
waynefordrains@gmail.com


Completed section inspection

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
66	66	10/03/25	13:57	01	No Rain Or Snow	Yes	FW12X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
SK	Not Specified	Solo Pro	Not Specified	Not Specified	1


JN - 11.81


JN - 14.05

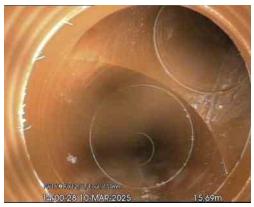
JN - 15.69


JN - 21.13

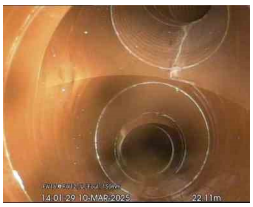
JN - 22.11


JN - 22.51


MHF - 27.78

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WinCan

Project

Project Name:	ROCHDALE ROAD MANCHESTER
Project Date:	14/09/2026
Inspection Standard:	MSCC5 Sewers & Drainage GB (SRM5 Scoring)

WinCan

Table of Contents

Project Name	Project Number	Project Date
ROCHDALE ROAD MANCHESTER		14/09/2026

Project Information P-1

Section Item 1: CW02 > SUBMAIN (CW02X) 1

Section Item 2: FW9 > FW5 (FW9X) 2

Section Item 3: FW11 > FW6 (FW11X) 3

Section Item 4: FW6 > FW9 (FW6X) 4

Section Item 5: FW22 > CW02 (FW22X) 5

Section Item 6: FW21 > FW22 (FW21X) 6

Section Item 7: BRANCH A > FW16 (BRANCH AX) 7

Section Item 8: FW12 > FW16 (FW12X) 8

Section Item 9: FW17 > FW16 (FW17X) 9

Section Item 10: FW18 > FW17 (FW18X) 10

Section Item 11: FW15 > FW19 (FW15X) 11

Section Item 12: FW19 > FW18 (FW19X) 12

Section Item 13: FW20 > FW21 (FW20X) 13

Section Item 14: SW11A > SW11 (SW11AX) 14

Section Item 15: SW12 > SW11 (SW12X) 15

Section Item 16: SW13 > SW12 (SW13X) 16

Section Item 17: SW14 > SW15 (SW14X) 17

Section Item 18: SW17 > SW16 (SW17X) 18

Section Item 19: SW18 > SW17 (SW18X) 19

Section Item 20: SW18A > SW18 (SW18AX) 20

Section Item 21: SW20 > SW21 (SW20X) 21

Section Item 22: SW21 > SW22 (SW21X) 22

Section Item 23: SW22 > CW02 (SW22X) 23

WinCan

Project Information

Project Name	Project Number	Project Date
ROCHDALE ROAD MANCHESTER		14/09/2026

WinCan

Section Inspection - 14/09/2026 - CW02X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
1	1	14/09/26	12:35	Not Specified	Not Specified	Not Specified	CW02X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
Not Specified	Not Specified	Not Specified	Not Specified	Not Specified	Not Specified

Town or Village:		**Inspection Direction:**	Downstream	**Upstream Node:**	CW02
Road:		**Inspected Length:**	2.31 m	**Upstream Pipe Depth:**	
Location:		**Total Length:**	2.31 m	**Downstream Node:**	SUBMAIN
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Combined	**Pipe Shape:**	Circular
Type of Pipe:		**Dia/Height:**	375 mm
Flow Control:		**Material:**	Concrete
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:		**Lining Material:**	No Lining

Comments:
Recommendations:

Scale: 1:50	Position [m]		Code	Observation	MPEG	Photo	Grade
Depth: m CW02							
	0.00		MH	Start node, manhole, reference: CW02			
	0.08	S02	DEC	Settled deposits, hard or compacted, 5% cross-sectional area loss, start: CONCRETE IN PIPE			
	2.31	F02	DEC	Settled deposits, hard or compacted, 5% cross-sectional area loss, finish: CONCRETE IN PIPE			3
	2.31		BRF	Finish node, major connection without manhole, reference: SUBMAIN			
SUBMAIN Depth: m							

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	1	2.0	2.6	6.0	4.0

WinCan

Section Inspection - 14/09/2026 - FW9X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
2	1	14/09/26	12:36	Not Specified	Not Specified	Not Specified	FW9X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
Not Specified	Not Specified	Not Specified	Not Specified	Not Specified	Not Specified

Town or Village:		**Inspection Direction:**	Upstream	**Upstream Node:**	FW9
Road:		**Inspected Length:**	9.76 m	**Upstream Pipe Depth:**	
Location:		**Total Length:**	9.76 m	**Downstream Node:**	FW5
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:		**Dia/Height:**	225 mm
Flow Control:		**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:		**Lining Material:**	No Lining

Comments:
Recommendations:

Scale: 1:85	Position [m]	Code	Observation	MPEG	Photo	Grade
Depth: m FW5						
	0.00	MH	Start node, manhole, reference: FW5			
	2.57	CN	Connection other than junction at 1 o'clock, 150mm dia			
	9.76	MHF	Finish node, manhole, reference: FW9			
FW9 Depth: m						

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WinCan

Section Inspection - 14/09/2026 - FW11X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
3	1	14/09/26	12:40	Not Specified	Not Specified	Not Specified	FW11X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
Not Specified	Not Specified	Not Specified	Not Specified	Not Specified	Not Specified

Town or Village:		**Inspection Direction:**	Upstream	**Upstream Node:**	FW11
Road:		**Inspected Length:**	5.59 m	**Upstream Pipe Depth:**	
Location:		**Total Length:**	5.59 m	**Downstream Node:**	FW6
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:		**Dia/Height:**	225 mm
Flow Control:		**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:		**Lining Material:**	No Lining

Comments:
Recommendations:

Scale: 1:50	Position [m]	Code	Observation	MPEG	Photo	Grade
Depth: m FW6						
	0.00	MH	Start node, manhole, reference: FW6			
	5.59	MHF	Finish node, manhole, reference: FW11			
FW11 Depth: m						

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WinCan

Section Inspection - 14/09/2026 - FW6X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
4	1	14/09/26	12:41	Not Specified	Not Specified	Not Specified	FW6X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
Not Specified	Not Specified	Not Specified	Not Specified	Not Specified	Not Specified

Town or Village:		**Inspection Direction:**	Upstream	**Upstream Node:**	FW6
Road:		**Inspected Length:**	11.93 m	**Upstream Pipe Depth:**	
Location:		**Total Length:**	11.93 m	**Downstream Node:**	FW9
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:		**Dia/Height:**	225 mm
Flow Control:		**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:		**Lining Material:**	No Lining

Comments:
Recommendations:

Scale: 1:104	Position [m]	Code	Observation	MPEG	Photo	Grade
Depth: m FW9						
	0.00	MH	Start node, manhole, reference: FW9			
	11.93	MHF	Finish node, manhole, reference: FW6			
FW6 Depth: m						

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WinCan

Section Inspection - 14/09/2026 - FW22X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
5	1	14/09/26	12:43	Not Specified	Not Specified	Not Specified	FW22X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
Not Specified	Not Specified	Not Specified	Not Specified	Not Specified	Not Specified

Town or Village:		**Inspection Direction:**	Downstream	**Upstream Node:**	FW22
Road:		**Inspected Length:**	0.77 m	**Upstream Pipe Depth:**	
Location:		**Total Length:**	0.77 m	**Downstream Node:**	CW02
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:		**Dia/Height:**	150 mm
Flow Control:		**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:		**Lining Material:**	No Lining

Comments:
Recommendations:

Scale: 1:50

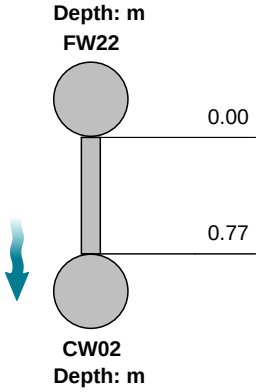

Position [m]	Code	Observation	MPEG	Photo	Grade
0.00	MH	Start node, manhole, reference: FW22			
0.77	BRF	Finish node, major connection without manhole, reference: CW02: BACKDROP			

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WinCan

Section Inspection - 14/09/2026 - FW21X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
6	1	14/09/26	12:44	Not Specified	Not Specified	Not Specified	FW21X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
Not Specified	Not Specified	Not Specified	Not Specified	Not Specified	Not Specified

Town or Village:		**Inspection Direction:**	Upstream	**Upstream Node:**	FW21
Road:		**Inspected Length:**	0.87 m	**Upstream Pipe Depth:**	
Location:		**Total Length:**	0.87 m	**Downstream Node:**	FW22
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:		**Dia/Height:**	150 mm
Flow Control:		**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:		**Lining Material:**	No Lining

Comments:
Recommendations:

Scale: 1:50

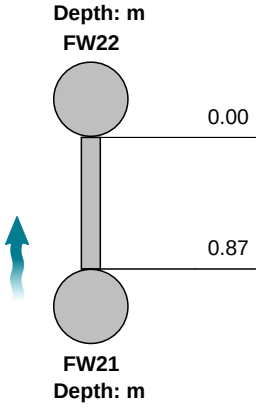

Position [m]	Code	Observation	MPEG	Photo	Grade
0.00	MH	Start node, manhole, reference: FW22			
0.87	MHF	Finish node, manhole, reference: FW21			

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WinCan

Section Inspection - 15/09/2026 - BRANCH AX

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
7	1	15/09/26	19:26	Not Specified	Not Specified	Not Specified	BRANCH AX

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
Not Specified	Not Specified	Not Specified	Not Specified	Not Specified	Not Specified

Town or Village:		**Inspection Direction:**	Upstream	**Upstream Node:**	BRANCH A
Road:		**Inspected Length:**	2.79 m	**Upstream Pipe Depth:**	
Location:		**Total Length:**	2.79 m	**Downstream Node:**	FW16
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:		**Dia/Height:**	150 mm
Flow Control:		**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:		**Lining Material:**	No Lining

Comments:
Recommendations:

Scale: 1:50	Position [m]	Code	Observation	MPEG	Photo	Grade
Depth: m FW16						
	0.00	MH	Start node, manhole, reference: FW16			
	2.79	BRF	Finish node, major connection without manhole, reference: BRANCH A: RESTBEND			
BRANCH A Depth: m						

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WinCan

Section Inspection - 15/09/2026 - FW12X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
8	1	15/09/26	19:28	Not Specified	Not Specified	Not Specified	FW12X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
Not Specified	Not Specified	Not Specified	Not Specified	Not Specified	Not Specified

Town or Village:		**Inspection Direction:**	Upstream	**Upstream Node:**	FW12
Road:		**Inspected Length:**	26.32 m	**Upstream Pipe Depth:**	
Location:		**Total Length:**	26.32 m	**Downstream Node:**	FW16
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:		**Dia/Height:**	150 mm
Flow Control:		**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:		**Lining Material:**	No Lining

Comments:
Recommendations:

Scale: 1:228

Position [m]	Code	Observation	MPEG	Photo	Grade
		Depth: m			
		FW16			
0.00	MH	Start node, manhole, reference: FW16			
3.08	CN	Connection other than junction at 11 o'clock, 150mm dia			
4.92	CN	Connection other than junction at 1 o'clock, 150mm dia			
9.85	CN	Connection other than junction at 11 o'clock, 150mm dia			
10.58	CN	Connection other than junction at 1 o'clock, 150mm dia			
13.00	CN	Connection other than junction at 11 o'clock, 150mm dia			
14.74	CN	Connection other than junction at 1 o'clock, 150mm dia			
19.63	CN	Connection other than junction at 1 o'clock, 150mm dia			
20.69	CN	Connection other than junction at 1 o'clock, 150mm dia			
21.11	CN	Connection other than junction at 11 o'clock, 150mm dia			
26.32	MHF	Finish node, manhole, reference: FW12			
		FW12			
		Depth: m			

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WinCan

Section Inspection - 15/09/2026 - FW17X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
9	1	15/09/26	19:38	Not Specified	Not Specified	Not Specified	FW17X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
Not Specified	Not Specified	Not Specified	Not Specified	Not Specified	Not Specified

Town or Village:		**Inspection Direction:**	Upstream	**Upstream Node:**	FW17
Road:		**Inspected Length:**	5.08 m	**Upstream Pipe Depth:**	
Location:		**Total Length:**	5.08 m	**Downstream Node:**	FW16
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:		**Dia/Height:**	150 mm
Flow Control:		**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:		**Lining Material:**	No Lining

Comments:
Recommendations:

Scale: 1:50	Position [m]	Code	Observation	MPEG	Photo	Grade
Depth: m FW16						
	0.00	MH	Start node, manhole, reference: FW16			
	5.08	MHF	Finish node, manhole, reference: FW17			
FW17 Depth: m						



Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WinCan

Section Inspection - 15/09/2026 - FW18X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
10	1	15/09/26	19:40	Not Specified	Not Specified	Not Specified	FW18X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
Not Specified	Not Specified	Not Specified	Not Specified	Not Specified	Not Specified

Town or Village:		**Inspection Direction:**	Downstream	**Upstream Node:**	FW18
Road:		**Inspected Length:**	14.44 m	**Upstream Pipe Depth:**	
Location:		**Total Length:**	14.44 m	**Downstream Node:**	FW17
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:		**Dia/Height:**	150 mm
Flow Control:		**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:		**Lining Material:**	No Lining

Comments:
Recommendations:

Scale: 1:126

Position [m]	Code	Observation	MPEG	Photo	Grade
		Depth: m			
		FW18			
0.00	MH	Start node, manhole, reference: FW18			
13.31	CN	Connection other than junction at 3 o'clock, 150mm dia			
14.44	MHF	Finish node, manhole, reference: FW17			
		FW17			
		Depth: m			

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WinCan

Section Inspection - 15/09/2026 - FW15X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
11	1	15/09/26	19:43	Not Specified	Not Specified	Not Specified	FW15X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
Not Specified	Not Specified	Not Specified	Not Specified	Not Specified	Not Specified

Town or Village:		**Inspection Direction:**	Upstream	**Upstream Node:**	FW15
Road:		**Inspected Length:**	29.61 m	**Upstream Pipe Depth:**	
Location:		**Total Length:**	29.61 m	**Downstream Node:**	FW19
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:		**Dia/Height:**	150 mm
Flow Control:		**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:		**Lining Material:**	No Lining

Comments:
Recommendations:

Scale: 1:257	Position [m]	Code	Observation	MPEG	Photo	Grade
Depth: m FW19						
	0.00	MH	Start node, manhole, reference: FW19			
	10.43	CN	Connection other than junction at 12 o'clock, 150mm dia			
	25.28	H	Hole in drain or sewer at 3 o'clock: HOLE IN PIPE			4
	27.38	CN	Connection other than junction at 9 o'clock, 150mm dia			
	29.61	MHF	Finish node, manhole, reference: FW15			
FW15 Depth: m						

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
1	80.0	2.7	80.0	4.0	0	0.0	0.0	0.0	1.0

WinCan

Section Inspection - 15/09/2026 - FW19X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
12	1	15/09/26	19:54	Not Specified	Not Specified	Not Specified	FW19X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
Not Specified	Not Specified	Not Specified	Not Specified	Not Specified	Not Specified

Town or Village:		**Inspection Direction:**	Downstream	**Upstream Node:**	FW19
Road:		**Inspected Length:**	14.59 m	**Upstream Pipe Depth:**	
Location:		**Total Length:**	14.59 m	**Downstream Node:**	FW18
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:		**Dia/Height:**	150 mm
Flow Control:		**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:		**Lining Material:**	No Lining

Comments:
Recommendations:

Scale: 1:127

Position [m]	Code	Observation	MPEG	Photo	Grade
		Depth: m **FW19**			
0.00	MH	Start node, manhole, reference: FW19			
0.66	CN	Connection other than junction at 3 o'clock, 150mm dia			
14.59	MHF	Finish node, manhole, reference: FW18			
		FW18 **Depth: m**			

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WinCan

Section Inspection - 15/09/2026 - FW20X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
13	1	15/09/26	19:56	Not Specified	Not Specified	Not Specified	FW20X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
Not Specified	Not Specified	Not Specified	Not Specified	Not Specified	Not Specified

Town or Village:		**Inspection Direction:**	Downstream	**Upstream Node:**	FW20
Road:		**Inspected Length:**	3.14 m	**Upstream Pipe Depth:**	
Location:		**Total Length:**	3.14 m	**Downstream Node:**	FW21
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:		**Dia/Height:**	150 mm
Flow Control:		**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:		**Lining Material:**	No Lining

Comments:
Recommendations:

Scale: 1:50

Position [m]	Code	Observation	MPEG	Photo	Grade
		Depth: m			
		FW20			
0.00	MH	Start node, manhole, reference: FW20			
3.14	MHF	Finish node, manhole, reference: FW21			
		FW21			
		Depth: m			

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WinCan

Section Inspection - 15/09/2026 - SW11AX

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
14	1	15/09/26	19:59	Not Specified	Not Specified	Not Specified	SW11AX

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
Not Specified	Not Specified	Not Specified	Not Specified	Not Specified	Not Specified

Town or Village:		**Inspection Direction:**	Upstream	**Upstream Node:**	SW11A
Road:		**Inspected Length:**	6.22 m	**Upstream Pipe Depth:**	
Location:		**Total Length:**	6.22 m	**Downstream Node:**	SW11
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:		**Dia/Height:**	450 mm
Flow Control:		**Material:**	Concrete
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:		**Lining Material:**	No Lining

Comments:
Recommendations:

Scale: 1:54	Position [m]	Code	Observation	MPEG	Photo	Grade
Depth: m SW11						
	0.00	MH	Start node, manhole, reference: SW11			
	6.22	MHF	Finish node, manhole, reference: SW11A			
SW11A Depth: m						

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WinCan

Section Inspection - 15/09/2026 - SW12X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
15	1	15/09/26	20:01	Not Specified	Not Specified	Not Specified	SW12X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
Not Specified	Not Specified	Not Specified	Not Specified	Not Specified	Not Specified

Town or Village:		**Inspection Direction:**	Upstream	**Upstream Node:**	SW12
Road:		**Inspected Length:**	19.15 m	**Upstream Pipe Depth:**	
Location:		**Total Length:**	19.15 m	**Downstream Node:**	SW11
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:		**Dia/Height:**	450 mm
Flow Control:		**Material:**	Concrete
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:		**Lining Material:**	No Lining

Comments:
Recommendations:

Scale: 1:166	Position [m]	Code	Observation	MPEG	Photo	Grade
Depth: m SW11						
	0.00	MH	Start node, manhole, reference: SW11			
	3.06	CN	Connection other than junction at 11 o'clock, 150mm dia			
	19.15	MHF	Finish node, manhole, reference: SW12			
SW12 Depth: m						

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WinCan

Section Inspection - 15/09/2026 - SW13X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
16	1	15/09/26	20:04	Not Specified	Not Specified	Not Specified	SW13X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
Not Specified	Not Specified	Not Specified	Not Specified	Not Specified	Not Specified

Town or Village:		**Inspection Direction:**	Upstream	**Upstream Node:**	SW13
Road:		**Inspected Length:**	2.40 m	**Upstream Pipe Depth:**	
Location:		**Total Length:**	2.40 m	**Downstream Node:**	SW12
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:		**Dia/Height:**	450 mm
Flow Control:		**Material:**	Concrete
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:		**Lining Material:**	No Lining

Comments:
Recommendations:

Scale: 1:50

Position [m]	Code	Observation	MPEG	Photo	Grade
Depth: m SW12					
0.00	MH	Start node, manhole, reference: SW12			
2.40	MHF	Finish node, manhole, reference: SW13			
SW13 Depth: m					

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WinCan

Section Inspection - 15/09/2026 - SW14X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
17	1	15/09/26	20:05	Not Specified	Not Specified	Not Specified	SW14X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
Not Specified	Not Specified	Not Specified	Not Specified	Not Specified	Not Specified

Town or Village:		**Inspection Direction:**	Downstream	**Upstream Node:**	SW14
Road:		**Inspected Length:**	32.68 m	**Upstream Pipe Depth:**	
Location:		**Total Length:**	32.68 m	**Downstream Node:**	SW15
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:		**Dia/Height:**	150 mm
Flow Control:		**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:		**Lining Material:**	No Lining

Comments:
Recommendations:

Scale: 1:283



Position [m]	Code	Observation	MPEG	Photo	Grade
0.00	MH	Start node, manhole, reference: SW14			
5.65	CN	Connection other than junction at 12 o'clock, 150mm dia			
6.77	CN	Connection other than junction at 12 o'clock, 150mm dia			
9.71	CN	Connection other than junction at 12 o'clock, 150mm dia			
18.69	CN	Connection other than junction at 12 o'clock, 150mm dia			
19.95	CN	Connection other than junction at 11 o'clock, 150mm dia			
27.09	CN	Connection other than junction at 12 o'clock, 150mm dia			
32.68	MHF	Finish node, manhole, reference: SW15			

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WinCan

Section Inspection - 15/09/2026 - SW17X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
18	1	15/09/26	20:09	Not Specified	Not Specified	Not Specified	SW17X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
Not Specified	Not Specified	Not Specified	Not Specified	Not Specified	Not Specified

Town or Village:		**Inspection Direction:**	Downstream	**Upstream Node:**	SW17
Road:		**Inspected Length:**	4.61 m	**Upstream Pipe Depth:**	
Location:		**Total Length:**	4.61 m	**Downstream Node:**	SW16
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:		**Dia/Height:**	300 mm
Flow Control:		**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:		**Lining Material:**	No Lining

Comments:
Recommendations:

Scale: 1:50	Position [m]	Code	Observation	MPEG	Photo	Grade
Depth: m SW17						
	0.00	MH	Start node, manhole, reference: SW17			
	4.61	MHF	Finish node, manhole, reference: SW16			
SW16 Depth: m						



Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WinCan

Section Inspection - 15/09/2026 - SW18X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
19	1	15/09/26	20:10	Not Specified	Not Specified	Not Specified	SW18X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
Not Specified	Not Specified	Not Specified	Not Specified	Not Specified	Not Specified

Town or Village:		**Inspection Direction:**	Downstream	**Upstream Node:**	SW18
Road:		**Inspected Length:**	18.94 m	**Upstream Pipe Depth:**	
Location:		**Total Length:**	18.94 m	**Downstream Node:**	SW17
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:		**Dia/Height:**	300 mm
Flow Control:		**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:		**Lining Material:**	No Lining

Comments:
Recommendations:

Scale: 1:164 **Position [m]** **Code** **Observation** **MPEG** **Photo** **Grade**

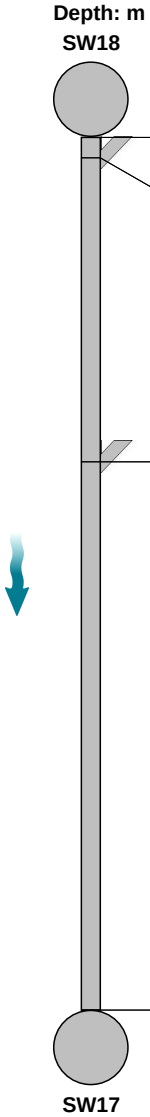

Position [m]	Code	Observation
0.00	MH	Start node, manhole, reference: SW18
0.45	CN	Connection other than junction at 11 o'clock, 150mm dia
7.05	CN	Connection other than junction at 10 o'clock, 150mm dia
18.94	MHF	Finish node, manhole, reference: SW17

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WinCan

Section Inspection - 15/09/2026 - SW18AX

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
20	1	15/09/26	20:12	Not Specified	Not Specified	Not Specified	SW18AX

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
Not Specified	Not Specified	Not Specified	Not Specified	Not Specified	Not Specified

Town or Village:		**Inspection Direction:**	Downstream	**Upstream Node:**	SW18A
Road:		**Inspected Length:**	25.26 m	**Upstream Pipe Depth:**	
Location:		**Total Length:**	25.26 m	**Downstream Node:**	SW18
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:		**Dia/Height:**	225 mm
Flow Control:		**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:		**Lining Material:**	No Lining

Comments:
Recommendations:

Scale: 1:219	Position [m]	Code	Observation	MPEG	Photo	Grade
Depth: m SW18A						
	0.00	MH	Start node, manhole, reference: SW18A			
	5.52	CN	Connection other than junction at 12 o'clock, 150mm dia			
	7.52	CN	Connection other than junction at 3 o'clock, 150mm dia			
	7.95	CN	Connection other than junction at 1 o'clock, 150mm dia			
	10.49	CN	Connection other than junction at 3 o'clock, 150mm dia			
	21.79	CN	Connection other than junction at 9 o'clock, 150mm dia			
	25.26	MHF	Finish node, manhole, reference: SW18			
SW18 Depth: m						

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WinCan

Section Inspection - 15/09/2026 - SW20X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
21	1	15/09/26	20:16	Not Specified	Not Specified	Not Specified	SW20X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
Not Specified	Not Specified	Not Specified	Not Specified	Not Specified	Not Specified

Town or Village:		**Inspection Direction:**	Upstream	**Upstream Node:**	SW20
Road:		**Inspected Length:**	9.25 m	**Upstream Pipe Depth:**	
Location:		**Total Length:**	9.25 m	**Downstream Node:**	SW21
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:		**Dia/Height:**	525 mm
Flow Control:		**Material:**	Concrete
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:		**Lining Material:**	No Lining

Comments:
Recommendations:

Scale: 1:81

Position [m]	Code	Observation	MPEG	Photo	Grade
		Depth: m			
		SW21			
0.00	MH	Start node, manhole, reference: SW21			
4.70	CN	Connection other than junction at 9 o'clock, 150mm dia			
8.06	CN	Connection other than junction at 11 o'clock, 150mm dia			
9.25	MHF	Finish node, manhole, reference: SW20			
		SW20			
		Depth: m			

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WinCan

Section Inspection - 15/09/2026 - SW21X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
22	1	15/09/26	20:18	Not Specified	Not Specified	Not Specified	SW21X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
Not Specified	Not Specified	Not Specified	Not Specified	Not Specified	Not Specified

Town or Village:		**Inspection Direction:**	Downstream	**Upstream Node:**	SW21
Road:		**Inspected Length:**	4.08 m	**Upstream Pipe Depth:**	
Location:		**Total Length:**	4.08 m	**Downstream Node:**	SW22
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:		**Dia/Height:**	525 mm
Flow Control:		**Material:**	Concrete
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:		**Lining Material:**	No Lining

Comments:
Recommendations:

Scale: 1:50	Position [m]	Code	Observation	MPEG	Photo	Grade
Depth: m SW21						
	0.00	MH	Start node, manhole, reference: SW21			
	2.69	CN	Connection other than junction at 9 o'clock, 150mm dia			
	4.08	MHF	Finish node, manhole, reference: SW22			
SW22 Depth: m						

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0

WinCan

Section Inspection - 15/09/2026 - SW22X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
23	1	15/09/26	20:19	Not Specified	Not Specified	Not Specified	SW22X

Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
Not Specified	Not Specified	Not Specified	Not Specified	Not Specified	Not Specified

Town or Village:		**Inspection Direction:**	Downstream	**Upstream Node:**	SW22
Road:		**Inspected Length:**	5.06 m	**Upstream Pipe Depth:**	
Location:		**Total Length:**	5.06 m	**Downstream Node:**	CW02
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Surface water	**Pipe Shape:**	Circular
Type of Pipe:		**Dia/Height:**	225 mm
Flow Control:		**Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining Type:**	No Lining
Inspection Purpose:		**Lining Material:**	No Lining

Comments:
Recommendations:

Scale: 1:50	Position [m]	Code	Observation	MPEG	Photo	Grade
Depth: m SW22						
	0.00	MH	Start node, manhole, reference: SW22			
	5.06	MHF	Finish node, manhole, reference: CW02			
CW02 Depth: m						

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
0	0.0	0.0	0.0	1.0	0	0.0	0.0	0.0	1.0